1. Root cause Analysis

▣ High quality analysis

	Contents
Picture	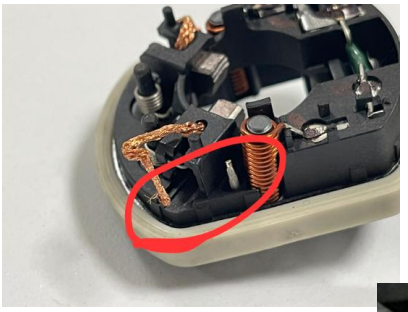
Description	**Bad Part:** Detached joint between brush wire-inductor **Good Part:** Brush wire correctly joined to inductor

DYAUTO

1. Root cause Analysis

▣ Investigation of past in-house history

	High quality
Picture	Pull test register Specification 58.9N min Frecuency: Start shift and after lunch 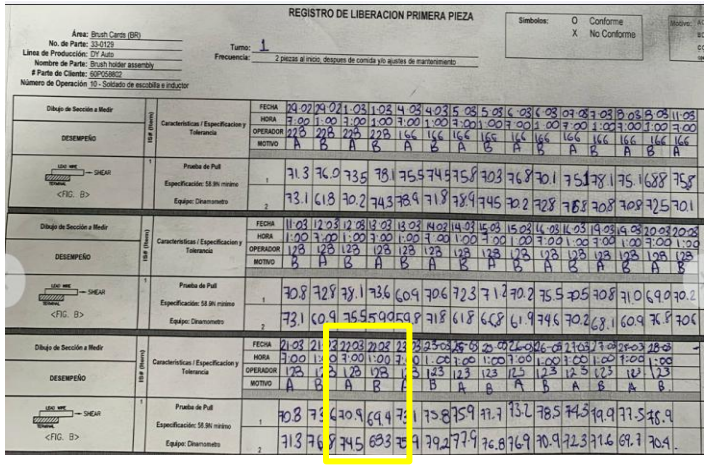 Pull test results 22-3-24: 70.9,74.5, 69.4,68.3 Set up register sheet 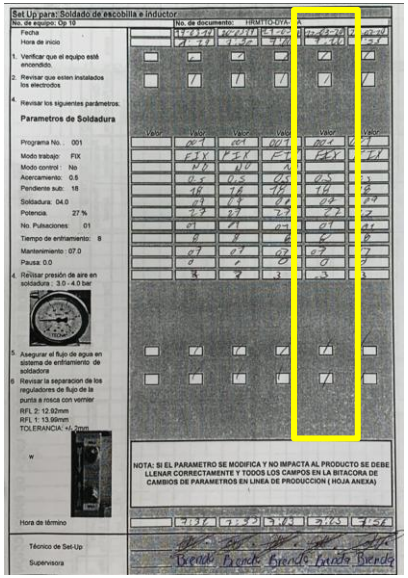
Description	The set up register sheet and pull test register shows datas in specification

DYAUTO

1. Root cause Analysis

▣ Manufacturing process analysis

Lay - Out

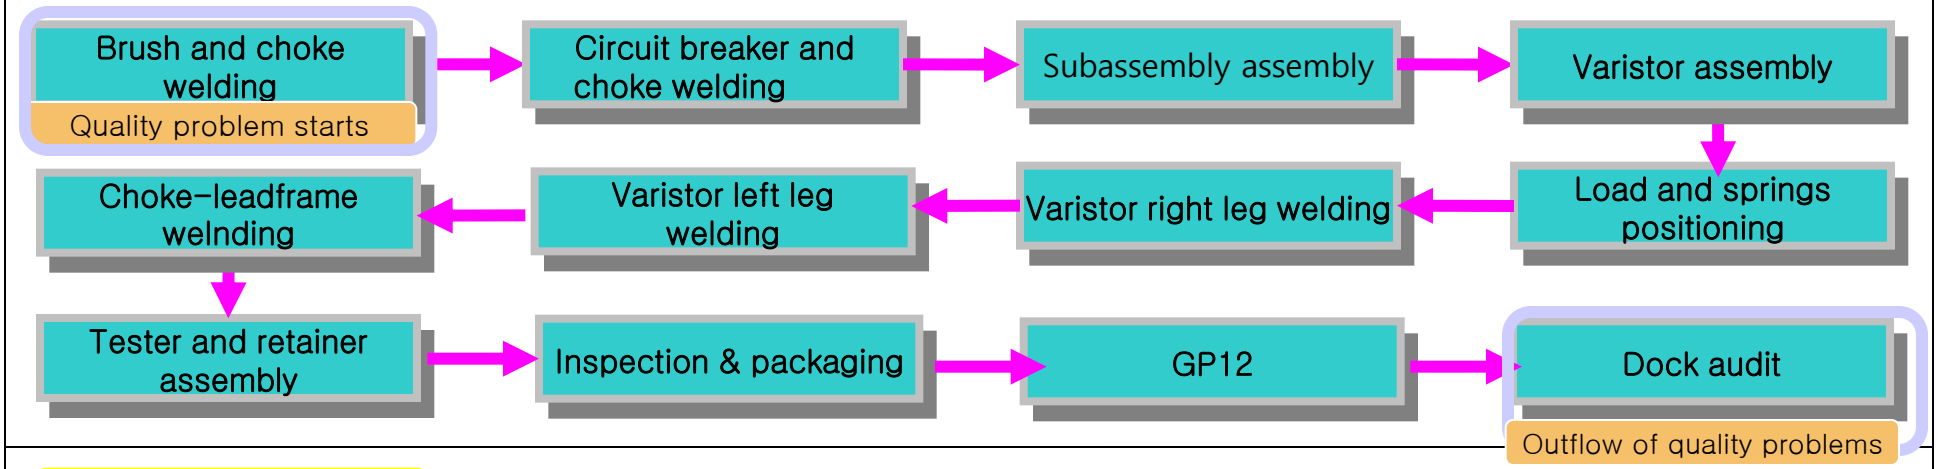

Occurrence/spill synthesis

fair		
Picture		
Contents	**Brush wire not combed to the moment to be welded to inductor**	

DYAUTO

1. Root cause Analysis

▣ Manufacturing process analysis

Detailed description of the occurrence process

INSTRUCCIÓN DE OPERACIÓN

Numero de Parte	Cliente	Número de Operación - Descripción	Fecha de Emisión	Fecha de Revisión	Nivel de Revisión	Codigo de Documento
33-0129	DY Auto	OP10 - Soldado de escobilla e inductor	27/05/2021	27/05/2021	A	OPI-DYA-010

¿Como? Ayuda visual	¿Qué hacer? Instrucción de operación y cuidados	¿Por qué hacerlo? Riesgos
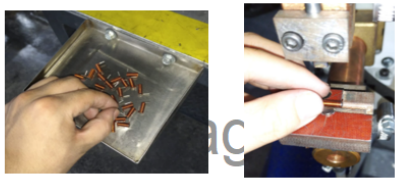	1.-Tomar con la mano izquierda un inductor de la bandeja situada a la izquierda y colocarla en la base del fixture con la pata a 90 grados hacia adelante y a la derecha dejandola pegada al tope. Verificar que el numero de parte sea: 50-0835M	Es necesario colocar la terminal en la base para iniciar con el soldado del componente.
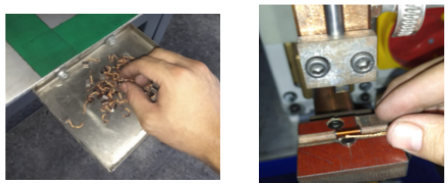	2.-Tomar con la mano derecha una escobilla de la bandeja situada a la derecha y colocarlo en la ranura del fixture con el cable de la escobilla 100% recto. Dejar el cuerpo de la escobilla hasta el tope de la ranura.Verificar que el numero de part sea: 33-9072	Es necesario colocar la escobilla hasta el tope de la ranura con el cable totalmente recto para evitar el riesgo de un soldado incompleto o falta de soldado.

There is no standard in work instruction to comb the wire

Brush wire not combed to the moment to be welded to inductor

Root cause: There is a no standard in the work instruction for a correct method to comb the brush wire

DYAUTO

1. Root Cause Analysis

▣ Prevent

		5 Whys	Corrective Action	Leader	Final Due date
Why? Produce the process Failed to prevent the production of defects? (Causes) **Quality Assurance**	M1	The brush wire was not correctly combed	Include in the work instruction the method to comb the brush wire and the way to place in the electrod	Leticia Castillo	March 29, 2024
	M2		Include in the visual aid the method to comb the brush	Leticia Castillo	March 29, 2024
	M3				
	M4				
	M5				
	M-RC				

DYAUTO

1. Root Cause Analysis

▣ Protect

		5 Whys	Corrective Action	Leader	Final Due date
Why? quality inspection Why didn't the process stop the leak from leaking? (cause of spill) **Quality Control**	Q1	**Was not considered in the FMEA the brush wire with filaments loose**	Include in the final inspection instruction the condiction of the brush wire	Leticia Castillo	March 29, 2024
	Q2		Include in the FMEA the failure mode of brush wire loose	Leticia Castillo	March 29, 2024
	Q3		Include in the Control Plan characteristic to be controlled	Leticia Castillo	March 29, 2024
	Q3				
	Q-RC				

DYAUTO