Assymex Monterrey S.A. de C.V.

QUALITY CONTROL REPORT (10D)

QCR	**112787**	*Date:*	**06-02-2025**
AssyMex Contact / Title:	**Astrid López**	*Customer Contact / Title:*	**Gregory Festian**
Contact Phone:	**+528181272830**	*Contact Phone:*	**+989-672-8400**
Email:	astrid.lopez@avocarbon.com	*Contact Email:*	GFestian@tifs.com

ONLY FILL THIS SECTION FOR INTERNAL SITUATIONS DETECTED AT ASSYMEX PLANT

- ☐ **INTERNAL PPM**
- ☐ **INTERNAL AUDIT BY IATF**
- ☐ **EXTERNAL AUDIT BY CUSTOMER**
- ☐ **INTERNAL METRIC:** _____
- ☐ **EXTERNAL AUDIT BY IATF**
- ☐ **OTHER:** _____

ONLY FILL THIS SECTION FOR QUALITY PROBLEMS DETECTED WITH CUSTOMER

- ☐ **Level 1 - Customer Return** - Immediate containment actions are required for all In House and Incoming stock within 24 hrs. Product Return Approval (RMA) may be necessary.
  Description of Root Cause & Corrective Action Plan are mandatory within 5 days.
- ☑ **Level 2 - Quality Rejection** - Immediate containment actions are required for all In House and Incoming stock within 24 hrs. Product Return Approval (RMA) may be necessary.
  Description of Root Cause & Corrective Action Plan are mandatory within 5 days.
- ☐ **Level 3 - Quality Concern** - Description of Root Cause & Corrective Action Plan are mandatory within 5 days.
  All Incoming stock 100% certified.
- ☐ **Level 4 - Notification** - All Incoming stock 100% certified.

WHAT IS THE PROBLEM ? > Use 4W + 2H to know what is the Current Situation ? Customer View and AssyMex View

- What happened? *Description of the Problem*	**Parts were found with brush detached from pin**	**- Why is it a problem?**	**Non-functional customer assembly**

BAD PART

Brush detached from pin

GOOD PART

Pin with correctly soldered brush without detachment

Assembly Components

- When it happened? *Date: dd-mm-yyyy*	**06-02-2025**	**- Where detected?** *Incoming, Production Line, Customer, Warranty, etc.*	**Customer´s production line**
- How detected?	**Manual, Pull test**	**- How many bad parts?**	**10**

Additional Information for Customer

Customer Part Number:	**1870680**	*AssyMex Part Number:*	**05-0420AM**
Customer Lot Number:	**WLD7/24/235/T1 2024/08/22**	*AssyMex Lot Number:*	**WLD7/24/291/T1 2024/10/17**
	WLD7/24/244/T1 2024/08/31	*Additional Information:*	**WLD7/24/285/T1 2024/10/11**
	WLD7/24/274/T1 2024/09/14		
	WLD7/24/291/T1 2024/10/17		
	WLD7/24/285/T1 2024/10/11		
Customer Inventory:	**89,000 pcs Raw Material & 3350 pumps**	*AssyMex Inventory:*	**3,000 pcs**
In Transit Inventory:	**0 pcs**	*Logistic Platform Inventory:*	**0 pcs**

Other part numbers sold to TI

Part number:	**05-0446M / HYRF001ACF00**	*TI Facility:*	**TI Greenville**
	05-0491M / HA50055022401		**TI Poland**

Material Disposition

- ☑ Return to Supplier. RMA # 4570105-0420AM 69,610 pcs
- ☐ Sort by Supplier.
- ☐ Sort / Rework by External Company WO #
- ☐ Scrap. Supplier's expense.
- ☐ Use as received
- ☐ Sort / Rework by AssyMex WO #

CORRECTIVE ACTION REPORT - 10D REPORT

1.- Problem Solving Team Members

Leader:	Astrid Rivera	**Title:**	**Quality Engineer**	**Phone:**	**+528181272830**
Email:	astrid.lopez@avocarbon.com	**Fax:**		**Mobile:**	

Group: Marco Estrada, Daniel Morales, Ramses Rendon, Alicio Flores, Jorge García, Armando Herrera

2.- Describe the Problem

Customer found in his production line parts where the shunt wire to pin weld connection fell apart, resulting in parts out of pull test specification below 20N min.

- Was part reworked by supplier ?	No	**- When was it manufactured ?**	2024/8/22 to 2024/10/19
- Are we capturing the defect when reinjecting product in normal process ? If YES, explain how ?	**No**	**- Did a similar problem happen previously at AssyMex or internally ? If YES, when ?**	**No**

3.- Immediate Countermeasures / Problem Containment ? (24 hours)

IMMEDIATE COUNTERMEASURES IN SUPPLIER PERIMETER	RESPONSIBLE	DATE	WHERE?

IMMEDIATE COUNTERMEASURES IN AssyMex PERIMETER	RESPONSIBLE	DATE	WHERE?
100% Welding rework and 100% visual inspection	Astrid López	06/02/2025	Assymex Plant

Sorting Activity >> by Supplier

	Total Sorted	Total Bad Parts		PPM	Sorting Date	Responsible
- Suspect Inventory in Customer plant :	89000	69610	=	782134.831	17/02/2025	Greg Festian
- Suspect Inventory in AssyMex plant :	3000	23	=	7666.66667	06/02/2025	Astrid Lopez
- Suspect Inventory in Transit :	0		=	'----'		
- Suspect Inventory in Logistic platform :	0		=	'----'		
- Suspect Inventory in Supplier plant :	0		=	'----'		

Identification of OK Parts

- Production dates of sorted parts:	From: 17-10-2024	To: 11-10-2024
- Production dates of bad parts:	Oldest part: 22-08-2024	Most recent part: 19-10-2024

First Certified Good Shipment	Lot Number: WLD7/25/048/T1
	Date: 17-02-2025

4,1.-	Analysis and Root Cause - Ocurrence

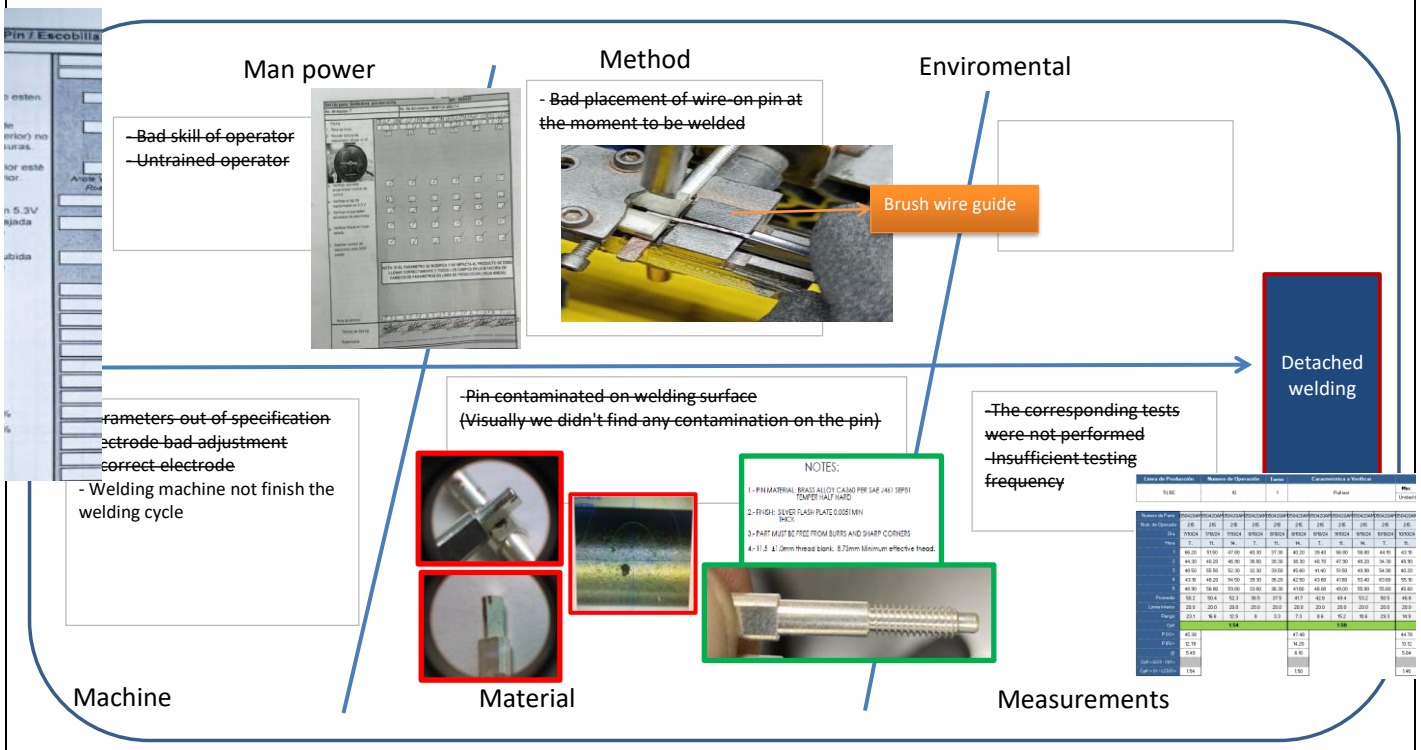

5 x Why Analysis Form - Ocurrences
Why did it happen?

1st Why?	Question:	Why the welding machine not finish the welding cycle
	Answer:	Pedal than active the welding cycle did not guarantee completion of the welding cycle
2nd Why?	Question:	Why the Pedal than active the welding cycle did not guarantee completion of the welding cycle
	Answer:	Cycle card of welding machine module was damage
3rd Why?	Question:	Why cycle card of welding machine module was damage?
	Answer:	system overcurrent due to a general power outage
4th Why?	Question:	
	Answer:	
5th Why?	Question:	
	Answer:	

4,2 .-	Analysis and Root Cause - Non Detection

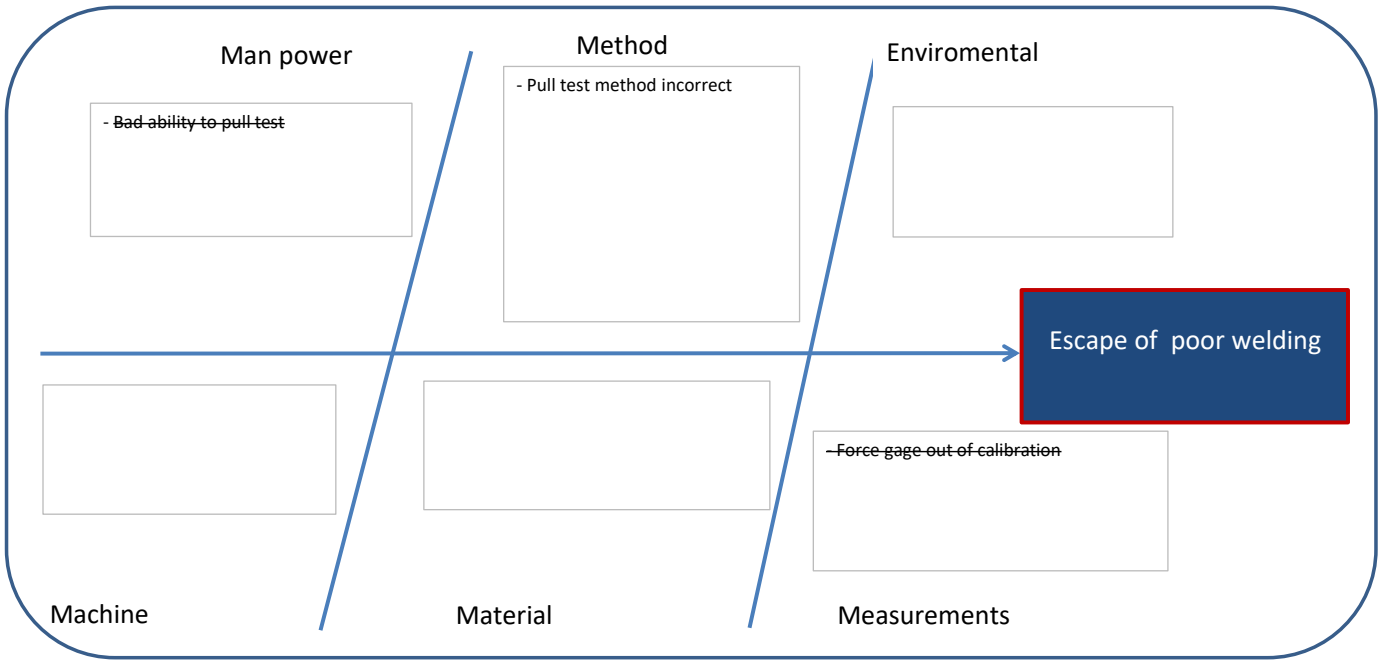

5 x Why Analysis Form - Non-Detection
Why did the non-conformity escape?

1st Why?	Question:	Why the pull test method was incorrect
	Answer:	pull test not repeated between each test
2nd Why?	Question:	Why pull test not repeated between each test
	Answer:	Fixture to performance pull test not hold the part correctly
3rd Why?	Question:	Why the fixture to performance pull test not hold the part correctly
	Answer:	Fixture used during the pull test was not according to the S-362 specification
4th Why?	Question:	Why the fixture used during the pull test was not according to the S-362 specification ?
	Answer:	Fixture was reported as missing and was not replaced it
5th Why?	Question:	
	Answer:	

5.- Corrective Action

To Eliminate Occurrence of the Problem:

Corrective Action	Who	Due Date	Done Date
Change cycle card of welding machine module	Alicio Flores	12-feb-25	12-feb-25
Add to the set up to verify that the foot pedal that activates the welding cycle completes the welding cycle.	Ramses Rendon	12-feb-25	12-feb-25

To Improve Detection of the Problem:

Corrective Action	Who	Due Date	Done Date
Create fixture correct to pull test according S-362 specification	Arleth Morales	16-feb-25	16-feb-25
Performance pull test instruction according S-362 specification	Astrid Lopez	18-feb-25	18-feb-25

6,1.- Implement and Verify Corrective Action - Occurences

Checks	CONFIRMATION CHECKS	CHECK QUALITY PER SHIFT 1st	2nd	3rd
Confirmation of Influent Factors	1- HAVE PARAMETERS BEEN CORRECTED IN SAFETY / WORKING INSTRUCTIONS?	Y		
	2- DO WORKING INSTRUCTIONS MATCH WITH QUALITY CONTROL PLAN?	Y		
	3- IS ALL DOCUMENTATION COHERENT?	Y		
	4- ARE THE INSTRUCTIONS CLEAR?	Y		
	5- ARE CRITICAL POINTS CLEARLY DESCRIBED?	Y		
Physical Check of Operation	6- DOES ACTUAL PROCESS MATCH WITH THE OPERATING INSTRUCTIONS?	Y		
	7- DOES ACTUAL PROCESS MATCH WITH EXPECTED CORRECTIVE ACTION?	Y		
	8- ARE OPERATORS AWARE OF THE DEFECT?	Y		
	9- ARE OPERATORS AWARE OF THE EXPECTED CORRECTIVE ACTION?	Y		
	10- HAS THE SOLUTION BEEN PROPERLY VALIDATED ON THE FLOOR?	Y		
Visual Aid	11- IS THERE A VISUAL AID?	Y		
	12- IS IT POSTED ON A VISIBLE SPOT?	Y		
	13- IS THE CONTENT CLEAR?	Y		
Equipment	14- IS IT COHERENT WITH THE CONTENT OF THE CORRECTIVE ACTION?	Y		
	15- HAS IT BEEN MODIFIED? IS PREVENTIVE MAINTENANCE RECORD MODIFIED?	Y		
	16- IS SET UP INSTRUCTION UPDATED? MATCHES WITH CONTROL PLAN?	Y		
AUDITOR'S NAME	Daniel Morales	DATE OF THE AUDITS	17-02-2025	
Comments		DECISION	Y / N	Y / N	Y / N