QUICK RESPONSE PDCA

Valeo / Contact name [1]	PRODUCT (Designation + Ref) [2]
Valeo Wiper Systems SLP MEXICO Hugo Iván Rodríguez Site SQA Engineer/Technician hugo-ivan.rodriguez2@valeo.com	W000037394 Brush Plate Assy AVO Carbon USA INC.

ORIGIN [3]			
Warranty	■	Supplier	
Okm Return		Logistic	
Internal		Project	
		Safety	

Which LLC was already issued on similar problem? [21]

VWS-W33SAN3-2209-004

LLC Ocurrence: Potential Cause: Position sensor was not aligned with the rai (Broken base)
Corrective action: Plastic prints for sensor support with higher resistance material, ABS
LLC Detection: Potential Cause: TheVoltage drop test is not capable of detecting an inductor without welded.
Corrective action: Add tool to the javelin to make contact with the inductor and cause a movement to the inductor

Supplier Incident Details

Supplier Incident number	VWS-W33SAN3-2405-002
Valeo SRM Incident numb	VWS-W33SAN3-2405-002
Date of Valeo notification	06/05/2024
Opened date & Time	08-05-2024 / 02:10 CTE

WHAT IS THE PROBLEM ? > Use 5W + 2H to know what is the Current Situation ?

5W2H		CHARACTERIZATION	
WHAT happened? [4]	***Customer view:*** C/S REAR WINDSHIELD IS NOT WORKING, CHECK AND ADVISE **Valeo view:** The motor runs and parks, but it gets inoperative when the cover around the BCH terminals area is pressed. During the teardown there was found that the coil's lead is not welded to the spring leaf (brush support), detecting an open loop between the inductors terminal and the spring leaf. Good part: The coil's lead are welded to the spring leaf (brush support). **Bad part:** The coil's lead is not welded to the spring leaf (brush support) generating an open loop. **Standard:** Electrical welding	What is the difference between good and bad parts? [11]	**Good part:** The inductor is welded to blade, the inductor is deformed for the pressure of electrodes to the moment to be welded and the has it datamatrix code impressed indicated that is acceptable by electrical tester **Bad part:** The inductor is not welded to blade, the inductor not is deformed for the pressure of electrodes and the has it datamatrix code impressed indicated that is acceptable by electrical tester 
WHY is it a problem? [5]	***Customer view:*** The wiper will not clean the rear windshield **Valeo view:** The lack of electrical welding creates an open loop that doesn't allow the correct electronic flow from the power supply to the BCH's brush causing a power	Was part produced in the standard process? [12]	Yes. In the welding machine op 80 according the work instruction OPI-FLE-080
WHEN detected [6]	***Customer view:*** Vehicle Repair Date: 29-Jan-24. Mileage: 5366 M. **Valeo view:** 06/May/2024	When was it manufactured at Supplier? [13]	September 6, 2023
WHO detected? [7]	***Customer view:*** Vehicle owner and confirmed by the dealer **Valeo view:** Marco Torres, Warranty Engineer	Who manufactured? [14]	Final inspector: Cristina Soto / Employeed number: 2323 Operator: Maria España / Employeed number: 209 Operator: Evangelina Hernandez / Employeed number: 197 **Supervisor: Kassandra Torres / Employeed number : 10**
WHERE detected? [8]	***Customer view:*** MI, USA **Valeo view:** Warranty laboratory, Valeo Wipers SLP	In which other application or processes product is used? [15]	VCS series part DRW W000037391 Revision Level H (-39A, -423, -39E)
HOW detected? [9]	***Customer view:*** Visually and functionally when wiper is turned on. **Valeo view:** Functionally during motor analysis and visually during teardown	Are we capturing the defect when reinjecting product in normal process? [16]	Op 90A- Electrical tester: Pass current trough the terminals and brushes and the part was not continuity due lack of connection between inductor and blade and the part is rejected Op 110 - Final inspection : Inspector check the condition of the welded between inductor and the blade and the part was not the deformed inductor and the part is rejected
HOW MANY bad parts? [10]	***Customer view:*** 1 **Valeo view:** 1 as final motor assy	Did a similar problem happen previously at customer or internally? [17]	YES, VWS-W33SAN3-2209-004

Did you detect any VARIABILITY during sorting ? [22]

	Real data of the detected VARIABILITY...? (please identify the involved standards)	Standard issue?[28]	Deployment issue?[29]	Enforcement issue?[30]	Factor(s) to include in FTA Occ or FTA Non Det
1/ ... in the MACHINE SETTINGS [23]	Set up register sheet HRMTOFLE-080A HRMTOFLE-090A -Verify machine on - Colocate part number on machine screen	NO	NO	NO	
2/ ... in the OPERATIONS [24]	OPI-FLE-080A OPI-FLE-110A-01	NO	NO	NO	
3/ ... in the QUALITY CONTROLS [25]	HRSM-FLE-090A-001 - Master samples of electrical tester	NO	NO	NO	
4/ ... in the RAW MATERIAL [26]	N/A	N/A	N/A	N/A	
5/ ...in the PROJECT ACTIVITY [27] Category applicable until SOP + 6 Months	N/A	N/A	N/A	N/A	

BAD PART [18]

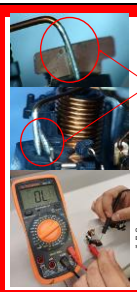



GOOD PART [19]

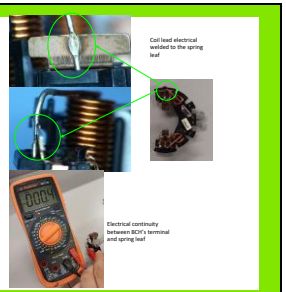

WHAT ARE THE IMMEDIATE COUNTERMEASURES (24 hours)?

1. IMMEDIATE COUNTERMEASURES IN SUPPLIER PERIMETER ? [31]	WHO	DATE	WHERE
Production was notified of a warranty complaint filed by valeo regarding the recurrence of an unsoldered inductor.			assymex plant
Create quality alert and containment instruction, The containment instruction indicate than due check the part with the Go/NoGo gage, if the gage does not enter in the joint between inductor and blade the part is bad			assymex plant
Implementation of CSL1			assymex plant

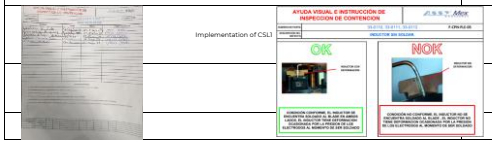

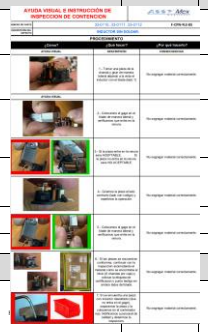

2. IMMEDIATE COUNTERMEASURES IN VALEO LINE ? [32]	WHO	DATE	WHERE
Start visual sorting activity for: W000037394 - 13,179 pzs W000079423 - 12,622 pzs			Valeo Wipers SLP
Block the suspicious batches and deploy a quality alert in affected production line	Hugo Iván Rodríguez	05/07/2024	Valeo Wipers SLP

SORTING ACTIVITY to protect customer [20]

	Nb. NC Parts	Nb. Sorted		PPM		Sorting date	WHO
-Results of sorting in Valeo Customer plant			≤	'-----'	PPM		
-Results of sorting in Valeo plant				'-----'	PPM		
-Results of sorting in Other Valeo plants				'-----'	PPM		
-Results of sorting in Transport			≤	'-----'	PPM		
-Results of sorting in Valeo Logistics platform			≤	'-----'	PPM		
-Results of sorting in Supplier Logistics platform			≤	'-----'	PPM		
-Results of sorting in Supplier plant	0	9600	≤	0	PPM	06/05/24	Leticia castillo
-Results of sorting in after-sales stocks			≤	'-----'	PPM		
TOTAL SORTING	0	9600	≤	0	PPM		

Identification OK parts

Certification

Production dates of sorted parts	From	To
	6/5/2024	6/5/2024
Period of NG parts	Earliest NG part Date	Latest NG part Date
	6/9/2023	6/9/2023

First certified good shipment:	Label's Number	Date
	16	07/05/24
	Identification OK parts / OK pallets	
	Certification label	

VALEO CAN DETECT THE DEFECT ON THE PRODUCTION LINE AT 100% (YES/NO) ?

If not, Supplier must set up a control at 100% on the Valeo line