8D report

Customer plant:	Igarashi SZ	**Supplier:**	AVO Carbon Germany	**Date of claim:**	10.01.2025
Customer contact:	MM Wang	**AVO contact:**	Gunther Luschtinetz		
Customer reference:	E-Mail 10.01.2025	**AVO reference:**	250102		

QUICK RESPONSE (D1-D3)
This document must be issued within 24 hours after claim notification

D 1. Description of the problem

1.a What is the problem? Use 5W+2H to describe what is the current situation.

Problem description	Carbon brush crack	What happened	Carbon brush crack
Incident type	Customer claim	Why is it a problem	•Interruption of the production •Decreased outputs from the line •Producing defective parts
Part number AVO	1023501	When did it happen	23.04.2024
Part number Customer	CB-C036-0032-06	Who detected it	Inspector
Batch number	278979	Where was it detected	Production
Recurrence	Non-recurrent	How was it detected	Visually
Defect S/R	No	How many bad parts	27/ 2000
Standard process used	Yes		
When was the part produced?	Pressing machine => 6125: 11.03.24-20.03.24 Grinding machine => SSS 3220: 25.03.24-27.03.24		

nOK part picture/ sketch

OK part picture/ sketch

1.b Problem solving team

Name	Position	Location	E-mail
Gunther Luschtinetz	Quality Management	AVO Germany	gunther.luschtinetz@avocarbon.com
Daniel Beil	Quality Management	AVO Germany	daniel.beil@avocarbon.com
Mustafa Yurulmaz	Production	AVO Germany	
Uwe Walocha	Tooling department	AVO Germany	
Heike Czernotzky	Logistic	AVO Germany	

Yes	Ishikawa	Yes	5why's		LLC		Audit		Other

1.d First analyse of problem / potential root causes

Potential root cause(s):In analysis

If you use our expressnumber, please use only economic express.

Samples of nok parts required in plant for analyse: Yes

Express shipping number account: FedEx 186141300

D 2. Risk on similar products and processes

Can this defect happen on similar parts?		Comments (compulsory, if yes)
Other family product	---	
Other line	---	
Other tools/work station	---	
Other	---	

D 3. Containment

Sorting criterias (add additional sheets if needed)

Location in the supply chain	N° of involved parts	N° parts sorted	N° nok parts	Ppm	Date	Responsible
Parts at customer	346.000	---	27	---	10.01.2025	MM Wang
Parts in transport	---	---	---	---	---	---
Parts at AVO Germany stock		---		---		
Parts at AVO production	---	---	---	---	---	---

First contained shipment information

Immediate actions to prevent production and delivery of nok parts ?

Containment actions	Responsible	Date planned	Date closed
Register the complaint + Quality alert	Gunther Luschtinetz	10.01.2025	10.01.2025
Check the production-, quality- and maintenance data	Gunther Luschtinetz	10.01.2025	10.01.2025
Information of all department leader during shop floor meeting QRQC	Daniel Beil	10.01.2025	10.01.2025

8D report

PLAN - DO (D4-D6)

D 4. Root cause of occurrence

Work out the root causes using Ishikawa and 5 why's

Root cause of occurrence :

The punch has different single parts, the mounting and five punch inserts. Every punch insert is fixed with a single grub screw. One of the grub screw has loose and the punch lost his fixing. As the result, the punch insert has been pushed upwards and the wire has not been pressed in deep enough. Based on the fewer inseration deepth of the wire, the wire come loose.

How was the defect reproduced ?

Fix a punch insert not properly.

D 5. Root cause of non detection

Work out the root causes using Ishikawa and 5 why's

Root cause of non detection :

The defect cannot be recognised by the measurements during the hourly check, as it occurs sporadically.

D 6. Corrective actions and non detection

Corrective actions	Responsible	Date planned	Date closed
Change the fixing grub screw to self secure grub screws	U. Walocha	28.11.2024	28.11.2024

CHECK - ACT (D7-D8)

D 7. Effectiveness of action plan

Actions to check effectiveness (to plan with part D6)	Responsible	Date planned	Date closed
During the next workplace audit	Team	29.11.2024	29.11.2024

D 8. Lessons learned

8.1 Do following documents require an update ?

	Responsible	Date planned	Date closed
P-FMEA			
Control Plan			
Procedure			
Instructions			
Other			
Other			

8.2 Generalization of countermeasures

Generally, if one of the tools listed above is used. This is carefully checked and updated.

8.3 Internal audit (if required)

Date 29.11.24 Results OK

Comments

Self secure grub screws are used and available.

Ishikawa

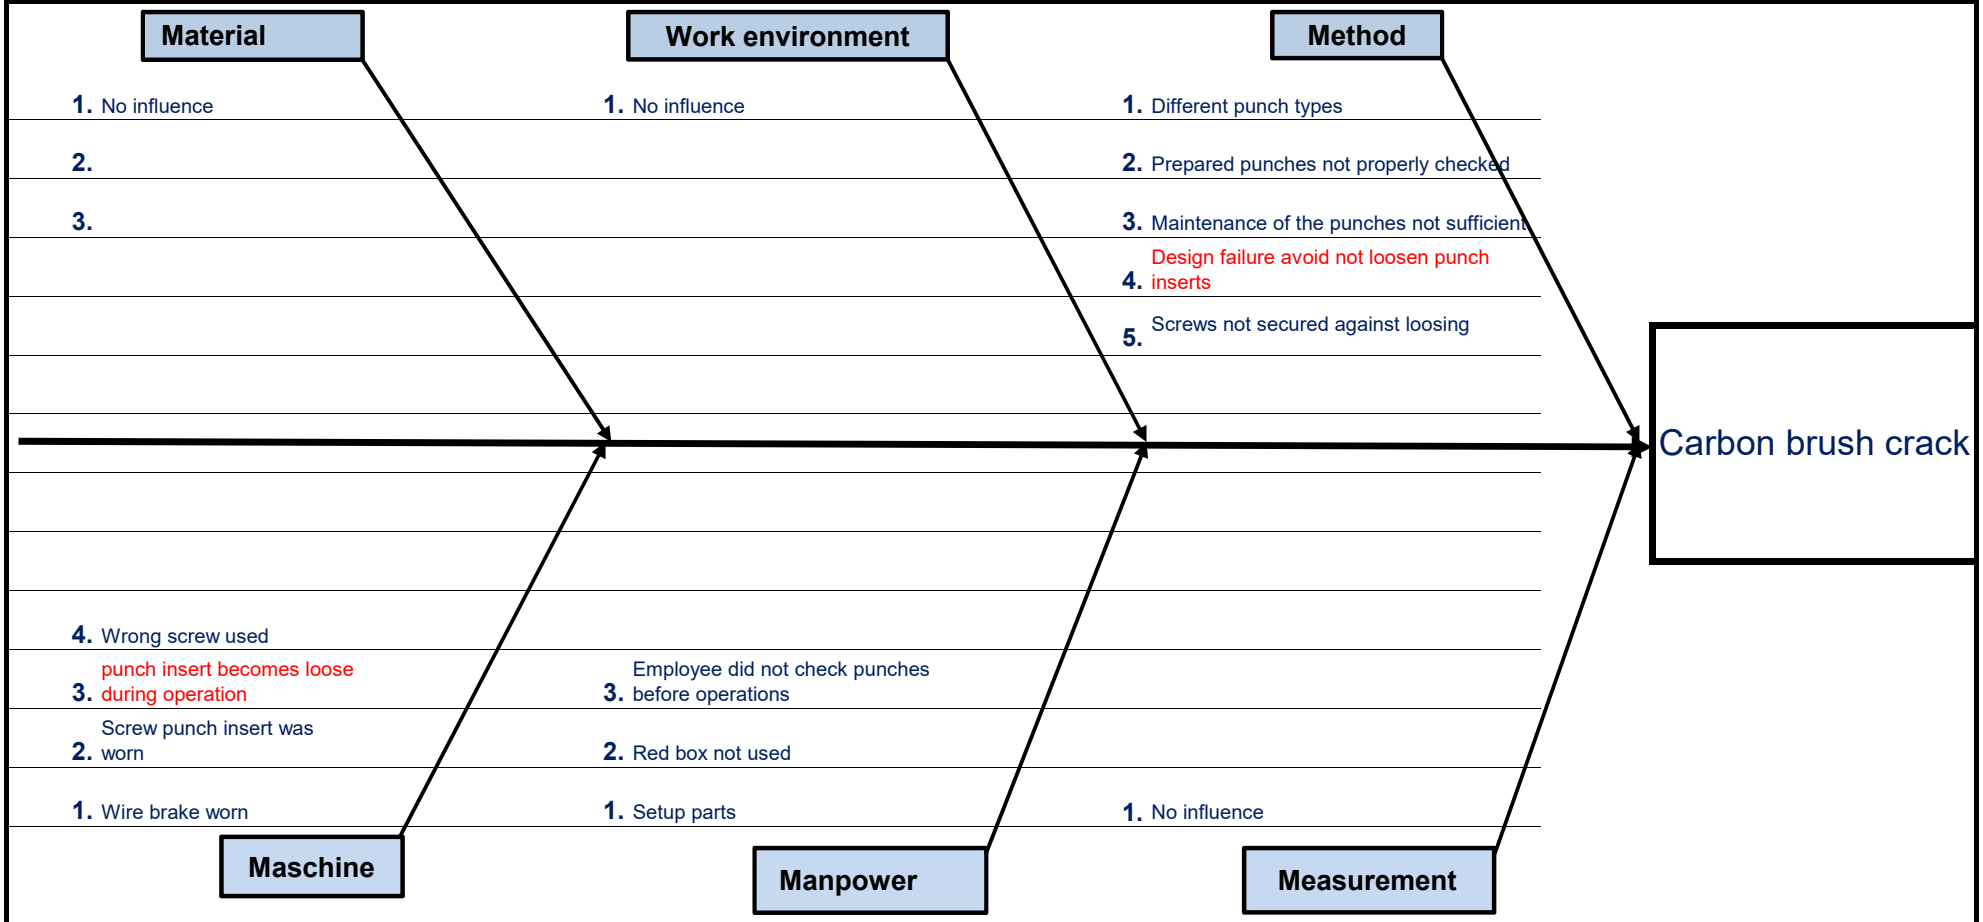
Material
1. No influence
2.
3.
4. Wrong screw used
3. punch insert becomes loose during operation
2. Screw punch insert was worn
1. Wire brake worn
Maschine
Work environment
1. No influence
3. Employee did not check punches before operations
2. Red box not used
1. Setup parts
Manpower
Method
1. Different punch types
2. Prepared punches not properly checked
3. Maintenance of the punches not sufficient
4. Design failure avoid not loosen punch inserts
5. Screws not secured against loosing
1. No influence
Measurement
Carbon brush crack

5 Why's

Problem description : Carbon brush crack

OCCURENCE

Problem	N°	1st WHY?	1st ANSWER	2nd WHY?	2nd ANSWER	3rd WHY?	3rd ANSWER	4th WHY?	4th ANSWER	5th WHY?	5th ANSWER
	1	Why is the wire loosen?	Because the wire depth is not according to the specification.	Why is the wire not according to the specification?	Because the wire was not fixed during pressing.	Why was the wire not fixed during pressing?	Because a punch insert was loosen.	Why was the punch insert loosen?	Because a screw was not tighten enough.	Why was the screw not tighten enough?	Because the screw had loosen during operation.
	N°	6th WHY?	6th ANSWER								
	1	Why had the screw become loosen during operation?	Because the screw was not secured against loosing.								

NON-DETECTION

Problem	N°	1st WHY?	1st ANSWER	2nd WHY?	2nd ANSWER	3rd WHY?	3rd ANSWER	4th WHY?	4th ANSWER	5th WHY ?	5th ANSWER
	1	Why was the defect not detected?	Because the visual control did not find the failure.	Why did not find the visual control the failure?	Because ist just visual check.	Why is just visual checked?					

Corrective actions and non detection:

Change the fixing grub screw to self secure grub screws

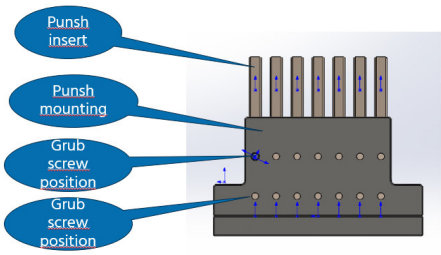

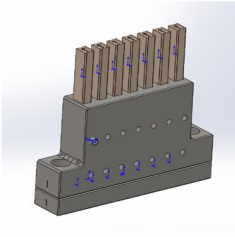

Upper punch