Claim Management Panel

Supplier: **AVO Carbon France (NMAS609128)**

Type: **C2 : Production claim**

Problem description: **Fuse Choke Leg Height NOK**

Claim reference: **NMAS/609128/2/2024/1673**

Settings

C2/C3 REMINDER PANEL

(QR) D2-D3 Defualt Due Date :	**2/23/2024**	5:49:13 PM (your local time)	D2-D3 Revised Due Date:	(QR) D2-D3 Actual Date:	**2/26/2024**	10:57:35 AM (your local time)	(QR) D2-D
D4 Default Due Date :	**2/27/2024**	5:49:13 PM (your local time)	D4 Revised Due Date :	D4 Actual Date :	**2/29/2024**	3:53:37 PM (your local time)	D
D5-D6 Default Due Date:	**3/7/2024**	5:49:13 PM (your local time)	D5-D6 Revised Due Date:	D5-D6 Actual Date:	**3/7/2024**	11:15:41 AM (your local time)	D5-D
D7-D8 Default Due Date:	**3/7/2024**	5:49:13 PM (your local time)	D7-D8 Revised Due Date C2/C3:	D7-D8 Actual Date:	**4/1/2024**	1:59:32 PM (your local time)	D7-D

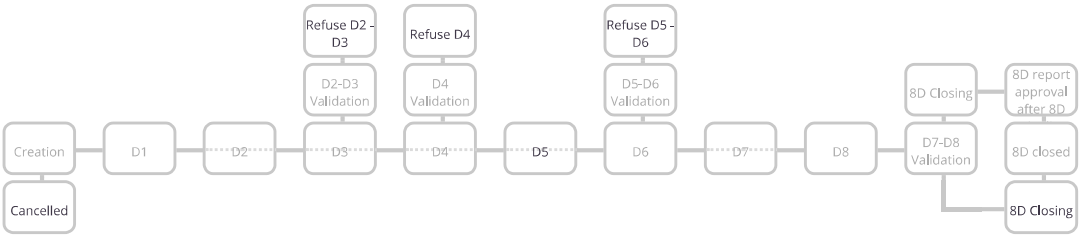

NOTIFICATIONS SENT

0 Result(s)

NIDEC APPROVALS & REFUSALS HISTORY

Steps approved

Step	Date of validation	User name
D8	4/1/2024	Marwen Haggui
8D Closing	4/2/2024	FRANCISCO MOYA
8D report approval after 8D Audit	4/2/2024	FRANCISCO MOYA
D1	2/22/2024	Alfons Lledo
D4 Validation	2/29/2024	Alfons Lledo
D2	2/29/2024	Marwen Haggui
D2	2/29/2024	Karim MNASRI
D2-D3 Validation	2/26/2024	Alfons Lledo
D3	2/29/2024	Marwen Haggui
D4	2/29/2024	Marwen Haggui
D5-D6 Validation	3/7/2024	Alfons Lledo
D6	3/7/2024	Alfons Lledo
D7	4/1/2024	Marwen Haggui
D7-D8 Validation	4/2/2024	Alfons Lledo
8D closed	4/2/2024	FRANCISCO MOYA

« ‹ 1 2 › 16 Result(s)

Steps rejected

Step	Date of refusal	User name	Reason for rejection
D4 Validation	2/29/2024	Alfons Lledo	Modify D4
8D Closing	3/25/2024	Alfons Lledo	Fill in 8.3

D7-D8 Validation	3/26/2024	FRANCISCO MOYA	Update point 8.3 with Audit

3 Result(s)

Forum

Filter

Keywords:

0 Result(s)

Quick Response (D1-D3)

ALERTS

-Component without PPAP

Plant issued a claim: NIDEC MOTORS & ACTUATORS (SPAIN) S.A.U
Supplier: **AVO Carbon France (NMAS609128)**
Date of Claim: **2/22/2024**
Customer Contact: **Lledo Alfons**
SAP Vendor Code: **609128**
Date of QR: **2/23/2024**
Claim reference: **NMAS/609128/2/2024/1673**
Author: **LLEDO Alfons**
Update of QR:
Status: **Closed**
Type: **C2 : Production claim**
CLAIM PPM: 0.00
D1-D3 evaluation score: 22

D1. Description of the problem

1.A WHAT IS THE PROBLEM ? USE 5W+2H TO DESCRIBE WHAT IS THE CURRENT SITUATION.

Problem description: **Fuse Choke Leg Height NOK**
What happened?: **Fuse Choke Leg Height measured at 10.19 - drawing spec 5.6min to 8max SPPC**
Part Number & Description: **BRUSH CARD HOLDER 11TA (A14116701A)**
Why is it a problem?: **Shortcircuit risk with the Motor Rear Cover**
Traceability of nok parts: **23041203**
When did it happen? : **2/20/2024** 12:00:00 AM (your local time)
Recurrence: **No reccurent defect**
Who detected it?: **11TA Line Operator**
Defect S/R: **Yes (S/security)**
Where was it detected? : **Assembly Line Electrical Test Station**
How was it detected?: **Shorticuit at Electrical Test**
How many parts ?: **14.00**

nok part picture / sketch:

ok part picture / sketch:

Other files::



1.B SUPPLIER PROBLEM SOLVING TEAM

Supplier Team

Add an existing contact:

Name		Contact	Email	Phone	Cell Phone	Fax	Position	Profile	Status
Haggui Marwen	✉	• marwen.haggui@avocarbon.com	marwen.haggui@avocarbon.com	+21656057189	+21656057189		Customer Quality	Supplier	Active
MNASRI Karim	✉	• karim.mnasri@avocarbon.com	karim.mnasri@avocarbon.com	+21656834809			Plant Quality Manager	Supplier	Active

NidecTeam

Contact	Email	Profile
LLEDO Alfons	Alfons.Lledo@nidec-ma.com	{profile} Local Quality (Local SQE) (Full) (Claim)
MACÍAS Juan Antonio	juan-antonio.macias@nidec-ma.com	{profile} Local Quality (Local SQE) (Full) (Claim)
MOYA FRANCISCO	francisco.moya@nidec-ma.com	{profile} Local Quality (Local SQE) (Full) (Claim)

1.C TOOL TO USE (DEFINED BY NIDEC)

Ishikawa: ☑ FTA: ☑ 5 Whys : ☑ LLC: ☑ Audit: ☑ Other: ☐

1.D PROBLEM DESCRIPTION FROM SUPPLIER / FIRST ANALYSE OF PROBLEM / POTENTIAL ROOT CAUSES

Problem description from Supplier: **Fuse Choke Leg Height NOK**

Samples of nok parts required at supplier location: ☑ Express shipping supplier account: **regular truck**

D2. Risk on similar products and processes

Can this defect happen on similar parts?: Comments (compulsory if yes): **(A14116701A)**

Other family product: ☐

Other machine: ☐

Other tooling: ☐

Other Nidec plants: ☐

Other: ☐

D3. Containment

WHAT ARE THE ACTIONS TO DETECT ALL NON-CONFORMING PARTS IN THE PROCESS FLOW?

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Delivery note and batch #	Responsible
Parts at Nidec plant	1,136.00	0.00	14.00		23041203	Nidec
Parts at Nidec logistics platform	0.00	0.00	0.00			
Parts at Nidecs customer (C1 claim)	0.00	0.00	0.00			

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Responsible	Delivery note and batch #
Parts in transport	0.00	0.00	0.00			
Parts at supplier / supplier platform	6,000.00	6,000.00	0.00	2/29/2024	Supplier	Delivery for Week 09
Parts at sub-supplier	0.00	0.00	0.00			
Other Nidec plant/s	0.00	0.00	0.00			

4 Result(s)

How are the ok parts identified?: **100% secured regarding NOK fuse choke height**

First contained shipment information: **first delevery for week 09**

How are the ok paletts identified?: **Orange NIDEC identification**

How are the ok parts identified? :: Identification of securing palette.docx

WHAT ARE THE IMMEDIATE ACTIONS TO PREVENT PRODUCTION/DELIVERY OF NOK PARTS?

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
Express delivery to Nidec to avoid production stop	Not required	Nidec	2/20/2024	

Nidec suspect stocks to be sent to supplier	Required	Nidec	2/20/2024	

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
QRQC meeting	Required	Supplier	2/23/2024	2/23/2024

1 Result(s)

D4-D8

ALERTS

-Component without PPAP

Plant issued a claim: NIDEC MOTORS & ACTUATORS (SPAIN) S.A.U
Supplier: **AVO Carbon France (NMAS609128)**
Creation Date: **2/22/2024**

Customer Contact: **Lledo Alfons**
SAP Vendor Code: **609128**
Date of QR: **2/23/2024**

Claim reference: **NMAS/609128/2/2024/1673**
Created by: **LLEDO Alfons**
Update of QR:

Status: **Closed**
Type: **C2 : Production claim**
Date of D4-D8: **2/29/2024**

CLAIM PPM: 0.00

D4-D8 evaluation score: 75
Update of D4-D8: **3/6/2024**

D 4. Root cause of occurrence

Work out the root causes using first Ishikawa, then FTA and finally 5 why's (Tools to use chosen by Nidec).

ROOT CAUSE OF OCCURRENCE

lack of standard : there is no standard of rework operation
Our Production team receive this palettes to checked and change the spring NOK and passed again in Electrical test.
After the rework, the pallet was still waiting for the availability of the electrical test, and due to the miscommunication between the production team and warehouse, the agent of the warehouse entered the pallet to be delivered

HOW WAS THE DEFECT REPRODUCED ?

passe the parts after rework with no control in electrical test

Attachment:

D 5. Root casue of non detection

ROOT CAUSE OF NON DETECTION :

lack of standard : parts are not re-controled and passed to electrical test
No risk analysis done

Attachments:

D 6. Countermeasure to non detection and occurrence

6.A ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan	Date Clos.	Attachments Please click 'Save' to activate attachment field
create standard for the rework spring	hajer jaffri	3/1/2024	3/1/2024	Copie de Instruction de chgt ressort.pdf
Create a general instruction for the rework of returned palettes.	marwan haggui	3/4/2024	3/4/2024	Standard Gestion des palettes retour client updated.pdf

2 Result(s)

6.B ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
risk analysis in PFMEA : adding action of rework spring	marwen	3/5/2024	3/5/2024	

1 Result(s)

D 7. Effectiveness of action plan

7A ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
first batch secured after corrective action N° palette : N° 08 N° batch : 240315	haggui marwan	3/16/2024	3/16/2024	

1 Result(s)

7B ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field

D 8. Action(s) to prevent recurrence

8.1 DO FOLLOWING DOCUMENTS REQUIRE AN UPDATE ?

Name of the document	Responsible	Date Plan	Date Clos.	Attachments
PFMEA	haggui marwan	3/5/2024	3/5/2024	
Control Plan				
Work instruction	haggui marwan	3/4/2024	3/4/2024	Standard_Gestion_des_palettes_retour_client_updated (1).pdf
Control instruction				
Procedure	hajjer jaffri	3/1/2024	3/1/2024	Copie_de_Instruction_de_chgt_ressort (1).pdf
Control gage				
Maintenance instruction				
Lesson Learned Card				
Other	training departement	3/4/2024	3/4/2024	sheet training returned pallets.pdf
Other	hamza jbelli	3/25/2024	3/25/2024	audit process ok.pdf
Other				

8.2 GENERALIZATION OF COUNTERMEASURES TO SIMILAR LINES/ PRODUCTS

8.3 AUDIT DONE BY SUPPLIER (IF REQUIRED)

8D Audit required?: **Yes**

Date of audit done by supplier: **3/25/2024**

Supplier Audit Results: **process audit for production line 11TA/B8 --> audit OK**

Supplier Audit Comment: **-**

8.4 VALIDATION OF 8D CLOSURE FROM SUPPLIER MANAGEMENT

Name: **haggui marwen**

Supplier Management Position: **Quality customer**

Date of validation of 8D closure from supplier management: **3/14/2024**

Closure of 8D from Nidec

Chargeback: **Done**

Efficiency of 8D proven: **Done**

Nok stocks at zero: **Done**

8D eval value (%): **100.00**

Date of closure: **3/25/2024**

Supplier 8D Report Evaluation Sheet

EVALUATION

D#	Discipline	Unsatisfactory/Not OK	Acceptable	Requirements
D1B	Supplier problem solving team	☐ Minimum standard not reached	☐ - Champion named - Cross functional team - Champion contact data available	☑ - Names and all functio team are available
D1D	Problem description from supplier / first analysis of the problem / potential root cause	☐ Minimum standard not reached	☐ - Clear and complete description of potential root cause - Express shipping account avaliable	☑ - Relevant attachment root cause provided
D2	Risk on similar products and processes	☐ Minimum standard not reached	☐ - Risk analysis for simmliar products/lines performed and adequate information provided	☑ - Information about ri numbers/family provi
D3	Containment	☐ Minimum standard not reached	☐ - Overview of actions in all material postions (e.g. in transit) available - Effectivity confirmed	☑ - Proof of containmen documentation availa
D4	Root cause of occurrence	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for occurence - Appropriate methods applied	☑ - Proof for actions to r pictures, records from
D5	Root cause of non detection	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for non-detection - Appropriate methods applied	☑ - Proof for actions to r pictures) provided
D6a	Actions for occurence	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions	☑ - Announced deadline respected
D6b	Actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions	☑ - Announced deadlines respected
D7a	Actions to check effectiveness actions for occurence	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containment actions introduction of perma
D7b	Actions to check effectiveness actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containment actions introduction of perma

D8.1	Do following documents require an update ?	☐ Minimum standard not reached	☐ - Documented lessons learned - Relevant documents updated (FMEA, Control Plan, etc.)	☑ - Analysis of generaliz to similar lines/produc
D8.4	Validation of 8D closure from supplier management	☐ Minimum standard not reached	☐ - All dates in logical order	☑ - 8D is cross-checked a champion/manageme
Report		☐ Minimum standard not reached	☐ - All content is understandable	☑ - No abbreviations anc used

EVALUATION RESULT

Evaluation result: 100

New tab

Ishikawa Diagram

Date of Ishikawa: **2/26/2024** Update of Ishikawa: **2/29/2024**

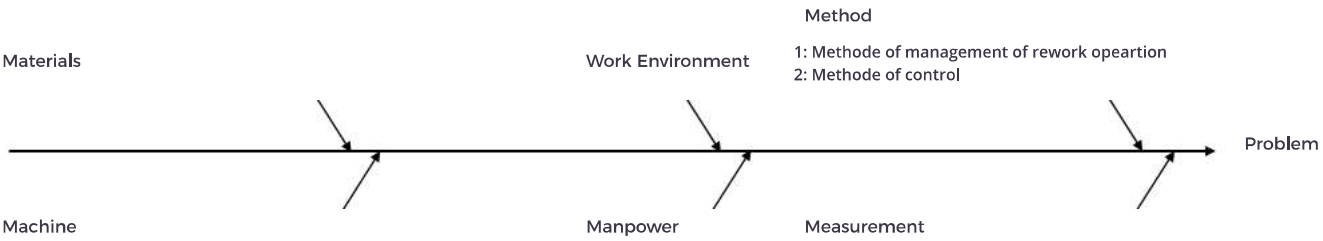

3: EOL electrical test : test the height of fuse choke

Nidec Comments

Factor Tree Analysis

Date of FTA: **2/26/2024** Update of FTA:

PROBLEM DESCRIPTION

Problem description: **Fuse Choke Leg Height NOK**

OCCURENCE

Factors	Control Point	Standard	OK parts	NOK parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Linl
1: methode of management of rework opeartion	all parts reworked must be re passed on electrical test and identified	There is no standard	ok parts reworked and passed on electrical test	NOK parts reworked and didn't passed in electrical test	No	No	due to the miscommunication between the production team and warehouse, the agent of the warehouse entered the pallet to be delivered without re-passed on electrical test due also to miss management of reworked parts	2/28/2024	Yes

1 Result(s)

NON DETECTION

Factor	Control Point	Standard	OK Parts	NOK Parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link?

2: Methode of control	in the final control station the opertor make the control the welding aspect of fuse choke and control visual the height of fuse choke	according to IC700 control instruction , control the height of fuse choke	OK part passed value of height fuse choke is less than 8 mm	NOK parts detecetd value of height fuse choke is 10.187 mm	Yes	Yes	no action to reproduice the defect		No	IC_700_ 243___7 (2).pdf
3: EOL electrical test : test the height of fuse choke	EOL 100% control of height of fuse choke	According to drawing A14116701A the value of fuse choke height is 5.6 min to 8 max	ok parts passed ok on electrical test	NOK parts are not passed on electrical test	Yes	Yes	no action to reproduice the defect		No	Média1.

2 Result(s)

Nidec Comment

5 Whys's

Date of 5 why's: **2/29/2024** Update of 5 Why's:

PROBLEM DESCRIPTION

Problem description: **Fuse Choke Leg Height NOK**

OCCURENCE

Relevant factors from FTA	1st WHY?	1st Check	2nd WHY?	2nd Check	3rd WHY?	3rd Check	4th WHY?	4th
1: methode of management of rework opeartion	risk not defined	>	There is no specific standard to manage the reworked palette requested by the customer.	>	no risk analysis done	X		

1 Result(s)

NON DETECTION

Relevant factors from FTA	1st WHY?	1st Check	2nd Check	2nd WHY?	3rd WHY?	3rd Check	4th WHY?	4th Check	5th WHY?	5th Check

Nidec Comment

Lesson Learned Card

LLC Type

Date of LLC: **3/14/2024**

Logistics: ☐ Management: ☐

Product: ☐ Detection: ☑

Occurence: ☑ Process: ☐

1. What was the problem?

What happened?

Fuse Choke Leg Height measured at 10.19 - drawing spec 5.6min to 8max SPPC

Who detected it?

11TA Line Operator

2. What is the cause?

lack of standard : there is no standard of rework operation
Our Production team receive this palettes to checked and change the spring NOK and passed again in Electrical test.

Where was it detected?

Assembly Line Electrical Test Station

How was it detected?

Shorticuit at Electrical Test

Why is it a problem?

Shortcircuit risk with the Motor Rear Cover

When did it happen?

2/20/2024 12:00:00 AM (your local time)

How many parts ?

14.00

After the rework, the pallet was still waiting for the availability of the electrical test, and due to the miscommunication between the production team and warehouse, the agent of the warehouse entered the pallet to be delivered

3. Description of the applied modification

BEFORE	AFTER
No standard of returned palette from customer and rework flow	create standard for the rework spring Create a general instruction for the rework of returned palettes.

4. What we learned?

ERADICATION

What is the countermeasure that was put in place to avoid recurrence ?

For occurence
1/ create standard of rework spring
2/ Create a general instruction for the rework of returned palettes
For non-detection
risk analysis in PFMEA : adding action of rework spring

CHECKING

What is the method (who, what, how) for the countermeasures?

Who: Supplier
What :
*/For occurence : check the apply the standard of returned palettes
*/For non-detection : take consideration all the risk in PFMEA

SIGNALING

What is the countermeasure supposed to do or m non conformity ?

In case of detection NOK parts with Fuse Choke Le Height NOK parts in the production line : alert and all stock for the sorting
+ ALert and block the parts in the transit

5. What has been modified?

- a. Proces is modified according to Before/ After sheet: ☐
- b. All documents have been updated and has been validated with the operators: ☑
- c. Procedures and work instructions: ☑
- d. Control Plan and PFMEA: ☑
- e. Maintenance instructions: ☐
- f. Records (start-up checklists, reaction sheets, preventive maintenance...): ☐
- g. Visual aids are postec
- h. Operators and other functions are trainec
- i. Proof of training is avalaible (records,5 ' meeting
- j. Operators can correctly describe what they must dc
- k. Other

An evidance of modification:

Standard_Gestion_des_palettes_retour_client_updated (1).pdf

Copie_de_Instruction_de_chgt_ressort (1).pdf

sheet training returned pallets.pdf

audit process ok.pdf

6. Potential applicability

LLC Applicability Product: A14116701A

LLC Applicability Line / process: 11TA/B8

LLC Applicability Plant: AVO

Sorting Approval

Approval of sorting / rework

This document must be sent to Nidec within 24 hour(s) after claim notification

Date of page: Update:

CLAIM ISSUER	CLAIM RECEIVER
Author: Lledo Alfons	Name: NEILI Amen Allah
Position: Supplier Quality Assurance	Position: Quality Engineer

Phone: +34 93 5447067
Fax:
Email: Alfons.Lledo@nidec-ma.com

Phone: +216 58 58 88 41
Fax:
Email: amenallah.neili@avocarbon.com

IMMEDIATE ACTIONS REQUIRED AT NIDEC

PROBLEM DESCRIPTION

Fuse Choke Leg Height NOK

DESCRIPTION OF SORTING/REWORK

QUANTITY AND PART NUMBERS CONCERNED

Parts at Nidec plant: 1,136.00
Parts at Nidec logistics platfrom: 0.00
Parts at Nidec's customer (C1): 0.00
Parts in transport: 0.00
Part Number & Description: BRUSH CARD HOLDER 11TA (A14116701A)
Suspected delivery notes and batches#: 23041203, Delivery for Week 09

SORTING COMPANY CHOSEN TO DO THE SORTING/REWORK

Company Name:
Company Address:
Company Website:
Phone:

COMMENTS FROM NIDEC

All costs for semi-finished goods and finished goods with nok components will be invoiced to the supplier. Nok components will be returned to the supplier.

UPLOAD SIGNED FILE

LIST OF SORTING APPROVAL FILES

0 Result(s)

New tab

8D Report Explanation

D1
Nidec opens and incident and issues an 8D to the Supplier
D2-D3

The Supplier undertakes to:

- **Contain all defective Supplies which have the same defect from all stocks (finished and semi-finished) and in transportation and at all affected Nidec locations worldwide,**
- **Upon request, send a team to carry out sorting and inspection operations at Nidec and Nidec's Customers locations,**
- **Upon request, send a team at Nidec's site to address the issue, even if the responsibility of the Supplier has not been proven yet,**
- **Replace defective batch (es),**
- **Label non-defective batch(es) accordingly,**

D4-D5-D6

The Supplier undertakes to:

- **Perform an exhaustive analysis to identify the root cause of the non-conformity with the defined methods,**
- **Provide Nidec with an action plan to be validated by Nidec prior to any action being implemented.**
- **Update the production CP accordingly to be validated by Nidec.**

D7-D8

The Supplier undertakes to:

- **Check the efficiency of the actions implemented. Results have to be validated by Nidec.**
- **Update all related documents.**
- **Implement the actions to similar Supplies and processes (elimination of recurrences).**
- **Issue a Lesson Learned Card.**

Supplier 8D Report Evaluation Sheet

8D Evaluation Sheet has to be presented with final version of 8D report. Evaluation sheet is a tool for assessing compliance of 8D content with Nidec requirements. There are with three levels of acceptance:

- **0% - 79% - 8D does not meet minimum requirements and cannot be accepted**
- **80% - 89% - 8D meets minimum requirements and can be accepted**
- **90% - 100% - 8D evaluated with bonus points and can be accepted**

8D Evaluation Sheet has three levels of points:

- **Unsatisfactory/Not OK**
- **Acceptable**
- **Requirements fulfilled/Bonus**

Incidents closure

8D following C1 and C2 incidents will be closed after Nidec validation.

Nidec may perform an 8D audit to assess 8D application for C1 incidents. The standard template (Supplier 8D audit) to be used is provided with the RFQ package.

New tab