Claim Management Panel

Supplier: **AVO Carbon France (NMAP551841)**

Type: **C1 : Customer claim**

Problem description: **Intermittent Hall function - unwelded fork**

Claim reference: **NMAP/551841/10/2024/1879**

Settings

C1 REMINDER PANEL

(QR) D2-D4 Defualt Due Date: **11/29/2024** 3:59:47 PM (your local time)
(QR) D2-D4 Revised Due Date:
(QR) D2-D4 Actual Date: **11/29/2024** 8:50:25 AM (your local time)
(QR) D2-D4

D5-D6 Default Due Date: **12/5/2024** 3:59:47 PM (your local time)
D5-D6 Revised Due Date:
D5-D6 Actual Date: **12/20/2024** 2:30:12 PM (your local time)
D5-D6

D7-D8 Default Due Date: **12/12/2024** 3:59:47 PM (your local time)
D7-D8 Revised Due Date:
D7-D8 Actual Date: **12/20/2024** 4:48:19 PM (your local time)
D7-D8

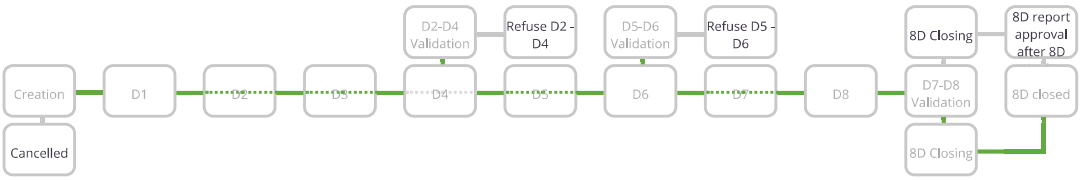

NOTIFICATIONS SENT

0 Result(s)

NIDEC APPROVALS & REFUSALS HISTORY

Steps approved

Step	Date of validation	User name
Creation	11/28/2024	Krzysztof Chłapek
D1	11/28/2024	Krzysztof Chłapek
D2	11/29/2024	Anis Othmani
D3	11/29/2024	Anis Othmani
D4	11/29/2024	Anis Othmani
D2-D4 Validation	12/18/2024	Dominik Dudek
D5	12/20/2024	Anis Othmani
D6	12/20/2024	Anis Othmani
D5-D6 Validation	12/20/2024	Dominik Dudek
D7	12/20/2024	Wissal Bechikh
D8	12/20/2024	Wissal Bechikh
D7-D8 Validation	12/30/2024	Dominik Dudek
8D Closing	12/30/2024	Dorota Siekaniec
8D closed	12/30/2024	Dorota Siekaniec

14 Result(s)

Steps rejected

Step	Date of refusal	User name	Reason for rejection
D2-D4 Validation	10/15/2024	Dominik Dudek	the D1-D4 cannot be approved because Nidec does not agree with reject the claim by AVO. NOK part will be shipped to AVO on Wednesda attached picture special label to amec pp
D2-D4 Validation	11/15/2024	Dominik Dudek	both sides test (AVO-Nidec) showed that hall IC wire was not welded to the fork (hall IC is lose inside the fork). Nidec not agree with rejecte
D2-D4 Validation	11/20/2024	Dominik Dudek	details you can find in the mail

D2-D4 Validation	11/22/2024	Dominik Dudek	D4 should be review and discuss with supplier due to the improve the analysis.

4 Result(s)

Forum

Filter

Keywords:

0 Result(s)

Quick Response (D1-D3)

ALERTS

-Component without PPAP

Plant issued a claim: NIDEC MOTORS & ACTUATORS (POLAND) Sp z o.o.
Supplier: **AVO Carbon France (NMAP551841)**
Date of Claim: **10/11/2024**

Customer Contact: **Dudek Dominik**
SAP Vendor Code: **551841**
Date of QR: **10/14/2024**

Claim reference: **NMAP/551841/10/2024/1879**
Author: **DUDEK Dominik**
Update of QR: **10/11/2024**

Status: **Closed**
Type: **C1 : Customer claim**

CLAIM PPM: 0.00

D1-D3 evaluation score: 22

D1. Description of the problem

1.A WHAT IS THE PROBLEM ? USE 5W+2H TO DESCRIBE WHAT IS THE CURRENT SITUATION.

Problem description: **Intermittent Hall function - unwelded fork**

Part Number & Description: Brush mounting plate assy (503-773-99-99)

Traceability of nok parts: **DMC 5037732418651051, ASN 180397098**

Recurrence: **Recurrent defect**

Defect S/R: **No**

nok part picture / sketch:

Other files::

What happened?: **Intermittent Hall function - unwelded fork**

Why is it a problem?: **Intermittent Hall function - unwelded fork**
No Hall sensor signal.

When did it happen? : **10/3/2024** 11:00:00 PM (your local time)

Who detected it?: **Customer - Adient Jimbolia**

Where was it detected? : **Adient Jimbolia production**

How was it detected?: **During production**

How many parts ?: **1.00**

ok part picture / sketch:

1.B SUPPLIER PROBLEM SOLVING TEAM

Supplier Team

Add ar

Name		Contact	Email	Phone	Cell Phone	Fax	Position	Pr
Bechikh Wissal		• wissal.bechikh@avocarbon.com	wissal.bechikh@avocarbon.com	+216 58598711			Customer Quality	Su
Ben Mallek Bassem			bassem.benmallek@avocarbon.com	00216 58588811			Project quality engineer	{pı
Ghribi Mohamed Aymen		• mohamedaymen.ghribi@avocarbon.com	mohamedaymen.ghribi@avocarbon.com	0021658352210			Quality	Su
Haggui Marwen		• marwen.haggui@avocarbon.com	marwen.haggui@avocarbon.com	+21656057189	+21656057189		Customer Quality	Su
Othmani Anis		• anis.othmani@avocarbon.com	anis.othmani@avocarbon.com	216	+21658588818		Quality Manager	Su

NidecTeam

Contact	Email	Profile
DUDEK Dominik	dominik.dudek@nidec-ma.com	{profile} Local Quality (Local SQE) (Full) (Claim)
MOSTOWIK Marek	marek.mostowik@nidec-ma.com	{profile} Contributor (Claim)

1.C TOOL TO USE (DEFINED BY NIDEC)

Ishikawa: ☑ FTA: ☑ 5 Whys : ☑ LLC: ☑ Audit: ☐ Other: ☐

1.D PROBLEM DESCRIPTION FROM SUPPLIER / FIRST ANALYSE OF PROBLEM / POTENTIAL ROOT CAUSES

Problem description from Supplier: **Intermittent Hall function - unwelded fork**

Samples of nok parts required at supplier location: ☐ Express shipping supplier account: **regular truck**

D2. Risk on similar products and processes

Can this defect happen on similar parts?: Comments (compulsory if yes): **503.989-99-99 503.775-99-99 503.773-99-99 503.991-99-99**

Other family product: ☐

Other machine: ☐

Other tooling: ☐

Other Nidec plants: ☐

Other: ☐

D3. Containment

WHAT ARE THE ACTIONS TO DETECT ALL NON-CONFORMING PARTS IN THE PROCESS FLOW?

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Delivery note and batch #	Responsible
Parts at Nidec plant	0.00	0.00	1.00			
Parts at Nidec logistics platform	0.00	0.00	0.00			
Parts at Nidecs customer (C1 claim)	0.00	0.00	0.00			

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Responsible	Delivery note and batch #
Parts in transport	0.00	0.00	0.00			
Parts at supplier / supplier platform	15,000.00	15,000.00	0.00	10/11/2024	Supplier	delevery of week W41
Parts at sub-supplier	0.00	0.00	0.00			
Other Nidec plant/s	0.00	0.00	0.00			

4 Result(s)

How are the ok parts identified?: **100% secured reagdring the Hall function - unwelded fork**

First contained shipment information: **delevery of week 41**

How are the ok paletts identified?: **orange Nidec identification**

How are the ok parts identified? ::

WHAT ARE THE IMMEDIATE ACTIONS TO PREVENT PRODUCTION/DELIVERY OF NOK PARTS?

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.

Express delivery to Nidec to avoid production stop				
Nidec suspect stocks to be sent to supplier				

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
display quality alert in production line	Not required	Supplier	10/11/2024	10/11/2024
QRQC meeting with all team	Not required	Supplier	10/11/2024	10/11/2024

2 Result(s)

D4-D8

ALERTS

-Component without PPAP

Plant issued a claim: NIDEC MOTORS & ACTUATORS (POLAND) Sp z o.o.
Supplier: **AVO Carbon France (NMAP551841)**
Creation Date: **10/11/2024**

Customer Contact: **Dudek Dominik**
SAP Vendor Code: **551841**
Date of QR: **10/14/2024**

Claim reference: **NMAP/551841/10/2024/1879**
Created by: **DUDEK Dominik**
Update of QR: **10/11/2024**

Status: **Closed**
Type: **C1 : Customer claim**
Date of D4-D8: **10/11/2024**

CLAIM PPM: 0.00

D4-D8 evaluation score: 75
Update of D4-D8: **12/20/2024**

D 4. Root cause of occurrence

Work out the root causes using first Ishikawa, then FTA and finally 5 why's (Tools to use chosen by Nidec).

ROOT CAUSE OF OCCURRENCE

1-Pressure controller not locked and setter can change the program manually
2-No sensor implemented to launch new cycle in the machine

HOW WAS THE DEFECT REPRODUCED ?

Parts were welded with pressure (=2 Bar) lower than the minimum (= 2,5 Bar)
Parts were welding not proply due to there is not enough pressure during the welding operation to melt the fork

Attachment:

D 5. Root casue of non detection

ROOT CAUSE OF NON DETECTION :

insuffisant standard :

in the current standart there is no indication to doubel check the presure after maintenance intervention by the quality agent on the station of Hall IC -fork

Attachments:

D 6. Countermeasure to non detection and occurrence

6.A ACTIONS FOR OCCURENCE