Claim Management Panel

Supplier: **AVO Carbon France (NMAP551841)**

Type: **C1 : Customer claim**

Problem description: **Intermittent Hall function - unwelded fork**

Claim reference: **NMAP/551841/10/2024/1879**

Settings

C1 REMINDER PANEL

(QR) D2-D4 Defualt Due Date: **11/29/2024** 3:59:47 PM (your local time)
(QR) D2-D4 Revised Due Date:
(QR) D2-D4 Actual Date: **11/29/2024** 8:50:25 AM (your local time)
(QR) D2-D4

D5-D6 Default Due Date: **12/5/2024** 3:59:47 PM (your local time)
D5-D6 Revised Due Date:
D5-D6 Actual Date: **12/20/2024** 2:30:12 PM (your local time)
D5-D6

D7-D8 Default Due Date: **12/12/2024** 3:59:47 PM (your local time)
D7-D8 Revised Due Date:
D7-D8 Actual Date: **12/20/2024** 4:48:19 PM (your local time)
D7-D8

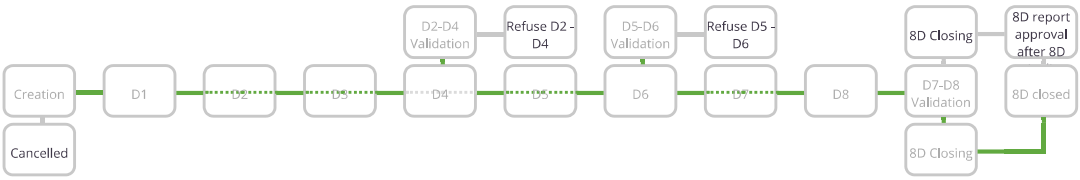

NOTIFICATIONS SENT

0 Result(s)

NIDEC APPROVALS & REFUSALS HISTORY

Steps approved

Step	Date of validation	User name
Creation	11/28/2024	Krzysztof Chłapek
D1	11/28/2024	Krzysztof Chłapek
D2	11/29/2024	Anis Othmani
D3	11/29/2024	Anis Othmani
D4	11/29/2024	Anis Othmani
D2-D4 Validation	12/18/2024	Dominik Dudek
D5	12/20/2024	Anis Othmani
D6	12/20/2024	Anis Othmani
D5-D6 Validation	12/20/2024	Dominik Dudek
D7	12/20/2024	Wissal Bechikh
D8	12/20/2024	Wissal Bechikh
D7-D8 Validation	12/30/2024	Dominik Dudek
8D Closing	12/30/2024	Dorota Siekaniec
8D closed	12/30/2024	Dorota Siekaniec

14 Result(s)

Steps rejected

Step	Date of refusal	User name	Reason for rejection
D2-D4 Validation	10/15/2024	Dominik Dudek	the D1-D4 cannot be approved because Nidec does not agree with reject the claim by AVO. NOK part will be shipped to AVO on Wednesda attached picture special label to amec pp
D2-D4 Validation	11/15/2024	Dominik Dudek	both sides test (AVO-Nidec) showed that hall IC wire was not welded to the fork (hall IC is lose inside the fork). Nidec not agree with rejecte
D2-D4 Validation	11/20/2024	Dominik Dudek	details you can find in the mail

D2-D4 Validation	11/22/2024	Dominik Dudek	D4 should be review and discuss with supplier due to the improve the analysis.

4 Result(s)

Forum

Filter

Keywords:

0 Result(s)

Quick Response (D1-D3)

ALERTS

-Component without PPAP

Plant issued a claim: NIDEC MOTORS & ACTUATORS (POLAND) Sp z o.o.
Supplier: **AVO Carbon France (NMAP551841)**
Date of Claim: **10/11/2024**

Customer Contact: **Dudek Dominik**
SAP Vendor Code: **551841**
Date of QR: **10/14/2024**

Claim reference: **NMAP/551841/10/2024/1879**
Author: **DUDEK Dominik**
Update of QR: **10/11/2024**

Status: **Closed**
Type: **C1 : Customer claim**

CLAIM PPM: 0.00

D1-D3 evaluation score: 22

D1. Description of the problem

1.A WHAT IS THE PROBLEM ? USE 5W+2H TO DESCRIBE WHAT IS THE CURRENT SITUATION.

Problem description: **Intermittent Hall function - unwelded fork**

Part Number & Description: Brush mounting plate assy (503-773-99-99)

Traceability of nok parts: **DMC 5037732418651051, ASN 180397098**

Recurrence: **Recurrent defect**

Defect S/R: **No**

nok part picture / sketch:

Other files::

What happened?: **Intermittent Hall function - unwelded fork**

Why is it a problem?: **Intermittent Hall function - unwelded fork**
No Hall sensor signal.

When did it happen? : **10/3/2024** 11:00:00 PM (your local time)

Who detected it?: **Customer - Adient Jimbolia**

Where was it detected? : **Adient Jimbolia production**

How was it detected?: **During production**

How many parts ?: **1.00**

ok part picture / sketch:

1.B SUPPLIER PROBLEM SOLVING TEAM

Supplier Team

Add ar

Name		Contact	Email	Phone	Cell Phone	Fax	Position	Pr
Bechikh Wissal		• wissal.bechikh@avocarbon.com	wissal.bechikh@avocarbon.com	+216 58598711			Customer Quality	Su
Ben Mallek Bassem			bassem.benmallek@avocarbon.com	00216 58588811			Project quality engineer	{pı
Ghribi Mohamed Aymen		• mohamedaymen.ghribi@avocarbon.com	mohamedaymen.ghribi@avocarbon.com	0021658352210			Quality	Su
Haggui Marwen		• marwen.haggui@avocarbon.com	marwen.haggui@avocarbon.com	+21656057189	+21656057189		Customer Quality	Su
Othmani Anis		• anis.othmani@avocarbon.com	anis.othmani@avocarbon.com	216	+21658588818		Quality Manager	Su

NidecTeam

Contact	Email	Profile
DUDEK Dominik	dominik.dudek@nidec-ma.com	{profile} Local Quality (Local SQE) (Full) (Claim)
MOSTOWIK Marek	marek.mostowik@nidec-ma.com	{profile} Contributor (Claim)

1.C TOOL TO USE (DEFINED BY NIDEC)

Ishikawa: ☑ FTA: ☑ 5 Whys : ☑ LLC: ☑ Audit: ☐ Other: ☐

1.D PROBLEM DESCRIPTION FROM SUPPLIER / FIRST ANALYSE OF PROBLEM / POTENTIAL ROOT CAUSES

Problem description from Supplier: **Intermittent Hall function - unwelded fork**

Samples of nok parts required at supplier location: ☐ Express shipping supplier account: **regular truck**

D2. Risk on similar products and processes

Can this defect happen on similar parts?: Comments (compulsory if yes): **503.989-99-99 503.775-99-99 503.773-99-99 503.991-99-99**

Other family product: ☐

Other machine: ☐

Other tooling: ☐

Other Nidec plants: ☐

Other: ☐

D3. Containment

WHAT ARE THE ACTIONS TO DETECT ALL NON-CONFORMING PARTS IN THE PROCESS FLOW?

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Delivery note and batch #	Responsible
Parts at Nidec plant	0.00	0.00	1.00			
Parts at Nidec logistics platform	0.00	0.00	0.00			
Parts at Nidecs customer (C1 claim)	0.00	0.00	0.00			

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Responsible	Delivery note and batch #
Parts in transport	0.00	0.00	0.00			
Parts at supplier / supplier platform	15,000.00	15,000.00	0.00	10/11/2024	Supplier	delevery of week W41
Parts at sub-supplier	0.00	0.00	0.00			
Other Nidec plant/s	0.00	0.00	0.00			

4 Result(s)

How are the ok parts identified?: **100% secured reagdring the Hall function - unwelded fork**

First contained shipment information: **delevery of week 41**

How are the ok paletts identified?: **orange Nidec identification**

How are the ok parts identified? ::

WHAT ARE THE IMMEDIATE ACTIONS TO PREVENT PRODUCTION/DELIVERY OF NOK PARTS?

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.

Express delivery to Nidec to avoid production stop				
Nidec suspect stocks to be sent to supplier				

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
display quality alert in production line	Not required	Supplier	10/11/2024	10/11/2024
QRQC meeting with all team	Not required	Supplier	10/11/2024	10/11/2024

2 Result(s)

D4-D8

ALERTS

-Component without PPAP

Plant issued a claim: NIDEC MOTORS & ACTUATORS (POLAND) Sp z o.o.
Supplier: **AVO Carbon France (NMAP551841)**
Creation Date: **10/11/2024**

Customer Contact: **Dudek Dominik**
SAP Vendor Code: **551841**
Date of QR: **10/14/2024**

Claim reference: **NMAP/551841/10/2024/1879**
Created by: **DUDEK Dominik**
Update of QR: **10/11/2024**

Status: **Closed**
Type: **C1 : Customer claim**
Date of D4-D8: **10/11/2024**

CLAIM PPM: 0.00

D4-D8 evaluation score: 75
Update of D4-D8: **12/20/2024**

D 4. Root cause of occurrence

Work out the root causes using first Ishikawa, then FTA and finally 5 why's (Tools to use chosen by Nidec).

ROOT CAUSE OF OCCURRENCE

1-Pressure controller not locked and setter can change the program manually
2-No sensor implemented to launch new cycle in the machine

HOW WAS THE DEFECT REPRODUCED ?

Parts were welded with pressure (=2 Bar) lower than the minimum (= 2,5 Bar)
Parts were welding not proply due to there is not enough pressure during the welding operation to melt the fork

Attachment:

D 5. Root casue of non detection

ROOT CAUSE OF NON DETECTION :

insuffisant standard :

in the current standart there is no indication to doubel check the presure after maintenance intervention by the quality agent on the station of Hall IC -fork

Attachments:

D 6. Countermeasure to non detection and occurrence

6.A ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan	Date Clos.	Attachments Please click 'Save' to activate attachment field
Automatisation of the pressure controller	Hafedh	12/2/2024	12/20/2024	
Add a sensor to detect the position of the piston	Kamel	12/4/2024	12/20/2024	
Update the process rules guideline: Add the requirement of sensor for each Piston installation	Kamel	12/4/2024	12/20/2024	

3 Result(s)

6.B ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activat
Update check list restart after maintenance intervention: Add the check of pressure controller after maintenance intervention	Bechikh Wissal	12/4/2024	12/20/2024	PH 3.70 Soudure Self -cont 1.xls

1 Result(s)

D 7. Effectiveness of action plan

7A ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
Station Audit	Wissal Bechikh	12/20/2024	12/20/2024	audit de poste.pdf

1 Result(s)

7B ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
Station Audit	Wissal Bechikh	12/20/2024	12/20/2024	audit de poste.pdf

1 Result(s)

D 8. Action(s) to prevent recurrence

8.1 DO FOLLOWING DOCUMENTS REQUIRE AN UPDATE ?

Name of the document	Responsible	Date Plan	Date Clos.	Attachments
PFMEA	Wissal Bechikh	12/19/2024	12/19/2024	
Control Plan	Wissal Bechikh	12/19/2024	12/19/2024	
Work instruction	wissal bechikh	12/20/2024	12/20/2024	audit de poste.pdf
Control instruction				
Procedure				

Control gage				
Maintenance instruction				
Lesson Learned Card	Wissal Bechikh	12/19/2024	12/19/2024	
Other				
Other				
Other				

8.2 GENERALIZATION OF COUNTERMEASURES TO SIMILAR LINES/ PRODUCTS

All products CM4

8.3 AUDIT DONE BY SUPPLIER (IF REQUIRED)

8D Audit required?:

Date of audit done by supplier: **12/20/2024**

Supplier Audit Results: **100%**

Supplier Audit Comment: **Correctives actions for occurence and detection are effecient**

8.4 VALIDATION OF 8D CLOSURE FROM SUPPLIER MANAGEMENT

Name: **Anis Othmani**

Supplier Management Position: **Quality Manager**

Date of validation of 8D closure from supplier management: **12/20/2024**

Closure of 8D from Nidec

Chargeback:

Efficiency of 8D proven:

Nok stocks at zero:

8D eval value (%): **100.00**

Date of closure:

Supplier 8D Report Evaluation Sheet

EVALUATION

D#	Discipline	Unsatisfactory/Not OK	Acceptable	Requirements fulfil
D1B	Supplier problem solving team	☐ Minimum standard not reached	☐ - Champion named - Cross functional team - Champion contact data available	☑ - Names and all functions of functional team are availabl
D1D	Problem description from supplier / first analysis of the problem / potential root cause	☐ Minimum standard not reached	☐ - Clear and complete description of potential root cause - Express shipping account avaliable	☑ - Relevant attachments (e.g possible root cause provide
D2	Risk on similar products and processes	☐ Minimum standard not reached	☐ - Risk analysis for simmliar products/lines performed and adequate information provided	☑ - Information about risk at numbers/family provided
D3	Containment	☐ Minimum standard not reached	☐ - Overview of actions in all material postions (e.g. in transit) available - Effectivity confirmed	☑ - Proof of containment effe documentation available
D4	Root cause of occurrence	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for occurence - Appropriate methods applied	☑ - Proof for actions to reproc (e.g. pictures, records from provided

D5	Root cause of non detection	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for non-detection - Appropriate methods applied	☑ - Proof for actions to reproc (e.g. pictures) provided
D6a	Actions for occurence	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions	☑ - Announced deadlines for c respected
D6b	Actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions	☑ - Announced deadlines for c respected
D7a	Actions to check effectiveness actions for occurence	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containment actions succ after introduction of perma action
D7b	Actions to check effectiveness actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containment actions succ after introduction of perma action
D8.1	Do following documents require an update ?	☐ Minimum standard not reached	☐ - Documented lessons learned - Relevant documents updated (FMEA, Control Plan, etc.)	☑ - Analysis of generalization countermeasures to simila performed
D8.4	Validation of 8D closure from supplier management	☐ Minimum standard not reached	☐ - All dates in logical order	☑ - 8D is cross-checked and a champion/management
Report		☐ Minimum standard not reached	☐ - All content is understandable	☑ - No abbreviations and tern definition used

EVALUATION RESULT

Evaluation result: 100

New tab

Ishikawa Diagram

Date of Ishikawa: **11/19/2024** Update of Ishikawa: **12/10/2024**

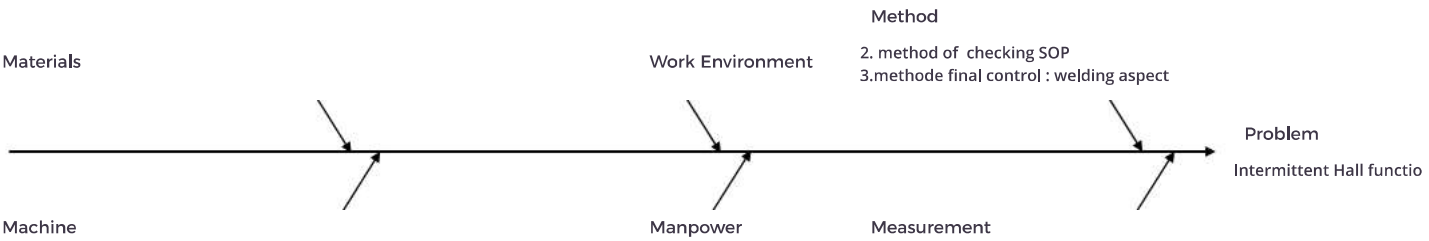

1.welding machine of Hall Ic fork : pressure parameters during welding.
4.welding machine of Hall Ic fork : current parameters during welding.

Nidec Comments

Factor Tree Analysis

Date of FTA: **11/19/2024** Update of FTA: **12/20/2024**

PROBLEM DESCRIPTION

Problem description: **Intermittent Hall function - unwelded fork**

OCCURENCE

Factors	Control Point	Standard	OK parts	NOK parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link?	De

1.welding machine of Hall Ic fork : pressure parameters during welding.	During SOP the quality Agent control the value of Pressure	according to the work instruction */ min 2.5 bar */ Max 3.5 bar if the pressure out tolrance the weling machin stop immediatly	the OK parts produced with pressure = 3 bar	the NOK parts produced with pressure = 2 bar machin not stopped and part skipped	No	Yes	Make the welding with pressure 2 bar (out of tolerance Min) --> defect was created	11/18/2024	Yes	
4.welding machine of Hall Ic fork : current parameters during welding.	During SOP the quality Agent control the value of Current	according to the work instruction */ min 1.9 KA */ Max 2.6 KA if the Welding current out of tolerance the welding machine stopped automatically	2.3 KA	1.8 KA minimum 2.7 KA maximum	Yes	Yes	Make the welding with current 1.6 KA (out of tolerance Min) and 2.7 KA (Out of tolerence maximum)	11/28/2024	No	

2 Result(s)

NON DETECTION

Factor	Control Point	Standard	OK Parts	NOK Parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link?	De
2.method of checking SOP	Start of production with parameters control record	according to the work instruction */ min 2.5 bar */ Max 3.5 bar	Ok parts with SOP validated by Quality agent	the NOK part was produced after the the mainteance intervention that the quality agent didn't verify the pressure parameters	No	Yes	lack of enforcement of second validation after the maintenace intervention		Yes	
3.methode final control	Visuel control of Hall IC-fork welding	according the IC700 control work instruction Visuel aspect of welding	Ok, part with poorly welding	NOK, part with poorly welding	Yes	Yes	the criteria of welding is Ok for the final control opeartor		No	

2 Result(s)

Nidec Comment

5 Whys's

Date of 5 why's: **11/19/2024** Update of 5 Why's: **11/28/2024**

PROBLEM DESCRIPTION

Problem description: **Intermittent Hall function - unwelded fork**

OCCURENCE

Relevant factors from FTA	1st WHY?	1st Check	2nd WHY?	2nd Check	3rd WHY?	3rd Check	4th WHY?	4th Check	5th W
1.welding machine of Hall Ic fork : pressure parameters during welding.	not prooply welding of Hall IC -fork	>	The pressure decrease from 3,5 to 2 bar without stop machine	>	Pressure controller not activated after mainteance intervention	>	Pressure controller not locked and setter can change the program manually "No automatic soft developped in the machine to lock the pressure controller"	>	Risk n the PF the be the pr

1.welding machine of Hall Ic fork : pressure parameters during welding.	not prooply welding of Hall IC -fork		The pressure decrease from 3,5 to 2 bar without stop machine	>	Machine blocked due to the perturbation of cycle "Mouvment of the piston "Jacks"	>	-No sensor implemented to detct the position to launch new cycle in the machine	>	Risk n the pr guide rules)

2 Result(s)

NON DETECTION

Relevant factors from FTA	1st WHY?	1st Check	2nd Check	2nd WHY?	3rd WHY?	3rd Check	4th WHY?	4th Check
2.method of checking SOP	the quality agent didn't re-verification the pressure	>	>	There is no visual device to show the pressure in this welding machine	lack of standard to check the pressure after mainteance intervention	X		

1 Result(s)

Nidec Comment

Lesson Learned Card

LLC Type

Date of LLC: **12/5/2024**

Logistics: ☐ Management: ☐

Product: ☐ Detection: ☐

Occurence: ☑ Process: ☐

1. What was the problem?

What happened?

Intermittent Hall function - unwelded fork

Who detected it?

Customer - Adient Jimbolia

Where was it detected?

Adient Jimbolia production

How was it detected?

During production

Why is it a problem?

Intermittent Hall function - unwelded fork
No Hall sensor signal.

When did it happen?

10/3/2024 11:00:00 PM (your local time)

How many parts ?

1.00

2. What is the cause?

Not activate of pressure control after maintenance intervention
Manual setting of pressure controller (Not locked)

3. Description of the applied modification

BEFORE

Manual pressure controller: unlocked system

AFTER

Automatic pressure controller : Locked system by IHM

4. What we learned?

ERADICATION

What is the countermeasure that was put in place to avoid recurrence ?

CHECKING

SIGNALING

Automatic pressure controller: Locked system in the machine	What is the method (who, what, how) for the countermeasures? **SOP check list**	What is the countermeasure supposed to do or make c a non conformity ? **Audit workstation**

5. What has been modified?

a. Proces is modified according to Before/ After sheet:	☑	g. Visual aids are posted:	☐
b. All documents have been updated and has been validated with the operators:	☐	h. Operators and other functions are trained:	☑
c. Procedures and work instructions:	☑	i. Proof of training is avalaible (records,5 ' meeting):	☑
d. Control Plan and PFMEA:	☑	j. Operators can correctly describe what they must do:	☑
e. Maintenance instructions:	☑	k. Other:	☐
f. Records (start-up checklists, reaction sheets, preventive maintenance...):	☑		
An evidance of modification:			

6. Potential applicability

LLC Applicability Product: **All CM4 Products**

LLC Applicability Line / process: **CM4**

LLC Applicability Plant: **SCEET TUNISIA**

Sorting Approval

Approval of sorting / rework

This document must be sent to Nidec within 24 hour(s) after claim notification

Date of page: Update:

CLAIM ISSUER

Author: **Dudek Dominik**
Position: **SQA Engineer**
Phone: **+48 12 297 27 86**
Fax:
Email: **dominik.dudek@nidec-ma.com**

CLAIM RECEIVER

Name: **Othmani Anis**
Position: **Quality Manager**
Phone: **216**
Fax:
Email: **anis.othmani@avocarbon.com**

IMMEDIATE ACTIONS REQUIRED AT NIDEC

PROBLEM DESCRIPTION

Intermittent Hall function - unwelded fork

DESCRIPTION OF SORTING/REWORK

QUANTITY AND PART NUMBERS CONCERNED

Parts at Nidec plant: **0.00**
Parts at Nidec logistics platfrom: **0.00**
Parts at Nidec's customer (C1): **0.00**
Parts in transport: **0.00**
Part Number & Description: **Brush mounting plate assy (503-773-99-99)**

Suspected delivery notes and batches#: delevery of week W41

SORTING COMPANY CHOSEN TO DO THE SORTING/REWORK

Company Name:

Company Address:

Company Website:

Phone:

COMMENTS FROM NIDEC

All costs for semi-finished goods and finished goods with nok components will be invoiced to the supplier. Nok components will be returned to the supplier.

UPLOAD SIGNED FILE

LIST OF SORTING APPROVAL FILES

0 Result(s)

New tab

8D Report Explanation

D1
Nidec opens and incident and issues an 8D to the Supplier
D2-D3
The Supplier undertakes to: • **Contain all defective Supplies which have the same defect from all stocks (finished and semi-finished) and in transportation and at all affected Nidec locations worldwide,** • **Upon request, send a team to carry out sorting and inspection operations at Nidec and Nidec's Customers locations,** • **Upon request, send a team at Nidec's site to address the issue, even if the responsibility of the Supplier has not been proven yet,** • **Replace defective batch (es),** • **Label non-defective batch(es) accordingly,**
D4-D5-D6
The Supplier undertakes to: • **Perform an exhaustive analysis to identify the root cause of the non-conformity with the defined methods,** • **Provide Nidec with an action plan to be validated by Nidec prior to any action being implemented.** • **Update the production CP accordingly to be validated by Nidec.**
D7-D8
The Supplier undertakes to: • **Check the efficiency of the actions implemented. Results have to be validated by Nidec.** • **Update all related documents.** • **Implement the actions to similar Supplies and processes (elimination of recurrences).** • **Issue a Lesson Learned Card.**
Supplier 8D Report Evaluation Sheet
8D Evaluation Sheet has to be presented with final version of 8D report. Evaluation sheet is a tool for assessing compliance of 8D content with Nidec requirements. There are with three levels of acceptance: • **0% - 79% - 8D does not meet minimum requirements and cannot be accepted** • **80% - 89% - 8D meets minimum requirements and can be accepted** • **90% - 100% - 8D evaluated with bonus points and can be accepted** **8D Evaluation Sheet has three levels of points:** • **Unsatisfactory/Not OK** • **Acceptable** • **Requirements fulfilled/Bonus**
Incidents closure
8D following C1 and C2 incidents will be closed after Nidec validation.

Nidec may perform an 8D audit to assess 8D application for C1 incidents. The standard template (Supplier 8D audit) to be used is provided with the RFQ package.

New tab