Claim Management Panel

Supplier: **AVO Carbon France (NMAP551841)**

Type: **I - Information**

Problem description: **pin of tin on the soldering pad, risk of contamination**

Claim reference: **NMAP/551841/2/2024/1662**

Settings

C2/C3 REMINDER PANEL

(QR) D2-D3 Defualt Due Date :	**2/5/2024**	1:26:04 PM (your local time)	D2-D3 Revised Due Date:	(QR) D2-D3 Actual Date:	**2/5/2024**	4:27:18 PM (your local time)	(QR) D2-D
D4 Default Due Date :	**2/7/2024**	1:26:04 PM (your local time)	D4 Revised Due Date :	D4 Actual Date :	**6/27/2024**	4:26:18 PM (your local time)	D
D5-D6 Default Due Date:	**2/16/2024**	1:26:04 PM (your local time)	D5-D6 Revised Due Date:	D5-D6 Actual Date:	**6/28/2024**	10:59:32 AM (your local time)	D5-D
D7-D8 Default Due Date:	**2/16/2024**	1:26:04 PM (your local time)	D7-D8 Revised Due Date C2/C3:	D7-D8 Actual Date:	**6/30/2024**	8:56:12 AM (your local time)	D7-D

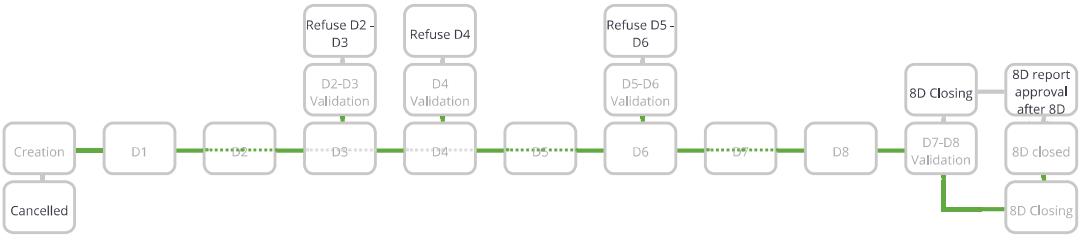

NOTIFICATIONS SENT

0 Result(s)

NIDEC APPROVALS & REFUSALS HISTORY

Steps approved

Step	Date of validation	User name
D8	6/30/2024	Marwen Haggui
D1	2/2/2024	Dominik Dudek
D4 Validation	6/28/2024	Dominik Dudek
D2	6/27/2024	Marwen Haggui
D2-D3 Validation	2/6/2024	Dominik Dudek
D3	6/27/2024	Marwen Haggui
D4	6/27/2024	Marwen Haggui
D5	6/28/2024	Marwen Haggui
D5-D6 Validation	6/28/2024	Dominik Dudek
D6	6/28/2024	Marwen Haggui
D7	6/30/2024	Marwen Haggui
D7-D8 Validation	7/1/2024	Dominik Dudek
8D closed	7/11/2024	Dorota Siekaniec
8D Closing	7/11/2024	Dorota Siekaniec
Creation	2/2/2024	Dominik Dudek

15 Result(s)

Steps rejected

0 Result(s)

Forum

Filter

Keywords:

0 Result(s)

Quick Response (D1-D3)

ALERTS

-Component without PPAP

Plant issued a claim:	NIDEC MOTORS & ACTUATORS (POLAND) Sp z o.o.	Supplier:	**AVO Carbon France (NMAP551841)**	Date of Claim:	**2/2/2024**
Customer Contact:	**Dudek Dominik**	SAP Vendor Code:	**551841**	Date of QR:	**2/5/2024**
Claim reference:	**NMAP/551841/2/2024/1662**	Author:	**DUDEK Dominik**	Update of QR:	**2/5/2024**
Status:	**Closed**	Type:	**I - Information**		
		CLAIM PPM:	0.00		

D1-D3 evaluation score: 22

D1. Description of the problem

1.A WHAT IS THE PROBLEM ? USE 5W+2H TO DESCRIBE WHAT IS THE CURRENT SITUATION.

Problem description:	**pin of tin on the soldering pad, risk of contamination**	What happened?:	**pin of tin on the soldering pad, risk of contamination**
Part Number & Description:	Brush mounting plate assy (503-772-99-99)	Why is it a problem?:	**pin of tin on the soldering pad, risk of contamination**
Traceability of nok parts:	**Batch 2401151, ASN 180382383**	When did it happen? :	**1/30/2024** 12:00:00 AM (your local time)
Recurrence:	**Recurrent defect**	Who detected it?:	**operator**
Defect S/R:	**No**	Where was it detected? :	**CM4 line**
		How was it detected?:	**visually**
		How many parts ?:	**1.00**

nok part picture / sketch:

ok part picture / sketch:

Other files::

1.B SUPPLIER PROBLEM SOLVING TEAM

Supplier Team

Add an existing contact:

Name		Contact	Email	Phone	Cell Phone	Fax	Position	Profile	Status
Haggui Marwen		• marwen.haggui@avocarbon.com	marwen.haggui@avocarbon.com	+21656057189	+21656057189		Customer Quality	Supplier	Active

NidecTeam

Contact	Email	Profile
DUDEK Dominik	dominik.dudek@nidec-ma.com	{profile} Local Quality (Local SQE) (Full) (Claim)

1.C TOOL TO USE (DEFINED BY NIDEC)

Ishikawa: ☑ FTA: ☑ 5 Whys : ☑ LLC: ☑ Audit: ☐ Other: ☐

1.D PROBLEM DESCRIPTION FROM SUPPLIER / FIRST ANALYSE OF PROBLEM / POTENTIAL ROOT CAUSES

Problem description from Supplier: **pin of tin on the soldering pad, risk of contamination**

Samples of nok parts required at supplier location: ☑ Express shipping supplier account: **regular truck**

D2. Risk on similar products and processes

Can this defect happen on similar parts?: Comments (compulsory if yes): **all reference CM4**

Other family product: ☐

Other machine: ☐

Other tooling: ☐

Other Nidec plants: ☐

Other: ☐

D3. Containment

WHAT ARE THE ACTIONS TO DETECT ALL NON-CONFORMING PARTS IN THE PROCESS FLOW?

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Delivery note and batch #	Responsible
Parts at Nidec plant	2,663.00	0.00	1.00			Nidec
Parts at Nidec logistics platform	0.00	0.00	0.00			
Parts at Nidecs customer (C1 claim)	0.00	0.00	0.00			

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Responsible	Delivery note and batch #
Parts in transport	0.00	0.00	0.00			
Parts at supplier / supplier platform	7,000.00	0.00	0.00	2/5/2024	Supplier	
Parts at sub-supplier	0.00	0.00	0.00			
Other Nidec plant/s	0.00	0.00	0.00			

4 Result(s)

How are the ok parts identified?: **'100 Sorted regarding pin of tin on the soldering pad, risk of contamination**

First contained shipment information: **delevery for week 06**

How are the ok paletts identified?: **With orange identification (standard NIDEC)**

How are the ok parts identified? :: Securing identification.pdf

WHAT ARE THE IMMEDIATE ACTIONS TO PREVENT PRODUCTION/DELIVERY OF NOK PARTS?

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
Express delivery to Nidec to avoid production stop				
Nidec suspect stocks to be sent to supplier				

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
display quality alert	Not required	Supplier	2/2/2024	2/2/2024
QRQC meeting with all the team	Not required	Supplier	2/2/2024	2/2/2024

2 Result(s)

D4-D8

ALERTS

-Component without PPAP

Plant issued a claim:	NIDEC MOTORS & ACTUATORS (POLAND) Sp z o.o.	Supplier:	**AVO Carbon France (NMAP551841)**	Creation Date:	**2/2/2024**
Customer Contact:	**Dudek Dominik**	SAP Vendor Code:	**551841**	Date of QR:	**2/5/2024**
Claim reference:	**NMAP/551841/2/2024/1662**	Created by:	**DUDEK Dominik**	Update of QR:	**2/5/2024**
Status:	**Closed**	Type:	**I - Information**	Date of D4-D8:	**6/27/2024**
		CLAIM PPM:	0.00		
D4-D8 evaluation score:	75			Update of D4-D8:	

D 4. Root cause of occurrence

Work out the root causes using first Ishikawa, then FTA and finally 5 why's (Tools to use chosen by Nidec).

ROOT CAUSE OF OCCURRENCE

At the end of soldering, the operator passes the soldering iron (with the tin remaining on the nozzle of the soldering iron) to be cleanned and the smal burr stick and drop in the sector of PCBA

HOW WAS THE DEFECT REPRODUCED ?

Making a Gemba check on the station and check the operation of soldering according to the work instruction : Each operator soldering his specific point --> When the operator slides the soldering iron through the soldered points (containing tin), the tin drop away.

Attachment:

D 5. Root casue of non detection

ROOT CAUSE OF NON DETECTION :

The operator didn't have the clear information to control the point.control point is unclear because The control instruction doesn't specify the control point of not having tin in sector of PCBA

Attachments:

D 6. Countermeasure to non detection and occurrence

6.A ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan	Date Clos.	Attachments Please click 'Save' to activate attachment field
switch to automatique soldering with robot	Hafedh	2/1/2024	2/1/2024	Automatic soldering with Robots.pptx

1 Result(s)

6.B ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field

Updated the Control instuction of station control & inspection soldering points	marwan	5/21/2024	5/21/2024	IC700 Control soldering station updated.pdf
training opeartor of control& inspection of soldering point regarding the new issue	training departement	5/21/2024	5/21/2024	20240628122945192.pdf

2 Result(s)

D 7. Effectiveness of action plan

7A ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
first batch secured shipped week 06	marwan	2/10/2024	2/10/2024	

1 Result(s)

7B ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
passing parts with the same defect to check the detection of final control	marwan	5/23/2024	5/23/2024	

1 Result(s)

D 8. Action(s) to prevent recurrence

8.1 DO FOLLOWING DOCUMENTS REQUIRE AN UPDATE ?

Name of the document	Responsible	Date Plan	Date Clos.	Attachments
PFMEA				
Control Plan				
Work instruction				
Control instruction	marwan	5/21/2024	5/21/2024	IC700_Control_soldering_station_updated (1).pdf
Procedure				
Control gage				
Maintenance instruction	hafedh	2/1/2024	2/1/2024	Automatic_soldering_with_Robots.pptx
Lesson Learned Card				
Other	training departement	5/21/2024	5/21/2024	20240628122945192.pdf
Other	training departement	6/27/2024	6/27/2024	TABLEAU_GENERIQUE_CM3CM4_SONIA_DRIDI (1).xls
Other	marwan	2/14/2024	2/14/2024	IC700_Cm4__Old_one_ (1).pdf

8.2 GENERALIZATION OF COUNTERMEASURES TO SIMILAR LINES/ PRODUCTS

8.3 AUDIT DONE BY SUPPLIER (IF REQUIRED)

8D Audit required?:

Date of audit done by supplier:

Supplier Audit Results:

Supplier Audit Comment:

8.4 VALIDATION OF 8D CLOSURE FROM SUPPLIER MANAGEMENT

Name: **haggui marwan**

Supplier Management Position: **Quality engineer**

Date of validation of 8D closure from supplier management: **6/30/2024**

Closure of 8D from Nidec

Chargeback:

Efficiency of 8D proven:

Nok stocks at zero:

8D eval value (%): **100.00**

Date of closure:

Supplier 8D Report Evaluation Sheet

EVALUATION

D#	Discipline	Unsatisfactory/Not OK	Acceptable
D1B	Supplier problem solving team	☐ Minimum standard not reached	☐ - Champion named - Cross functional team - Champion contact data available
D1D	Problem description from supplier / first analysis of the problem / potential root cause	☐ Minimum standard not reached	☐ - Clear and complete description of potential root cause - Express shipping account avaliable
D2	Risk on similar products and processes	☐ Minimum standard not reached	☐ - Risk analysis for simmliar products/lines performed and adequate information provided
D3	Containment	☐ Minimum standard not reached	☐ - Overview of actions in all material postions (e.g. in transit) available - Effectivity confirmed
D4	Root cause of occurrence	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for occurence - Appropriate methods applied
D5	Root cause of non detection	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for non-detection - Appropriate methods applied
D6a	Actions for occurence	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions
D6b	Actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions
D7a	Actions to check effectiveness actions for occurence	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)
D7b	Actions to check effectiveness actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)
D8.1	Do following documents require an update ?	☐ Minimum standard not reached	☐ - Documented lessons learned - Relevant documents updated (FMEA, Control Plan, etc.)
D8.4	Validation of 8D closure from supplier management	☐ Minimum standard not reached	☐ - All dates in logical order
Report		☐ Minimum standard not reached	☐ - All content is understandable

EVALUATION RESULT

Evaluation result: 100

New tab

Ishikawa Diagram

Date of Ishikawa: **6/27/2024** Update of Ishikawa:

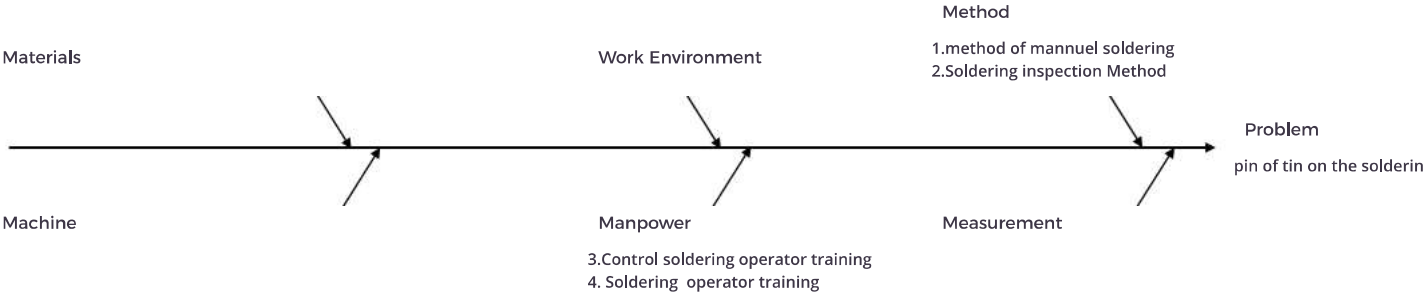

Nidec Comments

Factor Tree Analysis

Date of FTA: **6/27/2024** Update of FTA:

PROBLEM DESCRIPTION

Problem description: **pin of tin on the soldering pad, risk of contamination**

OCCURENCE

Factors	Control Point	Standard	OK parts	NOK parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link?	
1.method of mannuel soldering	Work instruction PC5.2-M3 Ind2	Conform soldering :	Standard was applied : OK part the PCBA was soldered	NOK part the PCBA was soldered with a smaill pin of tin on the soldering pad	Yes	No	opeartor didn't respected the direction of cleaning pad when she finish the opeartion	6/27/2024	Yes	
4.ManPower : Soldering operator training	Trained and validated operator according skilled sheet PS8.2-F2Ind. 6	The operator must be classified at level B	OK part soldered with the operator level B	NOK part soldered with the operator level B	Yes	Yes	Check the skill matrix for the operators :The operators are qualified and they respect the work instruction .	6/27/2024	No	TA

2 Result(s)

NON DETECTION

Factor	Control Point	Standard	OK Parts	NOK Parts	Std Meet?	Std OK?	Action to reproduce the defect
2.Soldering inspection Method	IC700 : soldering Control instruction	All points in the control instruction must be controlled 100%. Conform soldering : * Plastic not burnt * no lack of tin * no ball of tin * not burnt PCB	OK part was controlled	NOK part was controlled	Yes	No	the control instruction doesn't specify the con point of not having a tin between the pins --> t control point is unclear
3Control soldering operator training	Trained and validated operator according skilled sheet PS8.2-F2Ind. 6	The operator must be classified at level B	OK part controled by an operator in level B	NOK part controled by an operator in level B	Yes	Yes	Injecting 5 parts with spilled Tin between GND Contact to a control operator --> the control operator detect the defected part but with gre effort and concentration.

2 Result(s)

Nidec Comment

5 Whys's

Date of 5 why's: **6/27/2024** Update of 5 Why's:

PROBLEM DESCRIPTION

Problem description: **pin of tin on the soldering pad, risk of contamination**

OCCURENCE

Relevant factors from FTA	1st WHY?	1st Check	2nd WHY?	2nd Check	3rd WHY?
1.method of mannuel soldering	a litlle pin of tin was spilled o, soldering pas	>	At the end of soldering, the operator passes the soldering iron (with the tin remaining on the nozzle of the soldering iron) over the BC	>	the work instruction does not contain the desc removing the soldering iron in the end of opera the operator just finish)

1 Result(s)

NON DETECTION

Relevant factors from FTA	1st WHY?	1st Check	2nd Check	2nd WHY?	3rd WHY?
2.Soldering inspection Method	The tin control operator didn't recognize the smal burr of tin	>	>	The operator didn`t have the clean records to manipulate the point.	The control operator doesn`t specify the manipulate fa no longer having a tin in sector of PCBA --> the factor is

1 Result(s)

Nidec Comment

Lesson Learned Card

LLC Type

Date of LLC: **6/26/2024**

Logistics: ☐ Management: ☐

Product: ☐ Detection: ☑

Occurence: ☑ Process: ☐

1. What was the problem?

What happened?

pin of tin on the soldering pad, risk of contamination

Who detected it?

operator

Where was it detected?

CM4 line

How was it detected?

visually

Why is it a problem?

pin of tin on the soldering pad, risk of contamination

When did it happen?

1/30/2024 12:00:00 AM (your local time)

How many parts ?

1.00

2. What is the cause?

At the end of soldering, the operator passes the soldering iron (with the tin remaining on the nozzle of the soldering iron) to be cleanned and the smal burr stick and drop in the sector of PCBA

3. Description of the applied modification

BEFORE	AFTER

Manuel soldering
defect not recognize by control operator

IC700_Cm4__Old_one_ (1).pdf

automatic soldering with robots
updated the control instruction

IC700_Control_soldering_station_updated (1).pdf

4. What we learned?

ERADICATION

What is the countermeasure that was put in place to avoid recurrence ?

For occurence
*/switch to automatique soldering with robot
For non-detection
*/Updated the Control instuction of station control & inspection soldering points
*/training opeartor of control& inspection of soldering point regarding the new issue

CHECKING

What is the method (who, what, how) for the countermeasures?

Who : AVO
What :
*For occurence :
--Follow up the automatic soldering operation
*/For nin detection
-- checking the apply of standard of control

SIGNALING

What is the countermeasure su

In case of detection of NOK part
soldering pad, risk of contamina
line : alert and block all stock fo
+ Alert and block the parts in tra

5. What has been modified?

a. Proces is modified according to Before/ After sheet:	☐	g. Visual aids are posted:	☑
b. All documents have been updated and has been validated with the operators:	☑	h. Operators and other functions are trained:	☑
c. Procedures and work instructions:	☑	i. Proof of training is avalaible (records,5 ' meeting):	☑
d. Control Plan and PFMEA:	☐	j. Operators can correctly describe what they must do:	☐
e. Maintenance instructions:	☑	k. Other:	☐
f. Records (start-up checklists, reaction sheets, preventive maintenance...):	☐		

An evidance of modification:
IC700_Cm4__Old_one_ (1).pdf
TABLEAU_GENERIQUE_CM3CM4_SONIA_DRIDI (1).xls
Automatic_soldering_with_Robots.pptx
IC700_Control_soldering_station_updated (1).pdf
20240628122945192.pdf

6. Potential applicability

LLC Applicability Product: **Brush mounting plate assy**
LLC Applicability Line / process: **CM4**
LLC Applicability Plant: **AVO**

Sorting Approval

Approval of sorting / rework

This document must be sent to Nidec within 24 hour(s) after claim notification

Date of page: Update:

CLAIM ISSUER

Author: Dudek Dominik
Position: SQA Engineer
Phone: +48 12 297 27 86
Fax:
Email: dominik.dudek@nidec-ma.com

CLAIM RECEIVER

Name: Haggui Marwen
Position: Customer Quality
Phone: +21656057189
Fax:
Email: marwen.haggui@avocarbon.com

IMMEDIATE ACTIONS REQUIRED AT NIDEC

PROBLEM DESCRIPTION

pin of tin on the soldering pad, risk of contamination

DESCRIPTION OF SORTING/REWORK

QUANTITY AND PART NUMBERS CONCERNED

Parts at Nidec plant: 2,663.00

Parts at Nidec logistics platfrom: 0.00

Parts at Nidec's customer (C1): 0.00

Parts in transport: 0.00

Part Number & Description: Brush mounting plate assy (503-772-99-99)

Suspected delivery notes and batches#:

SORTING COMPANY CHOSEN TO DO THE SORTING/REWORK

Company Name:

Company Address:

Company Website:

Phone:

COMMENTS FROM NIDEC

All costs for semi-finished goods and finished goods with nok components will be invoiced to the supplier. Nok components will be returned to the supplier.

UPLOAD SIGNED FILE

LIST OF SORTING APPROVAL FILES

0 Result(s)

New tab

8D Report Explanation

D1
Nidec opens and incident and issues an 8D to the Supplier
D2-D3
The Supplier undertakes to: • **Contain all defective Supplies which have the same defect from all stocks (finished and semi-finished) and in transportation and at all affected Nidec locations worldwide,** • **Upon request, send a team to carry out sorting and inspection operations at Nidec and Nidec's Customers locations,** • **Upon request, send a team at Nidec's site to address the issue, even if the responsibility of the Supplier has not been proven yet,** • **Replace defective batch (es),** • **Label non-defective batch(es) accordingly,**
D4-D5-D6
The Supplier undertakes to: • **Perform an exhaustive analysis to identify the root cause of the non-conformity with the defined methods,** • **Provide Nidec with an action plan to be validated by Nidec prior to any action being implemented.** • **Update the production CP accordingly to be validated by Nidec.**
D7-D8

The Supplier undertakes to:

- **Check the efficiency of the actions implemented. Results have to be validated by Nidec.**
- **Update all related documents.**
- **Implement the actions to similar Supplies and processes (elimination of recurrences).**
- **Issue a Lesson Learned Card.**

Supplier 8D Report Evaluation Sheet

8D Evaluation Sheet has to be presented with final version of 8D report. Evaluation sheet is a tool for assessing compliance of 8D content with Nidec requirements. There are with three levels of acceptance:

- **0% - 79% - 8D does not meet minimum requirements and cannot be accepted**
- **80% - 89% - 8D meets minimum requirements and can be accepted**
- **90% - 100% - 8D evaluated with bonus points and can be accepted**

8D Evaluation Sheet has three levels of points:

- **Unsatisfactory/Not OK**
- **Acceptable**
- **Requirements fulfilled/Bonus**

Incidents closure

8D following C1 and C2 incidents will be closed after Nidec validation.

Nidec may perform an 8D audit to assess 8D application for C1 incidents. The standard template (Supplier 8D audit) to be used is provided with the RFQ package.

New tab