Claim Management Panel

Supplier: **AVO Carbon France (NMAP551841)**

Type: **C2 : Production claim**

Problem description: **lack of DMC**

Claim reference: **NMAP/551841/1/2024/1659**

Settings

C2/C3 REMINDER PANEL

(QR) D2-D3 Defualt Due Date :	**2/1/2024**	9:00:02 AM (your local time)	D2-D3 Revised Due Date:	(QR) D2-D3 Actual Date:	**2/5/2024**	3:38:33 PM (your local time)	(QR) D2-D
D4 Default Due Date :	**2/5/2024**	9:00:02 AM (your local time)	D4 Revised Due Date :	D4 Actual Date :	**3/19/2024**	10:53:11 AM (your local time)	D
D5-D6 Default Due Date:	**2/14/2024**	9:00:02 AM (your local time)	D5-D6 Revised Due Date:	D5-D6 Actual Date:	**3/20/2024**	1:04:27 PM (your local time)	D5-D
D7-D8 Default Due Date:	**2/14/2024**	9:00:02 AM (your local time)	D7-D8 Revised Due Date C2/C3:	D7-D8 Actual Date:	**3/20/2024**	1:52:57 PM (your local time)	D7-D

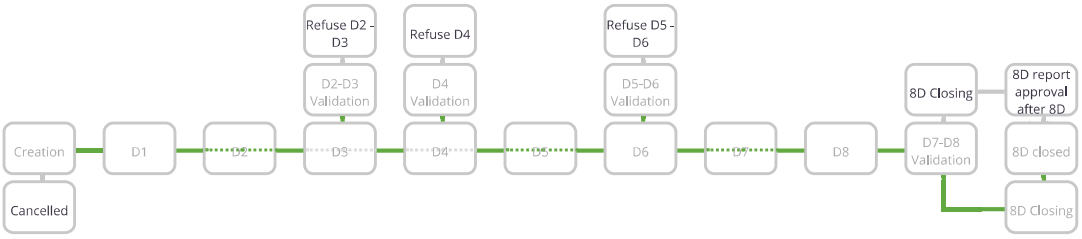

NOTIFICATIONS SENT

0 Result(s)

NIDEC APPROVALS & REFUSALS HISTORY

Steps approved

Step	Date of validation	User name
D8	3/20/2024	Marwen Haggui
D1	1/31/2024	Dominik Dudek
D4 Validation	3/19/2024	Dominik Dudek
D2	3/19/2024	Marwen Haggui
D2-D3 Validation	2/6/2024	Dominik Dudek
D3	3/19/2024	Marwen Haggui
D4	3/19/2024	Marwen Haggui
D5	3/20/2024	Marwen Haggui
D5-D6 Validation	3/20/2024	Dominik Dudek
D6	3/20/2024	Marwen Haggui
D7	3/20/2024	Marwen Haggui
D7-D8 Validation	3/22/2024	Dominik Dudek
8D closed	3/22/2024	Dorota Siekaniec
8D Closing	3/22/2024	Dorota Siekaniec
Creation	1/31/2024	Dominik Dudek

15 Result(s)

Steps rejected

0 Result(s)

Forum

Filter

Keywords:

0 Result(s)

Quick Response (D1-D3)

ALERTS

-Component without PPAP

Plant issued a claim:	NIDEC MOTORS & ACTUATORS (POLAND) Sp z o.o.	Supplier:	**AVO Carbon France (NMAP551841)**	Date of Claim:	**1/31/2024**
Customer Contact:	**Dudek Dominik**	SAP Vendor Code:	**551841**	Date of QR:	**2/1/2024**
Claim reference:	**NMAP/551841/1/2024/1659**	Author:	**DUDEK Dominik**	Update of QR:	**2/1/2024**
Status:	**Closed**	Type:	**C2 : Production claim**		
		CLAIM PPM:	0.00		

D1-D3 evaluation score: 22

D1. Description of the problem

1.A WHAT IS THE PROBLEM ? USE 5W+2H TO DESCRIBE WHAT IS THE CURRENT SITUATION.

Problem description:	**lack of DMC**	What happened?:	**lack of DMC**
Part Number & Description:	Brush mounting plate assy (503-852-99-99)	Why is it a problem?:	**lack of DMC, rejected on DMC scanner station**
Traceability of nok parts:	**batch 2401191, ASN 180382594**	When did it happen? :	**1/30/2024** 12:00:00 AM (your local time)
Recurrence:	**Recurrent defect**	Who detected it?:	**operator**
Defect S/R:	**No**	Where was it detected? :	**CM4 line**
		How was it detected?:	**visually**
		How many parts ?:	**1.00**

nok part picture / sketch:

ok part picture / sketch:

Other files::

1.B SUPPLIER PROBLEM SOLVING TEAM

Supplier Team

Add an existing contact:

Name		Contact	Email	Phone	Cell Phone	Fax	Position	Profile	Status
Haggui Marwen	✉	• marwen.haggui@avocarbon.com	marwen.haggui@avocarbon.com	+21656057189	+21656057189		Customer Quality	Supplier	Active

NidecTeam

Contact	Email	Profile ℹ
DUDEK Dominik	dominik.dudek@nidec-ma.com	{profile} Local Quality (Local SQE) (Full) (Claim)

1.C TOOL TO USE (DEFINED BY NIDEC)

Ishikawa: ☑ FTA: ☑ 5 Whys : ☑ LLC: ☑ Audit: ☐ Other: ☐

1.D PROBLEM DESCRIPTION FROM SUPPLIER / FIRST ANALYSE OF PROBLEM / POTENTIAL ROOT CAUSES

Problem description from Supplier: **lack of DMC**

Samples of nok parts required at supplier location: ☑ Express shipping supplier account: **Regular truck**

D2. Risk on similar products and processes

Can this defect happen on similar parts?: Comments (compulsory if yes): **All reference CM4**

Other family product: ☐

Other machine: ☐

Other tooling: ☐

Other Nidec plants: ☐

Other: ☐

D3. Containment

WHAT ARE THE ACTIONS TO DETECT ALL NON-CONFORMING PARTS IN THE PROCESS FLOW?

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Delivery note and batch #	Responsible
Parts at Nidec plant	1,207.00	0.00	1.00	1/31/2024	2401191	Nidec
Parts at Nidec logistics platform	0.00	0.00	0.00			
Parts at Nidecs customer (C1 claim)	0.00	0.00	0.00			

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Responsible	Delivery note and batch #
Parts in transport	0.00	0.00	0.00	2/5/2024		
Parts at supplier / supplier platform	12,000.00	12,000.00	0.00	2/5/2024		Delevery for Week 06
Parts at sub-supplier	0.00	0.00	0.00			
Other Nidec plant/s	0.00	0.00	0.00			

4 Result(s)

How are the ok parts identified?: **'100 Sorted regarding lack DMC**

First contained shipment information: **first deevery secured will be for week 06**

How are the ok paletts identified?: **With orange identification (standard NIDEC)**

How are the ok parts identified? :: Securing identification.pdf

WHAT ARE THE IMMEDIATE ACTIONS TO PREVENT PRODUCTION/DELIVERY OF NOK PARTS?

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
Express delivery to Nidec to avoid production stop				
Nidec suspect stocks to be sent to supplier				

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
display quality alert	Not required	Supplier	1/31/2024	1/31/2024
QRQC meeting with all the team	Not required	Supplier	1/31/2024	1/31/2024

2 Result(s)

D4-D8

ALERTS

-Component without PPAP

Plant issued a claim:	NIDEC MOTORS & ACTUATORS (POLAND) Sp z o.o.	Supplier:	**AVO Carbon France (NMAP551841)**	Creation Date:	**1/31/2024**
Customer Contact:	**Dudek Dominik**	SAP Vendor Code:	**551841**	Date of QR:	**2/1/2024**
Claim reference:	**NMAP/551841/1/2024/1659**	Created by:	**DUDEK Dominik**	Update of QR:	**2/1/2024**
Status:	**Closed**	Type:	**C2 : Production claim**	Date of D4-D8:	**2/7/2024**
		CLAIM PPM:	0.00		
D4-D8 evaluation score:	75			Update of D4-D8:	

D 4. Root cause of occurrence

Work out the root causes using first Ishikawa, then FTA and finally 5 why's (Tools to use chosen by Nidec).

ROOT CAUSE OF OCCURRENCE

Method : Jail management : Part with missing DMC mixed with good parts due to that part was escaped from the jail (NOK Vision test) and mixed with good parts because :
1-the transfet chute of nok part from the unloading clamp to the jail is not fixed and allow to drop NOK parts oustside the jail
2- the is lack training of opeartor due the management of parts on floor

HOW WAS THE DEFECT REPRODUCED ?

'Re-integration of evacuated parts in the electrical test once no visual problem is detected in the parts(Parts missing DMC) --> the control vision reject these parts --> rejection takes place in the prison --> the prison is damaged (upper side of transfer chute)--> the parts are thrown on the floor

Attachment:

D 5. Root casue of non detection

ROOT CAUSE OF NON DETECTION :

the parts was picked up from the floor and didn't passed on control station

Attachments:

D 6. Countermeasure to non detection and occurrence

6.A ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan	Date Clos.	Attachments Please click 'Save' to activate
update the design of the tansfer chute in the eletrical test to be tottaly cover and don't allow drop the NOK parts	hamza jbelli	2/19/2024	2/19/2024	
training session for all opeartor with mention forbidding to pick up all dropped parts on the flow and each dropped parts will be traited by quality agent	training departement	2/5/2024	2/5/2024	

2 Result(s)

6.B ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
R&R for the vision tester for the failure of lack DMC	hamza	3/20/2024	3/20/2024	R&R for part without marking.pdf
2 Result(s)				

D 7. Effectiveness of action plan

7A ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
first batch secured shipped week 12 (if it's planned for NIDEC need's)	haggui marwan	3/22/2024	3/22/2024	
1 Result(s)				

7B ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachmer
passing more parts to ensure the detection the camera vision the failure of lack DMC at second shift	hamza jballi	3/20/2024	3/20/2024	
1 Result(s)				

D 8. Action(s) to prevent recurrence

8.1 DO FOLLOWING DOCUMENTS REQUIRE AN UPDATE ?

Name of the document	Responsible	Date Plan	Date Clos.	Attachments
PFMEA				
Control Plan				
Work instruction				
Control instruction				
Procedure				
Control gage				
Maintenance instruction				
Lesson Learned Card				
Other	training departement	2/5/2024	2/5/2024	
Other	Hamza jbelli	3/20/2024	3/20/2024	R_R_for_part_without_marking.pdf
Other	Hamza jbelli	2/19/2024	2/19/2024	

8.2 GENERALIZATION OF COUNTERMEASURES TO SIMILAR LINES/ PRODUCTS

8.3 AUDIT DONE BY SUPPLIER (IF REQUIRED)

8D Audit required?:

Date of audit done by supplier:

Supplier Audit Results:

Supplier Audit Comment:

8.4 VALIDATION OF 8D CLOSURE FROM SUPPLIER MANAGEMENT

Name: **haggui marwan**

Supplier Management Position: **Quality engineer**

Date of validation of 8D closure from supplier management: **3/20/2024**

Closure of 8D from Nidec

Chargeback:

Efficiency of 8D proven:

Nok stocks at zero:

8D eval value (%): **100.00**

Date of closure:

Supplier 8D Report Evaluation Sheet

EVALUATION

D#	Discipline	Unsatisfactory/Not OK	Acceptable	Requirements fulfillec
D1B	Supplier problem solving team	☐ Minimum standard not reached	☐ - Champion named - Cross functional team - Champion contact data available	☑ - Names and all functions of th functional team are available
D1D	Problem description from supplier / first analysis of the problem / potential root cause	☐ Minimum standard not reached	☐ - Clear and complete description of potential root cause - Express shipping account avaliable	☑ - Relevant attachments (e.g. pi possible root cause provided
D2	Risk on similar products and processes	☐ Minimum standard not reached	☐ - Risk analysis for simmliar products/lines performed and adequate information provided	☑ - Information about risk at oth numbers/family provided
D3	Containment	☐ Minimum standard not reached	☐ - Overview of actions in all material postions (e.g. in transit) available - Effectivity confirmed	☑ - Proof of containment effectiv relevant documentation availa
D4	Root cause of occurrence	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for occurence - Appropriate methods applied	☑ - Proof for actions to reproduc (e.g. pictures, records from pr provided
D5	Root cause of non detection	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for non-detection - Appropriate methods applied	☑ - Proof for actions to reproduc (e.g. pictures) provided
D6a	Actions for occurence	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions	☑ - Announced deadlines for clo respected
D6b	Actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions	☑ - Announced deadlines for clos respected
D7a	Actions to check effectiveness actions for occurence	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containment actions success after introduction of permane action
D7b	Actions to check effectiveness actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containment actions success after introduction of permane action
D8.1	Do following documents require an update ?	☐ Minimum standard not reached	☐ - Documented lessons learned - Relevant documents updated (FMEA, Control Plan, etc.)	☑ - Analysis of generalization of countermeasures to similar lir

					performed
D8.4	Validation of 8D closure from supplier management	☐ Minimum standard not reached	☐ - All dates in logical order	☑	- 8D is cross-checked and appr champion/management
Report		☐ Minimum standard not reached	☐ - All content is understandable	☑	- No abbreviations and terms definition used

EVALUATION RESULT

Evaluation result: 100

New tab

Ishikawa Diagram

Date of Ishikawa: **3/13/2024** Update of Ishikawa: **3/18/2024**

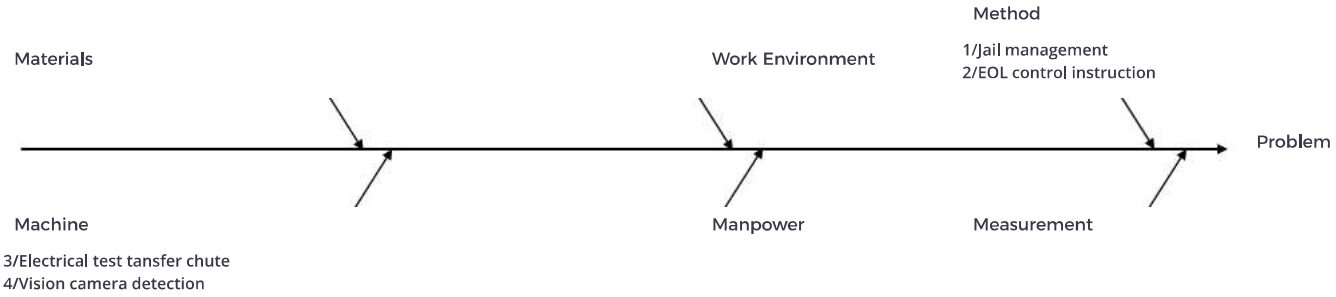

Nidec Comments

Factor Tree Analysis

Date of FTA: **3/13/2024** Update of FTA:

PROBLEM DESCRIPTION

Problem description: **lack of DMC**

OCCURENCE

Factors	Control Point	Standard	OK parts	NOK parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link?	Def. rep
3/Electrical test tansfer chute	flow of rejection parts by Electrical test	1.the NOK parts rejected by Electrical test 2-the NOK parts picked up from the palette by clamb 3- the NOK parts placed in jail by transfer chute	OK parts passed to final control	NOK parts should be dropped in the jail	Yes	No	The part with a lack of DMC was dropped in the floor, and after that at the end of the shift, the NOK parts was mixed with finish good after final control station		Yes	No
Jail management	flow chart	1- If there is a defect , the defected part rejected automatically on the jail. 2- The Jail must be closed 3- After evacuation on the jail , the	Standard applied	Standard not applied : Parts passed with re-injection	Yes	No	Re-integration of evacuated parts in the electrical test once no visual problem is detected in the parts(Parts missing DMC) --> the control vision reject these parts --> rejection takes place in the jail --> the prison is damaged (upper side of transfer chute)--> the parts are thrown on the floor --> due to lack of concentration the operator takes the part and puts it with the good parts.		Yes	No

		rejected parts processed by the quality agent.								

2 Result(s)

NON DETECTION

Factor	Control Point	Standard	OK Parts	NOK Parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link?	Def. rep
2/EOL control instruction	control all point mentionned in control insrtuction	Accroding control instuction IC 700 PS12-M9 ind,6	OK parts checked by final control and passed in finish good	NOK parts detected and puted in red box	Yes	Yes	no action to reporucde the defect because the claimed part was picked up from floor and didn't passe in normal flow and the control station		No	No
4/Vision camera detection	Master parts checklist PC5.2-M1 Ind. 6 Work instruction Work instruction PS12. 1-M3 ind. 2	- Correct reference / No wire in the internal circle of the housing / Spring presence / No wire out of the outside circle of the housing - the master samples must pass the vision machine	OK parts passed the vision machine	NOK parts passed detected on the vision machine	Yes	Yes	Producing parts with defects (Incorrect reference / wire in the internal circle of the housing / Spring absence / wire out of the outside circle of the housing) and following the test result -> the vision machine rejected the part because of a reading problem --> Parts rejected with missing DMC		No	No

2 Result(s)

Nidec Comment

5 Whys's

Date of 5 why's: **3/13/2024** Update of 5 Why's:

PROBLEM DESCRIPTION

Problem description: **lack of DMC**

OCCURENCE

Relevant factors from FTA	1st WHY?	1st Check	2nd WHY?	2nd Check	3rd WHY?	3rd Check	4th WHY?	4th Check	5th
3/Electrical test tansfer chute	the transfer chute allow to drop parts oustide the jail	>	the transfer chute nok part from the unloading clamp to the jail is not 100% pass the NOK parts to jail	>	the transfer chute nok part from the unloading clamp to the jail is not totally cover	>	there is no risk analysis	X	
Jail management	Part with missing DMC mixed with good parts	>	Part with missed DMC escape from the jail (NOK Vision test) and mixed with good parts	>	during the end of shift , the opeartor picked up from floor without check and puted in the finish goods trays	>	lack of training for opeartor regarding the parts on floor	X	

2 Result(s)

NON DETECTION

Relevant factors from FTA	1st WHY?	1st Check	2nd Check	2nd WHY?	3rd WHY?	3rd Check	4th WHY?	4th Check	5th WHY?	5th Check

Nidec Comment

Lesson Learned Card

LLC Type

Date of LLC: **3/20/2024**

Logistics:	☐	Management:	☐
Product:	☐	Detection:	☐
Occurence:	☑	Process:	☐

1. What was the problem?

What happened?

lack of DMC

Who detected it?

operator

Where was it detected?

CM4 line

How was it detected?

visually

Why is it a problem?

lack of DMC, rejected on DMC scanner station

When did it happen?

1/30/2024 12:00:00 AM (your local time)

How many parts ?

1.00

2. What is the cause?

Method : Jail management : Part with missing DMC mixed with good parts due to that part was escaped from the jail (NOK Vision test) and mixed with good parts because :
1-the transfet chute of nok part from the unloading clamp to the jail is not fixed and allow to drop NOK parts oustside the jail
2- the is lack training of opeartor due the management of parts on floor

3. Description of the applied modification

BEFORE

the transfet chute of nok part from the unloading clamp to the jail is not fixed and allow to drop NOK parts oustside the jail

AFTER

the transfet chute of nok part from the unloading clamp to the jail is totally covered and fixed

4. What we learned?

ERADICATION

What is the countermeasure that was put in place to avoid recurrence ?

For occurence
*/update the design of the tansfer chute in the eletrical test to be tottaly cover and don't allow drop the NOK parts
*/training session for all opeartor with mention forbidding to pick up all dropped parts on the flow and each dropped parts will be traited by quality agent
For the non-detection
*/R&R for the vision tester for the failure of lack DMC

CHECKING

What is the method (who, what, how) for the countermeasures?

Who : AVI
What :
*For occurence : check regular the transfer chute in electrical test
chech there is no dropped parts on floor
*/For non-detection
check the vision tester and pass some NOK parts and verifiy the good detection on vision camera

SIGNALING

What is the countermeasure supposed to do or make or h detecting a non conformity ?

In case of detection of NOK parts with lack of DMC in the production line : alert and block all stock for sorting
+ Alert and block the parts in transit

5. What has been modified?

a. Proces is modified according to Before/ After sheet:	☐	g. Visual aids are posted:	☑
b. All documents have been updated and has been validated with the operators:	☐	h. Operators and other functions are trained:	☑
c. Procedures and work instructions:	☐	i. Proof of training is avalaible (records,5 ' meeting):	☑
d. Control Plan and PFMEA:	☐	j. Operators can correctly describe what they must do:	☑
e. Maintenance instructions:	☐	k. Other:	☐
f. Records (start-up checklists, reaction sheets, preventive maintenance...):	☑		

An evidance of modification:

R_R_for_part_without_marking (1).pdf

6. Potential applicability

LLC Applicability Product: **Brush mounting plate assy**

LLC Applicability Line / process: **CM4**

LLC Applicability Plant: **AVO**

Sorting Approval

Approval of sorting / rework

This document must be sent to Nidec within 24 hour(s) after claim notification

Date of page: Update:

CLAIM ISSUER

Author: **Dudek Dominik**
Position: **SQA Engineer**
Phone: **+48 12 297 27 86**
Fax:
Email: **dominik.dudek@nidec-ma.com**

CLAIM RECEIVER

Name: **Haggui Marwen**
Position: **Customer Quality**
Phone: **+21656057189**
Fax:
Email: **marwen.haggui@avocarbon.com**

IMMEDIATE ACTIONS REQUIRED AT NIDEC

PROBLEM DESCRIPTION

lack of DMC

DESCRIPTION OF SORTING/REWORK

QUANTITY AND PART NUMBERS CONCERNED

Parts at Nidec plant: **1,207.00**
Parts at Nidec logistics platfrom: **0.00**
Parts at Nidec's customer (C1): **0.00**
Parts in transport: **0.00**
Part Number & Description: **Brush mounting plate assy (503-852-99-99)**
Suspected delivery notes and batches#: 2401191, Delevery for Week 06

SORTING COMPANY CHOSEN TO DO THE SORTING/REWORK

Company Name:
Company Address:
Company Website:
Phone:

COMMENTS FROM NIDEC

All costs for semi-finished goods and finished goods with nok components will be invoiced to the supplier. Nok components will be returned to the supplier.

UPLOAD SIGNED FILE

LIST OF SORTING APPROVAL FILES

0 Result(s)

New tab

8D Report Explanation

D1
Nidec opens and incident and issues an 8D to the Supplier
D2-D3
The Supplier undertakes to: • **Contain all defective Supplies which have the same defect from all stocks (finished and semi-finished) and in transportation and at all affected Nidec locations worldwide,** • **Upon request, send a team to carry out sorting and inspection operations at Nidec and Nidec's Customers locations,** • **Upon request, send a team at Nidec's site to address the issue, even if the responsibility of the Supplier has not been proven yet,** • **Replace defective batch (es),** • **Label non-defective batch(es) accordingly,**
D4-D5-D6
The Supplier undertakes to: • **Perform an exhaustive analysis to identify the root cause of the non-conformity with the defined methods,** • **Provide Nidec with an action plan to be validated by Nidec prior to any action being implemented.** • **Update the production CP accordingly to be validated by Nidec.**
D7-D8
The Supplier undertakes to: • **Check the efficiency of the actions implemented. Results have to be validated by Nidec.** • **Update all related documents.** • **Implement the actions to similar Supplies and processes (elimination of recurrences).** • **Issue a Lesson Learned Card.**
Supplier 8D Report Evaluation Sheet
8D Evaluation Sheet has to be presented with final version of 8D report. Evaluation sheet is a tool for assessing compliance of 8D content with Nidec requirements. There are with three levels of acceptance: • **0% - 79% - 8D does not meet minimum requirements and cannot be accepted** • **80% - 89% - 8D meets minimum requirements and can be accepted** • **90% - 100% - 8D evaluated with bonus points and can be accepted** **8D Evaluation Sheet has three levels of points:** • **Unsatisfactory/Not OK** • **Acceptable** • **Requirements fulfilled/Bonus**
Incidents closure
8D following C1 and C2 incidents will be closed after Nidec validation. **Nidec may perform an 8D audit to assess 8D application for C1 incidents. The standard template (Supplier 8D audit) to be used is provided with the RFQ package.**

New tab