4.1 HAB MANUAL DISPLAY

HAB 3232 - Manual Display Overview

Revision B - 05/2026

Manual Mode Interface

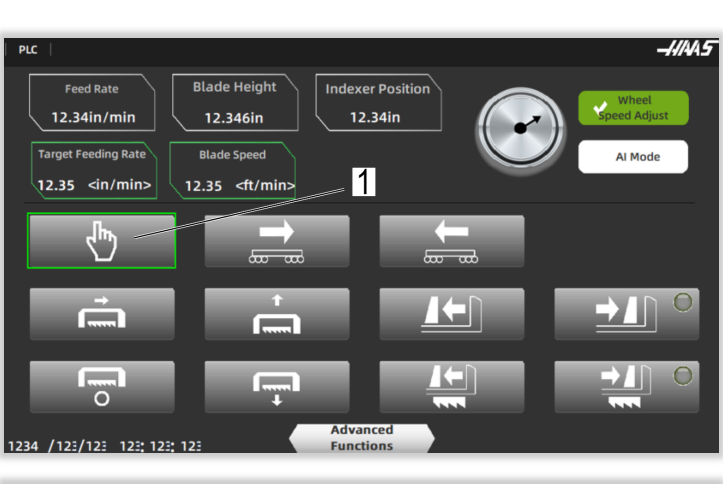

1

To activate the manual function, first turn the **external knob** to the specified icon [1].

Note: Each tab on the control will have an image of corresponding physical button that indicates its purpose.

In order to proceed with the manual mode, a material must be confirmed.

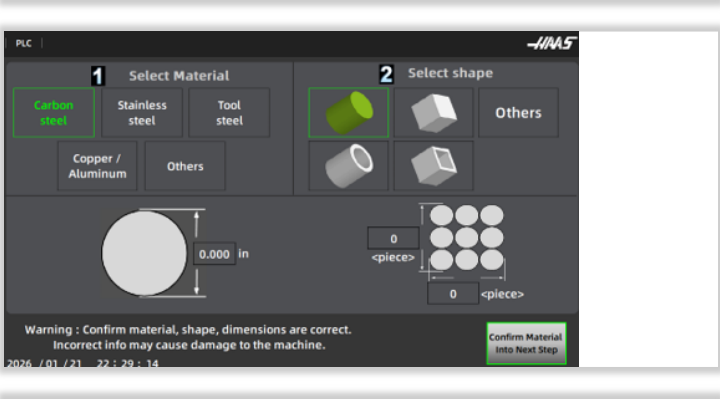

Warning : Confirm material, shape, dimensions are correct. Incorrect info may cause damage to the machine.

2

Check the material, shape, size and quantity in this interface, click "Material Confirmation" after completion, and then click **NEXT.**

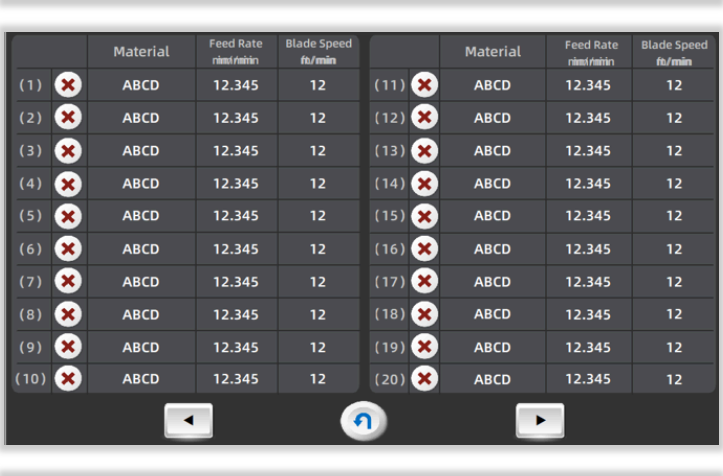

	Material	Feed Rate	Blade Speed		Material	Feed Rate	Blade Speed
(1) ✖	ABCD	12.345	12	(11) ✖	ABCD	12.345	12
(2) ✖	ABCD	12.345	12	(12) ✖	ABCD	12.345	12
(3) ✖	ABCD	12.345	12	(13) ✖	ABCD	12.345	12
(4) ✖	ABCD	12.345	12	(14) ✖	ABCD	12.345	12
(5) ✖	ABCD	12.345	12	(15) ✖	ABCD	12.345	12
(6) ✖	ABCD	12.345	12	(16) ✖	ABCD	12.345	12
(7) ✖	ABCD	12.345	12	(17) ✖	ABCD	12.345	12
(8) ✖	ABCD	12.345	12	(18) ✖	ABCD	12.345	12
(9) ✖	ABCD	12.345	12	(19) ✖	ABCD	12.345	12
(10) ✖	ABCD	12.345	12	(20) ✖	ABCD	12.345	12

3

Click **OTHERS** to access a customization page that will allow the operator to set a specific material and set a custom saw blade speed.

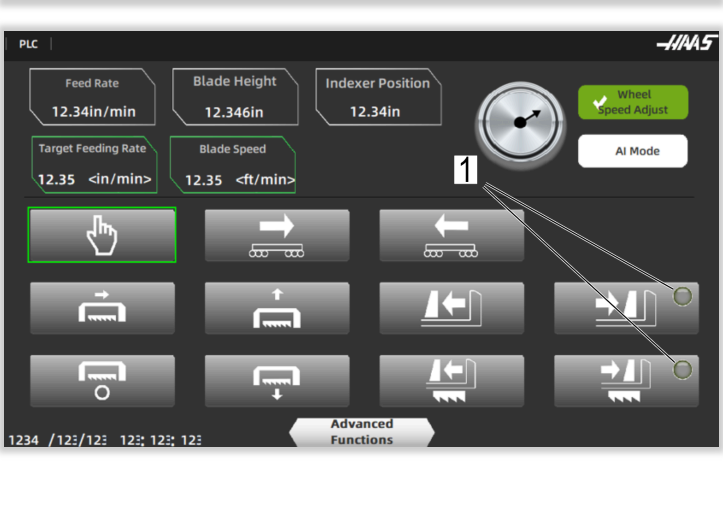

4

In order to start a job, there are some requirements that must be met.

When starting a job the front vise must be clamped.

Note: When either the front vise or rear vise are clamped a green indicator will show [1].

Note: When the front vise and back vise are clamped **Material in Feed** and **Material Out** cannot be executed.

After the vise or vises have been clamped, press the **BLADE START** button to begin the job.

Note: Refer to the **HAB CONTROLS** chapter for an identified list of the control panel.

4.2 HAB AUTOMATIC DISPLAY

HAB 3232 - Version 1 - Automatic Display Overview

Revision B - 9/2025

Introduction

This chapter will provide details on how to operate the automatic mode of the Version 1 Haas Automatic Bandsaw.

Note: To determine if your HAB-3232 is a V1 or V2 refer to the **HAB-3232 – IDENTIFICATION GUIDE** for reference.

Automatic Mode Interface

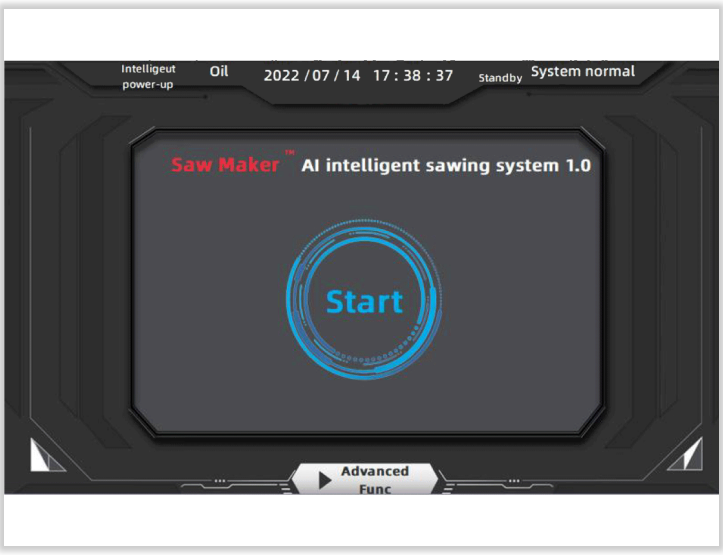

1

To activate the automatic function, first turn the **external knob** to the left.

Press **START** to continue.

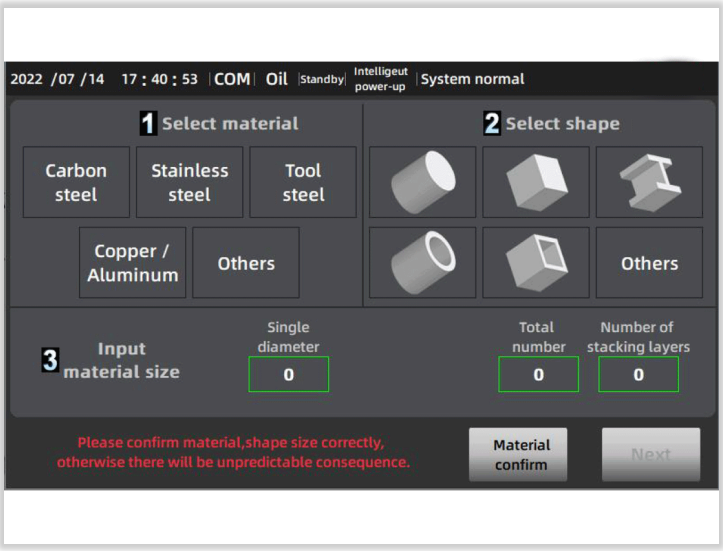

Please confirm material,shape size correctly, otherwise there will be unpredictable consequence.

2

Check the material, shape, size and quantity in this interface, click "Material Confirmation" after completion, and then click **NEXT.**

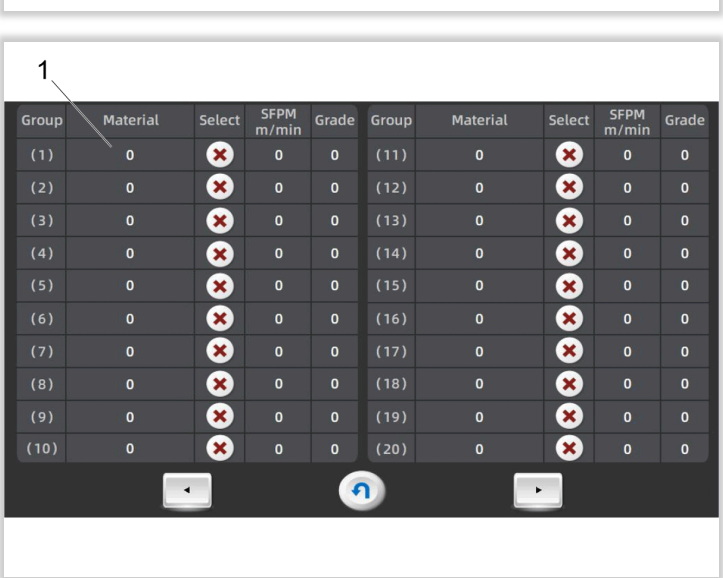

Group	Material	Select	SFPM m/min	Grade	Group	Material	Select	SFPM m/min	Grade
(1)	0	✖	0	0	(11)	0	✖	0	0
(2)	0	✖	0	0	(12)	0	✖	0	0
(3)	0	✖	0	0	(13)	0	✖	0	0
(4)	0	✖	0	0	(14)	0	✖	0	0
(5)	0	✖	0	0	(15)	0	✖	0	0
(6)	0	✖	0	0	(16)	0	✖	0	0
(7)	0	✖	0	0	(17)	0	✖	0	0
(8)	0	✖	0	0	(18)	0	✖	0	0
(9)	0	✖	0	0	(19)	0	✖	0	0
(10)	0	✖	0	0	(20)	0	✖	0	0

3

Click **OTHERS** to access a customization page that will allow the operator to set a specific material and set a custom saw blade speed.

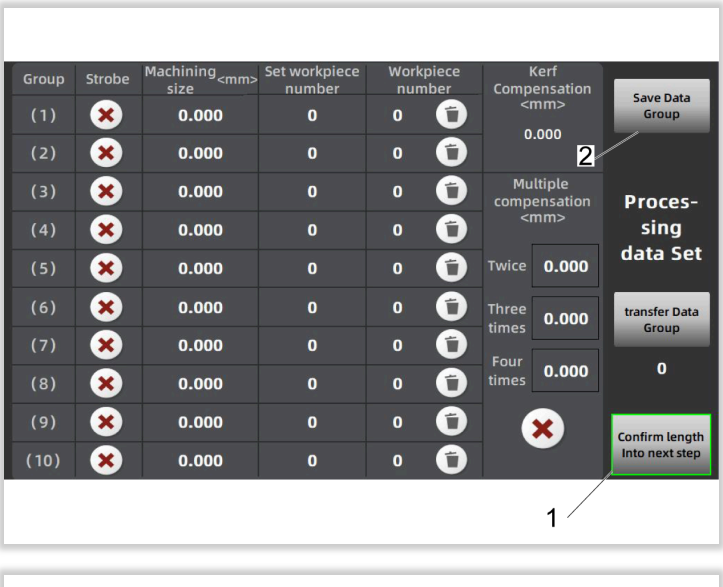

Group	Strobe	Machining size <mm>	Set workpiece number	Workpiece number
(1)	✖	0.000	0	0
(2)	✖	0.000	0	0
(3)	✖	0.000	0	0
(4)	✖	0.000	0	0
(5)	✖	0.000	0	0
(6)	✖	0.000	0	0
(7)	✖	0.000	0	0
(8)	✖	0.000	0	0
(9)	✖	0.000	0	0
(10)	✖	0.000	0	0

4

Set the size of the workpiece to be processed in this screen.

Note: The Confirm length icon will glow green after the length has been confirmed.

Click [1] to continue.

Note: Click **SAVE DATA GROUP [2]** on this page in order to store into a specific data group. When you need to use it, just click the corresponding data group to call it.

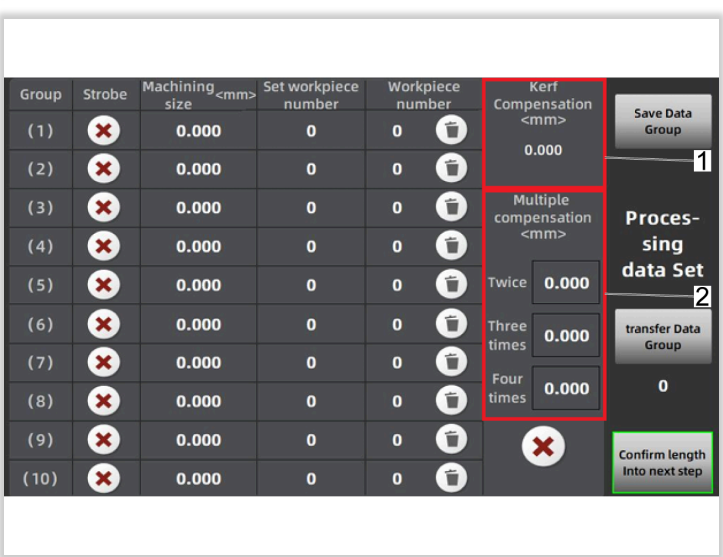

Group	Strobe	Machining size <mm>	Set workpiece number	Workpiece number
(1)	✖	0.000	0	0
(2)	✖	0.000	0	0
(3)	✖	0.000	0	0
(4)	✖	0.000	0	0
(5)	✖	0.000	0	0
(6)	✖	0.000	0	0
(7)	✖	0.000	0	0
(8)	✖	0.000	0	0
(9)	✖	0.000	0	0
(10)	✖	0.000	0	0

5

Set the kerf compensation value based on the thickness of the saw blade **[1]**.

Note: The kerf compensation value for the original saw blade provided with the machine should be set to 0.07in (1.8mm).

Use the multiple compensation **[2]** feature to account for part length deviation over multiple shuttles of the rear vise.

See more information on these settings in section **4.8 HAB Cut Compensations**

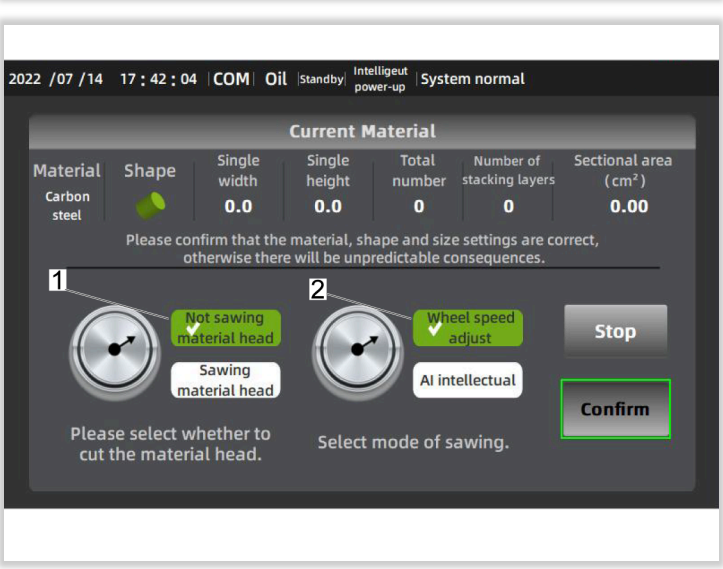

Material: Carbon steel; Single width: 0.0; Single height: 0.0; Total number: 0; Number of stacking layers: 0; Sectional area (cm²): 0.00

Please confirm that the material, shape and size settings are correct, otherwise there will be unpredictable consequences.

Please select whether to cut the material head.

Select mode of sawing.

6

Choose whether to cut the material head [1].

Choose the mode of sawing [2].

Click **CONFIRM** to start the sawing process.

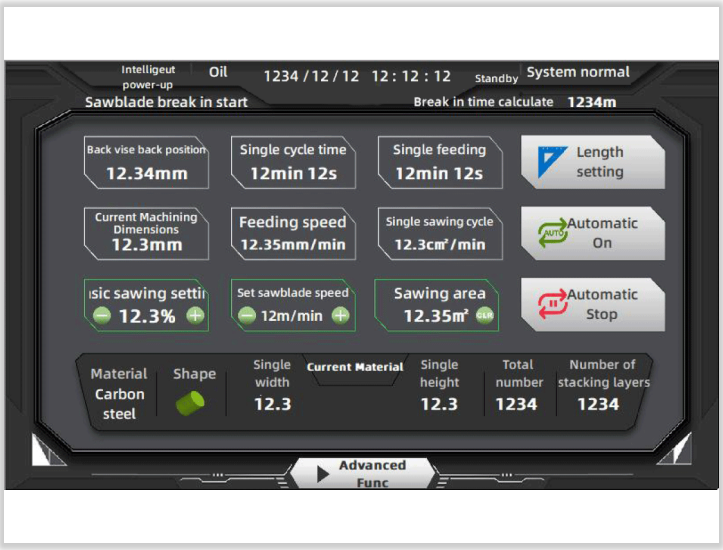

7

Note: Once a job has started, the machine will display the following screen. This screen adjusts and monitors the parameters and sawing efficiency in the automatic working mode.

4.3 HAB VERSION 2 AUTOMATIC DISPLAY

HAB 3232 - Version 2 - Automatic Display Overview

Revision B - 05/2026

Introduction

This chapter will provide details on how to operate the automatic mode of the Version 2 Haas Automatic Bandsaw.

Note: To determine if your HAB-3232 is a V1 or V2 refer to the **HAB-3232 – IDENTIFICATION GUIDE** for reference.

Automatic Mode Interface

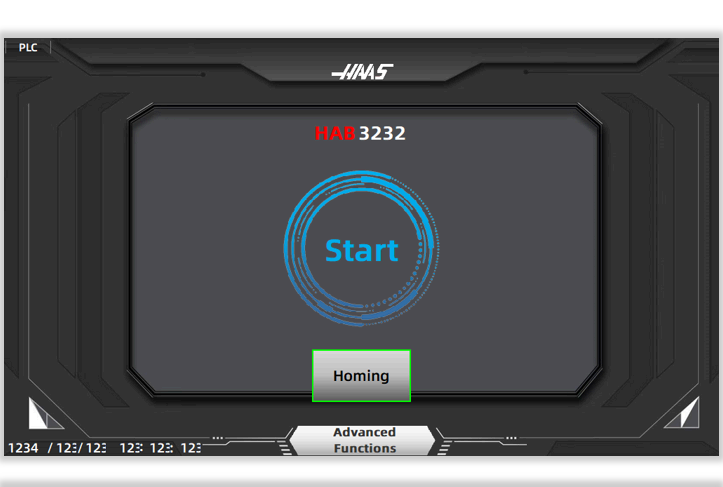

1

To activate the automatic function, first turn the **external knob** to the left.

Press **HOMING** to home and recalibrate the saw before use.

Note: Before using the saw for the first time, make sure to remove the shipping bracket located at the bottom of the main cylinder. For details on its exact placement, refer to the HAB - Installation chapter.

Once the screen states "Homing Completed", press **START** to proceed.

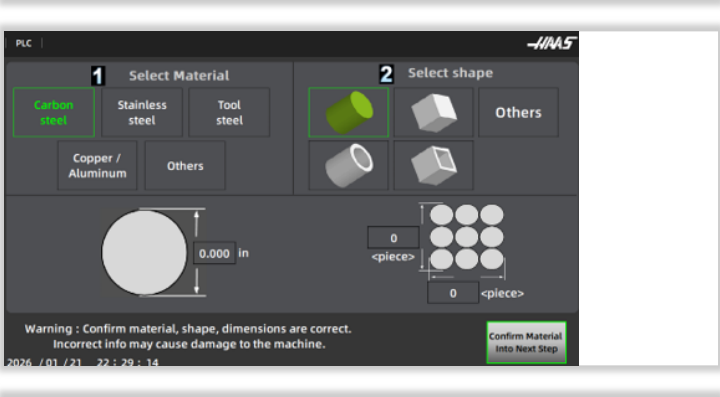

Warning : Confirm material, shape, dimensions are correct. Incorrect info may cause damage to the machine.

2

Check the material, shape, size and quantity in this interface, click **CONFIRM MATERIAL** after completion, and then click **NEXT.**

Note: The bandsaw will calculate a target cutting efficiency to measure how effectively the bandsaw removes material during cutting.

Note: Based on the geometry of the material, the bandsaw calculates the maximum allowable feed speed for the specified material

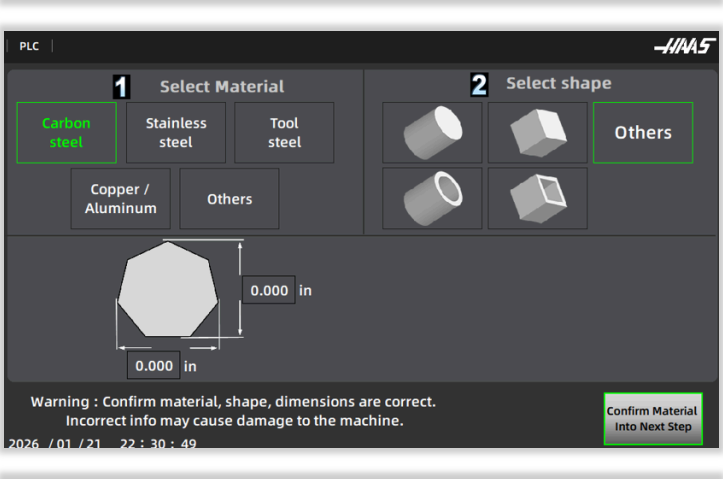

Warning : Confirm material, shape, dimensions are correct. Incorrect info may cause damage to the machine.

3

Under "Select Shape" click **OTHERS** to access a customization page that will allow the operator to set a specific cross sectional dimension.

Set the size of the workpiece to be processed in this screen. The Confirm Material icon will glow green after the dimensions have been confirmed.

Note: When selecting "Other" material, the "AI Intelligence" mode will be disabled, and only "Handwheel Speed Adjustment" is allowed.

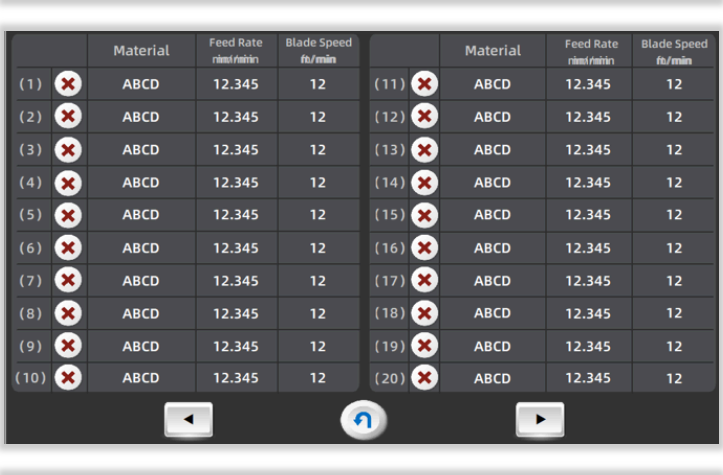

	Material	Feed Rate	Blade Speed		Material	Feed Rate	Blade Speed
(1) ✖	ABCD	12.345	12	(11) ✖	ABCD	12.345	12
(2) ✖	ABCD	12.345	12	(12) ✖	ABCD	12.345	12
(3) ✖	ABCD	12.345	12	(13) ✖	ABCD	12.345	12
(4) ✖	ABCD	12.345	12	(14) ✖	ABCD	12.345	12
(5) ✖	ABCD	12.345	12	(15) ✖	ABCD	12.345	12
(6) ✖	ABCD	12.345	12	(16) ✖	ABCD	12.345	12
(7) ✖	ABCD	12.345	12	(17) ✖	ABCD	12.345	12
(8) ✖	ABCD	12.345	12	(18) ✖	ABCD	12.345	12
(9) ✖	ABCD	12.345	12	(19) ✖	ABCD	12.345	12
(10) ✖	ABCD	12.345	12	(20) ✖	ABCD	12.345	12

4

Under "Select Material", click **OTHERS** to access a customization page that will allow the operator to set a specific material, feed rate, and blade speed.

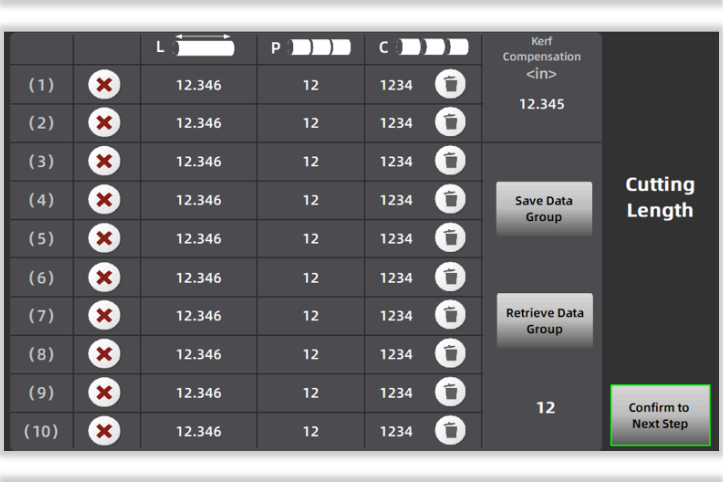

		L	P	C
(1)	✖	12.346	12	1234
(2)	✖	12.346	12	1234
(3)	✖	12.346	12	1234
(4)	✖	12.346	12	1234
(5)	✖	12.346	12	1234
(6)	✖	12.346	12	1234
(7)	✖	12.346	12	1234
(8)	✖	12.346	12	1234
(9)	✖	12.346	12	1234
(10)	✖	12.346	12	1234

5

Designate the cutting length (L), the set quantity (P), and completed quantity (C) of each material.

Set the kerf compensation value based on the thickness of the saw blade.

Note: The kerf compensation value for the original saw blade provided with the machine should be set to 0.07in (1.8mm).

See more information on these settings in section **4.8 HAB Cut Compensations**

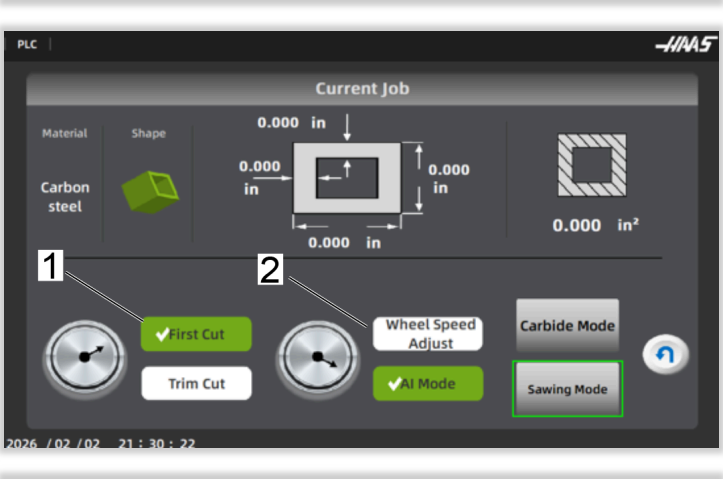

6

Choose whether to start with the first cut or trim cut [1].

Choose the mode of sawing [2].

Click **CONFIRM** to start the sawing process.

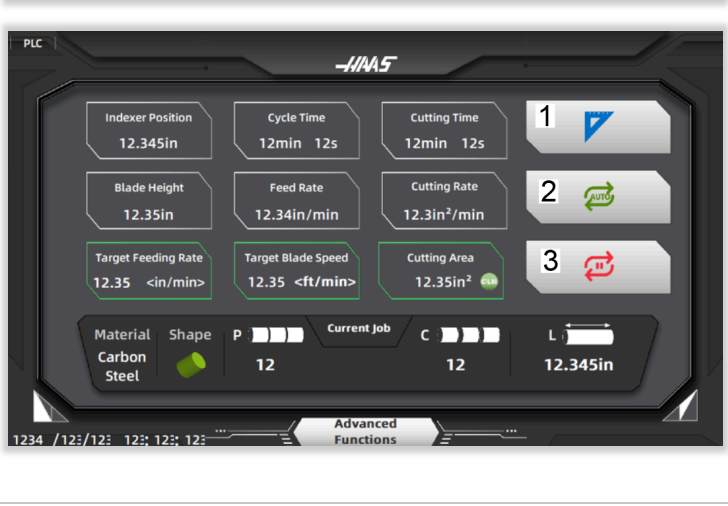

7

Note: Once a job has started, the machine will display the following screen. This screen adjusts and monitors the parameters and sawing efficiency in the automatic working mode.

To adjust the length of the part, select **LENGTH SETTING** [1] on the display. To pause automatic mode, select the **AUTOMATIC PAUSE** [3] button. To resume automatic mode, select **AUTOMATIC ON** [2].

4.3 HAB CONTROLS

HAB 3232 - Controls

Revision A - 11/2025

HAB Version 1 - Control Panel

Use the table below to understand the functions of the HAB-3232 V1 control panel.

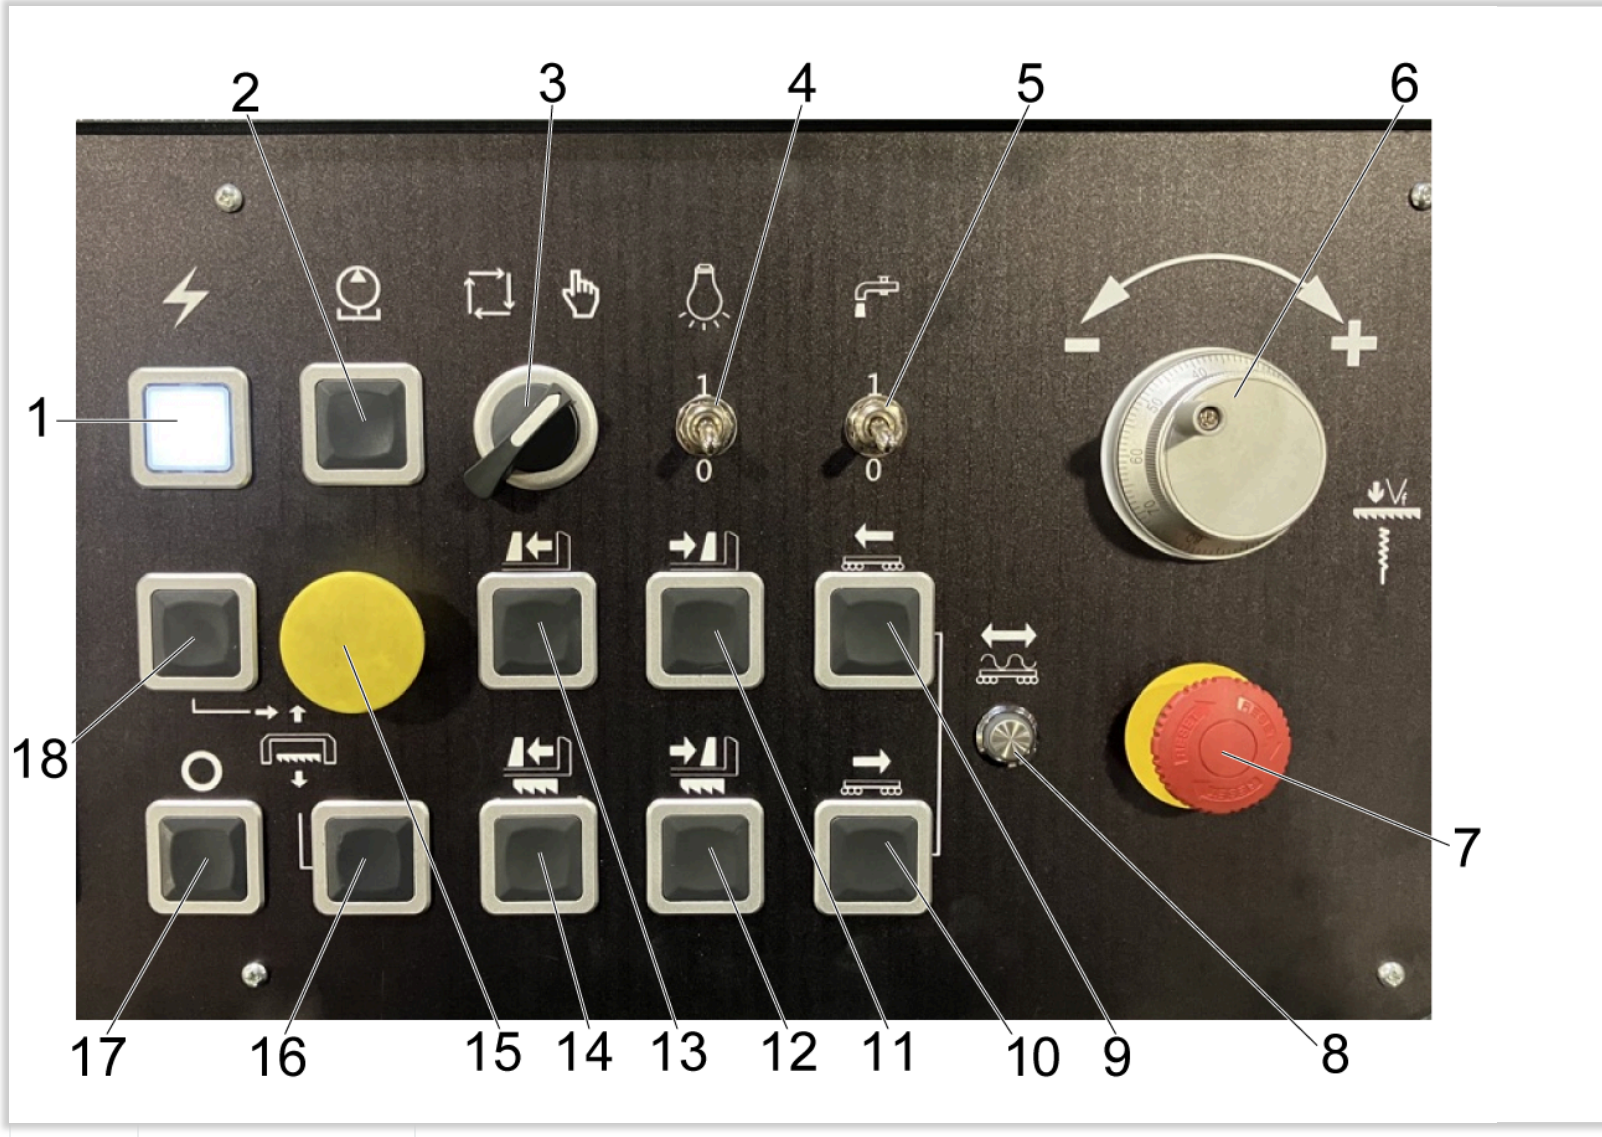

NUMBER	BUTTON FUNCTION	DESCRIPTION
1	Power Indicator Light	This light indicates that power is being supplied to the machine. If the light is off while the breaker is in the ON position, there may be an issue with the power source.
2	Oil Pump Start/Stop	The following button will start the hydraulic pump. If the hydraulic pump is already running, pressing this button will stop it.
3	Manual/Auto Switch Mode	The button toggles the saw between Auto Mode and Manual Mode. When the switch is pointing to the hand, the saw is in Manual Mode; when it points to the box on the right, the saw is in Auto Mode.
4	Saw Table Light	This light turns on the light that illuminates the saw bed area.
5	Coolant On/Off	Turns the coolant ON/OFF
6	Saw Down Feed Speed	The dial adjusts the rapid speed at which the saw frame descends toward the saw bed.
7	Emergency Stop	This is the emergency stop for the saw. Activate it during maintenance to prevent the saw from operating.
8	Feed/Return Material Speed Switch	This button slows down the speed at which the material is fed forward and backward.
9	Reverse Feed Material	Feeds the material back away from the saw blade.
10	Feed Material Forward	Feeds the material forward towards the saw blade.
11	Close Rear Vise	Closes the rear vise on the saw bed. Holding the button will move the rear vise in until the vise is clamped on the stock.
12	Close Front Vise	Closes the front vise on the saw bed that is closest to the front of the machine. Holding the button will move the vise in to clamp on the stock.
13	Open Rear Vise	Opens the rear vise on the saw bed.
14	Open Front Vise	Opens the front vise on the saw bed.
15	Raise Saw Frame	This raises the entire frame. The frame must be lifted to install or tension the blade
16	Lower Saw Frame	This button lowers the entire saw frame. Hold down the button until it reaches the end of travel.
17	Blade Stop	In Manual Mode, this button stops the saw wheel from turning. In Automatic Mode, it pauses the automatic cycle.
18	Blade Start	In Manual Mode, this button starts the saw wheel. In Automatic Mode, this button starts the automatic cycle that was set up.

HAB Version 2 - Control Panel

Use the table below to understand the functions of the HAB-3232 V2 control panel.

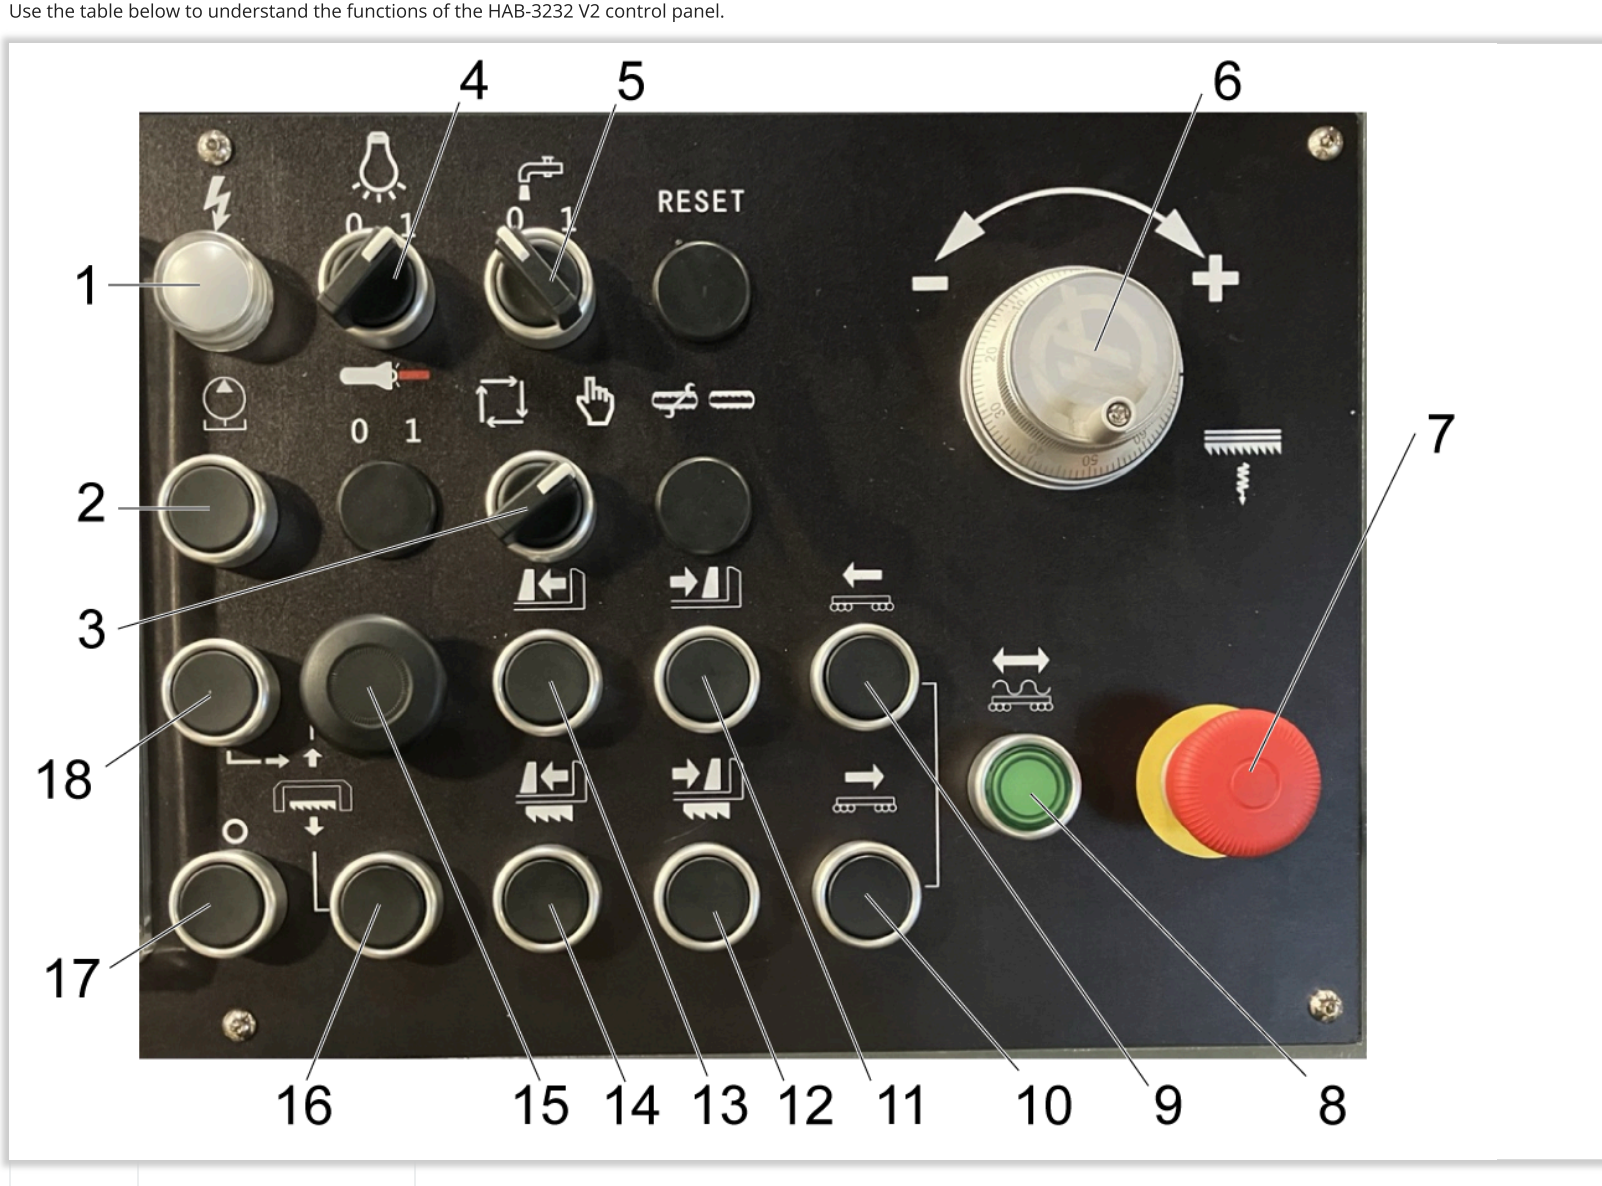

NUMBER	BUTTON FUNCTION	DESCRIPTION
1	Power Indicator Light	This light indicates that power is being supplied to the machine. If the light is off while the breaker is in the ON position, there may be an issue with the power source.
2	Oil Pump Start/Stop	The following button will start the hydraulic pump. If the hydraulic pump is already running, pressing this button will stop it.
3	Manual/Auto Switch Mode	The button toggles the saw between Auto Mode and Manual Mode. When the switch is pointing to the hand, the saw is in Manual Mode; when it points to the box on the right, the saw is in Auto Mode.
4	Saw Table Light	This light turns on the light that illuminates the saw bed area.
5	Coolant On/Off	Turns the coolant ON/OFF
6	Saw Down Feed Speed	The dial adjusts the rapid speed at which the saw frame descends toward the saw bed.
7	Emergency Stop	This is the emergency stop for the saw. Activate it during maintenance to prevent the saw from operating.
8	Feed/Return Material Speed Switch	This button slows down the speed at which the material is fed forward and backward.
9	Reverse Feed Material	Feeds the material back away from the saw blade.
10	Feed Material Forward	Feeds the material forward towards the saw blade.
11	Close Rear Vise	Closes the rear vise on the saw bed. Holding the button will move the rear vise in until the vise is clamped on the stock.
12	Close Front Vise	Closes the front vise on the saw bed that is closest to the front of the machine. Holding the button will move the vise in to clamp on the stock.
13	Open Rear Vise	Opens the rear vise on the saw bed.
14	Open Front Vise	Opens the front vise on the saw bed.
15	Raise Saw Frame	This raises the entire frame. The frame must be lifted to install or tension the blade
16	Lower Saw Frame	This button lowers the entire saw frame. Hold down the button until it reaches the end of travel.
17	Blade Stop	In Manual Mode, this button stops the saw wheel from turning. In Automatic Mode, it pauses the automatic cycle.
18	Blade Start	In Manual Mode, this button starts the saw wheel. In Automatic Mode, this button starts the automatic cycle that was set up.

4.4 HAB SAW BLADE SELECTION

HAB 3232 - Saw Blade Selection

The chart below provides recommendations for selecting a saw blade by teeth per inch, based on the width of rectangular stock, the diameter of cylindrical stock, or the wall thickness of tubing stock.

Note: The saw blade provided with the machine has a tooth profile of 8/12 teeth per inch.

Saw Blade Selection

RECTANGULAR STOCK		ROUND STOCK		TUBING (SQUARE AND ROUND)	
Width (inch)	Teeth Per Inch	Diameter (Inch)	Teeth Per Inch	Wall thickness (Inch)	TPI
0.40 - 0.51	8/12T	0.40 - 0.51	8/12T	0.16	8/12T
0.55 - 0.63	6/10T	0.55 - 0.63	6/10T	0.20 - 0.24	6/10T
0.67 - 0.98	5/8T	0.67 - 0.98	5/8T	0.28 - 0.35	5/8T
1.02 - 2.09	4/6T	1.02 - 2.09	4/6T	0.39 - 0.71	4/6T
2.13 - 4.49	3/4T	2.13 - 4.49	3/4T	0.74 - 1.30	3/4T
4.53 - 8.07	2/3T	4.53 - 8.07	2/3T	>1.34	2/3T
8.11 - 15.0	1.4/2.5T	8.11 - 15.0	1.4/2.5T	-	-
>15.04	1/1.5T	>15.04	1/1.5T	-	-

4.5 HAB SPEED RECOMMENDATION

HAB 3232 - Speed Recommendation

The chart below offers recommendations for cutting speeds based on specific materials. Depending on the material, they provide guidance on both blade speed and cutting rate.

Speed Recommendation

MATERIAL	SPECIFICATION	BLADE SPEED (FPM)	CUTTING RATE (INCH^2 / MIN)
Mild Steel	1010	164 - 246	11 - 12
	1015	164 - 246	11 - 12
Medium Steel	1045	164 - 230	9 - 11
	1055	164 - 230	8 - 9
Tool Carbon Steel	W1	131 - 164	3.9 - 7
Structural Alloy Steel	3140	98 - 131	4.7 - 6.2
	4140	131 - 164	5 - 7
	4340	115 - 148	4.7 - 6.2
High-Speed Steel	T1	82 - 115	3.1 - 4.7
	T4	66 - 98	2.3 - 3.9
Cold Molded Alloy Tool Steel	D2	82 - 115	3.1 - 3.9
	D7	66 - 98	1.5 - 3.1
	D1	82 - 115	3.1 - 3.9
Hot Molded Alloy Tool Steel	H21	115 - 148	4.7 - 5
	H13	98 - 131	3.9 - 4.7
	L6	82 - 98	3.1 - 3.9
Alloy Spring Steel	6150	66 - 115	3.9 - 5
Bearing Steel	52100	115 - 148	4.7 - 6.2
Stainless Steel	304	115 - 148	3.1 - 4.7
	316	66 - 82	2.3 - 3.1
	430	98 - 131	3.9 - 5

4.6 HAB BUNDLE CUTTING

HAB 3232 - Bundle Cutting

Revision B - 05/2026

Operation

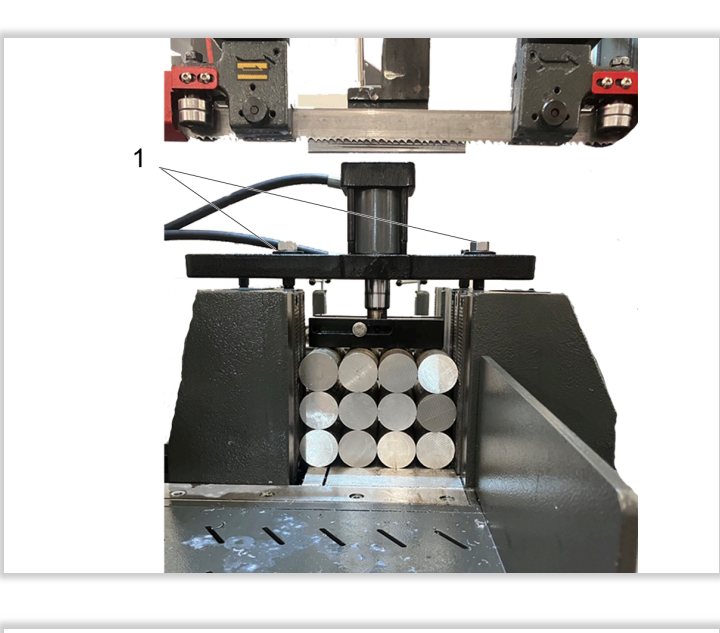

The bundle cut dimensions provided are to serve as a reference, and may vary depending on the installation of the bundle cut piston and threaded piston rod.

The bandsaw comes with two threaded rod sizes for the bundle cut piston; a 6.0 inch "Extended Rod" and a 3.4 inch "Stubby Rod". The height of your bundle cut will depend on which threaded piston rod is installed.

Bundle cut height dimensions with the "Extended Rod" :

- Minimum Height (piston extended) = 2.1 inch
- Maximum Height (piston retracted) = 2.9 inch

Bundle cut height dimensions with the "Stubby Rod" :

- Minimum Bundle Height (piston extended) = 5.2 inch
- Maximum Bundle Height (piston retracted) = 6.0 inch

Bundle cut width dimensions:

- Minimum Width = 6.6 inch
- Maximum Width = 12.8 inch

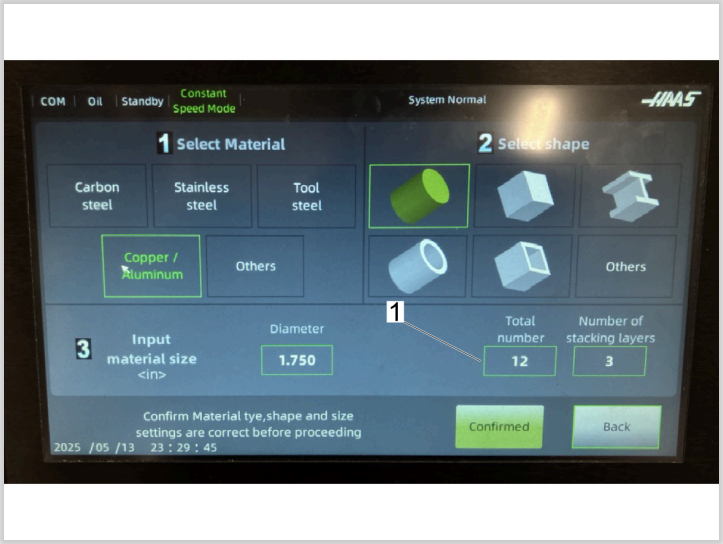

Confirm Material tye,shape and size settings are correct before proceeding

Note: When setting up a job on the material selection page, enter the total number of pieces in the bundle **[1]**, along with the number of stacking layers.

Installation

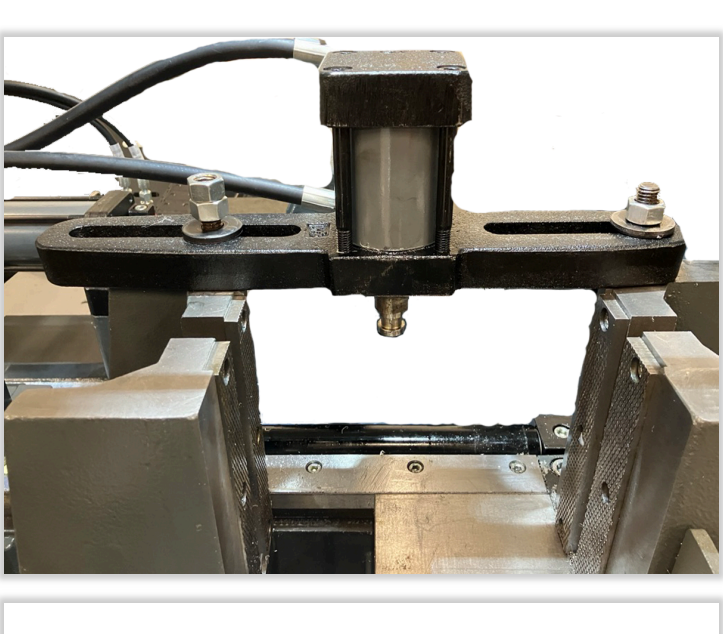

1

Locate the black vertical vise clamps positioned at the rear of the machine. One clamp will be used for the front vise, and the other for the rear vise.

Remove the hardware from the front and rear vises, then insert the black vertical vise clamp onto the threaded rods of the front and rear vises.

Install the hardware to securely fasten the vertical clamp back into place. as shown.

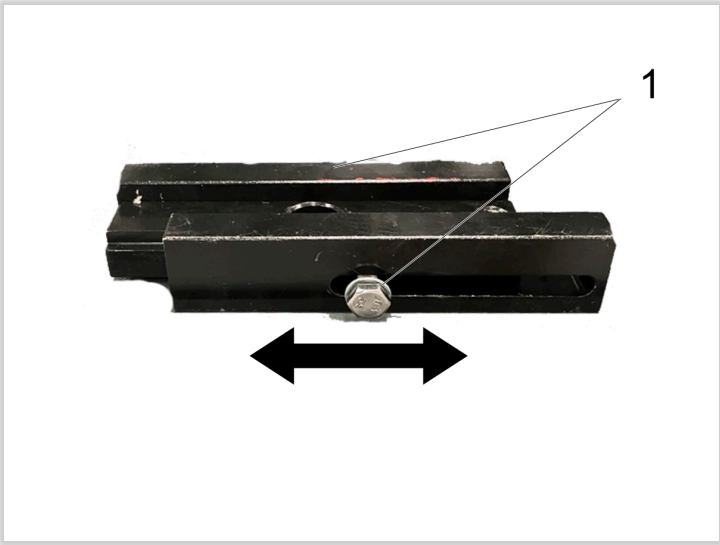

2

Locate the two black machined blocks that arrived with the Band Saw.

Note: To adjust the width of each machined block, use a 14mm wrench **[1]** to loosen the two hex bolts on both sides of the block until you reach the desired length.

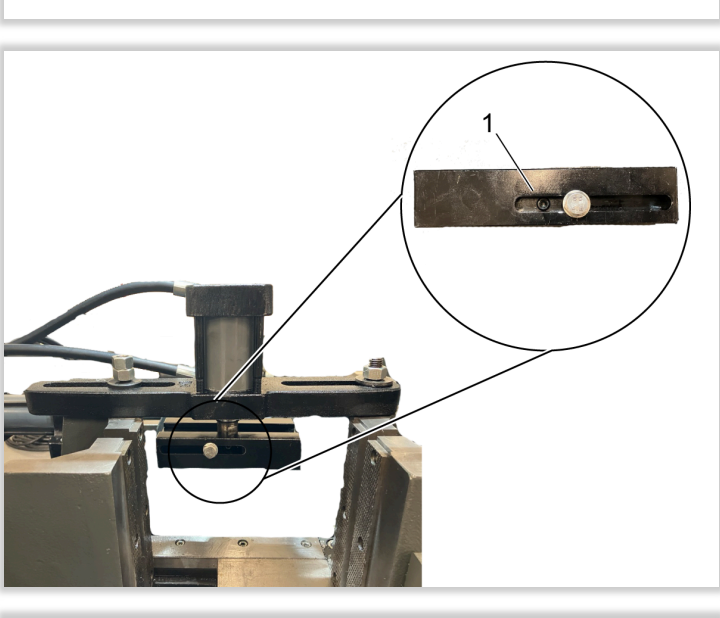

3

Locate the set screw on the machined block **[1].**

Use a 4 mm Allen key to loosen up the setscrew.

Align the center bore of the machined block to the piston rod.

Once secure, tighten down the set screw to the piston rod.

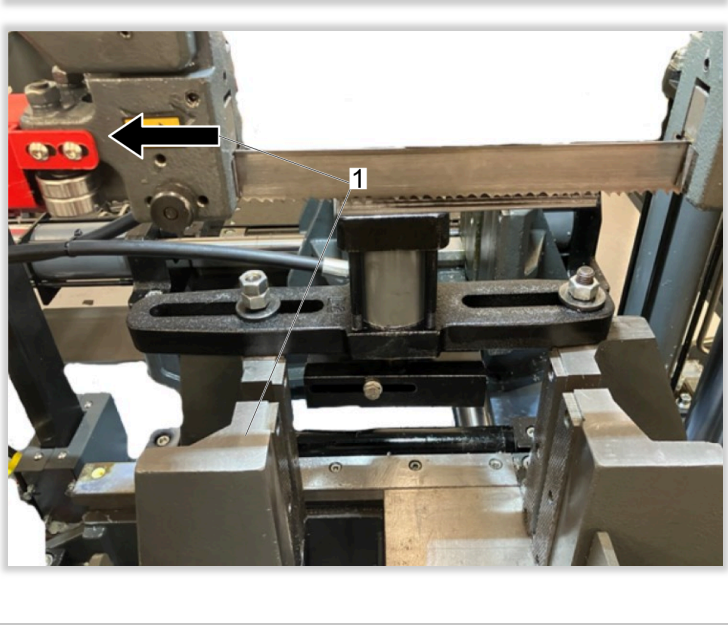

4

Note: Adjust the position of the saw blade guide arms **[1]** that way the frame does not crash into the front vise before commanding the saw to cut.

4.8 CUT COMPENSATIONS

HAB 3232 - Cut Compensations

Revision A - 10/2025

Kerf Compensation

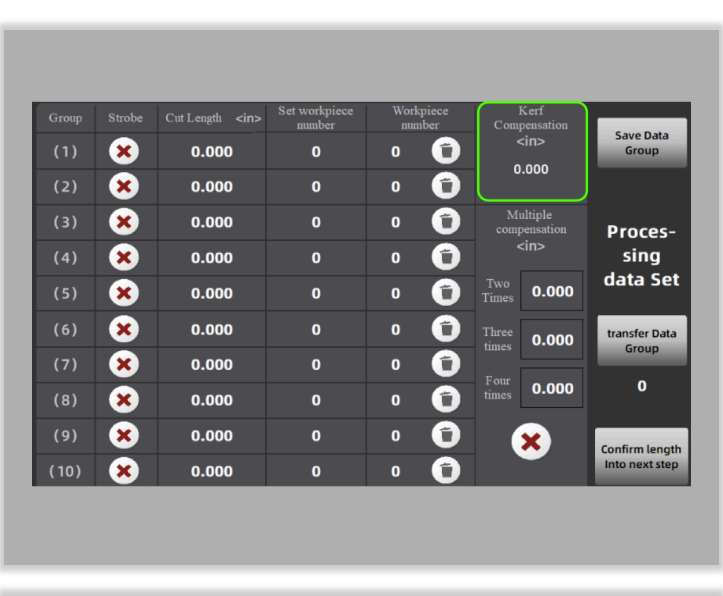

Group	Strobe	Cut Length <in>	Set workpiece number	Workpiece number
(1)	✖	0.000	0	0
(2)	✖	0.000	0	0
(3)	✖	0.000	0	0
(4)	✖	0.000	0	0
(5)	✖	0.000	0	0
(6)	✖	0.000	0	0
(7)	✖	0.000	0	0
(8)	✖	0.000	0	0
(9)	✖	0.000	0	0
(10)	✖	0.000	0	0

1

Kerf compensation is used to account for the width of the blade and the variation in width the machine creates through motion.

Note: The kerf compensation value for the original saw blade provided with the machine should be set to 0.07in (1.8mm).

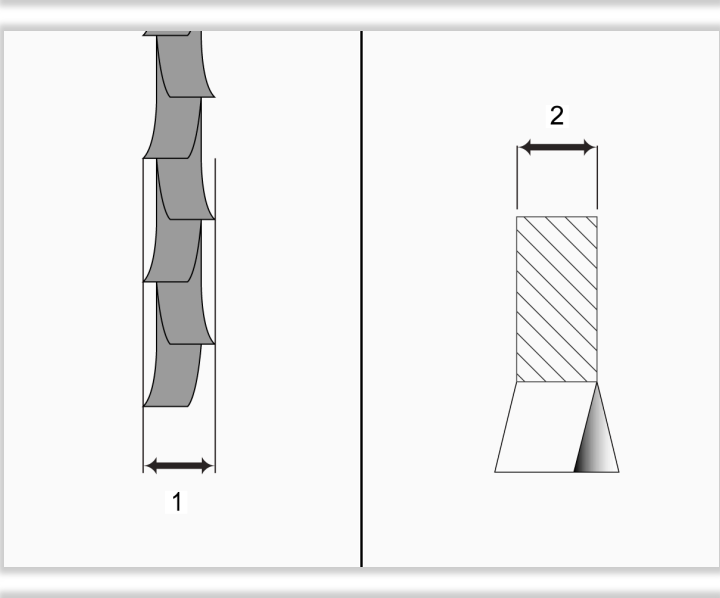

2

Kerf: Cut width of the blade including the offset of the teeth.

1 = Kerf width

2 = Blade width

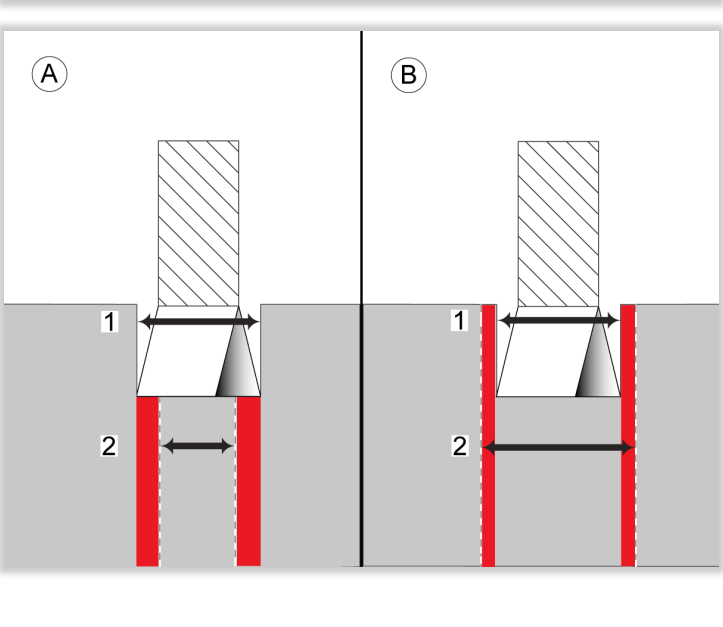

3

1: Effective kerf width

2: Kerf compensation (value in machine)

(A) If the kerf compensation set in the machine is **smaller** than the blade's tooth set then the work will be **smaller** in length.

(B) If the kerf compensation set in the machine is **larger** than the blade's tooth set then the work will be **larger** in length.

The datum for the kerf compensation, and part length measurement, is based off the center line of the blade. Therefore, if the kerf value is not correct the **deviation in length will be consistent.**

Note: The effective kerf is subject to change as the blade dulls and is used. A new blade will require a new compensation depending on the wear or new tooth set.

Multiple Compensation

1

The maximum length of material that the HAB3232 can move in one shuttle of the rear vise is 19.7 inches (500mm).

If a part is longer than this maximum feed of the rear vise, the machine will have to un-clamp and reposition itself on the work. This can cause error in the overall part length.

With Multiple Compensation the machine is able to account for this variation in length.

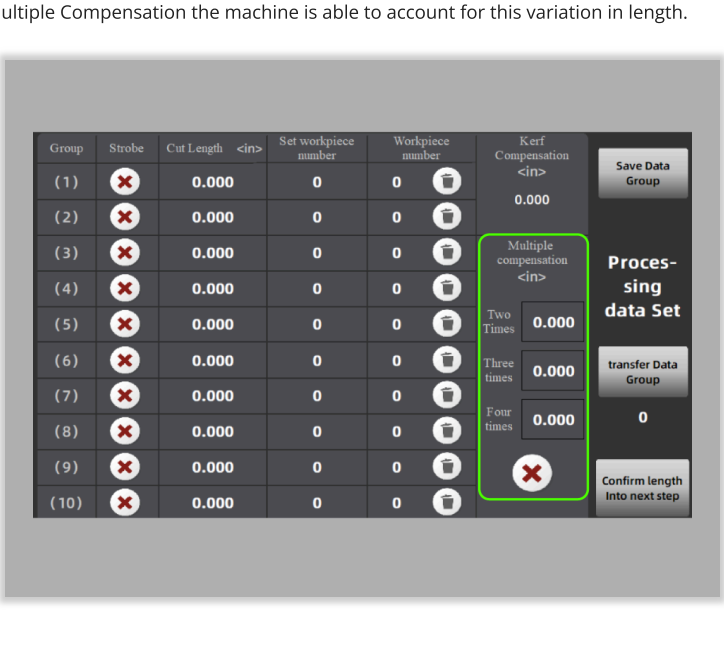

Group	Strobe	Cut Length <in>	Set workpiece number	Workpiece number
(1)	✖	0.000	0	0
(2)	✖	0.000	0	0
(3)	✖	0.000	0	0
(4)	✖	0.000	0	0
(5)	✖	0.000	0	0
(6)	✖	0.000	0	0
(7)	✖	0.000	0	0
(8)	✖	0.000	0	0
(9)	✖	0.000	0	0
(10)	✖	0.000	0	0

2

When the Multiple Compensation button shows the green check mark the setting is enabled.

The machine is able to adjust for variation on a total of 4 feeds individually (for one cut length).

Once: This is accounted for with kerf compensation

Material Range: **0 - 19.7 in (0 - 500 mm)**

Two times: Second time the shuttle has to move.

Material Range: **19.7 - 39.4 in (500 - 1000 mm)**

Three times: Third time the shuttle has to move

Material Range: **39.4 - 59.1 in (1000 - 1500 mm)**

Four times: Fourth time the shuttle has to move

Material Range: **59.1 in - end (1500mm - end)**

3

The multiple compensation feature is not a compounding compensation. If a value is set in the Two Times category then the machine will not use that value when compensating the Three Times category.

Note: For example if Two Times is set to 2.00in and all other compensations in this category are zero,.

Parts from 0 - 19.7 in will be nominal.

Parts from 19.7 - 39.4in will be 2 inches longer than nominal.

Parts greater than 39.4in will be nominal.

4.9 HAB SETTINGS AND PARAMETERS

HAB 3232 - Settings and Parameters

Revision A - 11/2025

Advanced Functions

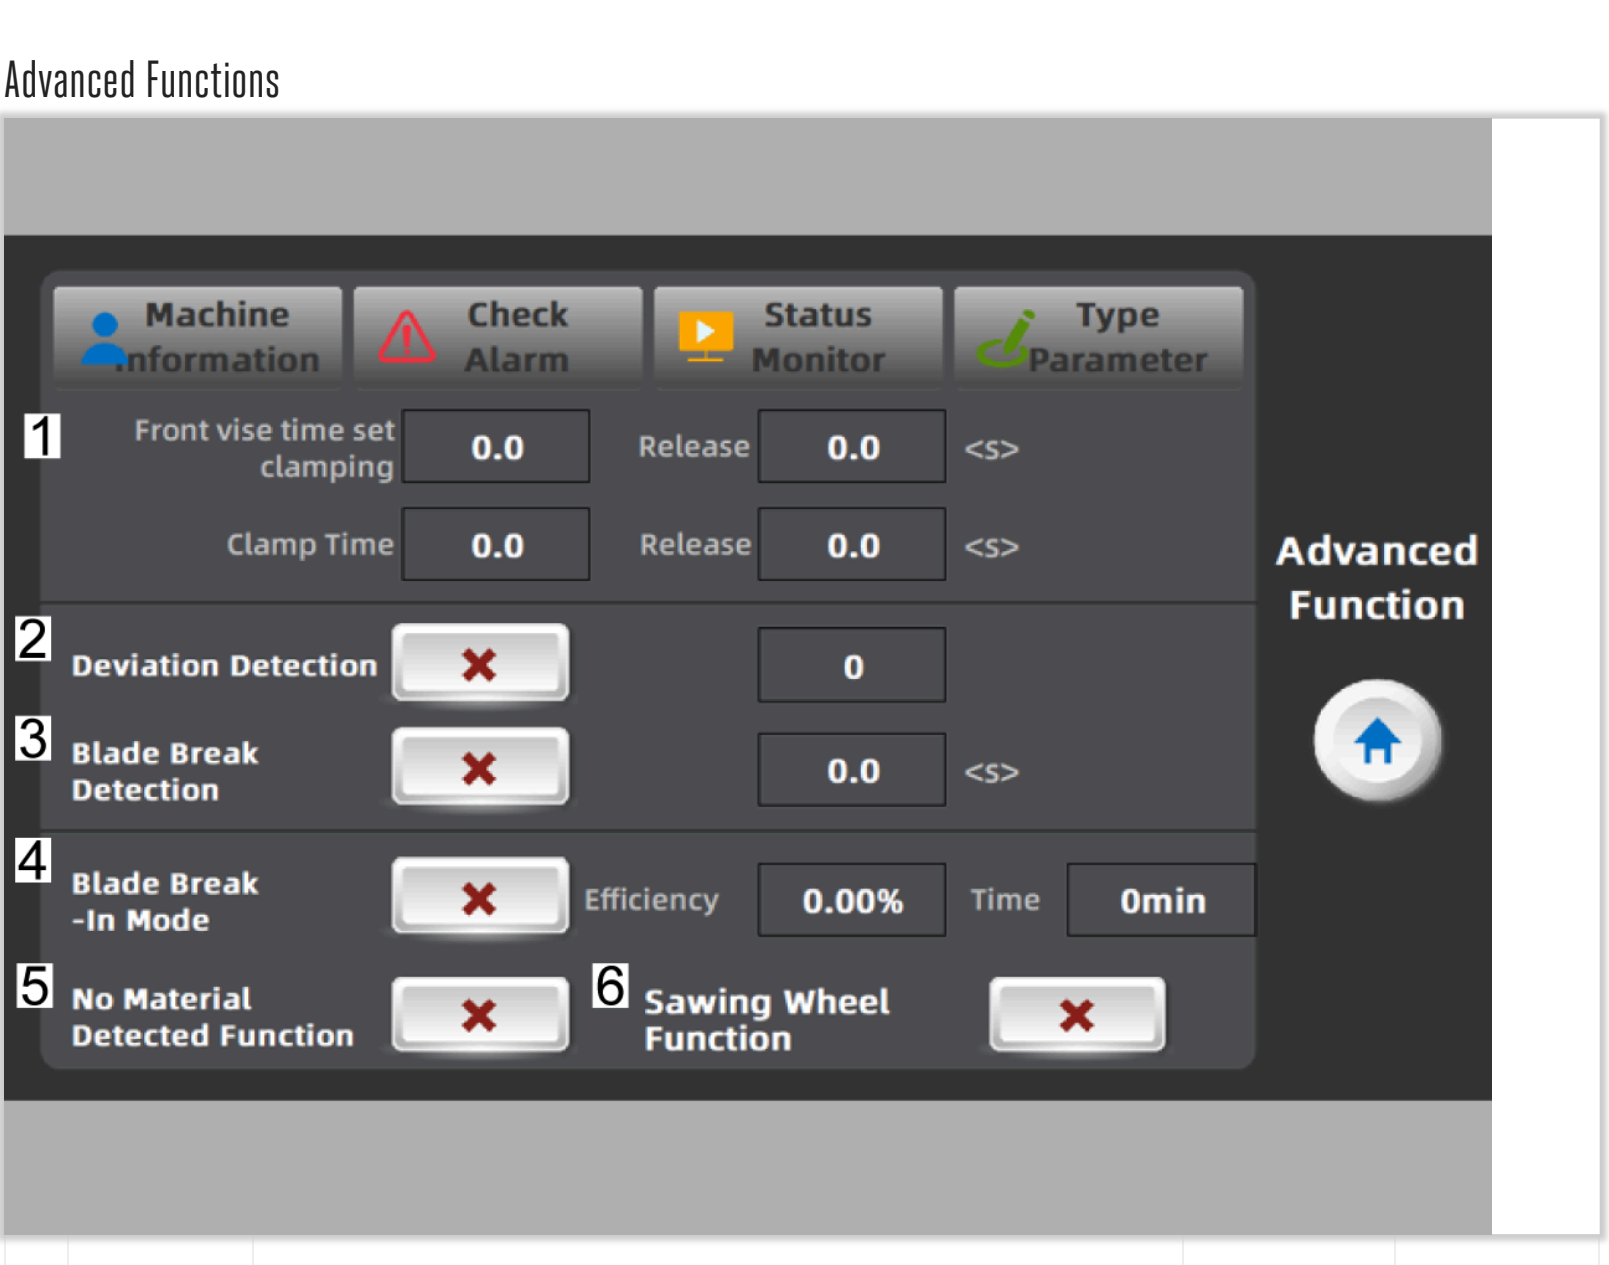

Front vise time set clamping: 0.0; Release: 0.0 <s>

Clamp Time: 0.0; Release: 0.0 <s>

Deviation Detection: ✖ 0

Blade Break Detection: ✖ 0.0 <s>

Blade Break -In Mode: ✖ Efficiency 0.00% Time 0min

No Material Detected Function: ✖

Sawing Wheel Function: ✖

#	SETTING	DESCRIPTION	RECCOMENDED SETTING	RECCOMENDED VALUE
1	Front Vise Time Set Clamping	Set the time associated with opening and closing the **front vise.**	N/A	Open: 2.5s Release: 1.0s
	Clamp Time	Set the time associated with opening and closing the **rear vise.**	N/A	Open: 2.5s Release: 1.0s
2	Deviation Detection	Releases both vises after a set number of parts in automatic mode. It will re-level the stock in the vises when machining materials that are subject to warping or deflecting mid-operation.	OFF	User Dependent
3	Blade Break Detection	Machine will stop if the blade is broken.	ON	1.5s
4	Blade Break-in Mode	Will lower the cutting efficiency of the machine. This function will hone the teeth of the blade, decreasing the likelyhood of breaking or chipping teeth. This setting will have to be turned on and off manually. There will be an alarm/notification stating that the set time for break in has elapsed.	ON	Efficiency: 70.0% Time: 20 min
5	No Material Detected Function	Toggles the material detection switch on the rear vise. This setting will stop an automatic process when it detects that there is no material left to be sawed.	User Dependent	N/A
6	Sawing Wheel Function	Will keep the saw running until the process quantity has been met or the automatic stop is engaged.	OFF	N/A