SCHENKTRONICS

# ST-01 Multiple


## Assembly Guide

For PCB v1.1 - Updated 2026-10-16
Official version: github.com/Schenktronics/ST01-multiple

This kit takes about 20-30 minutes and 30 solder joints. There are no polarized parts, and nothing to get backwards except which side of the board the parts go on, so it makes a good first Eurorack build.

**Prefer to watch?** There's a video of the whole build: Watch me assemble a switched passive multiples module! (https://www.youtube.com/watch?v=nGc3uMlrRig)

## What you need

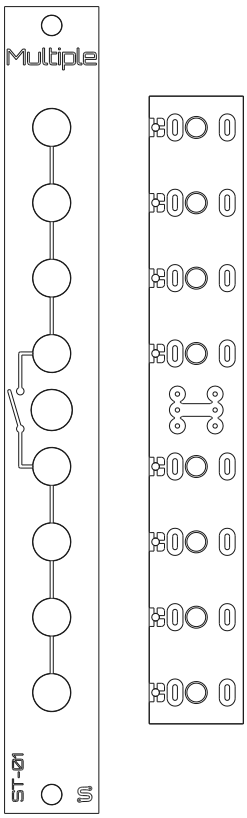


### Kit contents

Check your kit against this list before you start (full details in the BOM (https://github.com/Schenktronics/ST01-multiple/blob/master/docs/BOM.md)):

- [ ] 1 x main PCB
- [ ] 1 x faceplate
- [ ] 8 × 3.5 mm jacks with nuts
- [ ] 1 x latching pushbutton switch
- [ ] 1 x button cap

### Tools

- Soldering iron (about 330-360 °C for leaded solder)
- Solder
- Multimeter with a continuity (beep) mode
- Small pliers (optional, for squaring up the jacks)
- Nut driver or wrench for the jack nuts (optional, but less likely to scratch the panel than pliers)

## Before you start

- The jacks and switch go on the **front** of the PCB, the side with the part outlines (J1-J8, SW1). The back is printed "ST-01 v1.1 / Passive Multiple" and "schenktronics.com", and that's the side you solder on.
- The switch gets soldered first. **Don't solder the jacks until the faceplate is on.** The faceplate holds the jacks in line, and it's how you center the button in its hole.

### First time soldering?

You only need the basics for this kit:


- Touch the iron to the pad and the pin at the same time, then feed solder into the joint, not onto the iron tip. A second or two is usually enough.
- A good joint is shiny and shaped like a small cone around the pin. A dull, lumpy blob usually means the pad didn't get hot enough; reheat it, use some flux, and add a touch more solder if necessary.
- Keep the tip clean and lightly tinned. Wipe it on a damp sponge or brass wool between joints.
- Remember that solder flows toward the heat.

## Step 1: Solder the switch

1. Push the switch's six pins into the SW1 footprint from the front of the PCB. It fits either way round: the footprint is wired symmetrically.
2. Hold it flat against the board and square to it, then solder one pin from the back.
3. Check that the switch is still flat and straight. If it isn't, reheat that pin and straighten it.
4. Solder the other five pins. Don't linger on them, so the plastic body doesn't overheat.

**Front (part side)**


Fit the switch into SW1

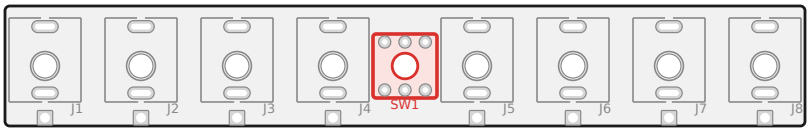


J1 end (top of panel) J8 end

**Back (solder side)**


Solder the 6 switch pins

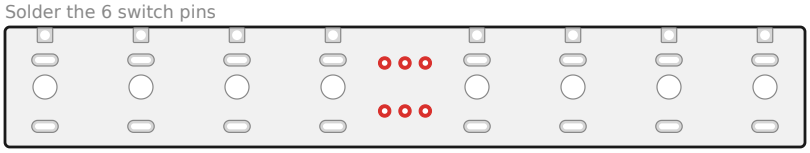

J1 end (top of panel) J8 end

## Step 2: Fit the button cap

Press the cap onto the switch plunger, then push the button a few times to check that it latches in and pops back out.

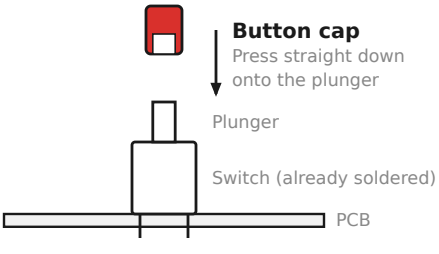



Side view, not to scale

## Step 3: Fit the jacks and faceplate

1. Take the nuts off the jacks and set them aside.

2. Push all eight jacks into J1-J8 from the front of the PCB. Make sure each one sits flat with all three legs through their holes. Don't solder them yet.
3. Lower the faceplate over the jacks. The "Multiple" label goes at the top, next to J1, and the button goes through the bigger hole between the two banks.
4. Rubber bands or small spring clips can be helpful to hold the faceplate and the board together while you work.
5. Put the nuts back on, finger-tight for now.
6. Shift the PCB until the button is **centered in its hole** and moves in and out without rubbing. The jack legs have a little play in their holes, which gives you room to adjust.
7. Snug the nuts down, and check the button again. Don't overtighten: it can strip the jack threads or mark the panel.

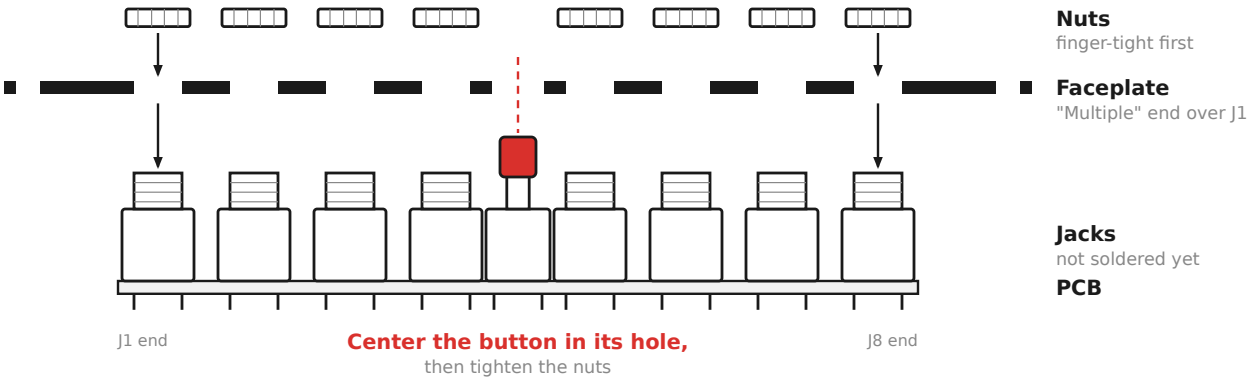



Side view, not to scale vertically

## Step 4: Solder the jacks

Turn the whole thing over and solder from the back of the PCB.

1. On each jack, solder only the square pad. Then check again that the button is centered and moves freely. If it doesn't, reheat those eight joints and nudge the board.
2. Use a small pair of pliers to rotate the jacks as necessary to align them squarely with each other. This step is optional, but a nice touch.
3. Solder the other two pads on each jack (24 jack joints in all).

**Back (solder side)**

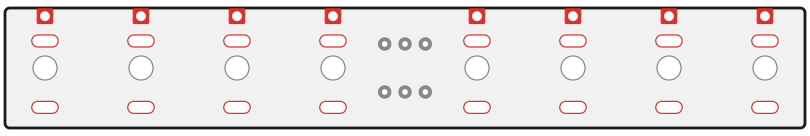


- 1. Tack these first: one leg per jack (8 joints)
- 2. Then the rest (16 joints)
- Switch, already soldered in step 1

Look over every joint before moving on. Each should be shiny and cone-shaped, with no solder bridging neighboring pads.


## Step 5: Test

Set your multimeter to continuity mode. No power is needed. The tip contact is the one that touches the tip of a plugged-in cable; the easiest way to test is to plug in two patch cables and probe their plugs.

| Test | Expected result |
|---|---|
| Sleeve of any jack ↔ sleeve of every other jack | Beep |
| Tip ↔ tip, within Bank A (top four) | Beep |
| Tip ↔ tip, within Bank B (bottom four) | Beep |
| Tip of Bank A ↔ tip of Bank B, button **in** | Beep (linked) |
| Tip of Bank A ↔ tip of Bank B, button **out** | No beep (split) |
| Tip ↔ sleeve, any jack, either button position | **No beep.** A beep means a short: look for a solder bridge. |

## Step 6: Install

Mount the module in your case with two M3 screws. How to use it is in the User Manual (https://github.com/Schenktronics/ST01-multiple/blob/master/docs/manual.md).

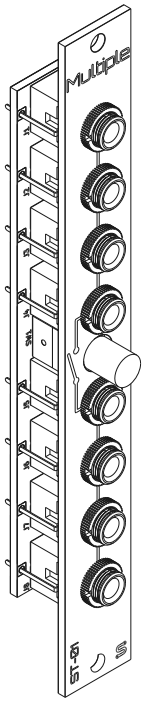

## Troubleshooting

| Symptom | Likely cause |
| --- | --- |
| One jack is dead | A cold or missing joint on that jack. Reflow all three of its legs. |
| The banks never link, or never split | A bad joint on the switch, or the switch isn't fully seated. Reflow the six switch pins. |
| A signal is shorted to ground | A solder bridge between a tip pad and a sleeve pad. |
| The button rubs or sticks | It isn't centered in its hole. Loosen the nuts, reheat the jack joints, and shift the board until it's centered. |