
RE: Portable Fire Equipment Asset Defect Report- October 2025

From Jay Hawkins <jay.hawkins@fvs.com.au>
Date Tue 18/11/2025 3:37 PM
To Brent Simpson <brent.simpson@shangri-la.com>
Cc Michelle Davis <michelle.davis@shangri-la.com>

CAUTION: This e-mail is from an external party. Do not click or reply if you are not sure about the source. For any questions related to phishing emails, please contact infosec@shangri-la.com
注意: 此电邮发送自公司外部。如果您不确定来源, 请不要点击或回覆。 如有任何相关网络钓鱼邮件的疑问, 请联系 infosec@shangri-la.com

Hi Brent,

Thanks for your email. I've reviewed the matters raised by Lewie Fire and can provide the following update:


- **Stop Valve Height:** The valves we installed are at 1120mm, slightly above the AS2441 range of 900–1100mm. This minor deviation is due to practical site limitations. The original valves were seized from corrosion, and our fitters attempted to remove them numerous times using several pairs of Stilson wrenches, but they could not be freed without cutting the copper pipework, which would require a plumber and falls outside the scope of our works. The valves are fully functional, and the minor deviation does not affect operational safety. This also explains why the old valves remain in place.
- **Hose Reel Clearance:** Any gaps or clearance issues shown in the photos provided relate to the original hose reels and do not pertain to the units we installed.
- **Old Valves:** The previous valves had handles removed and spindles cut off (bar one), effectively rendering them openings in the pipe rather than functioning valves. As such, there is no requirement for them to be locked open.

In summary, all works completed by us are compliant with the scope of works. The minor valve height deviation is due to practical site limitations and does not affect the operational safety or performance of the system.

Kind regards,

Jay Hawkins | Service Manager

T 07 4041 3322
E jay.hawkins@fvs.com.au
91 Links Drive, Woree, QLD 4868

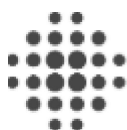

FVS FIRE
SOLUTIONS

www.fvs.com.au



From: Brent Simpson <brent.simpson@shangri-la.com>
Sent: Friday, 14 November 2025 3:05 PM
To: Jay Hawkins <jay.hawkins@fvs.com.au>
Cc: Michelle Davis <michelle.davis@shangri-la.com>
Subject: Fw: Portable Fire Equipment Asset Defect Report- October 2025


Hi Jay,

Can you please confirm all the below is completed and compliant with all FLS AS requirements.

Regards

Brent Simpson
Engineering
Shangri-La, The Marina, Cairns
E. Brent.simpson@shangri-la.com
T. (617) 4052 7603
M. 0439775515

Pier Point Road, Cairns, Queensland 4870, Australia
Shangri-La.com

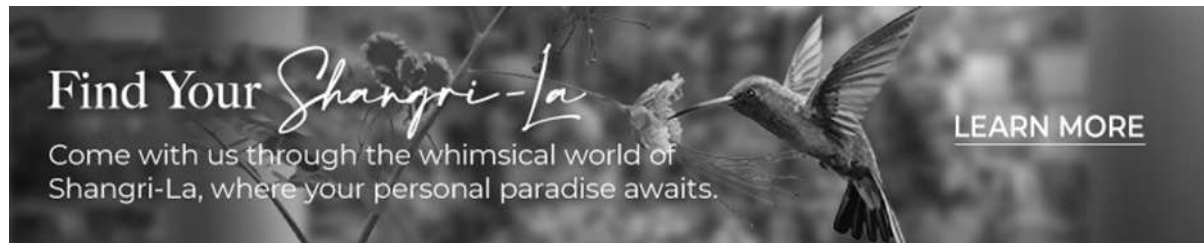

From: Brent Simpson <brent.simpson@shangri-la.com>
Sent: Thursday, October 30, 2025 8:00 AM
To: Jay Hawkins <jay.hawkins@fvs.com.au>
Cc: Michelle Davis <michelle.davis@shangri-la.com>; Brent Simpson <brent.simpson@shangri-la.com>
Subject: Fw: Portable Fire Equipment Asset Defect Report- October 2025

Morning Jay,

Can you please review the email below sent by Lewie Fre and revert back.

Thanks

Regards

Brent Simpson

Engineering

Shangri-La, The Marina, Cairns


E. Brent.simpson@shangri-la.com

T. (617) 4052 7603

M.

Pier Point Road, Cairns, Queensland 4870, Australia

Shangri-La.com

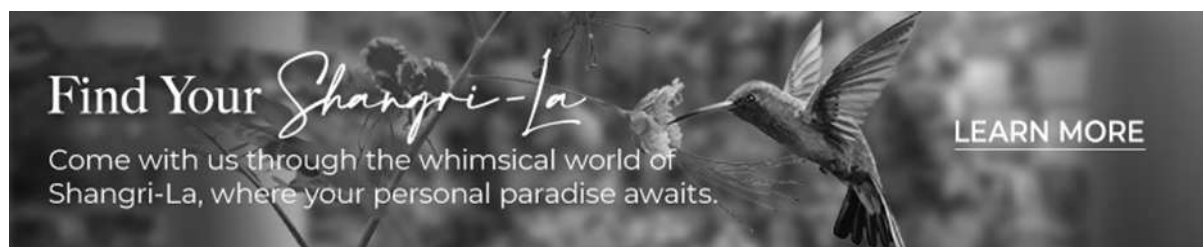

From: Aaron Nixon <aaron@lewiefire.com>

Sent: Thursday, October 30, 2025 7:32 AM

To: Michelle Davis <michelle.davis@shangri-la.com>; Brent Simpson <brent.simpson@shangri-la.com>

Cc: Darren Mahoney <darren@lewiefire.com>

Subject: Portable Fire Equipment Asset Defect Report- October 2025

CAUTION: This e-mail is from an external party. Do not click or reply if you are not sure about the source. For any questions related to phishing emails, please contact infosec@shangri-la.com

注意：此电邮发送自公司外部。如果您不确定来源，请不要点击或回覆。如有任何相关网络钓鱼邮件的疑问，请联系 infosec@shangri-la.com

Good Morning Brent/Michelle,

Please find attached the **Asset Defect Report** for the servicing of the **Portable Fire Equipment** at *Shangri-La Cairns* completed this month.

During our inspection, we identified that **repairs on several Fire Hose Reels** had previously been carried out by another contractor; however, these repairs have been completed **incorrectly**.

We have attached **photos of the affected assets** for your reference, along with an **excerpt from the Fire Hose Reel installation standard(AS2441)**, which states that *any valve capable of preventing water flow must be secured and locked*. Additionally, we noted that **the stop valve has been installed at an incorrect height**, which is **non-compliant with the standard**.

Please review the attached documentation and advise how you would like us to proceed. Once direction is provided, we will prepare a quotation to address the issues listed in the asset defect report.

6.2 Metered water supply

Where a fire hose reel is connected to a metered water supply, it shall comply with the following requirements:

- (a) The supply from the town mains to the allotment shall have a nominal diameter of not less than DN 25.
- (b) The water supply pipework reticulation arrangements shall comply with Figure 6.1.


- (c) Any valve that can prevent flow of water to the hose reel shall be secured and padlocked in the open position. It shall be marked on an attached corrosion-resistant and durable tag, with the following in nominal 8 mm upper case text:

FIRE SERVICE VALVE

CLOSE ONLY TO SERVICE FIRE HOSE REELS

NOTES:

- 1 Strainers on a backflow prevention device are acceptable.

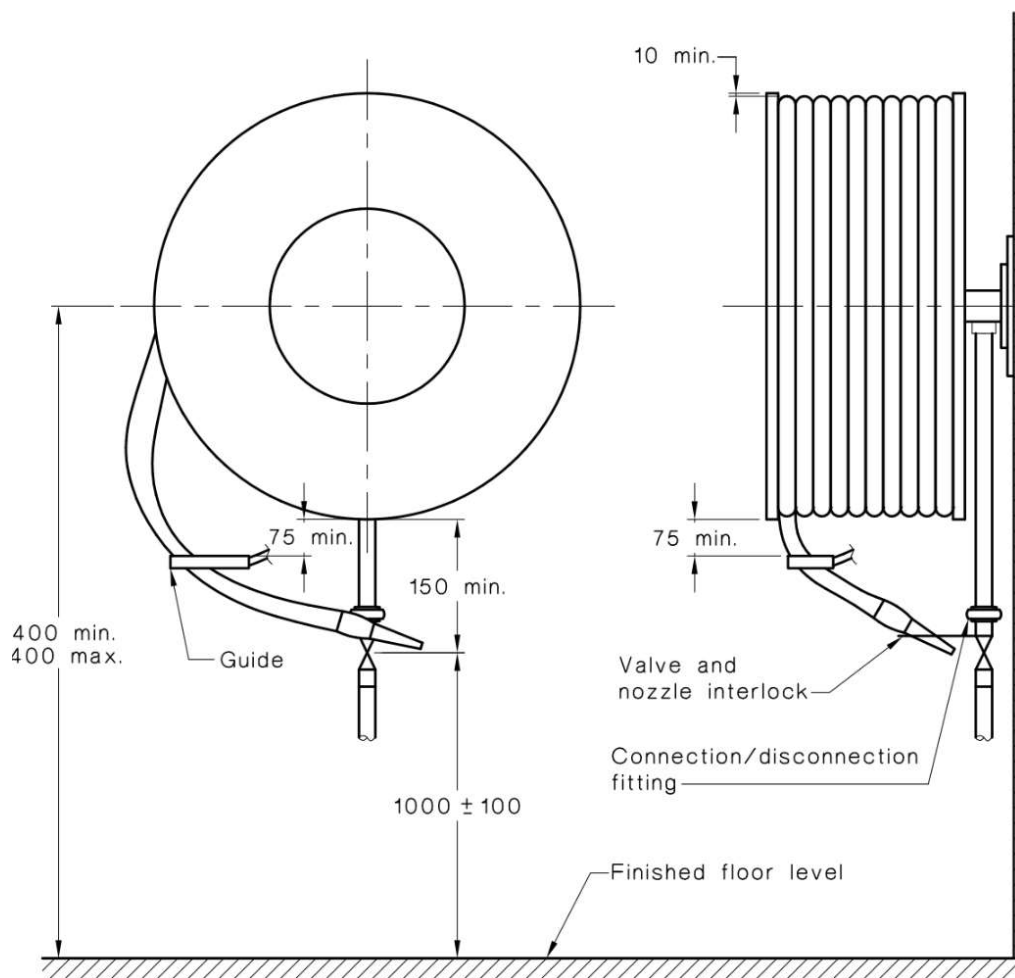

Have a Great and Safe Day.

Kind Regards,

Aaron Nixon | Cairns Manager

Lewie Fire Protection Pty Ltd | 267 Spence Street Bungalow 4870

P.O box 240 Bungalow 4870 Qld

Ph : 0427 200 056

Ph : (07) 4035 1054 | Fax : (07) 4743 3988

Email : aaron@lewiefire.com



Click [here](#) for the Lewie Fire Protection Capability Statement

The information contained in this email and any attachments may be confidential and is provided solely for the use of the intended recipient(s). If you are not the intended recipient, you are hereby notified that any disclosure, distribution, or use of this e-mail, its attachments or any information contained therein is unauthorized and prohibited. If you have received this in error, please contact the sender immediately and delete this e-mail and any attachments. No responsibility is accepted for any virus or defect that might arise from opening this e-mail or attachments, whether or not it has been checked by anti-virus software.

The information contained in this message may be privileged and confidential and protected from disclosure. Any dissemination, distribution, copying of or taking of any action in reliance upon this message, other than to/by the addressee, is strictly prohibited.
If you have received this in error, please destroy it and notify us immediately. Opinions, conclusions and other information in this message that do not relate to the official business of our company shall be understood as neither given nor endorsed by it and we disclaim all liability for any such statements.
