



Property:

P-0810 Shangri-La Hotel
The Marina Cairns
Pierpoint Road, Cairns,
QLD, 4870, Australia

Client:

Shangri-La Hotel (Cairns)
Pty Ltd Trading As
Shangri-La Hotel The
Marina Cairns

Task:

T-94207

Issued by:

Jay Hawkins
1st June 2026

Performed Date:

15th December 2025

Scope of Works

Hinged and Pivoted Doorsets: SOU (AS 1851:2012 Section 12): Annual (350)
Hinged and Pivoted Doorsets: Common (AS 1851:2012 Section 12): Six-monthly (298)
Fire Rated Horizontal Sliding Doors (AS 1851:2012 Section 12): Six-monthly (4)

0	Critical defect	Defect that renders a system non-operational.
129	Non-critical defect	Defect that does not affect the operation of the system.
0	Non-conformance	Missing information or incorrect feature.
0	Recommendation	Modification is suggested to improve system operations.
0	Informational	Detailed advice that may require further action.

Servicing Summary

Service	Asset	Quantity
Fire Rated Horizontal Sliding Doors (AS 1851:2012 Section 12): Six-monthly	Horizontal Sliding Fire Rated Door	1

Maintenance

Fire Rated Horizontal Sliding Doors (AS 1851:2012 Section 12): Six-monthly

AS1851-2012 (a1) - Routine service of fire protection systems and equipment

Asset	Status
670 level 1058	FAIL

Repairs

655
h37

NO TEST

RESOLVED Non-critical defect

ID: 397593 [↗](#)

Added: 9th Dec 2025 2PM
Last Verified: 9th Dec 2025 2:50PM

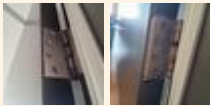
Description:

The door was found to have multiple hinge screws across five hinges (x4 per hinge set) that were undersized at approximately 30 mm, resulting in insufficient fixing strength.

Resolution:

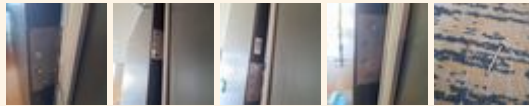
All hinge screws were replaced with 50 mm screws across the affected hinges, improving fixation strength and ensuring the door is securely fastened and operating correctly.

Before



[Click photos to enlarge](#)

After



Parts/Labour

Quantity

656
h36

NO TEST

RESOLVED Non-critical defect

ID: 397595 [↗](#)

Added: 9th Dec 2025 2:50PM
Last Verified: 9th Dec 2025 2:52PM

Description:

The door hinge was found to be insecure.

Resolution:

The hinge was re-secured using 50 mm screws, restoring stability and correct operation of the door.



[Click photos to enlarge](#)

Parts/Labour

Quantity

657

level1 rm 1011

NO TEST

RESOLVED
Non-critical defect

Added: 10th Dec 2025 10:48AM

ID: 397809 [🔗](#)

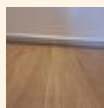
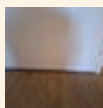
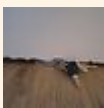
Last Verified: 10th Dec 2025 11:25AM

Description:

An under-door gap of approximately 12 mm was identified. The door was assessed and found not to require replacement. Minor timber chips were also noted on the door; however, these do not penetrate or expose the core.

Resolution:

An FDBU20 fire seal was installed at the base of the door to close the under-door gap. The rubber insert was removed due to a fall in the floor level causing excessive tightness; the remaining fire seal remains compliant without the rubber component. Minor surface chips were assessed as non-structural and require no further action.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

658

level 1 1014

NO TEST

RESOLVED
Non-critical defect

Added: 10th Dec 2025 11:54AM

ID: 397864 [🔗](#)

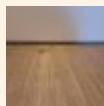
Last Verified: 10th Dec 2025 12:36PM

Description:

The door had an under-door gap measuring approximately 15 mm on the hinge side and 12 mm on the lock side. An existing FDBU seal was present but was coming loose.

Resolution:

The existing seal was replaced with a new FDBU20 seal at the base of the door. As the under-door clearance is within the compliant range of less than 20 mm, the installation restores appropriate sealing performance. The door also includes an integrated smoke rubber seal at the base, contributing to overall smoke sealing effectiveness.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

659
level1 1016

NO TEST

RESOLVED Non-critical defect
ID: 397870 [↗](#)

Added: 10th Dec 2025 12:41PM
Last Verified: 10th Dec 2025 12:54PM

Description:

An under-door gap was identified, measuring approximately 14 mm on the lock side and 13 mm on the hinge side.

Resolution:

A new FDBU20 fire-rated seal with integrated smoke seal rubber was installed at the base of the door to close the under-door gap and improve both fire and smoke sealing performance.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

660
level 1 1034

NO TEST

RESOLVED Non-critical defect
ID: 397899 [↗](#)


Added: 10th Dec 2025 1:18PM
Last Verified: 10th Dec 2025 1:43PM

Description:

The door edges were found to be in poor condition, with minor chips in the plywood and one larger section missing at the bottom lock side. No damage was identified as penetrating or exposing the core.

Resolution:

The affected areas were filled using fire-rated filler to restore the surface condition of the door edges, with no impact to the structural integrity of the core.



[Click photos to enlarge](#)

Parts/Labour

Quantity

661
level 1 1026

NO TEST

RESOLVED Non-critical defect
ID: 397900 [↗](#)

Added: 10th Dec 2025 1:44PM
Last Verified: 10th Dec 2025 1:45PM

Description:

An excessive gap was identified at the top of the door.


Resolution:

An intumescent seal was installed on the frame above the door to reduce the gap and improve sealing performance.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

662
level 1 1040

NO TEST

RESOLVED Non-critical defect
ID: 397919 [↗](#)

Added: 10th Dec 2025 2:19PM
Last Verified: 10th Dec 2025 2:24PM

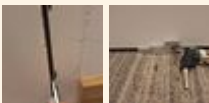
Description:

Excessive gaps were identified between the door leaf and frame, with an additional gap noted at the base of the door. However, the under-door clearance was measured at less than 10 mm and did not require sealing.

Resolution:

No under-door seal was required as the gap was within acceptable limits. An intumescent strip was installed on the lock side of the door, extending approximately 600 mm from the bottom, to address areas where gaps exceeded 3 mm and improve sealing performance.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

663

level1 1066

NO TEST
RESOLVED Non-critical defect

ID: 398137 [↗](#)

Added: 11th Dec 2025 10:12AM

Last Verified: 11th Dec 2025 10:27AM


Description:

An under-door gap was identified, measuring approximately 16 mm on the lock side and 12 mm on the hinge side. The overall gap does not exceed 20 mm.

Resolution:

An FDBU20 fire seal was installed at the base of the door to close the gap and improve sealing performance, in accordance with its compliance range for gaps up to 20 mm.

Before

After


Click photos to enlarge

Parts/Labour
Quantity
664

level 1068

NO TEST
RESOLVED Non-critical defect

ID: 398175 [↗](#)

Added: 11th Dec 2025 10:44AM

Last Verified: 11th Dec 2025 11:30AM


Description:

The defect stated that the under-door gap exceeded 20 mm. However, measurements confirmed approximately 16 mm on the hinge side and 20 mm on the lock side, with slight variation across the threshold.

Resolution:

An FDBU20 seal was installed at the base of the door to close the under-door gap and improve sealing performance, within the allowable tolerance for uneven surfaces.

Before

After


Click photos to enlarge

Parts/Labour
Quantity

665

level 1078

NO TEST

RESOLVED

Non-critical defect

Added: 11th Dec 2025 11:34AM

ID: 398196 [↗](#)

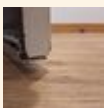
Last Verified: 11th Dec 2025 12:17PM

Description:

The defect noted a loose kickplate and excessive under-door gap. The “kickplate” is actually an under-door fire seal arrangement, not a kickplate or drop seal, as the door has no effective bottom clearance. The floor level is significantly out of tolerance, making standard rectification impractical without excessive planing.

Resolution:

An FDBU60 seal was installed to close the excessive under-door gap. Due to the extent of floor variation and required modifications, the door was replaced as part of the additional works (19th extra door).

Before
After


Click photos to enlarge

Parts/Labour
Quantity

666

level 1080

NO TEST

RESOLVED

Non-critical defect

Added: 11th Dec 2025 1:12PM

ID: 398219 [↗](#)

Last Verified: 11th Dec 2025 1:18PM

Description:

The defect noted a loose kickplate, an under-door gap exceeding 10 mm, and a hinge-side gap. The door does not have a kickplate; instead, it is fitted with an older dropseal which was found to be loose. The under-door gap was measured at approximately 14 mm, and the hinge-side gap measured up to 4 mm from the top down to approximately 400 mm.

Resolution:

An FDBU20 seal was installed at the base of the door to close the 14 mm under-door gap. The existing dropseal was re-secured with screws and confirmed to be fixed in place. An intumescent fire seal was installed along the hinge side to close the identified gap and improve sealing performance.

After


Click photos to enlarge

Parts/Labour
Quantity

667
1070

NO TEST

RESOLVED Non-critical defect
ID: 398244 [↗](#)

Added: 11th Dec 2025 1:44PM
Last Verified: 11th Dec 2025 2PM


Description:

An under-door gap of approximately 15 mm was identified, along with a gap on the hinge side of the door.


Resolution:

An FDBU20 seal was installed at the base of the door to close the under-door gap, and an intumescent seal strip was installed on the hinge side to improve sealing performance.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

668
level1065

NO TEST

RESOLVED Non-critical defect
ID: 398259 [↗](#)

Added: 11th Dec 2025 2:11PM
Last Verified: 11th Dec 2025 2:30PM


Description:

The defect stated an under-door gap exceeding 30 mm; however, the measured gap was approximately 19 mm.


Resolution:

An FDBU20 seal was installed at the base of the door to close the gap and improve sealing performance. The rubber insert was adjusted/removed due to wind impact to ensure correct operation and prevent interference.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

669
level 1057

NO TEST

RESOLVED Non-critical defect
ID: 398859 [↗](#)

Added: 15th Dec 2025 10:05AM
Last Verified: 15th Dec 2025 10:41AM

Description:

The defect stated that the gap between the door leaf and finished floor exceeded 20 mm. Upon inspection, the gap was measured at approximately 17 mm on the lock side and 10 mm on the hinge side.


Resolution:

An FDBU20 fire seal was installed at the base of the door to close the under-door gap and improve sealing performance, in line with its suitability for gaps up to 20 mm.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

670
level 1058

FAIL

RESOLVED Non-critical defect
ID: 398882 [↗](#)

Added: 15th Dec 2025 11:05AM
Last Verified: 15th Dec 2025 11:06AM


Description:

Excessive gap

Resolution:

A seal was installed as required to improve sealing performance of the door.

After



[Click photos to enlarge](#)

Parts/Labour

Quantity

RESOLVED
Non-critical defect

ID: 398878 [↗](#)

Added: 15th Dec 2025 10:56AM

Last Verified: 15th Dec 2025 11:02AM

Description:

The defect noted excessive gaps at the top and bottom of the door. The top gap was measured at approximately 6 mm, and the under-door clearance ranged from 4 mm on the hinge side to 7 mm on the lock side, with a slight dip in the centre measuring up to 8 mm.

Resolution:

The hinges were adjusted to improve alignment at the top of the door, and an intumescent seal was installed at the top to reduce the gap. The under-door clearance was assessed and found to be within acceptable limits, requiring no further rectification.



Click photos to enlarge

Parts/Labour
Quantity
671

level 1081

NO TEST
RESOLVED
Non-critical defect

ID: 398937 [↗](#)

Added: 15th Dec 2025 12:23PM



Last Verified: 15th Dec 2025 12:37PM

Description:

The largest under-door gap was measured at approximately 15 mm. The door is fitted with a dropseal (no kickplate present), which was found to be operating correctly. Gaps around the remainder of the door were within acceptable limits, not exceeding 3 mm.

Resolution:

An FDBU20 seal was installed at the base of the door to close the under-door gap and improve sealing performance. The existing dropseal was assessed as functional and remained in place. No additional sealing was required around the door as all other gaps were within tolerance.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

672
level 1061

NO TEST

RESOLVED Non-critical defect
ID: 398975 [↗](#)

Added: 15th Dec 2025 1:30PM
Last Verified: 15th Dec 2025 1:49PM

Description:

The under-door gap was reported as exceeding 20 mm; however, measurements confirmed approximately 16 mm on the lock side and 17 mm on the hinge side.

Resolution:


An FDBU20 seal was installed at the base of the door to close the under-door gap and improve sealing performance.

Before



Click photos to enlarge

After



Parts/Labour

Quantity

673
level 1084

NO TEST

RESOLVED Non-critical defect
ID: 399007 [↗](#)

Added: 15th Dec 2025 2:45PM
Last Verified: 15th Dec 2025 3:16PM

Description:

The defect noted a faulty kickplate; however, the door is not fitted with a kickplate and instead has a dropseal, which was found to be operating inconsistently. An under-door gap of approximately 17 mm was also identified.

Resolution:

The dropseal was adjusted and confirmed to be operating correctly. An FDBU20 seal with integrated smoke sealing was installed at the base of the door to close the under-door gap and improve fire and smoke sealing performance. The dropseal is considered redundant following installation of the FDBU20 seal system.

Before



Click photos to enlarge

After



Parts/Labour

Quantity

674
level 1036

NO TEST

RESOLVED Non-critical defect
ID: 399267 [↗](#)

Added: 16th Dec 2025 11:50AM
Last Verified: 16th Dec 2025 11:54AM


Description:

A gap of approximately 6 mm was identified at the bottom right on the lock side of the door.


Resolution:

An intumescent seal was installed from the lock area downwards to close the gap and improve sealing performance on the lock side.

Before



After



Click photos to enlarge

Parts/Labour

Quantity

675
level 1085

NO TEST

RESOLVED Non-critical defect
ID: 399286 [↗](#)

Added: 16th Dec 2025 12:26PM
Last Verified: 16th Dec 2025 12:38PM

Description:

An under-door gap of approximately 15 mm was identified. The defect also noted a faulty kickplate; however, the door is fitted with a dropseal rather than a kickplate, and the dropseal was found to be ineffective.


Resolution:

An FDBU20 seal with integrated smoke sealing was installed at the base of the door to close the under-door gap and improve both fire and smoke sealing performance. The existing dropseal was assessed as redundant and not required following installation of the FDBU20 seal system.

Before



After



Click photos to enlarge

Parts/Labour

Quantity

676
level2077

NO TEST

RESOLVED Non-critical defect
ID: 399362 [↗](#)

Added: 16th Dec 2025 1:03PM
Last Verified: 16th Dec 2025 2:22PM


Description:

The under-door gap was reported as exceeding the allowable limit, measuring approximately 14 mm.


Resolution:

The door was removed and planed to improve clearance, and an FDBU20 fire seal was installed at the base of the door to close the gap and restore compliant sealing performance.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

677
level 2086

NO TEST

RESOLVED Non-critical defect
ID: 399372 [↗](#)

Added: 16th Dec 2025 2:33PM
Last Verified: 16th Dec 2025 2:44PM

Description:

A minor chip in the door ply was identified, which does not penetrate or expose the core. An under-door gap of approximately 15 mm was also identified.


Resolution:

The chipped area was filled and made good, with no impact to the structural integrity of the door. An FDBU20 seal was installed at the base of the door to close the under-door gap and improve sealing performance.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

678
level 2089

NO TEST

RESOLVED Non-critical defect
ID: 399396 [↗](#)

Added: 16th Dec 2025 2:54PM
Last Verified: 16th Dec 2025 3:24PM

Description:

An under-door gap of approximately 15 mm was identified at the base of the door. Minor flaking of the plywood was also noted, which does not penetrate or expose the core.


Resolution:

The affected flaking areas were glued and made good, with no impact to the structural integrity of the door core. An FDBU20 seal was installed at the base of the door to close the gap and improve sealing performance.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

679
level 2090

NO TEST

RESOLVED Non-critical defect
ID: 399399 [↗](#)

Added: 16th Dec 2025 3:28PM
Last Verified: 16th Dec 2025 3:35PM


Description:

An under-door gap of approximately 17 mm was identified.


Resolution:

An FDBU20 seal was installed at the base of the door to close the gap and improve sealing performance.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

680
level 1075

NO TEST

RESOLVED **Non-critical defect**
ID: 399539 [↗](#)

Added: 17th Dec 2025 10AM
Last Verified: 17th Dec 2025 10:49AM

Description:

An under-door gap of approximately 13–14 mm was identified.


Resolution:

An FDBU20 seal was installed at the base of the door to close the gap and improve sealing performance.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

681
level 1077

NO TEST

RESOLVED **Non-critical defect**
ID: 399562 [↗](#)

Added: 17th Dec 2025 11:19AM
Last Verified: 17th Dec 2025 11:42AM


Description:

An under-door gap of approximately 15 mm was identified. The door also had a gap on the hinge side and at the top of the frame. The hinge required adjustment. The door does not have a kickplate.


Resolution:

The hinge was adjusted and secured, and seals were installed on the hinge side and at the top of the frame to reduce gaps and improve sealing performance. An FDBU20 seal was installed at the base of the door to close the under-door gap.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

682
level 1093

NO TEST

RESOLVED Non-critical defect
ID: 399599 [↗](#)

Added: 17th Dec 2025 12:21PM
Last Verified: 17th Dec 2025 12:27PM

Description:

The door was reported as having a faulty kickplate and an under-door gap of approximately 14 mm. The door is not fitted with kickplates; instead, it has a dropseal, which was found to be bent and not operating correctly.

Resolution:

An FDBU20 seal with integrated smoke sealing was installed to close the under-door gap and improve sealing performance. The dropseal was adjusted and confirmed to be operating correctly; however, it is considered redundant following installation of the FDBU20 seal system.

After



[Click photos to enlarge](#)

Parts/Labour

Quantity

683
Room 2078

NO TEST

RESOLVED Non-critical defect
ID: 399678 [↗](#)

Added: 17th Dec 2025 1:30PM
Last Verified: 17th Dec 2025 2:32PM

Description:



An under-door gap of approximately 14 mm was identified at the base of the door.

Resolution:

An FDBU20 seal was installed to close the gap and improve sealing performance at the base of the door.

Before

After



[Click photos to enlarge](#)

Parts/Labour

Quantity

684
level2088

NO TEST

RESOLVED **Non-critical defect**
ID: 399689 [↗](#)

Added: 17th Dec 2025 2:41PM
Last Verified: 17th Dec 2025 2:43PM

Description:

An under-door gap of approximately 16 mm was identified on the fire door.


Resolution:

An FDBU20 seal was installed to close the gap at the base of the door and improve sealing performance.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

685
Room 1042

NO TEST

RESOLVED **Non-critical defect**
ID: 399842 [↗](#)

Added: 18th Dec 2025 10:30AM
Last Verified: 18th Dec 2025 10:33AM


Description:

A gap exceeding allowable limits was identified at the top left of the door.


Resolution:

An intumescent seal strip was installed to close the gap and improve sealing performance at the affected area.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

686
level 1083

NO TEST

RESOLVED Non-critical defect
ID: 399892 [↗](#)

Added: 18th Dec 2025 10:51AM
Last Verified: 18th Dec 2025 11:14AM

Description:

An under-door gap of approximately 16 mm was identified on the fire door. The door is fitted with a dropseal (no kickplate present), which was not operating correctly.


Resolution:

An FDBU20 seal was installed to close the under-door gap and improve sealing performance. The existing dropseal was adjusted and confirmed to be operating correctly.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

687
level 2060

NO TEST

RESOLVED Non-critical defect
ID: 399922 [↗](#)

Added: 18th Dec 2025 11:46AM
Last Verified: 18th Dec 2025 12:07PM


Description:

The door edges were found to be in poor condition due to general wear and minor impact damage. Several small sections of ply are chipped (approximately 2 mm deep) but do not penetrate or expose the core. An under-door gap of approximately 16 mm was also identified.


Resolution:

Minor edge damage was filled and made good, as it did not affect the door core or structural integrity. An FDBU20 seal was installed at the base of the door to close the under-door gap and improve sealing performance.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

688

level 2069

NO TEST

RESOLVED
Non-critical defect

Added: 18th Dec 2025 12:29PM

ID: 399955 [↗](#)



Last Verified: 18th Dec 2025 12:51PM

Description:

An under-door gap of approximately 15 mm was identified on the fire door. Minor edge damage was also noted, with small chips present that do not expose the core or cause delamination.

Resolution:

An FDBU20 seal was installed to close the under-door gap and improve sealing performance. Minor surface chips in the door edges were filled, with no structural compromise to the door identified.

Before

After


Click photos to enlarge

Parts/Labour
Quantity

689

level2085

NO TEST

RESOLVED
Non-critical defect

Added: 18th Dec 2025 1:07PM

ID: 399978 [↗](#)

Last Verified: 18th Dec 2025 1:20PM


Description:

An under-door gap of approximately 15 mm was identified. The defect also noted a faulty kickplate; however, the door is fitted with a dropseal rather than a kickplate, which was found to be ineffective.

Resolution:

An FDBU20 seal with integrated smoke seal was installed at the base of the door to close the gap and improve fire and smoke sealing performance. The existing dropseal was assessed as redundant and not required following installation of the FDBU20 system.

Before

After


Click photos to enlarge

Parts/Labour
Quantity

690
level2091

NO TEST

RESOLVED Non-critical defect
ID: 399988 [↗](#)

Added: 18th Dec 2025 1:37PM
Last Verified: 18th Dec 2025 1:52PM

Description:

An under-door gap of approximately 16 mm was identified. The kickplate/drop seal arrangement was also noted, however its effectiveness was not considered necessary given the proposed sealing solution.

Resolution:

An FDBU20 seal was installed at the base of the door to close the under-door gap and improve sealing performance. The existing dropseal was assessed as functional but not required following installation of the FDBU20 seal.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

691
Room 1095

NO TEST

RESOLVED Non-critical defect
ID: 446636 [↗](#)

Added: 29th May 2026 12PM
Last Verified: 29th May 2026 12:02PM

Description:

An excessive under-door gap exceeding 20 mm was identified. Damage from a previously removed door stop has left a significant void, preventing effective installation of a standard seal.

Resolution:

Due to the condition of the door and the large void at the base, a seal could not be effectively installed to achieve a compliant result. Replacement of the door is recommended as the most appropriate long-term solution.



[Click photos to enlarge](#)

Parts/Labour

Quantity

692

Room 1079

NO TEST
RESOLVED
Non-critical defect

Added: 28th Jan 2026 11:08AM

ID: 406919 [↗](#)


Last Verified: 28th Jan 2026 1:46PM

Description:

The defect noted faulty kickplates and an excessive under-door gap. The maximum measured gap was approximately 23 mm.

Resolution:

An FDBU60 seal was installed to close the under-door gap, including integrated smoke sealing performance. As a result, additional smoke sealing under kickplates was not required. Kickplates were assessed and found not to be required for rectification in this instance.

Before

After


Click photos to enlarge

Parts/Labour
Quantity
693

Room 1063

NO TEST
RESOLVED
Non-critical defect

Added: 28th Jan 2026 2:57PM

ID: 407003 [↗](#)

Last Verified: 28th Jan 2026 3:24PM

Description:

An under-door gap of approximately 24 mm was identified. An existing smoke seal/drop seal arrangement at the base was also found to be ineffective.

Resolution:

An FDBU60 seal was installed to close the excessive gap at the base of the door, and the existing smoke seal/drop seal was replaced to restore proper sealing performance.

After


Click photos to enlarge

Parts/Labour
Quantity

694

Room 2082

NO TEST

RESOLVED

Non-critical defect

Added: 29th Jan 2026 2:23PM

ID: 407506 [↗](#)

Last Verified: 29th Jan 2026 3:30PM

Description:

An under-door gap of approximately 14 mm was identified.

Resolution:

An FDBU20 seal with integrated smoke seal was installed to close the gap at the base of the door and improve both fire and smoke sealing performance.

Before

After


Click photos to enlarge

Parts/Labour
Quantity

695

Room 1076

NO TEST

RESOLVED

Non-critical defect

Added: 30th Jan 2026 1:27PM

ID: 407820 [↗](#)

Last Verified: 30th Jan 2026 1:45PM

Description:

An under-door gap of approximately 14 mm was identified on the fire door.

Resolution:

An FDBU20 seal was installed to close the gap at the base of the door and improve sealing performance.

Before

After


Click photos to enlarge

Parts/Labour
Quantity

696

Room 2011

NO TEST

RESOLVED
Non-critical defect

Added: 2nd Feb 2026 10:10AM

ID: 408095 [↗](#)



Last Verified: 2nd Feb 2026 10:17AM

Description:

A gap of approximately 5 mm was identified on the lock side of the door.

Resolution:

An intumescent seal was installed on the lock side to close the gap and improve sealing performance.

Before

After


Click photos to enlarge

Parts/Labour
Quantity

697

Room 2017

NO TEST

RESOLVED
Non-critical defect

Added: 2nd Feb 2026 10:30AM

ID: 408159 [↗](#)

Last Verified: 2nd Feb 2026 11:11AM


Description:

An under-door gap of approximately 14 mm was identified.

Resolution:

An FDBU20 seal was installed to close the gap at the base of the door and improve sealing performance.

Before

After


Click photos to enlarge

Parts/Labour
Quantity

698

Room 2022

NO TEST

RESOLVED

Non-critical defect

Added: 2nd Feb 2026 11:38AM

ID: 408179 [↗](#)


Last Verified: 2nd Feb 2026 11:39AM

Description:

The door was found to have a gap on the hinge side and was binding on the lock side during operation.

Resolution:

The door hinges were adjusted to correct alignment. The door now operates correctly, with no binding and acceptable clearances achieved.

After


Click photos to enlarge

Parts/Labour
Quantity

699

Room 2026

NO TEST

RESOLVED

Non-critical defect

Added: 2nd Feb 2026 12:03PM

ID: 408196 [↗](#)

Last Verified: 2nd Feb 2026 12:08PM

Description:

The defect report indicated an excessive gap of approximately 15 mm on the hinge side.

Resolution:

The door was inspected and all measured gaps were found to be under 10 mm, which is within acceptable limits. No rectification works were required.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

700

Room 2029

NO TEST
RESOLVED
Non-critical defect

Added: 2nd Feb 2026 12:13PM

ID: 408202 [↗](#)

Last Verified: 2nd Feb 2026 12:16PM

Description:

An under-door gap was reported as excessive.

Resolution:

The door was inspected and the under-door clearance was confirmed to be no greater than 10 mm at any point. No sealing or rectification works were required as the gap is within acceptable limits.

After


Click photos to enlarge

Parts/Labour
Quantity
701

Room 2072

NO TEST
RESOLVED
Non-critical defect

Added: 10th Mar 2026 3:13PM

ID: 420051 [↗](#)

Last Verified: 10th Mar 2026 3:25PM

Description:

An under-door gap of approximately 19 mm was identified. The floor level is significantly out of tolerance, contributing to the excessive gap and uneven clearance.

Resolution:

An FDBU20 seal was assessed as unsuitable due to the floor level variation, and installation would not provide an effective or durable seal without excessive door planing or installation of a large threshold. No rectification works were carried out. Replacement of the door is recommended as the most appropriate long-term solution to achieve compliance and avoid further modification of the door leaf.



Click photos to enlarge

Parts/Labour
Quantity

702

Room 2109

NO TEST
RESOLVED
Non-critical defect

Added: 2nd Feb 2026 2:48PM

ID: 408284 [↗](#)

Last Verified: 2nd Feb 2026 3:12PM

Description:

An under-door gap of approximately 17 mm was identified at the base of the door.

Resolution:

An FDBU20 seal was installed to close the gap and improve sealing performance at the base of the door.



Click photos to enlarge

Parts/Labour
Quantity
703

stairwell 10 to horizon 1692 (129)

NO TEST
RESOLVED
Non-critical defect

Added: 4th Feb 2026 9:46AM

ID: 408860 [↗](#)


Last Verified: 4th Feb 2026 9:49AM

Description:

The door was reported as requiring seals on both sides due to excessive gaps. Upon inspection, the only area exceeding 3 mm was identified on the lock side.

Resolution:

Approximately 700 mm of seal was installed on the lock side only, addressing the area where the gap exceeded acceptable limits. Other areas were assessed as compliant and required no additional sealing.

After


Click photos to enlarge

Parts/Labour
Quantity

704

Room 1037

NO TEST
RESOLVED
Non-critical defect

Added: 4th Feb 2026 10:26AM

ID: 408884 [↗](#)

Last Verified: 4th Feb 2026 10:27AM

Description:

The door was reported as not self-closing. The door is part of an interconnecting arrangement between rooms, where both fire doors are normally kept in the closed position and are not fitted with door closers. Similar configurations were observed across other interconnecting doors on site, which remain permanently closed without self-closing devices. This is the only door identified as being flagged for this reason.

Resolution:

No rectification works were carried out, as the door is not fitted with a closer and is intended to remain in a normally closed position. If self-closing functionality is required, the defect should be reissued as “missing door closer” to accurately reflect the required scope of works.

After


Click photos to enlarge

Parts/Labour
Quantity
705

Room 2100

NO TEST
RESOLVED
Non-critical defect

Added: 4th Feb 2026 10:55AM

ID: 408915 [↗](#)


Last Verified: 4th Feb 2026 10:56AM

Description:

A gap was identified on the lock side of the door.

Resolution:

An intumescent seal was installed on the lock side to close the gap and improve sealing performance.

After


Click photos to enlarge

Parts/Labour
Quantity

706

Room 2102

NO TEST
RESOLVED
Non-critical defect

Added: 4th Feb 2026 11:01AM

ID: 408959 [↗](#)



Last Verified: 4th Feb 2026 11:30AM

Description:

An under-door gap of approximately 15 mm was identified.

Resolution:

An FDBU20 seal was installed to close the gap at the base of the door and improve sealing performance.

Before

After


Click photos to enlarge

Parts/Labour
Quantity
707

Room 2106

NO TEST
RESOLVED
Non-critical defect

Added: 4th Feb 2026 11:51AM

ID: 409004 [↗](#)



Last Verified: 4th Feb 2026 12:29PM

Description:

An under-door gap of approximately 15 mm was identified.

Resolution:

An FDBU20 seal was installed to close the gap at the base of the door and improve sealing performance.

Before

After


Click photos to enlarge

Parts/Labour
Quantity

708

Room 2065

NO TEST
RESOLVED
Non-critical defect

Added: 4th Feb 2026 12:59PM

ID: 409042 [↗](#)


Last Verified: 4th Feb 2026 1:17PM

Description:

An under-door gap of approximately 17–19 mm was identified.

Resolution:

An FDBU20 seal was installed to close the gap at the base of the door and improve sealing performance.

Before

After


Click photos to enlarge

Parts/Labour
Quantity
709

Room 1074

NO TEST
RESOLVED
Non-critical defect

Added: 4th Feb 2026 3:26PM

ID: 409130 [↗](#)


Last Verified: 4th Feb 2026 3:26PM

Description:

An under-door gap of approximately 14 mm was identified.

Resolution:

An FDBU20 seal was installed to close the gap at the base of the door and improve sealing performance.

After


Click photos to enlarge

Parts/Labour
Quantity

710

Room 2064

NO TEST
RESOLVED
Non-critical defect

Added: 6th Feb 2026 10:58AM

ID: 409984 [🔗](#)


Last Verified: 6th Feb 2026 11:36AM

Description:

An under-door gap of approximately 15 mm was identified on the fire door.

Resolution:

An FDBU20 seal was installed to close the gap at the base of the door and improve sealing performance.

Before
After


Click photos to enlarge

Parts/Labour
Quantity
711

Room 2107

NO TEST
RESOLVED
Non-critical defect

Added: 29th Apr 2026 12:57PM

ID: 435531 [🔗](#)





Last Verified: 29th Apr 2026 1:51PM

Description:

An excessive under-door gap of approximately 30 mm was identified, with the floor noted as uneven.

Resolution:

A fire-rated threshold was installed in conjunction with an FDBU60 seal to close the excessive gap at the base of the door and achieve improved sealing performance.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

712

Room 2096

NO TEST
RESOLVED
Non-critical defect

Added: 9th Feb 2026 10:28AM

ID: 410432 [↗](#)



Last Verified: 9th Feb 2026 10:48AM

Description:

An under-door gap was identified; however, the gap was confirmed to be less than 20 mm.

Resolution:

An FDBU20 seal was installed to close the gap at the base of the door and improve sealing performance.

Before

After


Click photos to enlarge

Parts/Labour
Quantity
713

Room 2041

NO TEST
RESOLVED
Non-critical defect

Added: 1st May 2026 1:25PM

ID: 436326 [↗](#)



Last Verified: 1st May 2026 1:49PM

Description:

The door was identified as requiring a bottom seal. An existing FDBU20 seal was found to be missing the rubber insert and installed at an incorrect height.

Resolution:

The existing seal was removed and replaced with a new FDBU20 seal, correctly installed at the appropriate height to restore effective sealing at the base of the door.

After


Click photos to enlarge

Parts/Labour
Quantity

714

Room 2042

NO TEST
RESOLVED
Non-critical defect

Added: 9th Feb 2026 12:15PM

ID: 410518 [↗](#)



Last Verified: 9th Feb 2026 12:15PM

Description:

A 4 mm gap was identified on the hinge side of the door, extending approximately halfway down the door height.

Resolution:

An Illuminescent seal strip was installed along the affected hinge side to close the gap and improve sealing performance.

Before
After


Click photos to enlarge

Parts/Labour
Quantity
715

Room 2044

NO TEST
RESOLVED
Non-critical defect

Added: 9th Feb 2026 12:41PM

ID: 410533 [↗](#)




Last Verified: 9th Feb 2026 12:43PM

Description:

Excessive gap was identified between the door leaf and frame on the lock side.

Resolution:

An Illuminescent seal was installed on the lock side up to the lock area, where the gap was excessive. Beyond this point, the gap was assessed as acceptable, resulting in improved sealing and door performance.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

716

Room 2041

NO TEST
RESOLVED
Non-critical defect

Added: 9th Feb 2026 1:23PM

ID: 410567 [↗](#)

Last Verified: 9th Feb 2026 1:33PM

Description:

An under-door gap of approximately 19–20 mm was identified.

Resolution:

An FDBU20 seal was installed to close the gap at the base of the door, improving sealing and door performance.



Click photos to enlarge

Parts/Labour
Quantity
717

Room 1060

NO TEST
RESOLVED
Non-critical defect

Added: 9th Feb 2026 1:45PM

ID: 410610 [↗](#)

Last Verified: 9th Feb 2026 2:25PM

Description:

An under-door gap of approximately 15 mm was identified.

Resolution:

An FDBU20 seal was installed to reduce and close the gap at the base of the door, improving sealing and overall door performance.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

718
NO TEST

stairwell 5 1772

RESOLVED

Non-critical defect

Added: 10th Feb 2026 3:07PM

 ID: 411046 [↗](#)


Last Verified: 10th Feb 2026 3:11PM

Description:

The door was found to be split and structurally compromised.

Resolution:

The door was replaced to restore integrity, proper operation, and compliance.

Before
After


Click photos to enlarge

Parts/Labour
Quantity
719
NO TEST

3a stairwell to carpark

RESOLVED

Non-critical defect

Added: 11th Feb 2026 1:04PM

 ID: 411519 [↗](#)


Last Verified: 11th Feb 2026 1:05PM

Description:

The door was binding during operation. The door is part of a one-way egress path, with a handle provided on the egress side. The opposite side has a fixed knob and is permanently locked from that side, which does not affect egress functionality.

Resolution:

The door was planed and adjusted to remove binding. The door now operates smoothly and self-closes correctly while maintaining its intended one-way egress function.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

720
roof level 6

NO TEST

RESOLVED Non-critical defect
ID: 411560 [↗](#)

Added: 11th Feb 2026 1:35PM
Last Verified: 11th Feb 2026 1:36PM

Description:

The door closer was reported as coming loose from the door.


Resolution:

The closer fixing screws were tightened and secured. The closer is now firmly attached and operating correctly.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

721
stairwell 2

NO TEST

RESOLVED Non-critical defect
ID: 411582 [↗](#)

Added: 11th Feb 2026 2:01PM
Last Verified: 11th Feb 2026 2:03PM

Description:

Excessive gap was identified at the head of the door.

Resolution:

An intumescent seal was installed at the head of the door to reduce the gap and improve sealing performance.


Location:

Stairwell 2 mez

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

722

5a stairwell to carpark

NO TEST

RESOLVED

Non-critical defect

Added: 11th Feb 2026 2:38PM

ID: 411598 [↗](#)



Last Verified: 11th Feb 2026 2:40PM

Description:

The door was binding during operation and the lock was found to be slightly sticky.

Resolution:

The door was adjusted to eliminate binding and ensure smooth operation. The lock was lubricated, restoring proper function and ease of use.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

723

level 2053

NO TEST

RESOLVED

Non-critical defect

Added: 12th Feb 2026 2:57PM

ID: 412351 [↗](#)


Last Verified: 12th Feb 2026 2:58PM

Description:

The door was found to be peeling at the bottom and undersized for the frame, resulting in excessive gaps exceeding 6 mm on the sides and 10 mm at the base.

Resolution:

The door was replaced to restore proper fit, sealing, and compliance within the frame.

After


Click photos to enlarge

Parts/Labour
Quantity

724
NO TEST
Room 2083
RESOLVED **Non-critical defect**

Added: 13th Feb 2026 2:19PM

 ID: 412534 [↗](#)


Last Verified: 13th Feb 2026 2:20PM

Description:

An excessive under-door gap exceeding 20 mm was identified, and the door was also found to be cracked.

Resolution:

The door was replaced to restore integrity, sealing, and compliant operation.

After


Click photos to enlarge

Parts/Labour
Quantity
725
NO TEST
Room 1049
RESOLVED **Non-critical defect**

Added: 16th Feb 2026 3:51PM

 ID: 412966 [↗](#)


Last Verified: 16th Feb 2026 3:51PM

Description:

The existing door was identified as requiring replacement.

Resolution:

A new door was installed, restoring proper operation, integrity, and compliance.

After


Click photos to enlarge

Parts/Labour
Quantity

726

Room 2068

NO TEST

RESOLVED

Non-critical defect

Added: 17th Feb 2026 2:50PM

ID: 413393 [↗](#)

Last Verified: 17th Feb 2026 2:51PM

Description:

The existing door was identified as requiring replacement.

Resolution:

A new door was installed, restoring proper operation, integrity, and compliance.

After


Click photos to enlarge

Parts/Labour
Quantity
727

Room 1029

NO TEST

RESOLVED

Non-critical defect

Added: 19th Feb 2026 11:31AM

ID: 414308 [↗](#)


Last Verified: 19th Feb 2026 3:19PM

Description:

The door was found to be cracked with excessive gaps present, and replacement was recommended.

Resolution:

The door was replaced, restoring integrity, proper sealing, and compliant operation.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

728
NO TEST
Room 2070
RESOLVED
Non-critical defect

Added: 10th Mar 2026 3:28PM

 ID: 420053 [↗](#)


Last Verified: 10th Mar 2026 3:29PM

Description:

The door was identified as damaged with excessive gaps present.

Resolution:

The door was replaced due to the extent of damage and non-compliant gaps, restoring proper operation and sealing.

After


Click photos to enlarge

Parts/Labour
Quantity
729
NO TEST
Room 2067
RESOLVED
Non-critical defect

Added: 23rd Feb 2026 3:50PM

 ID: 415211 [↗](#)


Last Verified: 23rd Feb 2026 4:14PM

Description:

The fire door was identified as requiring replacement.

Resolution:

The fire door was replaced, restoring compliance and operational integrity.

After


Click photos to enlarge

Parts/Labour
Quantity

730

Room 2019

NO TEST

RESOLVED

Non-critical defect

Added: 24th Feb 2026 11:36AM

ID: 415685 [↗](#)


Last Verified: 24th Feb 2026 12:35PM

Description:

The fire door was identified as cracked.

Resolution:

The fire door was replaced to restore integrity, compliance, and safe operation.

After


Click photos to enlarge

Parts/Labour
Quantity
731

Room 1044

NO TEST

RESOLVED

Non-critical defect

Added: 24th Feb 2026 12:36PM

ID: 415848 [↗](#)


Last Verified: 24th Feb 2026 4:31PM

Description:

The door was found to be cracked and in poor condition.

Resolution:

The door was replaced to restore integrity, operation, and compliance.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

732
NO TEST

Room 1027

RESOLVED
Non-critical defect

Added: 25th Feb 2026 3:57PM

ID: 416427 [🔗](#)


Last Verified: 25th Feb 2026 3:57PM

Description:

Excessive gaps were identified on all sides of the door.

Resolution:

The door was replaced as instructed to restore proper fit, sealing, and compliance.

After


[Click photos to enlarge](#)

Parts/Labour
Quantity
733
NO TEST

Room 1027 Riser

RESOLVED
Non-critical defect

Added: 25th Feb 2026 3:58PM

ID: 416429 [🔗](#)


Last Verified: 25th Feb 2026 3:59PM

Description:

An excessive under-door gap of approximately 40 mm was identified at the base of the door.

Resolution:

The door was replaced, restoring appropriate clearance, sealing, and compliance.

After


[Click photos to enlarge](#)

Parts/Labour
Quantity

734

Room 3006

NO TEST

RESOLVED

Non-critical defect

Added: 26th Feb 2026 9AM

ID: 416768 [↗](#)



Last Verified: 26th Feb 2026 12:50PM

Description:

An excessive gap was identified underneath the door.

Resolution:

The door has been assessed as unsuitable for rectification due to the size of the under-door gap, and replacement is recommended to restore compliance and proper sealing.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

735

Room 3001

NO TEST

RESOLVED

Non-critical defect

Added: 26th Feb 2026 1:09PM

ID: 416906 [↗](#)

Last Verified: 26th Feb 2026 5:10PM

Description:

Excessive gaps were identified around the door.

Resolution:

The door was replaced due to the extent of the gaps and inability to achieve a compliant seal through adjustment or sealing alone.

After


Click photos to enlarge

Parts/Labour
Quantity

736

NO TEST

Room 1069

RESOLVED

Non-critical defect

Added: 2nd Mar 2026 7:54AM

ID: 417632 [↗](#)


Last Verified: 2nd Mar 2026 2:28PM

Description:

Excessive gaps and damage were identified on the door.

Resolution:

The door was replaced to restore proper operation, integrity, and compliance.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

737

NO TEST

Room 2094

RESOLVED

Non-critical defect

Added: 3rd Mar 2026 10:29AM

ID: 417772 [↗](#)

Last Verified: 3rd Mar 2026 10:37AM

Description:

An under-door gap of approximately 18 mm was identified.

Resolution:

An FDBU20 seal was installed to close the gap and improve sealing at the base of the door.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

738
NO TEST

Room 3007

RESOLVED
Non-critical defect

Added: 5th Mar 2026 4:57PM

ID: 418804 [🔗](#)

Last Verified: 5th Mar 2026 4:58PM

Description:

The door was found to have cracks and an excessive gap at the base.

Resolution:

The door was replaced to restore compliance and ensure proper operation and sealing.

After


Click photos to enlarge

Parts/Labour
Quantity
739
NO TEST

Room 1045

RESOLVED
Non-critical defect

Added: 9th Mar 2026 12:40PM

ID: 419489 [🔗](#)


Last Verified: 9th Mar 2026 12:44PM

Description:

Clearance between the door leaf edge and finished floor was assessed, with measurements of approximately 9 mm on the lock side and 5.5 mm on the hinge side.

Resolution:

The door clearance was inspected and found to be within acceptable limits, in accordance with AS 1905.1 clause 12.4.3.1 (requiring a 3–10 mm gap). No rectification works were required.

After


Click photos to enlarge

Parts/Labour
Quantity

740

Room 1067

NO TEST

RESOLVED
Non-critical defect

Added: 9th Mar 2026 12:51PM

ID: 419532 [↗](#)


Last Verified: 9th Mar 2026 1:20PM

Description:

An under-door gap was identified, measuring approximately 14–18 mm.

Resolution:

An FDBU20 seal was installed to close the gap and improve sealing at the base of the door.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

741

Room 2075

NO TEST

RESOLVED
Non-critical defect

Added: 10th Mar 2026 1:41PM

ID: 419998 [↗](#)

Last Verified: 10th Mar 2026 1:42PM

Description:

The door was identified as requiring an under-door seal; however, the floor is significantly out of level, making a standard seal unsuitable. The door itself is also in poor condition.

Resolution:

Due to the extent of floor level variation, a threshold solution would be required to achieve an effective seal. However, given the overall condition of the door, replacement is recommended as the most appropriate long-term solution rather than further rectification.



Click photos to enlarge

Parts/Labour
Quantity

742
Room 2073

NO TEST

RESOLVED Non-critical defect
ID: 420039 [↗](#)


Added: 10th Mar 2026 1:47PM
Last Verified: 10th Mar 2026 3:02PM

Description:

The under-door gap was found to be excessive due to the finished floor level being too low, resulting in a gap that would require significant material removal from the door if planing was continued.

Resolution:

The defect has been assessed and identified as being related to the floor level rather than the door itself. Further planing of the door was not carried out to avoid over-reduction of the door leaf. Recommendation is for the floor level to be rectified to achieve a compliant under-door clearance.



[Click photos to enlarge](#)

Parts/Labour

Quantity

743
21108

NO TEST

RESOLVED Non-critical defect
ID: 420809 [↗](#)

Added: 12th Mar 2026 11:35AM
Last Verified: 12th Mar 2026 11:36AM

Description:

An under-door gap of approximately 19 mm was identified at floor level.

Resolution:

An FDBU20 seal was installed to close the gap and improve sealing at the base of the door.

After



[Click photos to enlarge](#)

Parts/Labour

Quantity

744

Room 3009

NO TEST

RESOLVED

Non-critical defect

Added: 12th Mar 2026 12:27PM

ID: 420910 [🔗](#)


Last Verified: 12th Mar 2026 12:36PM

Description:


The door closer was reported as leaking oil.

Resolution:

The existing door closer was removed due to oil leakage and replaced with a new Yale 2400 series closer, installed using the existing fixing holes. The door now operates correctly.

Before


Click photos to enlarge

After

Parts/Labour
Quantity

745

Room 3008

NO TEST

RESOLVED

Non-critical defect

Added: 12th Mar 2026 12:51PM

ID: 420921 [🔗](#)


Last Verified: 12th Mar 2026 12:54PM

Description:

The door closer was reported as contacting the wall due to the position of the door stop.

Resolution:

The door stop was inspected and found not to require relocation, as doing so would leave an unnecessary floor penetration. Fire doors are not required to have a door stop in this application. The closer makes only light contact with the wall without causing damage, and the door opens beyond 80 degrees and self-closes correctly. No rectification works were carried out as the installation was assessed to be operating as intended.

Before


Click photos to enlarge

After

Parts/Labour
Quantity

746
Room 3010

NO TEST

RESOLVED Non-critical defect
ID: 420972 [↗](#)

Added: 12th Mar 2026 2:10PM
Last Verified: 12th Mar 2026 2:13PM


Description:

Excessive gap was reported at the top of the door, with concerns raised regarding the hinges. The hinges were inspected and found to be in satisfactory condition.

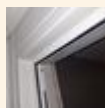
Resolution:

A seal was installed at the top of the door to reduce the gap to approximately 3 mm, improving the overall seal and door operation.

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

747
I1 service doors in corridor 1416(103)

NO TEST

RESOLVED Non-critical defect
ID: 421739 [↗](#)

Added: 16th Mar 2026 10:55AM
Last Verified: 16th Mar 2026 10:58AM


Description:

The door was reported as not closing under its own weight, requiring adjustment of the door closer.

Resolution:

The door closer was checked and adjusted as required. The door now closes under its own weight and operates correctly.

After



[Click photos to enlarge](#)

Parts/Labour

Quantity

748

NO TEST

I1 service doors cleaners1413

RESOLVED Non-critical defect

ID: 421766 [↗](#)

Added: 16th Mar 2026 11:28AM

Last Verified: 16th Mar 2026 11:32AM

Description:

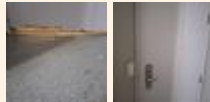
The door was reported as binding and requiring removal and planing.

Resolution:

The top hinge screws were replaced and a hinge adjustment was carried out, resolving the binding issue and allowing the door to close correctly. The door now operates and self-closes as intended.

Note: The door was also found to be in a deteriorated condition, with the bottom section missing and the core exposed, indicating it is likely due for full replacement. This was not previously identified, however the immediate operational issue has been rectified and the door is now functioning correctly.

Before

After

[Click photos to enlarge](#)
Parts/Labour
Quantity

749

NO TEST

I1 service corridor 1414

RESOLVED Non-critical defect

ID: 421769 [↗](#)

Added: 16th Mar 2026 11:35AM



Last Verified: 16th Mar 2026 11:37AM

Description:

The door was reported as binding at the head.

Resolution:

The door was inspected and found to be operating correctly, with no binding at the head or sides. The door self-closes as intended.

Before

After

[Click photos to enlarge](#)
Parts/Labour
Quantity

750

NO TEST

I1 service doors in corridor 1402

RESOLVED

Non-critical defect

Added: 16th Mar 2026 12:17PM

ID: 421796 [↗](#)


Last Verified: 16th Mar 2026 12:18PM

Description:

The door was reported as binding at the head.

Resolution:

The door was inspected and found not to be binding. The door operates correctly and self-closes as intended.



Click photos to enlarge

Parts/Labour
Quantity

751

NO TEST

I2 server riser 1392

RESOLVED

Non-critical defect

Added: 16th Mar 2026 12:51PM

ID: 421813 [↗](#)


Last Verified: 16th Mar 2026 12:52PM

Description:

The door was not latching correctly.

Resolution:

The striker plate was replaced, restoring proper latching function and ensuring the door closes securely.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

752

Room 2101

NO TEST
RESOLVED
Non-critical defect

Added: 17th Mar 2026 1:39PM

ID: 422312 [↗](#)

Last Verified: 17th Mar 2026 2:05PM


Description:

The door was found to be binding during operation.

Resolution:

New hinge screws were installed and tightened, which corrected the binding and restored normal door operation.

Before

After


Click photos to enlarge

Parts/Labour
Quantity
753

Room 1053

NO TEST
RESOLVED
Non-critical defect

Added: 19th Mar 2026 1:06PM

ID: 423073 [↗](#)

Last Verified: 19th Mar 2026 1:16PM

Description:

An under-door gap of approximately 12 mm was identified at the base of the door.

Resolution:

A 4 mm threshold plate was installed to reduce the under-door gap and improve sealing at the base of the door.

Before

After


Click photos to enlarge

Parts/Labour
Quantity

754

NO TEST

I1 service doors in corridor 1427

RESOLVED

Non-critical defect

Added: 19th Mar 2026 2:57PM

ID: 423148 [↗](#)


Last Verified: 19th Mar 2026 3:01PM

Description:

The door did not close under its own weight.

Resolution:

The door closer was adjusted and swapped with a like-for-like unit, however the issue persisted. The fault was identified in the hinges. Hinge pins were removed, lubricated, and reinstalled, restoring normal self-closing operation.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

755

NO TEST

I2 server rises 1405

RESOLVED

Non-critical defect

Added: 23rd Apr 2026 11:53AM

ID: 433929 [↗](#)


Last Verified: 23rd Apr 2026 11:55AM

Description:

The key cylinder was not engaging correctly, preventing normal operation of the door.

Resolution:

The key cylinder was adjusted and tested, and is now engaging correctly, allowing the door to lock and unlock as intended.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

756
stairwell 7 1716

NO TEST

RESOLVED Non-critical defect
ID: 434032 [↗](#)

Added: 23rd Apr 2026 1:30PM
Last Verified: 23rd Apr 2026 1:57PM

Description:

Excessive gap was identified under the door.


Resolution:

A suitable under-door seal was installed to close the gap and improve the door sealing condition.

Before



After



Click photos to enlarge

Parts/Labour

Quantity

757
Room 4006

NO TEST

RESOLVED Non-critical defect
ID: 434727 [↗](#)

Added: 27th Apr 2026 12:50PM
Last Verified: 27th Apr 2026 1:17PM


Description:

The door was identified as requiring a bottom seal and replacement screws.


Resolution:

An FDBU20 seal was installed to the base of the door, and the required screws were replaced to secure the assembly and restore proper operation.

Before



After



Click photos to enlarge

Parts/Labour

Quantity

758

Room 1091

NO TEST

RESOLVED
Non-critical defect

Added: 27th Apr 2026 2:17PM

ID: 434799 [🔗](#)



Last Verified: 27th Apr 2026 3:23PM

Description:

Excessive under-door gap was identified, measuring over 30 mm. An existing FDBU20 seal was also found to be undersized for the gap. The door was noted as 45 mm thick.

Resolution:

The existing FDBU20 seal was replaced with an FDBU60 seal to properly close the excessive gap at the base of the door and achieve an effective seal.

Before

After


Click photos to enlarge

Parts/Labour
Quantity

759

Room 4008

NO TEST

RESOLVED
Non-critical defect

Added: 28th Apr 2026 2:12PM

ID: 435123 [🔗](#)


Last Verified: 28th Apr 2026 2:15PM

Description:

The under-door gap was measured between approximately 10–13 mm, with the lock side gap being insufficient for a standard seal installation.

Resolution:

A 4 mm fire-rated threshold plate was installed to achieve a consistent and suitable clearance, improving the under-door gap condition and allowing for proper sealing.

After


Click photos to enlarge

Parts/Labour
Quantity

760

Room 1062

NO TEST
RESOLVED
Non-critical defect

Added: 29th Apr 2026 2:32PM

ID: 435604 [↗](#)



Last Verified: 29th Apr 2026 3:43PM

Description:

The under-door gap was reported as exceeding 50 mm; however, it was measured at approximately 32 mm.

Resolution:

An FDBU20 seal was installed to reduce and close the gap at the base of the door, bringing it to an acceptable condition.

Before
After


Click photos to enlarge

Parts/Labour
Quantity
761

Room 2038

NO TEST
RESOLVED
Non-critical defect

Added: 1st May 2026 12:31PM

ID: 436288 [↗](#)






Last Verified: 1st May 2026 1:17PM

Description:

The door was found to be rubbing on the floor and had splitting/damage on all sides, as shown in the provided photos. Minor chips were also present but did not penetrate the core.

Resolution:

The bottom of the door was planed to eliminate contact with the floor, resulting in an increased gap on the lock side. Minor chips in the door surface were filled and made good, ensuring no damage to the core material.

Before
After


Click photos to enlarge

Parts/Labour
Quantity

762

Room 1090

NO TEST
RESOLVED
Non-critical defect

Added: 1st May 2026 2:47PM

ID: 436461 [🔗](#)



Last Verified: 1st May 2026 3:23PM

Description:

Excessive under-door gap was identified, measuring approximately 30 mm. An incorrectly installed FDBU20 seal was also found in place.

Resolution:

The existing FDBU20 seal was removed and replaced with an FDBU60 seal, closing the gap and achieving an acceptable seal at the base of the door.

Before
After


Click photos to enlarge

Parts/Labour
Quantity
763

bassment passage 10 carpark exit

NO TEST
RESOLVED
Non-critical defect

Added: 5th May 2026 12:03PM

ID: 437283 [🔗](#)



Last Verified: 5th May 2026 12:04PM

Description:

The door frame and door were identified as requiring replacement.

Resolution:

The door frame and door were replaced, restoring the opening to a serviceable condition

Before
After


Click photos to enlarge

Parts/Labour
Quantity

764

2053 connect door

NO TEST

RESOLVED

Non-critical defect

Added: 27th May 2026 12:17PM

ID: 445569 [↗](#)



Last Verified: 27th May 2026 12:21PM

Description:

Excessive gaps were identified around the door.

Resolution:

Hinge screws were tightened, which corrected the gap on the hinge side. Illuminescent seal will be installed on the lock side to further reduce the remaining gap and improve the door seal.

Before

After


Click photos to enlarge

Parts/Labour
Quantity

765

rear dock to horizon rooms old office 1681

NO TEST

RESOLVED

Non-critical defect

Added: 27th May 2026 2:22PM

ID: 445733 [↗](#)



Last Verified: 27th May 2026 2:51PM

Description:

Broken tiles were identified, resulting in an excessive under-door gap of approximately 18 mm to the original slab level

Resolution:

The void created by the removed/broken tiles will be infilled with concrete to raise the finished floor level and reduce the under-door gap to less than 10 mm.

Before

After


Click photos to enlarge

Parts/Labour
Quantity

766
stairwell 3 1795

NO TEST

RESOLVED Non-critical defect
ID: 446513 [↗](#)

Added: 29th May 2026 8:02AM
Last Verified: 29th May 2026 8:08AM

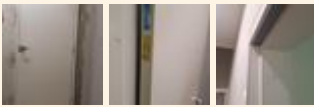
Description:

Excessive gaps were identified on the hinge side at both the top and bottom of the door. The door frame was also found to be untagged, and evidence suggests the door may have been previously modified (including reversal of swing and installation of a hold-open device), indicating the frame may not align with current fire door requirements.

Resolution:

Seals were installed to reduce side gaps to less than 6 mm, including an FDBU20 seal, bringing the door into acceptable operational condition without requiring replacement of the fire door leaf. The door itself is now sealing correctly; however, the condition and compliance of the frame remain uncertain and may require further assessment.

After



[Click photos to enlarge](#)

Parts/Labour

Quantity

767
shopping centre nxt to reef adventures

NO TEST

RESOLVED Non-critical defect
ID: 446518 [↗](#)

Added: 29th May 2026 8:10AM
Last Verified: 29th May 2026 8:11AM

Description:

The pair doors were found to be cracked at the bottom.

Resolution:

The damaged section of the pair doors was replaced, restoring the doors to a serviceable condition.

After



[Click photos to enlarge](#)

Parts/Labour

Quantity

768

NO TEST

stairwell 3 1785 note door is by rear dock to gas room not in the stairwell

RESOLVED

Non-critical defect

Added: 29th May 2026 8:26AM

ID: 446526 [🔗](#)

Last Verified: 29th May 2026 8:41AM

Description:


Excessive gaps were reported around the sides of the door.

Resolution:

The hinge side gap was assessed and found to be within acceptable limits. Illuminescent seal was installed to the head and lock side to reduce the remaining gaps and improve overall sealing around the door.

Before


Click photos to enlarge

After


Parts/Labour

Quantity

769

NO TEST

horizon corridor outside room 45

RESOLVED

Non-critical defect

Added: 29th May 2026 9:06AM

ID: 446539 [🔗](#)

Last Verified: 29th May 2026 9:07AM

Description:

The sequence selector was found to be broken.

Resolution:

The faulty sequence selector was replaced and tested to confirm correct operation.

Before


Click photos to enlarge

After


Parts/Labour

Quantity

770

leading into stairwell 6

NO TEST
RESOLVED
Non-critical defect

Added: 29th May 2026 9:09AM

 ID: 446540 [↗](#)


Last Verified: 29th May 2026 9:11AM

Description:

The handle was reported as broken on a door providing one-way access into a fire escape.

Resolution:

The door is configured as a one-way entry point into the fire escape, with no requirement for a handle on the egress side. The path of egress remains unaffected and compliant, and no further rectification is required.

Before
After


Click photos to enlarge

Parts/Labour
Quantity
771

stairwell 9 1772

NO TEST
RESOLVED
Non-critical defect

Added: 29th May 2026 9:48AM

 ID: 446550 [↗](#)


Last Verified: 29th May 2026 9:50AM

Description:

A door was reported as binding and requiring hinge adjustment in Stairwell 9; however, the referenced door number could not be located within that stairwell. Further investigation identified door 1772 is actually located in Stairwell 5.

Resolution:

All doors in Stairwell 9 were inspected and found to operate correctly, with no binding or adjustment required. Door 1772 in Stairwell 5 was checked, hinge screws were tightened, and the door was confirmed to close and operate correctly.



Click photos to enlarge

Parts/Labour
Quantity

772

stairwell 5 1776

NO TEST

RESOLVED

Non-critical defect

Added: 29th May 2026 11:24AM

ID: 446609 [↗](#)

Last Verified: 29th May 2026 11:25AM

Description:

A door closer was reported as pulling away from the door within Stairwell 5; however, the referenced number could not be located.

Resolution:

A full inspection of all door closers in Stairwell 5 was carried out. All closers were found to be secure, correctly fitted, and operating as intended at the time of inspection.



Click photos to enlarge

Parts/Labour
Quantity

773

stairwell 5 1779

NO TEST

RESOLVED

Non-critical defect

Added: 29th May 2026 11:26AM

ID: 446612 [↗](#)


Last Verified: 29th May 2026 11:27AM

Description:

A door was reported as requiring a seal on the head within Stairwell 5; however, upon inspection, no door number matching the reference could be identified.

Resolution:

A full inspection of all doors within Stairwell 5 was completed, and no doors were found to require a head seal at the time of attendance.



Click photos to enlarge

Parts/Labour
Quantity

774

NO TEST

Room 2109 side door

RESOLVED

Non-critical defect

Added: 29th May 2026 11:52AM

ID: 446629 [🔗](#)

Last Verified: 29th May 2026 11:53AM

Description:

Side door was identified with a gap exceeding 20 mm beneath the door.

Resolution:

An FDBU60 seal was installed to close the gap and improve the seal at the base of the door.

Before

After


Click photos to enlarge

Parts/Labour

Quantity

775

NO TEST

2109 side door

RESOLVED

Non-critical defect

Added: 29th May 2026 11:54AM

ID: 446631 [🔗](#)


Last Verified: 29th May 2026 11:55AM

Description:

The door on the opposite side in room 2109 was found to have a gap exceeding 20 mm at the base.

Resolution:

An FDBU60 seal was installed to reduce the gap, bringing it down to approximately 10 mm and improving the seal at the base of the door.

After


Click photos to enlarge

Parts/Labour

Quantity

776
4005

NO TEST

RESOLVED **Non-critical defect**
ID: 446634 [↗](#)

Added: 29th May 2026 11:56AM
Last Verified: 29th May 2026 11:58AM

Description:

A gap exceeding 10 mm was identified beneath the door.

Resolution:

An FDBU20 seal was installed to close the gap and achieve a compliant seal at the base of the door

Before



After



[Click photos to enlarge](#)

Parts/Labour

Quantity

777
h26

NO TEST

RESOLVED **Non-critical defect**
ID: 446979 [↗](#)

Added: 31st May 2026 9AM
Last Verified: 31st May 2026 9:01AM


Description:

A gap was identified on the lock side of the door, requiring sealing to maintain correct clearances and operation.

Resolution:

A suitable seal was installed to the lock side of the door, rectifying the gap and restoring compliance.

After



[Click photos to enlarge](#)

Parts/Labour

Quantity

778

h12

NO TEST

RESOLVED
Non-critical defect

Added: 31st May 2026 9:03AM

ID: 446980 [↗](#)


Last Verified: 31st May 2026 9:04AM

Description:

A gap was identified on the lock side of the door, requiring sealing to maintain correct clearances and operation.

Resolution:

A suitable seal was installed to the lock side of the door, rectifying the gap and restoring compliance.

After


Click photos to enlarge

Parts/Labour
Quantity

779

h10

NO TEST

RESOLVED
Non-critical defect

Added: 31st May 2026 9:13AM

ID: 446982 [↗](#)


Last Verified: 31st May 2026 9:13AM

Description:

Missing hinge screws were identified across four hinges, affecting the secure fixing of the door.

Resolution:

Installed replacement 50mm screws to all affected hinges, restoring secure fixing and correct door support.

After


Click photos to enlarge

Parts/Labour
Quantity

780

h15

NO TEST

RESOLVED
Non-critical defect

Added: 31st May 2026 9:15AM

ID: 446983 [↗](#)


Last Verified: 31st May 2026 9:16AM

Description:

The existing hinge screws were inadequate and not providing sufficient fixing strength to securely support the door.

Resolution:

Replaced all screws in the five hinges with 50mm screws to improve fixing strength and ensure the door is securely supported.

After


Click photos to enlarge

Parts/Labour
Quantity

781

h16

NO TEST

RESOLVED
Non-critical defect

Added: 31st May 2026 9:19AM

ID: 446984 [↗](#)


Last Verified: 31st May 2026 9:20AM

Description:

A gap was identified on the lock side of the door, requiring sealing to maintain correct clearances and operation.

Resolution:

A suitable seal was installed to the lock side of the door, rectifying the gap and restoring compliance.

After


Click photos to enlarge

Parts/Labour
Quantity

782
h20

NO TEST

RESOLVED Non-critical defect
ID: 446985 [🔗](#)

Added: 31st May 2026 9:23AM
Last Verified: 31st May 2026 9:23AM

Description:

A chip was identified in the door surface.

Resolution:

The damaged area was patched and repaired.

After



Click photos to enlarge

Parts/Labour

Quantity

Sign Off

Maintenance has been carried out in accordance with Building Fire Safety Regulation 2008 and the Queensland Development Code MP 6.1.

Completed By

Technician	Date/Time	Accreditations	Signature
------------	-----------	----------------	-----------

Jonathon Peterson	15th December 2025	QBCC No.15456821	
-------------------	--------------------	---------------------	--



Company Accreditations:

QBCC: 745564

Electrical Licence: 79673