MOLD BUSTERS®
DECONTAMINATION EXPERTS | EST. 2005



INDOOR ENVIRONMENTAL ASSESSMENT

Report Prepared for: [client name removed]

Address of the Inspected Property: **31 Ross St E, Smiths Falls, ON K7A 4V7, Canada**

Inspected by:



Luka Markovic, MSC ME, CMI
Indoor Environmental Inspector

Date: September 3, 2026

Created by:



Stefan Ivkovic
Administrative Client Support

Date: September 8, 2026

Reviewed by



Goran Petkoski
Administrative Client Support

Date: September 8, 2026

www.bustmold.com

TABLE OF CONTENTS

01

COMPANY PROFILE

02

EQUIPMENT

03

VISUAL & DIAGNOSTIC RESULTS

04

PHOTOGRAPHIC EVIDENCE

05

CONCLUSION AND RECOMMENDATION

⚠ Disclaimer

The results and interpretation of our inspection and sampling procedures are based on conditions present at the time of the assessment. All efforts were made to ensure accuracy in the collection, and observation of relevant data within the inspected area(s). Unless otherwise stated, the assessment is non-invasive in nature, and inaccessible areas (i.e., behind wall cavities, under sub-floor materials, etc.) may contain concerns not presented in this report due to the restrictions and limitations of the assessment provided. The information and recommendations presented in this report are based on data available at the time of the inspection. Any recommendations made in this report are made, in good conscience and in accordance with the following guidelines:

- Residential Mold Removal Guidelines, 1st Edition, Mold Busters, 2019;
- S520 Standard and Reference Guide for Professional Mold Remediation, IICRC, 2015;
- Mould Guidelines for the Canadian Construction Industry, Canadian Construction Association, 2004;
- ANSI/ASHRAE 62.2-2010, Ventilation for Acceptable Indoor Air Quality in Low-Rise Residential Buildings, American Society of Heating, Refrigeration, and Air-Conditioning Engineers, 2010

Health Canada considers indoor mould growth to be a significant health hazard. The level of concern depends on the extent of mould, how long it has been present and the sensitivity and overall health of the residents. Some people are more susceptible than others. Health Canada recommends controlling dampness indoors and cleaning up any mould regardless of the type of mould present.

01

COMPANY PROFILE

Mold Busters: Decontamination Experts

Mold Busters is a Canadian-owned and operated mold inspection, testing, and removal company that has been established since 2005.

Based in Ottawa, Mold Busters have been servicing residential, commercial, and government clients, promptly dealing with their indoor environmental concerns with professionalism and precision. Their dedication to providing excellent service to their customers have allowed them to grow, opening locations across Ontario, Quebec and the Asia-Pacific.

MOLD BUSTERS SPECIALIZES IN THE FOLLOWING SERVICES:

- Visual & diagnostic mold assessments
- Mold testing
- Comprehensive reports

- Mold removal
- Remediation
- Disinfection

- Non-viable, and viable air quality testing

- Odor removal

- Asbestos testing

- Ventilation
- Duct cleaning
- Air exchanger installation

- Thermal imaging inspections

Mold Busters does not sub-contract any inspection or remediation work, unless otherwise stated. All Mold Busters inspectors are trained through the National Association of Mold Professionals, InterNACHI, IAQA, or the IICRC.

Please visit our website for more information: www.bustmold.com

02

EQUIPMENT

Mold Busters utilizes a variety of diagnostic and sampling equipment during the assessment. The type of equipment used for each assessment is determined by the technician conducting the inspection. All equipment is regularly calibrated to ensure accuracy in the results. Common diagnostic equipment utilized includes:

1. Precision Hygro-Thermometer - Extech RH490

This measures relative humidity, temperature, and dew point levels. As per ASHRAE guidelines, relative humidity levels above 65% are indicative of a potential for mold propagation.

2. Pinless Moisture Meter – Extech MO257

This non-invasive moisture meter measures the moisture content of a building material. Typically, the MC (moisture content) of wood & drywall should be below 16%.

3. FLIR One Pro

This is a thermal imaging camera attachment that assists in determining heat differentials, or thermal anomalies within building materials.

4. Particle Scan Pro - IQAir

This is an airborne laser particle counter which gives an instantaneous reading of solid particulates between

0.3µm and 5.0µm with a refresh rate of 0.025CFM.

5. Instant Swab Analysis

This is an instant swab analysis utilized to confirm or deny the presence of biological contaminants, such as bacteria, fungi (mold), etc., on a discolored surface area. This is a non-speciating diagnostic swab test.

6. Buck BioAire – Bioaerosol Sampling Pump B520 used with Air-O-Cell cassettes

This is a compact 5-20 LPM controlled flow sampling pump for bioaerosol sampling, which accommodates Air- O-Cell cassettes. This is utilized for air quality testing. All sampled cassettes are sent to an independent, government accredited laboratory that specializes in microbial analysis.

All technicians are equipped with the necessary PPE (Personal Protective Equipment), lighting, and accessibility tools required to perform most indoor assessments. Additional equipment or specialized diagnostics may be utilized on requested projects, as needed. The technician reserves the right to use any or none of the equipment listed or unlisted during the assessment process.

Although there have been many changes in the world due to COVID-19, our commitment to providing safe and effective services holds strong. As such, our highly trained and experienced staff are taking additional precautions to keep you safe during in-person appointments and remediation projects. To view all our Covid-19 Safety and Prevention Measures, please visit https://www.bustmold.com/covid-19/.

03

VISUAL & DIAGNOSTIC RESULTS

Objectives

Mold Busters conducted a visual and diagnostic inspection at 31 Ross St E, Smiths Falls, ON K7A 4V7, Canada, on September 3, 2026.

The objectives of the assessment were to:

1. Visually and/or diagnostically inspect areas of the property to identify any potential indoor environmental concerns;
2. Determine the source(s) and extent of these concerns, if present;
3. Establish an appropriate action plan and/or provide recommendations for improvement, if necessary.

Diagnostic Results

The technician made the following diagnostic observations during his inspection of the property 31 Ross St E, Smiths Falls, ON K7A 4V7, Canada, ON:

LOCATION:Attic

GENERAL OBSERVATIONS:

• The client initiated contact with Mold Busters for an inspection of the attic due to concerns raised during a prior home inspection regarding potential mold issues.

• During the inspection, visible discoloration was noted in the attic; however, there were no apparent structural issues associated with this discoloration.

• The inspection did not reveal any obvious rot or structural damage within the attic space.

• It was observed that only one layer of fiber batt insulation was present in the attic. While this may be sufficient for some climates, additional insulation could improve energy efficiency and comfort levels within the home.

• Some soffits were found to be blocked by insulation during the inspection. Blocked soffits can impede proper ventilation in attics and potentially lead to moisture buildup if not addressed.

• Thermal imaging revealed multiple anomalies on the ceiling indicative of disturbed and unevenly distributed insulation. Such conditions can result in thermal inefficiencies and should be corrected to ensure optimal energy performance.

• Anomalies detected at the attic hatch through thermal imaging suggest similar issues with insulation distribution or air sealing around this area which may contribute to heat loss or gain depending on seasonal conditions.

• No moisture-related problems were identified during this assessment which reduces immediate concern for mold growth since moisture is a primary catalyst for such development. • A popcorn ceiling material suspected of containing asbestos was present within certain areas inspected. Asbestos-containing materials require careful handling due to health risks when disturbed; thus professional evaluation is advised before any renovation work begins involving these surfaces.

• Throughout various sections of property inspected, several exposed holes were noted in materials suspected of containing asbestos further necessitating cautionary measures until confirmed testing results are obtained regarding their composition status ensuring safety.


04

PHOTOGRAPHIC EVIDENCE

Photographs taken by the technician during the assessment

Location: 31 Ross St E, Smiths Falls, ON K7A 4V7, Canada

Date: September 3, 2026

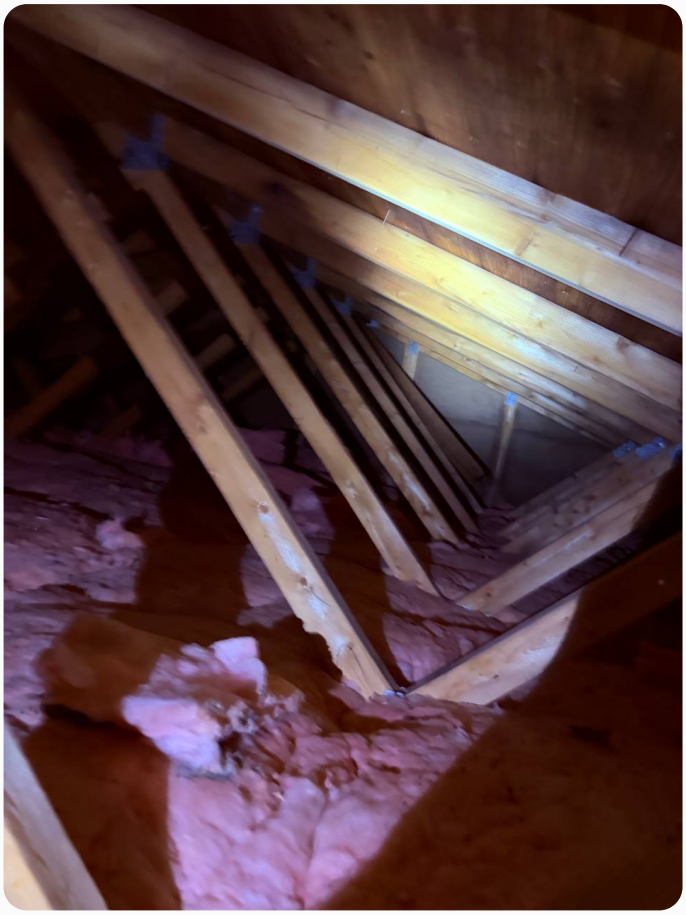

Attic discoloration and insulation




Attic discoloration and insulation




Attic discoloration and insulation




Attic discoloration and insulation

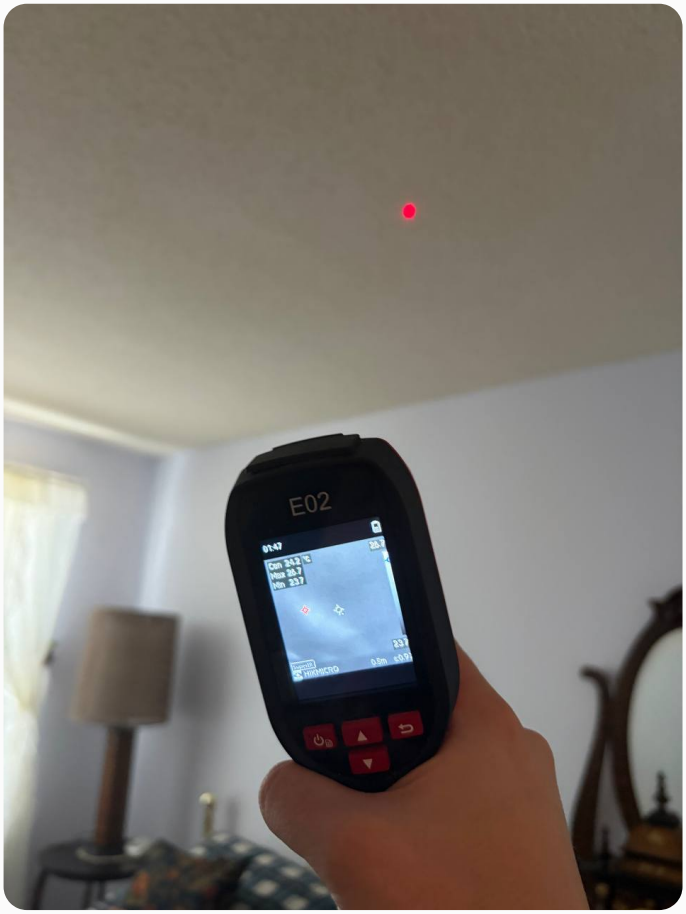

Thermal anomalies throughout the property

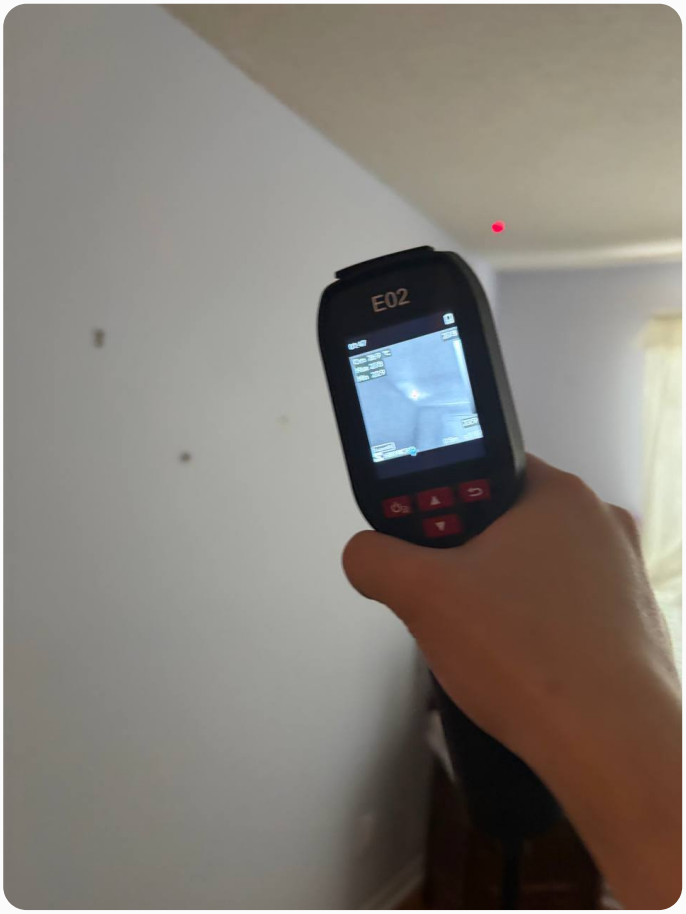


Thermal anomalies throughout the property

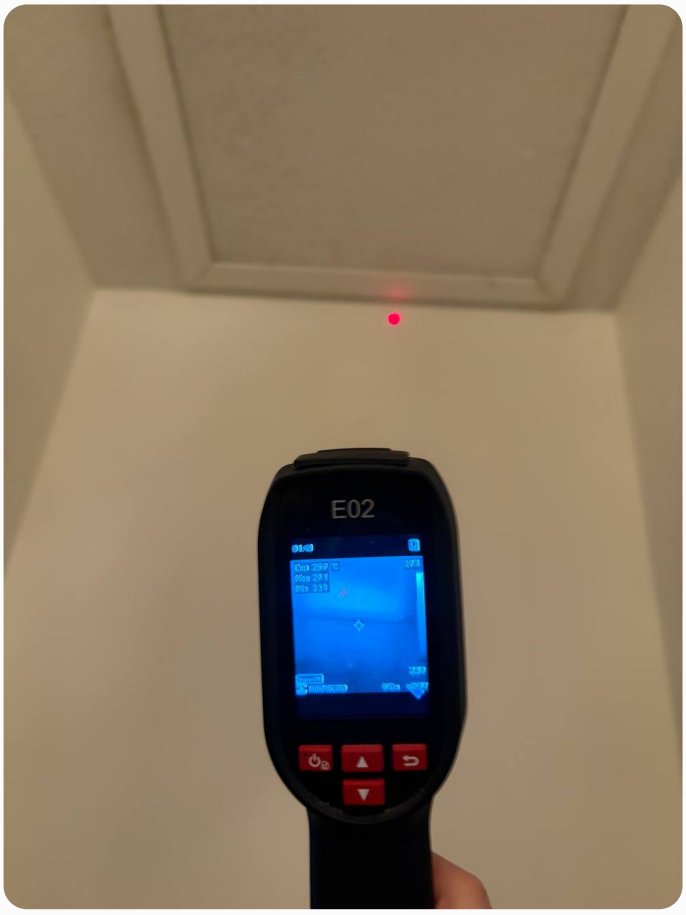



Thermal anomalies throughout the property


Thermal anomalies throughout the property

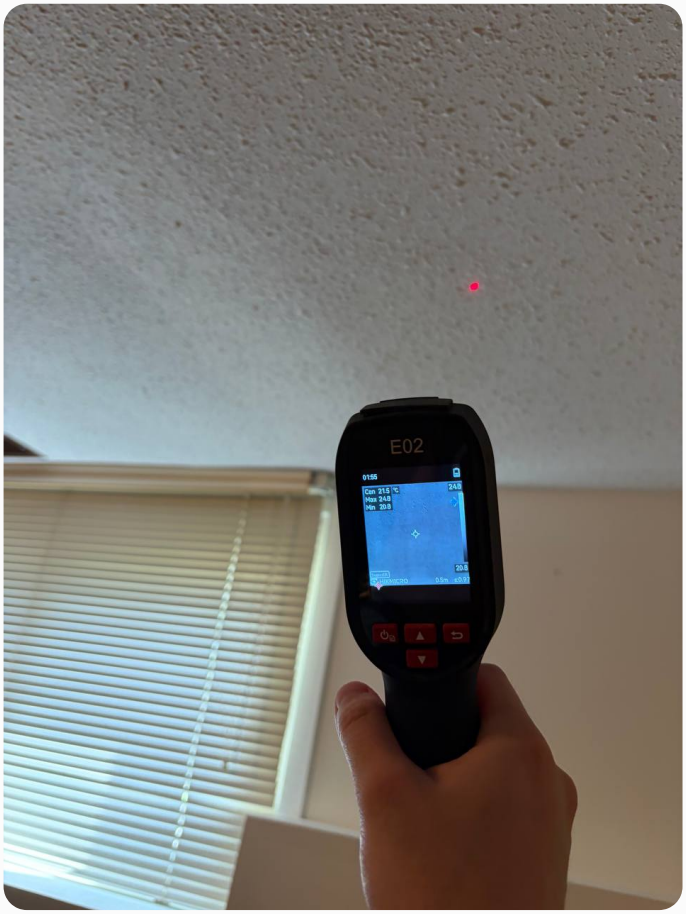


Thermal anomalies throughout the property



Humidity within standard

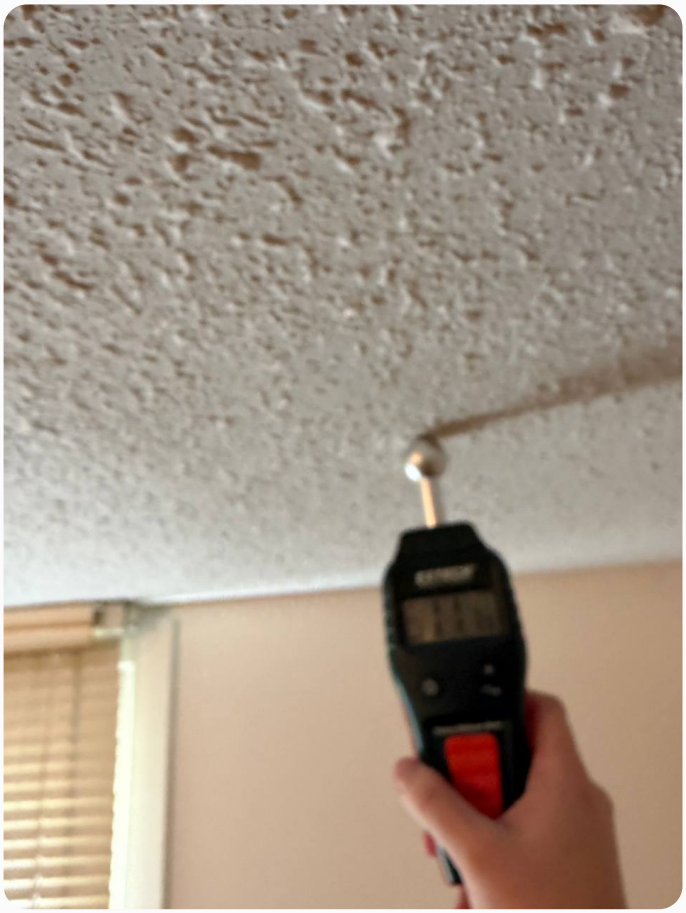

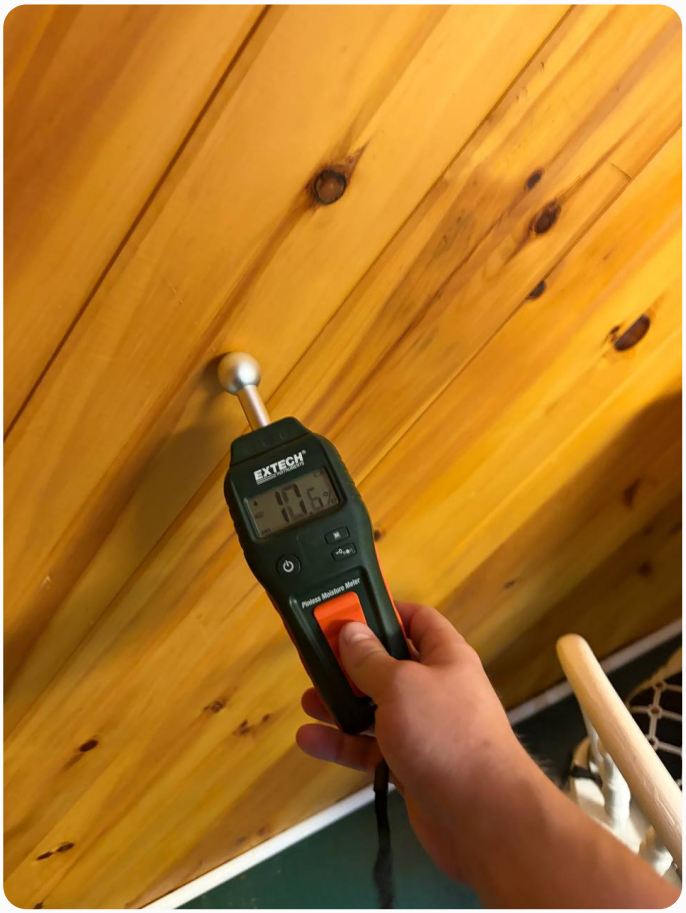

No moisture issues detected

No moisture issues detected



No moisture issues detected



Exposed holes on the popcorn ceiling



Exposed holes on the popcorn ceiling

05

CONCLUSIONS & RECOMMENDATIONS

The following recommendations are based on the technician's visual and diagnostic observations at the time of the inspection within the property at 31 Ross St E, Smiths Falls, ON K7A 4V7, Canada.

• Professional mold remediation is recommended to be performed in accordance with Residential Mold Removal Guidelines. This includes the removal of any non-structural building material that is contaminated with mold, active moisture, or rot. All residual surface areas will be thoroughly disinfected using HEPA vacuums and anti-fungal treatments. This work should be performed by trained indoor environmental professionals and be verified upon completion to ensure clearance criteria have been met before any reconstruction begins.

• Ensure that the insulation in the attic meets current standards (R-50) and is evenly distributed throughout the space to prevent heat loss and potential condensation issues which could contribute to mold growth.

• Unblock soffits to improve airflow within the attic space, thereby reducing humidity levels that can lead to mold development. Additionally, install baffles as needed for added ventilation efficiency.

• Address exposed holes on popcorn ceilings throughout the property by containing them properly until testing confirms if they are asbestos containing or not.

Please note that every individual will react differently to mold. The severity of the reaction will depend on factors such as the individual's immune system, exposure threshold, type of mold species present in the space, and the duration of exposure. Health Canada considers indoor mold growth to be a "**significant health hazard**" and recommends that all mold, regardless of the species, be cleaned and that the underlying water or humidity problem be dealt with quickly to prevent potential health issues. (Source: *Addressing moisture and mould in your home; Canada.ca*)

If you have any questions regarding this report and the findings therein, please contact **Mold Busters** at 1-877-566-6653.

As a local business, we really value our client's feedback. This helps us to improve as a team, and gives other, new clients the opportunity to see the value in hiring our company.

We kindly ask you to write an honest review of our services by visiting the link below:

Service Feedback and Insights Survey



Luka Markovic, MSC ME, CMI

Indoor Environmental Inspector

06

APPENDIX - KNOWLEDGE BASE



Everything You Need to Know About Mold



The Mold Library



Residential Mold Removal Guidelines



Asbestos in Canada: A Homeowner's Handbook



The Ultimate Mold Prevention Guide



Indoor Air Quality



Mold Videos

Copyright © 2026 Bust Mold Inc. All rights reserved.