

HONDA Service Bulletin



Applies To: 1997-99 CR-V - All with Accessory Cargo Cover

January 18, 2000

Accessory Cargo Cover End Caps Come Off

SYMPTOM

The end caps on the accessory cargo cover flexible rods come off or are missing.

PROBABLE CAUSE

The adhesive that holds the end caps has failed.

CORRECTIVE ACTION

Replace all four end caps.

PARTS INFORMATION

Rod End Caps:

P/N 08U35-S10-100R2, H/C 6380471

REQUIRED MATERIALS

3M Quick-Fix Adhesive: 3M P/N 051135-08155

3M General Purpose Adhesive Cleaner: 3M P/N 051135-08984

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Operation Number: 018108 Flat Rate Time: 0.3 hour

Failed Part: P/N 08U35-S10-100R2

H/C 6380471


Defect Code: 025 Contention Code: A02 Template ID: 00-002A

Skill Level: Repair Technician

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

REPAIR PROCEDURE

- 1. Remove the end cap from the flexible rod if the end cap is still there, and remove any remaining adhesive from the rod end with adhesive cleaner.
- 2. Apply a small amount of adhesive around the outside of the rod end.

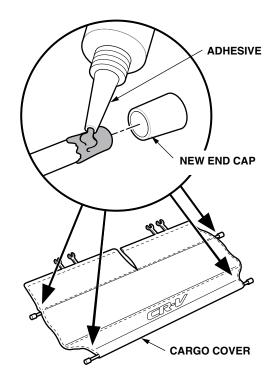

- 3. Install the new end cap onto the rod end.
- 4. Repeat steps 1 thru 3 for the other three end caps.

1 of 1

