


How To Control a Stepper Motor with A4988 Driver and Arduino



by Dejan • 125 Comments • Arduino Tutorials

In this Arduino Tutorial we will learn how to control a [Stepper Motor](#) using the A4988 Stepper Driver. You can watch the following video or read the written tutorial below.

There's also another more [comprehensive tutorial on how to control stepper motors](#) with Arduino and the A4988, DRV8825 and the TMC2208 stepper motor driver.

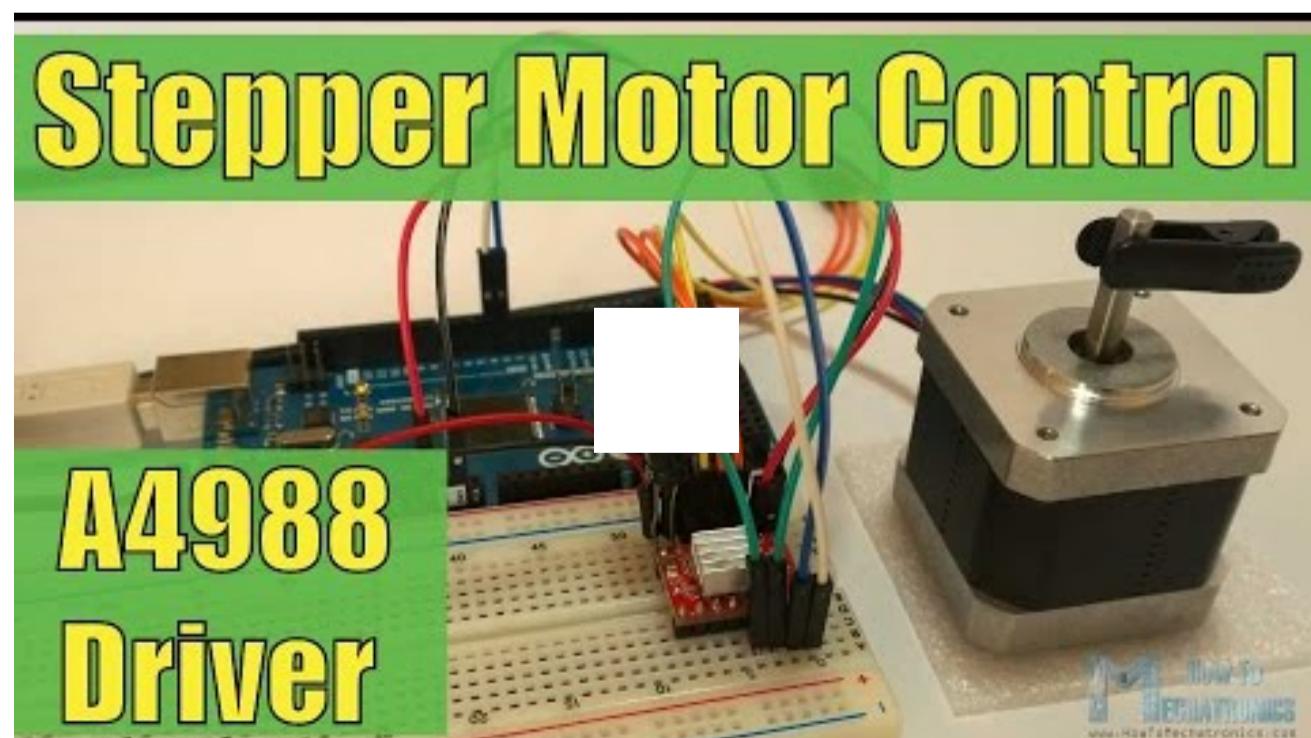

Overview



Hey I'm Dejan, a maker, a techie and a mechatronics engineer. I love making electronics and robotics projects for you to learn and make something cool on your own.

Don't forget to check my 560K+ subs [YouTube Channel](#).

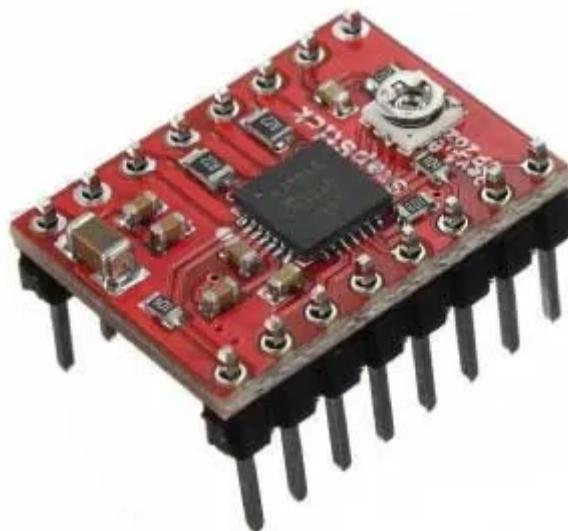


Table of Contents

- [1. Overview](#)
- [2. A4988 Stepper Driver Pinout](#)
- [3. Components needed for this Arduino Tutorial](#)
- [4. Circuit Schematics](#)
- [5. A4988 Current Limiting](#)



MOTORS WHICH HAS BUILT IN TRANSISTOR FOR EASY OPERATION. THIS MEANS THAT we can control the stepper motor with just 2 pins from our controller, or one for controlling the rotation direction and the other for controlling the steps.



The Driver provides five different step resolutions: full-step, half-step, quarter-step, eighth-step and sixteenth-step. Also, it has a potentiometer for adjusting the current output, over-temperature thermal shutdown and crossover-current protection.

Its logic voltage is from 3 to 5.5 V and the maximum current per phase is 2A if good addition cooling is provided or 1A continuous current per phase without heat sink or cooling.

Minimum Logic Voltage:	3V
Maximum Logic Voltage:	5.5 V
Continuous current per phase:	1 A
Maximum current per phase:	2 A
Minimum Operating Voltage:	8 V
Maximum Operating Voltage:	35 V

PCBWay Custom PCB Service

Only \$5

for 10 boards

Rogers, HDI, aluminum and rigid-flex PCB are available now

Production time 24 hours


[Order Now](#)

FEATURED PROJECTS



A4988 Stepper Driver Pinout

Now let's close look at the pinout of the driver and hook it up with the stepper motor and the controller. So we will start with the 2 pins on the button right side for powering the driver, the VDD and Ground pins that we need to connect them to a power supply of 3 to 5.5 V and in our case that will be our controller, the Arduino Board which will provide 5 V. The following 4 pins are for connecting the motor. The 1A and 1B pins will be connected to one coil of the motor and the 2A and 2B pins to the other coil of the motor. For powering the motor we use the next 2 pins, Ground and VMOT that we need to connect them to Power Supply from 8 to 35 V and also we need to use decoupling capacitor with at least 47 μ F for protecting the driver board from voltage spikes.

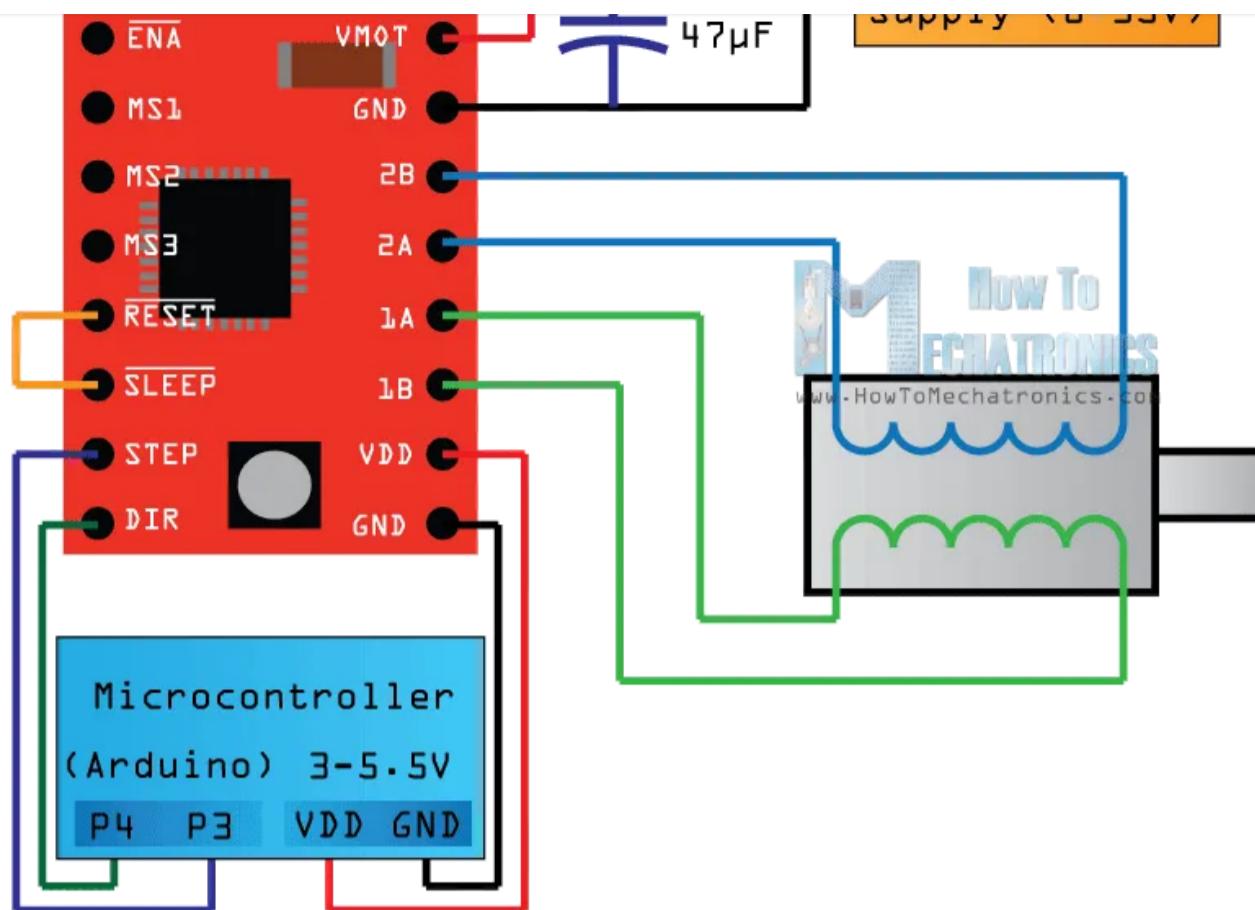

The next two 2 pins, Step and Direction are the pins that we actually use for controlling the motor movements. The Direction pin controls the rotation direction of the motor and we need to connect it to one of the digital pins on our microcontroller, or in our case I will connect it to the pin number 4 of my Arduino Board.

With the Step pin we control the microsteps of the motor and with each pulse sent to this pin the motor moves one step. So that means that we don't need any complex programming, phase sequence tables, frequency control lines and so on, because the built-in translator of the A4988 Driver takes care of everything. Here we also need to mention that these 2 pins are not pulled to any voltage internally, so we should not leave them floating in our program.

Next is the SLEEP Pin and a logic low puts the board in sleep mode for minimizing power consumption when the motor is not in use.

Next, the RESET pin sets the translator to a predefined Home state. This Home state or Home Microstep Position can be seen from these Figures from the A4988 Datasheet. So these are the initial positions from where the motor starts and they are different depending on the microstep resolution. If the input state to this pin is a logic low all the STEP inputs will be ignored. The Reset pin is a floating pin so if we don't have intention of controlling it with in our program we need to connect it to the SLEEP pin in order to bring it high and enable the board.

LOW	LOW	LOW	Full Step
HIGH	LOW	LOW	Half Step
LOW	HIGH	LOW	Quarter Step
HIGH	HIGH	LOW	Eighth step
HIGH	HIGH	HIGH	Sixteenth Step

The next 3 pins (MS1, MS2 and MS3) are for selecting one of the five step resolutions according to the above truth table. These pins have internal pull-down resistors so if we leave them disconnected, the board will operate in full step mode.

The last one, the ENABLE pin is used for turning on or off the FET outputs. So a logic high will keep the outputs disabled.

Components needed for this Arduino Tutorial


You can get the components from any of the sites below:

- Stepper Motor (NEMA17)..... [Amazon](#) / [Banggood](#) / [AliExpress](#)
- A4988 Stepper Driver..... [Amazon](#) / [Banggood](#) / [AliExpress](#)
- 12V 2A Adapter..... [Amazon](#) / [Banggood](#) / [AliExpress](#)
- Power Jack..... [Amazon](#) / [Banggood](#) / [AliExpress](#)
- Arduino Board [Amazon](#) / [Banggood](#) / [AliExpress](#)
- Breadboard and Jump Wires [Amazon](#) / [Banggood](#) / [AliExpress](#)

Disclosure: These are affiliate links. As an Amazon Associate I earn from qualifying purchases.


Circuit Schematics

Here's the complete circuit schematics. I will use the drive in Full Step Mode so I will leave the 3 MS pins disconnected and just connect the Direction and the Step pins of the drive to the pins number 3 and 4 on the Arduino Board and as well the Ground and the 5 V pins for powering the board. Also I will use a 100µF capacitor for decoupling and 12V, 1.5A adapter for powering the motor. I will use a NEMA 17 bipolar Stepper Motor and its wires A and C will be connected to the pins 1A and 1B and the B and D wires to the 2A and 2B pins.

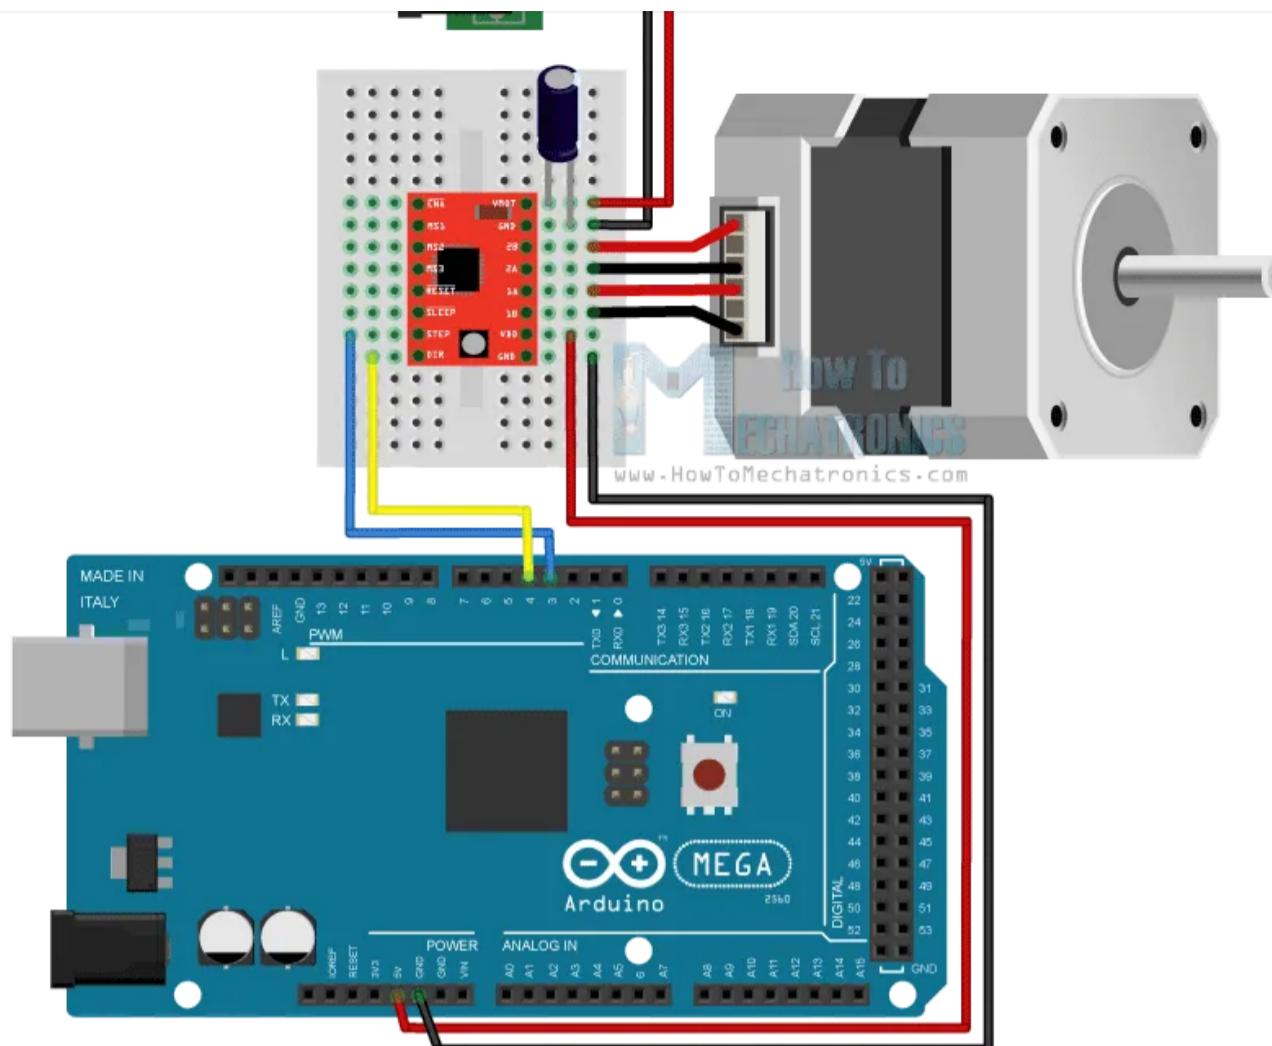


A4988 Current Limiting


Before we connect the motor we should adjust the current limiting of the driver so that we are sure that the current is within the current limits of the motor. We can do that by adjusting the reference voltage using the potentiometer on the board and considering this equation:

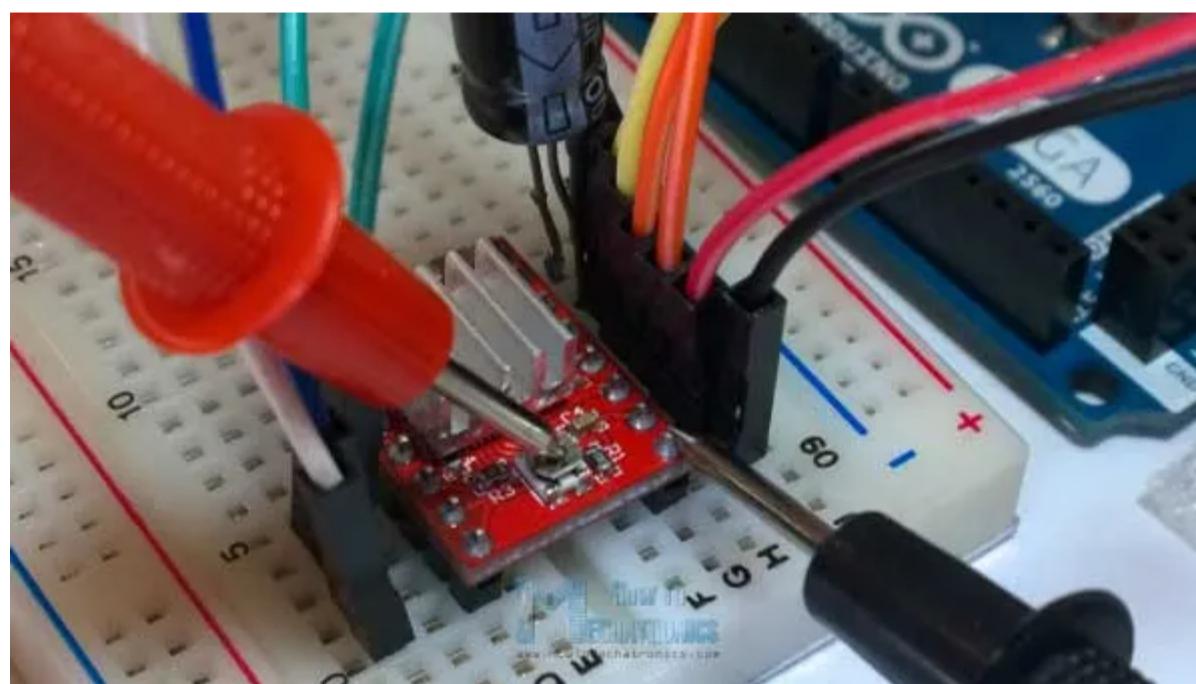

However this equation is not always correct as there are different manufacturers of the A4988 driver board. Here's a demonstration of my case: I adjusted the potentiometer and measured 0.6V reference voltage. So the current limiting should be that value of 0.6×2 , equal 1.2 A.

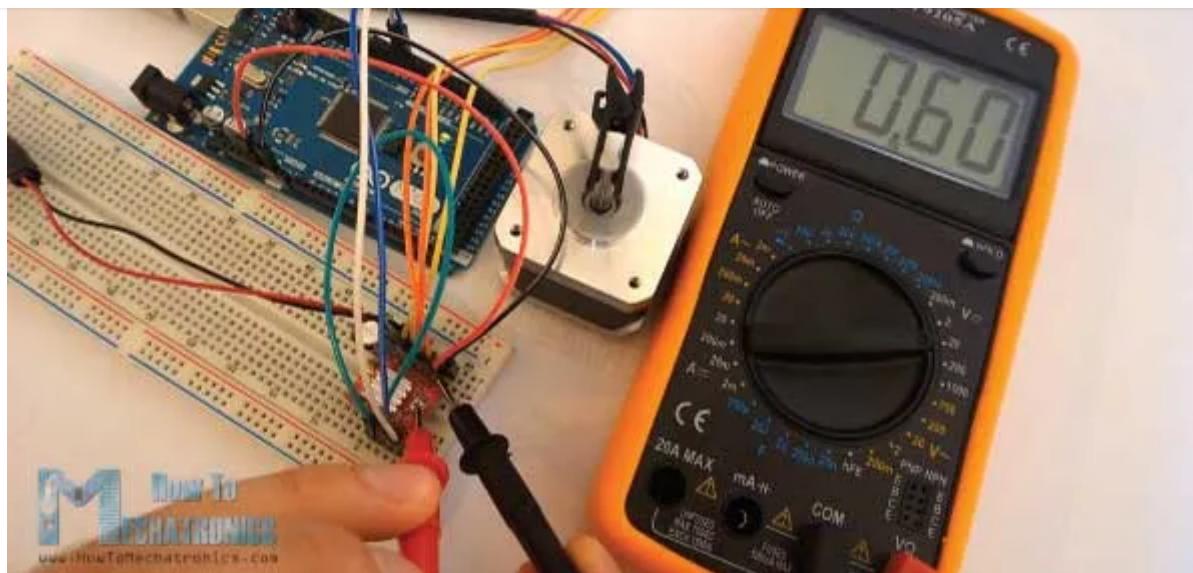

Now because I am using the Driver in Full Step Mode and according to the A4988 Datasheet in this mode the winding current could reach only 70% of the current limit, the $1.2A \times 0.7$ would equal 0.84A. In order to check this I uploaded a simple code that sends continuous logic high to the Step pin (so that we can better notice the current) and connected my meter in series with one winding of the motor and powered it up. What I got was 0.5A which means that the equation wasn't correct for my case.

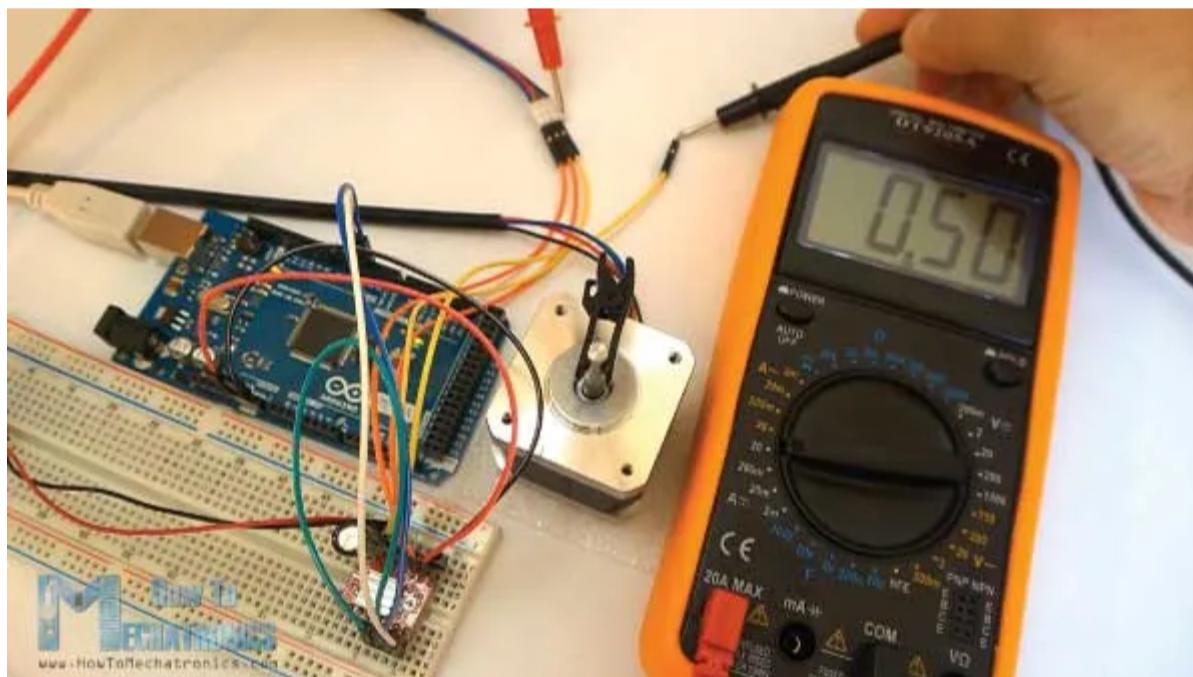

Arduino and A4988 Code

Here's an example code. First we have to define the Step and Direction pins. In our case they are the pins number 3 and 4 on the Arduino Board and they are named stepPin and dirPin and the setup section we have to define them as an outputs.

```
/*
 *      Simple Stepper Motor Control Example Code
 *
 * by Dejan Nedelkovski, www.HowToMechatronics.com
 *
 */
// defines pins numbers
const int stepPin = 3;
const int dirPin = 4;

void setup() {
    // Sets the two pins as Outputs
    pinMode(stepPin,OUTPUT);
    pinMode(dirPin,OUTPUT);
}
void loop() {
    digitalWrite(dirPin,HIGH); // Enables the motor to move in a particular direc-
```



```

delayMicroseconds(500);
digitalWrite(stepPin,LOW);
delayMicroseconds(500);
}
delay(1000); // One second delay

digitalWrite(dirPin,LOW); //Changes the rotations direction
// Makes 400 pulses for making two full cycle rotation
for(int x = 0; x < 400; x++) {
  digitalWrite(stepPin,HIGH);
  delayMicroseconds(500);
  digitalWrite(stepPin,LOW);
  delayMicroseconds(500);
}
delay(1000);
}

```

In the loop section first we will set the Direction pin on high state that will enable the motor to move in a particular direction. Now using this for loop we will make the motor make one full cycle rotation. As the driver is set on Full Step Mode and our Stepper Motor has 1.8 degrees step angle, or 200 steps, we need to send 200 pulses into the Step Pin to make one full cycle rotation. So the for loop will have 200 iterations and each time it will set the Step pin on high and then low state for making the pulses. Between each digitalWrite we need add some delay from which the speed of the motor will depend.

After this full cycle rotation we will make one second delay, then change the direction of rotation by setting the dirPin on a low state and now make 2 full cycle rotations with this loop of 400 iterations. At the end there is one more second delay. Now let's upload the code and see how it will work.

I made one more example for this tutorial, where I control the speed of the motor using a potentiometer. Here's the source code of that example:

```

/*
 *      Simple Stepper Motor Control Example Code
 *
 *  by Dejan Nedelkovski, www.HowToMechatronics.com
 *
 */

// Defines pins numbers
const int stepPin = 3;
const int dirPin = 4;

int customDelay,customDelayMapped; // Defines variables

void setup() {
  // Sets the two pins as Outputs
  pinMode(stepPin,OUTPUT);
  pinMode(dirPin,OUTPUT);

  digitalWrite(dirPin,HIGH); //Enables the motor to move in a particular direction
}
void loop() {

  customDelayMapped = speedUp(); // Gets custom delay values from the custom slider
  // Makes pulses with custom delay, depending on the Potentiometer, from which
  digitalWrite(stepPin, HIGH);
  delayMicroseconds(customDelayMapped);
  digitalWrite(stepPin, LOW);
  delayMicroseconds(customDelayMapped);
}

```



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS



```
int newCustom = map(customDelay, 0, 1023, 300,4000); // Converts the read value  
return newCustom;  
}
```

Arduino Tutorials

[How a Stepper Motor Works](#)[What is Schmitt Trigger | How It Works](#)

125 thoughts on “How To Control a Stepper Motor with A4988 Driver and Arduino”

**Laz**

March 13, 2021 at 8:22 pm

so i can that Pins MS1 – MS3 connect to the Arduino output pins?
for example P7-P9, no need pulldown resistor?
thnks

[Reply](#)**Dejan**

March 14, 2021 at 9:58 pm

The MS pins have internal pull-down resistors.

[Reply](#)**Caden**

February 17, 2021 at 4:47 pm

Hi, I connected everything correctly and uploaded the right code,
but nothing is happening. Any ideas of what might be wrong? I am
using an 11v volt external power supply and a 100uf decoupling
capacitor.



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS

**Caden**

February 18, 2021 at 4:02 pm

Uptade: So now the motor is making this weird buzzing noise and vibrating a tiny bit but not moving like there's not enough voltage. What voltage is your power supply? Would 12v be sufficient?

Thanks

[Reply](#)

Stefan Scott

December 9, 2020 at 3:48 am

Hey Dejan,

Just wanted to say thanks for all the great projects and content you make. I'm a high school instructor and have been teaching robotics for a couple of years (Computer Science is my main area). Anyway, I've got some of my 2nd and 3rd level students creating some of your projects and they've been really well received so far (Strain Wave Generator, Color Candy Sorter).

Really awesome work!

[Reply](#)

Dejan

December 10, 2020 at 11:08 pm

Hey, I'm so glad to hear that. Thanks!

[Reply](#)

Loren

May 25, 2020 at 6:24 am



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS



I do have a question:

I am hoping to trigger my stepper on linear actuator to turn on, move one direction, then reverse and come back to original start location. I want to use a micro switch to trigger the process.

Is this done all with code? Will I need to configure pins different from what this tutorial shows?

Thanks again!!

[Reply](#)

Dejan

May 29, 2020 at 11:20 am

Well I guess you would need few "if" statements to tell the stepper what to do when the micro switch is triggered. The pins configuration for the driver will be all the same, you just need to define the micro switch trigger as digital input and use the "if" statements to tell the stepper what to do.

[Reply](#)

Jay Edgerton

March 27, 2020 at 9:39 pm

I've been working on your 4988 board/arduino system for controlling a stepper motor. I have the arduino/4988 board and motor connected as per your drawing. My problem is the code you published won't load into the arduino. It hangs up at the last line:
delayMicroseconds(500);

It says that a" ; is expected before Microseconds."

What is the cure for this? I've tried everything I can think of with no luck.

Thanks, I find your projects well written.

[Reply](#)



April 1, 2020 at 7:10 am

Hey, I've just checked the codes and they work fine. It seems like your error comes from missing the ";" character at the end of some line.

[Reply](#)

Sweta

February 26, 2020 at 12:36 pm

Hello Dejan,

I am trying to run three stepper motor with Arduino mega 2560. my goal is to run all three motors together but the number of steps would be different. I've tried using Adafruit Motor Shield V2, A4988 driver and also by directly connecting to Arduino, but so far all motors are not running simultaneously and with shield, they run together but just one step at a time and it takes a long time to reach my desired steps. can you just share how can I solve this?

My stepper Motor: Saia UCD10N28R, Step Angle 7.5, Rated Voltage 6V, Coil resistance 24Ohm, Steps/Rev 48

Aim: max 1200Steps of stepper motors time needed should be less than 5 sec (all three together)

[Reply](#)

Dejan

February 28, 2020 at 10:59 am

Hey, I would suggest to try the AccelStepper library, it has really good functions to control multiple stepper motors. You can check some of my other tutorial/ projects where I used this library, for example the camera slider, the wire bending machine, etc.

[Reply](#)



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS



October 20, 2019 at 2:56 pm

Great theoretical and practical explanations. Easy to understand and follow. You would be a good lecturer. Best

[Reply](#)**Dejan**

October 20, 2019 at 7:26 pm

Thanks, I'm glad you found it useful!

[Reply](#)**Rob**

July 26, 2019 at 2:57 pm

To add (in case you find it useful for a future project). I've just implemented a dual current limit which works really well. This allows you to run a high current for moving, (so you can accelerate a mass quickly etc) and a low current for braking.

I am using this on a linear stage in a small robotics project, without the dual current limit I would be forced to run at a current limit set by the thermal performance of the chip/heatsink. There are many ways to implement the switchable limit, but for many projects having the the high peak current and a low hold current is thermally/performance beneficial.

Thanks again

Rob,

[Reply](#)**Rob**

July 23, 2019 at 3:31 pm



question – does the motor brake when you are not toggling the step input? Ie, is current still flowing through the windings?

If this is the case (i think it must be) does the sleep input pin allow you to release the motor?

Cheers!

[Reply](#)

Dejan

July 23, 2019 at 11:17 pm

Hey, thanks! Yes, that's right, the current is still flowing through the windings when the motor is not moving, it holds its position. And yes, the sleep or enable pins can be used for releasing the motor.

[Reply](#)

Rob

July 26, 2019 at 2:50 pm

Great, thank you Dejan!

[Reply](#)

Lucas Cohen

April 15, 2019 at 11:50 pm

Hey, great video! Could I power this with enough AA batteries in order to create 12V? If I use batteries do I still need a capacitor? And also, could I add a resistance and create the 5V for the boards with these same batteries?
Thanks!

[Reply](#)



April 18, 2019 at 5:58 am

Hey, no you cannot really power NEMA 17 stepper with AA batteries. This stepper can draw up to 1A of current. You could use Li-ion 18650 batteries or Li-PO batteries.

[Reply](#)

Nick

January 12, 2019 at 6:41 pm

Very useful for my Picaxe projects. You explain in a clear, concise manner. Many thanks for the effort of producing this how to guide.

[Reply](#)

Dejan

January 12, 2019 at 11:18 pm

Thanks!

[Reply](#)

Adam Maassingale

December 17, 2018 at 1:56 am

Hi.

Great tutorial! I followed and have everything working. Would you mind explaining how to convert this into 1/16 microsteps using the MS Pins? What code needs to be added? Thank you for your help!

[Reply](#)

Dejan

December 19, 2018 at 2:04 pm



to connect HIGH or 5V to the three MS pins, just like seen on the MS truth table in the article.

[Reply](#)**Pete Kohler**

October 7, 2018 at 12:16 pm

Hello Dejan,

Trying to control a stepper motor with a manual pulse generator (hand wheel type). Is this possible with the A4988? If so, any help in this direction would be greatly appreciated. Thanks.

[Reply](#)**Dejan**

October 8, 2018 at 9:10 pm

Well as you have probably noticed the A4988 has a STEP pins, which if triggered from Low to High it moves the motor a step. So if you make such a generator that generates that type of pulses you should be able to manually control the steps.

[Reply](#)**Carlo Malalad**

August 26, 2018 at 10:59 am

Hello sir. How about if the stepper motor is connected to a belt and the positons (steps and direction) are controlled using push buttons? Is it possible? If it is possible, can you give me some pointers or things to remember? I am developing an automated arbiter of the game of the generals (if you are familiar with this game) and an stepper motor is needed to position the robotic arm in 8 rows of the board.

[Reply](#)

**Dejan**

September 1, 2018 at 7:56 pm

It's possible for sure. You just assign what the stepper should do when the particular button is pressed. You can see the commands from the explained code above (change direction, make the stepper move one step, multiple steps etc), so you just need to implement them appropriately when a particular button is pressed.

[Reply](#)**Curtis V Harrison**

August 18, 2018 at 1:59 am

Excellent Tutorial !!! I do have a question though. For my application, I have the motor go back and forth about 1/4 revolution and I repeat this 5000 times and then I want it to stop.

I can stop it in the code, but the motor is locked in position and keeps getting hotter the longer it is plugged in. Is there a way in code to release or disengage the motor so that it doesn't keep getting hotter?

[Reply](#)**Dejan Nedelkovski**

August 19, 2018 at 2:14 pm

In order the motor to stay in play you need to keep the motor active all the time. You could try to lower the current draw of the motor by adjusting the potentiometer on the A4988 driver, and in that way lower the motor heat.

[Reply](#)**Hristo**

August 16, 2018 at 10:46 am



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS



My name is Hristo, from Plovdiv, Bulgaria. My experience in mechatronics is too short, but this matter is very interesting for me.

I have watched your video "How To Control a Stepper Motor with A4988 Driver and Arduino" and made successful attempt with one stepper motor. Your program code is so simple and understandable. Can I rotate 2 or 3 steppers "simultaneously" with any similar way?

Best wishes from Hristo

[Reply](#)**Dejan Nedelkovski**

August 19, 2018 at 2:18 pm

Check my DIY Camera Slider project where I use the AccelStepper library for controlling 3 steppers simultaneously.

[Reply](#)**Benjamin Gerhart**

July 11, 2018 at 6:14 am

The information you provide is excellent, not only here, but all the projects you publish. I am looking at driving 4 separate stepper motors with an Arduino mega, however the LCD uses all of the available PWM pins, do the STEP and DIR pins have to be PWM pins, or can I use any of the digital pins (like pins 22-53)? I noticed all the stepper libraries I have found need to use PWM pins to work.

Thanks for the great work!

[Reply](#)**Dejan Nedelkovski**

July 16, 2018 at 8:53 am



be connected to PWM pins in order to be able to control the motor with the A4988 driver. However, there might be some libraries that use them for controlling the stepper.

[Reply](#)

Max

February 20, 2018 at 2:41 pm

love.... Thanks alot homie.

[Reply](#)

Josef

November 7, 2017 at 8:42 am

Great guide! I am about to build my own CNC 2D plotter using DVD drives motors + A4988. Do I have to make some preset of X and Y axis position? I am afraid about damaging stepper motors. Could it happen that motor wants to move in X-axis but it is already at the end of range = damaged motor? Do I need end stops to prevent this? Thanks!

[Reply](#)

Dejan Nedelkovski

November 10, 2017 at 10:09 pm

End stops are definitely recommended have for such an application.

[Reply](#)

Alex

October 12, 2017 at 2:01 pm



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS



you cut the wire then insert the positive and negative ends? All I can see in the pictures/video is two red and black wires but never how they are connected to the power supplier. I purchased the same power supplier that you provided through the link above.

[Reply](#)**Dejan Nedelkovski**

October 22, 2017 at 7:46 am

Yes, that's how I did it, cut the wires and soldered two jumper wires to it for easier connection to the breadboard. However don't have to do that, just get a 12V Adapter Jack. I should've added a link to it earlier, but updated it now. By the way, thanks for the support!

[Reply](#)**Stelios**

July 17, 2017 at 3:07 pm

Hello and nice work! I try this tut but with little differences(32 μ F cap and 9V battery). I upload the code and i can hear the steps (500 microseconds) but the motor dont turn.the circuit is correct. Is it possible that the 4 wires of the motor are not like your schematic?

[Reply](#)**Dejan Nedelkovski**

July 23, 2017 at 2:05 pm

Your battery might not have enough power to drive the motor.

[Reply](#)



June 5, 2017 at 8:48 am

Hello Dejan

I want to do this work by these device. can you tell me the datasheet of stepper motor (or model that used to rotate 2 Kg plate that work in this project)and voltage and amper of adapter?? because I am beginner. Thanks alot

[Reply](#)

Bdta

May 27, 2017 at 10:00 pm

What happens if i put 9V instead of 12V?

[Reply](#)

Dejan Nedelkovski

June 1, 2017 at 9:36 pm

It should work as long the power supply has enough power. It's already stated that the operating voltage of the driver is from 8V to 35V.

[Reply](#)

Kc

May 20, 2017 at 8:01 am

I tried the same circuit with NEMA 17. The Stepper is not rotating but just making some noises. With slight pressure tangential to the shaft it is making a microstep movement.I used set a 3 HW 9Volt batteries as external power source to the stepper at VMot and Gnd. What should be done?

[Reply](#)



May 24, 2017 at 2:20 pm

The problem is the battery, it doesn't have enough power. You should use an DC adapter power supply rated at least 2A.

[Reply](#)

Muhammed

May 10, 2017 at 7:01 am

hi everybody

I have a question

The model of my stepmotor is 23Hs and in its datasheet write that it need to 12 V and 3 Amper current. Now we should connect 12V ,3 A adapter???

[Reply](#)

Dejan Nedelkovski

May 11, 2017 at 6:14 am

That's correct, but your won't be able to use the A4988 driver as 3A is too high for it.

[Reply](#)

mavci

March 22, 2017 at 8:51 pm

I'm using 17hd1402-01n model step motor.and I also using your codes the above.but when I try to use delay time as 500ms my motor never turn any direction .it is only vibrating.if I set delay time to 1000ms my motor turning . I want to ask you,why my motor don't turn below 1000ms delay time?I also using a4988 .what is the actual problem.is it step motor or what ?
thanks and best regards

**Dejan Nedelkovski**

March 27, 2017 at 7:45 am

Well it seems that the motor doesn't have enough power to start rotating with that small steps. Check your power supply amps rating, make sure it has enough power for driving the motor.

[Reply](#)**Hamid**

February 9, 2017 at 5:56 pm

Hi buddy

Thank you for your practical tutorial and video. i have done the same procedure but i have a uni-polar 5 wire stepping motor and it just vibrate instead of rotating. i can feel just small movements in motor.

could you help me with that?

[Reply](#)**Dejan Nedelkovski**

February 21, 2017 at 12:05 am

Try increasing the delay time between the steps. It seems like the motor doesn't get enough power.

[Reply](#)**Gui**

February 8, 2017 at 1:52 pm

Hi,



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS



Does this work with an arduino UNO?

Thank you in advance.

[Reply](#)

Dejan Nedelkovski

February 21, 2017 at 12:07 am

Sure, it's compatible with Arduino UNO as well.

[Reply](#)

Markus

February 6, 2017 at 2:22 pm

Hello Dejan,

thank you for your reply.

So it is not a problem to connect the power supply through one of the driver? The second stepper is getting enough power through the arduino and the driver number one? Which pins would you use on the microcontroller? P3/P4 and VDD/GND is for driver number 1. Certainly I could use P5/P6 for driver number 2. But is there a second pair of VDD and GND pin?

Thank you so much!

[Reply](#)

markus

January 9, 2017 at 8:26 am

Great tutorial, thanks for publishing!

I would like to run two steppers with one arduino and 2 A4988 but with one power supply. Could you please tell how to insert a second stepper?

Thank you so much!

Best regards

Markus

**Dejan Nedelkovski**

January 11, 2017 at 3:14 am

Thanks!

Well it should be much of a problem. You just need to add another driver and connect it the same way as the first one. Also modify the code in similar way.

You can use the same power supply for the motors but just make sure it has enough power to power both motors.

[Reply](#)**Markus**

January 16, 2017 at 12:07 pm

Hello Dejan,
thank you for your reply.

So it is not a problem to connect the power supply through one of the drivers? The second stepper is getting enough power through the arduino and the driver number one? Which pins would you use on the microcontroller? P3/P4 and VDD/GND is for driver number 1. Certainly I could use P5/P6 for driver number 2. But is there a second pair of VDD and GND pin?

Thank you so much!

[Reply](#)**James Taylor**

October 30, 2016 at 10:57 pm

Does anyone know where I can get library files for A4988 to use in Diptrace PCB artwork program. Thanks

[Reply](#)



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS



October 23, 2016 at 12:43 am

Really good tutorial – showing how to adjust current limits. One should be cautious not to make a short circuit between GND and VDD – like I did. That cost me an Arduino Nano....

[Reply](#)**Dejan Nedelkovski**

October 23, 2016 at 11:09 pm

Thanks. Yeah, that's true, you should be cautious about it, I should have mentioned that in the video. I'm sorry to hear that about your Arduino.

[Reply](#)**Brian Tozer**

October 21, 2016 at 6:04 pm

Hi Dejan.

Being new to arduino could you please explain for me. In the first example I assume the motor is driven at 'full speed' all the time. Then in your second example you alter the speed of the motor using a potentiometer. My question is I want the motor to work at a slow speed all the time, can the potentiometer be replaced by a determined resistor or can it be controlled by a extra line of code in the initial sketch?

[Reply](#)**Dejan Nedelkovski**

October 22, 2016 at 12:28 pm

Hi there. Well in my example the speed of the motor is controlled by adjusting the delay time between the steps of the motor, or if you that a look at the code that's the



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS



So all you have to do is set this value according to your need.

[Reply](#)**Shaun**

October 8, 2016 at 9:56 am

Just found your website and the answers to what has been puzzling me regarding stepper motors. I would like to say thank you for such a well presented precise explanation of how things work and more importantly what is going on in the background, not only have you shared your knowledge but you have also took the time to answer questions. This should be used as a bench mark of how other internet websites/forums should be. THANK YOU for taking the time to teach others !!

[Reply](#)**Dejan Nedelkovski**

October 14, 2016 at 1:22 am

I'm so happy to hear this, thank you!

[Reply](#)**Viwawa**

August 24, 2016 at 6:01 am

Hi Dejan, thanks for your useful tutorial.

I've got a question, is it possible to control 2 stepper motors at the same time by using 2 drivers? The motor rotation is not the same, for example, I want the first motor to rotate 400 steps CW and the others 800 CCW starting at the same time.

I've already tried to write the code for it, but it the motor doesn't



Thanks for your help!!

[Reply](#)

Dejan Nedelkovski

August 26, 2016 at 12:52 am

Sure it's possible to drive the motors the way you described
you just need to make the right code for that.

[Reply](#)

Cristian

August 12, 2016 at 12:42 pm

Hi Dejan!

First of all, thank you for sharing your tutorial. It is very usefull.

I have a question with the script in wich i have to use a
potentiometer, ¿Is there a way to measure the motor rpm? i mean,
i want to know how many revolutions per minute is the motor
when i set the potentiometer to a particular state.

Thanks a lot!

[Reply](#)

Dejan Nedelkovski

August 14, 2016 at 10:26 pm

Well you will need an encoder for measuring the rpm of the
motor. Or you could calculate the rpm if you measure the
time the arduino needs to execute the 200 steps (full cycle).

[Reply](#)



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS



July 12, 2016 at 11:47 pm

Dejan, great tutorial. Do you mind answering as to what the difference is between this driver and the one used for the 28bjy-48-stepper? Are they interchangeable or each stepper needs to have their own driver board? The one used in that video is much cheaper"

Thanks,
Mark

[Reply](#)**Dejan Nedelkovski**

July 13, 2016 at 9:59 pm

Thanks. Sure there is a difference between the drivers. Even if you just look at the basic stats of the drivers you can notice a big difference. Just because one is cheaper doesn't mean it has lower performances.

[Reply](#)**Maddie**

July 11, 2016 at 10:04 pm

Hi Dejan,

Thank you for this great tutorial. I have two questions: in the video, the circuitry diagram (the one that looked like a Fritzing image) does not show that the Sleep and Step pins are connected. Yet it appears as if they are at the end of the video? Could you clarify for me which is the correct circuit?

And secondly, more importantly, I am finding that my stepper motor, an FSM0815-KD95, is getting extremely hot. After checking the voltage of the 1A-2B driver pins, I found that even when my code was simply looping "digitalWrite(stepPin, LOW);," two of the pins are still receiving voltage. Is there anyway that I can make the

[Reply](#)**Dejan Nedelkovski**

July 13, 2016 at 9:55 pm

Hi there and thanks!

"Step" pin is connected to Arduino, of course, because it gives controls the steps of the motor.

"Sleep" pin is connected to the "Reset" pin of the driver.

The motor supply voltage of the A4988 driver is 8 – 35 V accross the VMOT and GND, so your motor might not be suitable for this driver.

[Reply](#)**Kenny**

July 7, 2016 at 10:21 pm

Great tutorial and thanks. I am up and running thanks to you.

My only issue is that my NEMA 17 running on an A4988 controller and Uno board is that it will only run one direction. Changing the code does nothing. I can get a direction change by switching the wires around at the controller, but not by changing the code.

I am very new at this so hopefully it's something simple.

[Reply](#)**Dejan Nedelkovski**

July 13, 2016 at 9:37 pm

That's strange. Currently I don't have anything on mind to say about it. It could be a drivers fault...

[Reply](#)



Dejan,

thank you very much, but, can you please better explain that part about current limiting? I have source 12V 1500mA (motor same as you), what should i measure and what to change? I don't understand it, thank you

[Reply](#)

lottie

April 7, 2016 at 12:03 am

what type of capacitor should i be using because you said to use a 47 microfered capacitor but the diagram said to use a 100 microfered.what capacitor should i use

motor: [link]

cheers

[Reply](#)

Dejan Nedelkovski

April 7, 2016 at 8:43 am

Well it should be used at least 47uF.

[Reply](#)

Heather

November 4, 2017 at 6:48 pm

My 47uF blew on 12V. 100uF works.

[Reply](#)



November 10, 2017 at 10:10 pm

Thanks for the remark!

[Reply](#)

Olaf

April 4, 2016 at 8:41 am

Hi Dejan,

Thank you for sharing this tutorial.

Just wondering; you used a NEMA 17 42BYGHW609 (the 'get one' link refers to this type)? It is rated at 3.4 V and 1.68 A.

Now, the A4988 has a minimum operating voltage of 8 V. Actually, you prescribe a 12 V, 1.5 A power source. Does this not lead to any conflicts?

Cheers, Olaf

[Reply](#)

Dejan Nedelkovski

April 4, 2016 at 10:36 am

Yes the 8V – 35 V are the Motor Supply Voltage so you can connect any adapter you want within that range. The driver will take care of the driving the stepper with the appropriate voltage.

[Reply](#)

Jimmy

March 25, 2016 at 1:48 am



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS



Dejan Nedelkovski, congratulations and thank you for sharing this tutorial.

According to the Delay control the speed of the stepper motor in your code, you wrote a delay (500 microseconds). your mapping delay for the potentiometer is between (300; 4000).

My question ... Where did you find these values and their limits ?

Thank you for your answer

Jimmy

[Reply](#)

Dejan Nedelkovski

March 25, 2016 at 12:40 pm

Hi there. Well I made tested them. For example If I set the delay time lower than 250, I think, the stepper wouldn't start at all. The lowest delay time (fastest speed) I managed to try was like 90, but with higher delay at the start, more than 300, then lowering with the potentiometer to 90. Also you could find more details about this, the timing, in the datasheet of the stepper driver.

[Reply](#)

Jimmy

March 25, 2016 at 3:53 pm

Thank you for the Reply and sharing this tutorial.

Best Regard.

[Reply](#)

Manas Bose

March 21, 2016 at 5:58 am

Respected sir,



potentiometer, and arduino the sir I have wrote a sketch with the help of a friend attached herewith, it is working fine.

Sir now I want to make this thing wireless, sir I want to use 2 arduino and 2 xbee, on sending side a arduino, xbee, and a potentiometer will be there. On receiving side a arduino, xbee and a stepper motor will be there. Earlier one setup I made with servo motor.

Sir, I and my friend don't have adequate knowledge of c++, I hereby request u to kindly help

In the coding, or at least if u can throw some light on it.

Hope to be favored please

Thanking you

Manas

```
#include
int current_position = 0;
const char direction_pin = 2;
const char step_pin = 3;
const char pot_pin = 1; //analog input 1
void setup()
{
    pinMode(direction_pin, OUTPUT);
    pinMode(step_pin, OUTPUT);
    pinMode(pot_pin, INPUT);
}

void loop()
{
    int readvalue = analogRead(pot_pin);
    readvalue = map(readvalue,0,1023,0,1151);
    if (readvalue > current_position)
    {
        step_motor_forward();
        current_position += 1;
    }
    else if (readvalue < current_position)
    {
        step_motor_back();
        current_position -= 1;
    }
}//end of loop
```



```
digitalWrite(direction_pin, LOW);
digitalWrite(step_pin, HIGH);
digitalWrite(step_pin, LOW);
}
```

```
void step_motor_back()
{
digitalWrite(direction_pin, HIGH);
digitalWrite(step_pin, HIGH);
digitalWrite(step_pin, LOW);
}
```

[Reply](#)**Dejan Nedelkovski**

March 21, 2016 at 10:00 am

I don't have any tutorial for the Xbee so I can't help you much with that.

[Reply](#)**Scat**

March 14, 2016 at 5:15 am

Hello, nice tutorial. May I ask what is the difference to drive the motor in Full Step Mode and microstep mode and how to change between the modes?

[Reply](#)**Dejan Nedelkovski**

March 16, 2016 at 12:59 pm

Check my Stepper Motor – How It Works article in order to understand the difference of the modes. And as for this driver, selecting different modes is already explained in the post itself.

**miguel**

March 11, 2016 at 8:16 pm

I have a question , can regulate the speed of UN NEMA 17 with 4 letters of my computer, for example letter a = 0 speed, b= 25 %, c =50 % d= 100, i don want use potentiometer

[Reply](#)

Dejan Nedelkovski

March 12, 2016 at 3:14 pm

Sure you can, but you have to make a program for that. You could use the Arduino Serial Port to send these signals or use Processing IDE in order to make even cooler interface.

[Reply](#)

miguel

March 12, 2016 at 6:28 pm

can you help me? im a confused i dont know where to start, i have this materials, Testing A4988 + NEMA17 + Arduino, i dont have idea how to regulate the speed

[Reply](#)

miguel

March 12, 2016 at 7:21 pm

I think that is more difficult to have the control of the motor bipolar u.u that motor cd and you have a razon i need to use a serial port

[Reply](#)



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS

**Manas Bose**

March 2, 2016 at 11:14 am

Respected sir,

I have seen your video on How to control a stepper motor it is a good and nice tutorial.

sir I have question, sir I want to control a stepper motor's rotation angle from 0 to 360 and 360 to 0, with a potentiometer. sir there is an example sketch in the Arduino software, called stepper motorknob. sir in that example sketch four control inputs are there, by using A4988 driver board that sketch is not going to run the motor.

sir please throw some light on this.

or can u suggest some sketch on this without using library

thank you

Manas

[Reply](#)

Dejan Nedelkovski

March 3, 2016 at 8:16 am

Well I don't have such a code. But here's a tip how you make that: map the potentiometer values from 0 to the number of steps the stepper motors needs to make a full 360 cycle.

[Reply](#)

Steve OBrien, Sydney, Australia

March 1, 2016 at 7:09 am



successfully get my A4988 board & stepper motor project working. It saved me a lot of time! But I did have to change the stepper wiring, the illustration shows the wires straight through from the motor into the A4988 board, but I had to cross them over. My stepper is a NEMA 17HS3001-20B it has 4 wires and similar looking connections on the motor. Would it be worth adding a warning about this in the next version of your page?

[Reply](#)**Dejan Nedelkovski**

March 1, 2016 at 1:00 pm

I'm glad to hear you've found it useful! Well there many different manufactures of these motors so each of them might have different order of the pins. So therefor, before connecting, you should always check datasheet of the motor.

[Reply](#)**Germán Fernández**

February 26, 2016 at 8:36 pm

Gracias, excelente tutorial, sin ningún problema.

Saludos cordiales

[Reply](#)**Robert Friberg**

February 24, 2016 at 9:18 am

Hi, I'm building a rubiks cube solving robot using a A4988 driver and bipolar stepper motor for each face of the cube so this article is perfect for me! I'm documenting the project on twitter, see @robertfriberg



power and logic circuits are connected. It seems you don't connect the grounds. What's the difference?

[Reply](#)**Dejan Nedelkovski**

February 25, 2016 at 9:29 am

Well, you don't have to connect them together as they are already connected. The two GND pins of the A4988 board are already internally connected together.

[Reply](#)**Nick**

February 9, 2016 at 3:35 am

Great tutorial! I got everything to work with the potentiometer after playing around with it for a bit. Now I want to add another motor/potentiometer to the same Arduino board. I tried copying everything you had in potentiometer code and just renamed and add a few variables. I was successfully flashed my code to my Arduino Uno but when I changed one potentiometer both motor speeds would change at the same time. I can't figure out how to get each motor to work independently. Any suggestions?

[Reply](#)**Dejan Nedelkovski**

February 9, 2016 at 9:23 pm

It got to be the code. In the tutorial example with the potentiometer value we change the delay time between the steps. So you need to make separate delay variables for both motors. You could achieve that if you make separate custom functions outside the main "loop" for both motors so that they have separate delay variables and then you just have to call those custom functions in the main "loop" to be executed.

Did you get me?

**Nick**

February 10, 2016 at 7:06 pm

I think I got ya. Here's what I have. Still learning Arduino code. I the stepper motors don't want to work independently.

```
void loop() {

    customDelayMappedFeed = speedUpFeed(); // Gets
    custom delay values from the custom speedUp
    function
    // Makes pules with custom delay, depending on the
    Potentiometer, from which the speed of the motor
    depend
    digitalWrite(stepPinFeed, HIGH);
    delayMicroseconds(customDelayMappedFeed);
    digitalWrite(stepPinFeed, LOW);
    delayMicroseconds(customDelayMappedFeed);

    customDelayMappedCut = speedUpCut(); // Gets
    custom delay values from the custom speedUp
    function
    // Makes pules with custom delay, depending on the
    Potentiometer, from which the speed of the motor
    depend
    digitalWrite(stepPinCut, HIGH);
    delayMicroseconds(customDelayMappedCut);
    digitalWrite(stepPinCut, LOW);
    delayMicroseconds(customDelayMappedCut);

}

// Function for reading the Potentiometer
int speedUpFeed() {
    int customDelayFeed = analogRead(A0); // Reads the
    potentiometer
    int newCustomFeed = map(customDelayFeed, 0,
    1023, 300, 4000); // Convrests the read values of the
    potentiometer from 0 to 1023 into desireded delay
    values (300 to 4000)
    return newCustomFeed;
}
```



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS



```
int customDelayCut = analogRead(A1); // Reads the  
potentiometer  
int newCustomCut = map(customDelayCut, 0, 1023,  
300, 4000); // Converts the read values of the  
potentiometer from 0 to 1023 into desired delay  
values (300 to 4000)  
return newCustomCut;  
}
```

[Reply](#)**David**

July 6, 2018 at 8:28 pm

Hi Nick,

I did the same but it seems like the first pot delay time is added to the second pot delay time.

How did you deal with that?

I can't seem to find any updates to your post.

[Reply](#)**Argyris**

February 3, 2016 at 3:53 pm

Hello again, in your code with the potentiometer, in your function you have the following code : int newCustom = map(customDelay, 0, 1023, 300,4000); // Converts the read values of the potentiometer from 0 to 1023 into desired delay values (300 to 4000). My question is, How exactly you found the desirable delay values ? My motor is an Nema 17 stepper motor . Thanks in advance (I'm trying to control 3 motors wireless in my project 😊)

[Reply](#)**Argyris**

January 29, 2016 at 6:22 pm



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS



DRV8825 and an arduino uno. I used your tutorial with the potentiometer, but I have some difficulties with the speed . In your tutorial you have only one direction and your values are from 0 to 1023. I want to devide the potentiometer for RIGHT and LEFT direction, any suggestions on how to do that? Also, the speed on my motor is slower than your tutorial(When the motor turns clockwise and anticlockwise). Thanks in advance, still your tutorial was very helpfull.

[Reply](#)**Dejan Nedelkovski**

January 30, 2016 at 8:37 am

Well you should adjust the delay time between the steps that will suit your driver and stepper capabilities and match your desired speed. As for the potentiometer you should use the map() function and try to map the values you get from the potentiometers into the suitable delay times, as well, probably with an "if" statement, for half of the values make the "dir" variable positive or negative.

[Reply](#)**Argyris**

January 31, 2016 at 8:57 am

Thanks for the reply, I manage to fix it and it runs smoothly. Thanks again for a wanderfull tutorial !

[Reply](#)**Ralph Brown**

January 21, 2016 at 12:36 pm

Hi'

Thanks for this tutorial. I've been trying for weeks to run 3 steppers on a Uno with a motor shield and A4988's. I've had no success at all and thinking I had fried everything, bought full replacements, with the same results. Thanks to your tutorial I've at last managed



...fry anything! I'll now need to think about how to test the shields.

Thanks again, Ralph

[Reply](#)

Dejan Nedelkovski

January 23, 2016 at 11:34 am

I'm glad to hear you found it helpful!

[Reply](#)

Matija

January 7, 2016 at 12:09 pm

Hi there. Joining others. Really comprehensive and useful and worth all congrats. Bookmarked!

[Reply](#)

Dejan Nedelkovski

January 8, 2016 at 8:57 am

Thanks!

[Reply](#)

Berat Uslu

January 6, 2016 at 10:29 pm

Hello Dejan,

Thanks for great tut. I followed your tut same. But result is like on the video. After I connecting stepper's wires to a4988 its like vibrating. Its like affecting kind of magnetic field. It is strange. After I connect the arduino result is like on the video. What can be the



Thanks.

[Reply](#)

Dejan Nedelkovski

January 7, 2016 at 1:17 am

Hi there,

As I can notice the stepper might be skipping steps. Try to increase the delay time between the steps. What power supply do you use?

[Reply](#)

Berat Uslu

January 7, 2016 at 2:55 pm

Now its working! I did everything same. How its possible. I am using 12v for powering the stepper 5v for logic. But i was not shure about which coil cables which. I had tried all the combinations. But now its working... Great!.

Thank you so much.

[Reply](#)

Berat Uslu

January 7, 2016 at 3:16 pm

Difference was, I earlier took logic power from another source. Now I am taking it from Arduino. For who encountering same problem.

Cheers!

[Reply](#)



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS



Good to hear it solved your problem!

[Reply](#)

axel

January 5, 2016 at 2:54 pm

HI, thanks for the good tutorial. I am using the code you wrote with the potentiometer. However, even when I change

`digitalWrite(dirPin,HIGH); //Enables the motor to move in a particular direction`

TO

`digitalWrite(dirPin,LOW); //Enables the motor to move in a particular direction`

The motor keeps going in the same direction – any idea why?

thanks

[Reply](#)

Dejan Nedelkovski

January 6, 2016 at 10:32 am

Well that's strange. Try reconnect the driver exactly as explained and try the code again. There's nothing else you can do, because the DIR pin of the driver is meant for that. Either is LOW or HIGH and the motor should move in different direction.

[Reply](#)

Andres Tejada

December 13, 2015 at 10:19 pm



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS



I have a question, could you show the scheme with the potentiometer?

I don't know how connect this.

thaks a lot

Andres

[Reply](#)

Dejan Nedelkovski

December 14, 2015 at 8:29 am

You can find more details about that on my Arduino Analog Inputs Tutorial:

<https://howtomechatronics.com/tutorials/arduino/analog-inputs/>

[Reply](#)

julian

December 1, 2015 at 7:01 pm

Thanks!, great tutorial!!!

[Reply](#)

Dejan Nedelkovski

December 2, 2015 at 8:00 am

Yep, thanks!

[Reply](#)

Jerry

November 24, 2015 at 2:04 am



ARDUINO PROJECTS

TUTORIALS

HOW IT WORKS

PROJECTS

TOOLS



Please help with mechatronics and I would do whatever you want.

unsuccessful.

[Reply](#)

Dejan Nedelkovski

November 24, 2015 at 10:35 am

I haven't tried that combination. Sorry I can't assist you with that.

[Reply](#)

Leave a Comment

Name *

Email *

[Post Comment](#)

How To Mechatronics

HowToMechatronics is an education website in the area of Mechanical, Electrical and Computer Engineering. Tutorials, Tips, Tricks, How It Works, Projects, Examples, Source Codes, Download files and much more can be found here.

Disclosure

HowToMechatronics is a participant in the Amazon Services LLC Associates Program, an affiliate advertising program designed to provide a means for sites to earn advertising fees by advertising and linking to Amazon.com

[ARDUINO PROJECTS](#)[TUTORIALS](#)[HOW IT WORKS](#)[PROJECTS](#)[TOOLS](#)