

Power-Share Setpoint Sweep under Trapezoidal Load: Bench Results, a Minority-Channel Dropout Limit Cycle, and Validation of Its Firmware Mitigation

Ricky Tan
rstan@ucdavis.edu

2026-08-11 (revised 2026-08-13 with the firmware v3, v4, v5, and v6 validation sweeps)

Abstract

Seven bench runs (TP0007–TP0013) sweep the power-share setpoint of the DC balancer board’s droop-based share controller across the full $[0, 1]$ range under an identical trapezoidal motor-current profile. Steady-state tracking is excellent and unbiased at every setpoint (hold-window mean error $< 10^{-3}$ across the sweep), and interior setpoints settle in under 2s with no actuator saturation. Two runs, however, expose a previously unobserved failure mode: at asymmetric setpoints (0.30 and 0.85) and low total current ($\lesssim 1.2$ A), the loop enters a sustained 17–18.5 Hz *minority-channel dropout limit cycle*. In its severe form (TP0010, setpoint 0.30) the two boost channels conduct mutually exclusively, reconnect spikes reach 3.6 A, and the bus collapses below 15 V sixty-four times — to a minimum of 6.55 V on a 15.9 V rail — without raising any fault. This paper documents the sweep, characterizes the limit cycle, evaluates candidate mechanisms, and recommends firmware and test-procedure changes. The event is logged as a nondestructive datapoint in the board’s bring-up failure record.

A second campaign (Section 5; TP0014–TP0038, WP0039–WP0040, firmware v3) validates the resulting mitigation set — a minority-current setpoint governor, a droop-ratio slew limit, and per-profile state reset — over a 25-point setpoint ladder and two moving-setpoint profiles. The limit cycle is eliminated at every governed setpoint, including the original failure points 0.30 and 0.85, with hold-window bias below 10^{-3} throughout. Three boundary conditions remain outside the mitigation’s reach: the in-band edge setpoint 0.15 still collapses the bus (to 8.2 V), setpoints in the narrow window between the governed band and the channel-cutoff threshold (e.g. 0.87) run the original cycle unmitigated, and one moving-setpoint run ended in a brownout-terminated total-dropout ratchet. Parameter and structural fixes for each are identified.

A third campaign (Section 6; TP0041–TP0068, WP0069–WP0073, firmware v4) validates those fixes and finds their limits. The setpoint-latched channel cutoff closes both boundary gaps completely: every out-of-band setpoint now latches once with zero switch cycling, and the band-edge setpoint 0.15 runs clean under the raised 0.30 A governor floor. Two new failure modes appear in their place. First, six runs at fuel-cell-heavy setpoints (0.67–0.80) collapse the bus to 7–9 V through a *source-commutation relay cycle* ignited inside the governor’s collapse-to-0.5 window, where the fallback commands a split it has itself declared infeasible; the new undervoltage fault latches every event, but its persistence filter tolerates more than a second of sub-8 V excursions first. Second, two moving-setpoint runs terminate in MCU brownouts with the bus in regulation at 15.7 V — an upstream source-rail collapse that a bus-referenced fault cannot see — while their pre-death limit cycle shows the constant-current governor floor sits below the failure bracket at higher load. Structural fixes for the governor fallback, the floor law, and the fault coverage are identified.

A fourth campaign (Section 7; TP0074–TP0094, WP0095–WP0101, firmware v5) validates the redesigned low-current fallback and the reworked undervoltage filter. The 21-point trapezoid

ladder is clean end to end — the relay-cycle setpoints included — and the leaky-dwell undervoltage filter latches within ≈ 20 ms of first bus excursion. The W-profile share-bound excursion, however, is identified as a concentrated failure generator: it combines peak load with an extreme share command, reproducing the 18.8 Hz minority dropout cycle in band (where the governor is structurally inert) and, at an unclipped command of 1.0, turning the setpoint-latched cutoff itself into a hazardous under-load actuation. The new source-rail logging shows the subsequent collapses are fuel-cell source-knee runaways invisible to any bus-referenced fault; the battery rail is healthy at the log rate through every stop, while an oscilloscope capture resolves a sub-millisecond battery-rail collapse to ≈ 4 –5 V, coincident with a current spike — relocating the MCU-stop mechanism to a transient the log cannot see. A bus-versus-reference dropout margin, a source-rail undervoltage fault, and profile changes are recommended.

A fifth campaign (Section 8; TP0102–TP0120, WP0121–WP0124, firmware v6) validates the profile de-rating and the reference slew, and relocates the failure mode a second time. The share-bound excursion, now de-rated to $0.3 I_{\max}$, carries an order of magnitude less current than the source knee, and all three combined-profile runs at 6 A complete across the full span of the clip bound — the bound no longer predicts survival. One residual remains in band: at the exact upper band edge the open-loop-to-closed-loop handover opens both channels for 5.9 ms and drops the bus to 12.19 V, because the governor floor demands half the total current from a channel carrying 61 mA at the crossing. The slew limits the reference rate, but the exposure is its magnitude. The one truncation of the campaign is not share-mediated at all: at an $I_{\max}$ raised to 8 A the battery rail collapses ohmically through a 1.35Ω source — four times softer than the fuel-cell side — into the logic regulator’s dropout region, with the share loop tracking to ± 0.02 and the bus in regulation throughout. Replaying the dwell filter over the campaign shows that no battery-rail undervoltage threshold separates that stop from healthy runs which sag lower still, which identifies the discriminator as a sub-millisecond transient rather than the logged operating point.

1 Test setup and data provenance

All runs were performed on the 20260622 balancer board in State-98 test mode using the trapezoidal current profile T 6 3 1: motor current command ramps $0 \rightarrow 6$ A at 1 A/s, holds 6 A for 3 s, then ramps back to zero (≈ 15 s total). The Youla- H_{∞} power-share controller (`share_controller.h`, $K_{\text{DROOP}} = 0.300 \Omega$) is active throughout; the swept variable is the constant share setpoint r^* (fuel-cell fraction of total channel current), one value per run. Firmware is the pre-versioning build (“fw 0” in the version ledger) compiled with `BENCH_TEST=1`, which arms *overvoltage faults only* — a fact that matters in Section 3. The bus regulates at ≈ 15.9 V no-load. Sections 1–5 cover this discovery sweep; Section 5 covers the follow-up validation campaign (TP0014–TP0038, WP0039–WP0040), run on firmware v3 with the mitigation set derived from the discovery analysis, under the same profile and bench conditions. Section 6 covers the second validation campaign (TP0041–TP0068, WP0069–WP0073), run on firmware v4 with the fixes derived from the first.

Data come from the on-board SD bench logger (1 kHz nominal; measured ≈ 865 Hz effective, 1.15 ms median sample interval). All seven captures are complete: zero dropped records, zero missed periods, clean trailer close. Decoding and the per-run overview figures were produced by the `tools/benchlog_analysis` pipeline; the zoomed and summary figures in this paper are generated by the accompanying `make_figs.py`. No oscilloscope was armed during the sweep, so all quantities are ADC-path readings through the firmware’s averaging chain (current LSB ≈ 8.06 mA); sub-millisecond structure is not observable.

Table 1: The sweep, in session order. Hold-window statistics are computed over the 3 s 6 A plateau (`trap_phase=1`). “Settle” is time from load onset (filtered total current > 0.15 A) to $|e| < 0.05$ sustained 0.2 s; 0.0 means the loop was already within band at onset.

Run	r^*	Mean err	σ	Settle [s]	$\bar{I}_{\text{tot}}$ [A]	Anomaly
TP0007	0.50	−0.00002	0.010	0.0	1.20	none (baseline)
TP0008	0.70	−0.00000	0.011	0.0	1.38	none
TP0009	1.00	−0.00000	0.0001	0.0	1.55	degenerate: BT off, MDACs railed
TP0010	0.30	−0.0044	0.108	1.81	1.50	17 Hz limit cycle; bus to 6.5 V
TP0011	0.00	+0.00000	0.0001	0.0	1.61	degenerate: FC off, loop frozen
TP0012	0.15	−0.00000	0.010	0.0	1.65	g_{FC} within 5 % of rail
TP0013	0.85	+0.00002	0.043	1.89	1.72	18.5 Hz BT dropout chatter

2 Steady-state tracking: unbiased across the full span

Figure 1 summarizes the sweep. Hold-window mean error is below 10^{-3} at every setpoint from 0 to 1 — the integral action carries no bias anywhere in the span, matching the design intent of the Youla controller’s exact $T(0) = 1$ constraint. Interior setpoints (0.3–0.7) show $\sigma \approx 0.01$ with the droop-gain commands comfortably mid-band, and Figure 2 shows the representative clean run at $r^* = 0.5$. The endpoints are degenerate by construction: at $r^* = 1$ the BT channel simply stops conducting and both MDAC commands sit pinned at the band edges (an open loop with zero error); at $r^* = 0$ the loop freezes mid-range with the FC channel dark. Neither endpoint misbehaves.

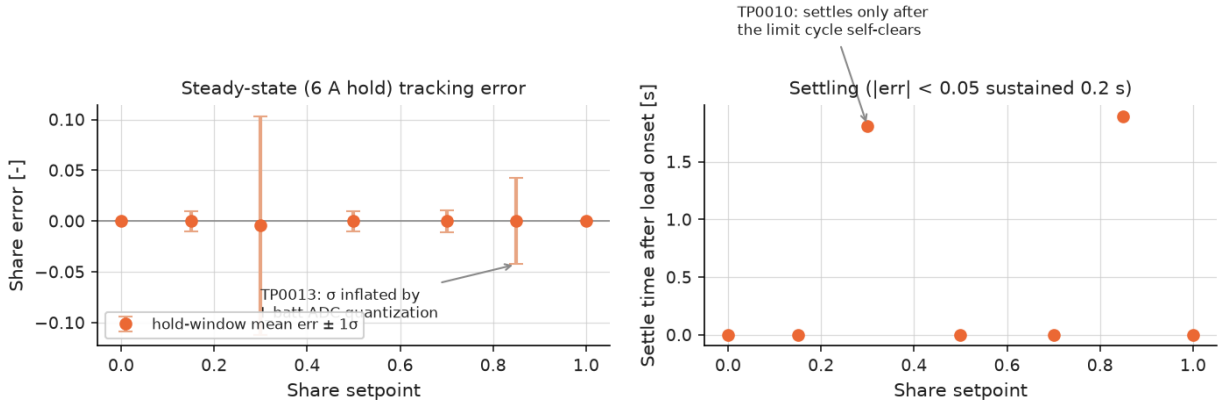


Figure 1: Sweep summary. Left: hold-window tracking error is unbiased at every setpoint; the two inflated σ bars belong to the limit-cycle runs (TP0010) and the quantization-corrupted high-share run (TP0013). Right: settling time; interior and endpoint runs are within band at load onset, while the two anomalous runs take ≈ 1.8 – 1.9 s.

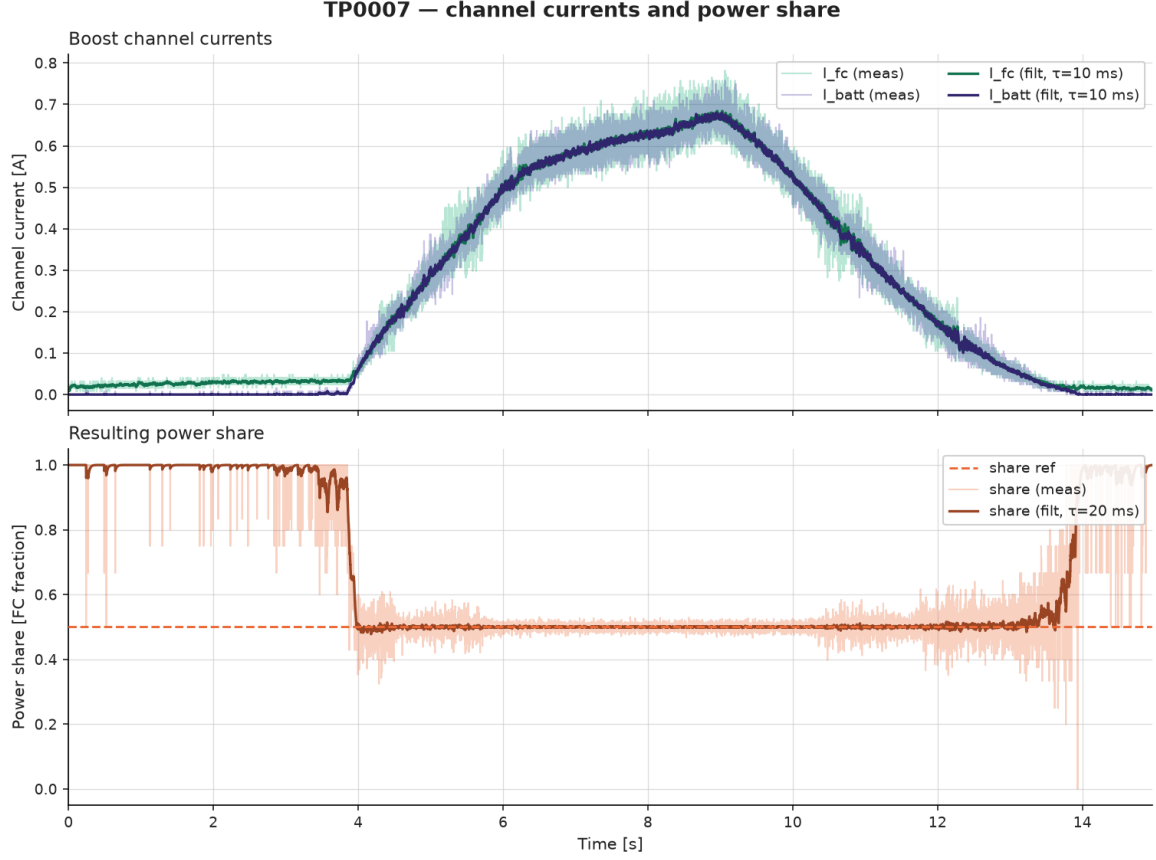


Figure 2: Representative clean run (TP0007, $r^* = 0.5$): symmetric channel currents through the full trapezoid, share locked to the setpoint whenever total current is above the measurement floor. The share excursions before load onset and after load release are the known low-current region where the share ratio is numerically undefined, not a control failure.

Actuator headroom, however, is *asymmetric*. At $r^* = 0.15$ the FC droop command rides 0.85–0.91 (within $\approx 5\%$ of its ceiling) yet the run is the fastest-settling of the sweep. The mirror case $r^* = 0.85$ needs $g_{BT} \approx 0.90$ – 0.99 and g_{FC} pinned at its 0.175 floor for 85% of the loaded window — and misbehaves (Section 3.2). The usable share band is therefore not symmetric about 0.5: the FC-heavy side runs out of authority first. This should inform the pending bench calibration of K_{DROOP} and the droop-ratio band rather than being read as a controller defect.

3 The minority-channel dropout limit cycle

3.1 Severe form: TP0010, $r^* = 0.30$

From $t = 4.33\text{s}$ to 6.15s — mid ramp-up, with the motor command between 4.3 and 6 A but total channel current still below $\approx 1.2\text{ A}$ — the loop enters a sustained relaxation oscillation with a median period of 58–59 ms ($\approx 17\text{ Hz}$). Figure 3 shows the full window; Figure 4 resolves individual cycles.

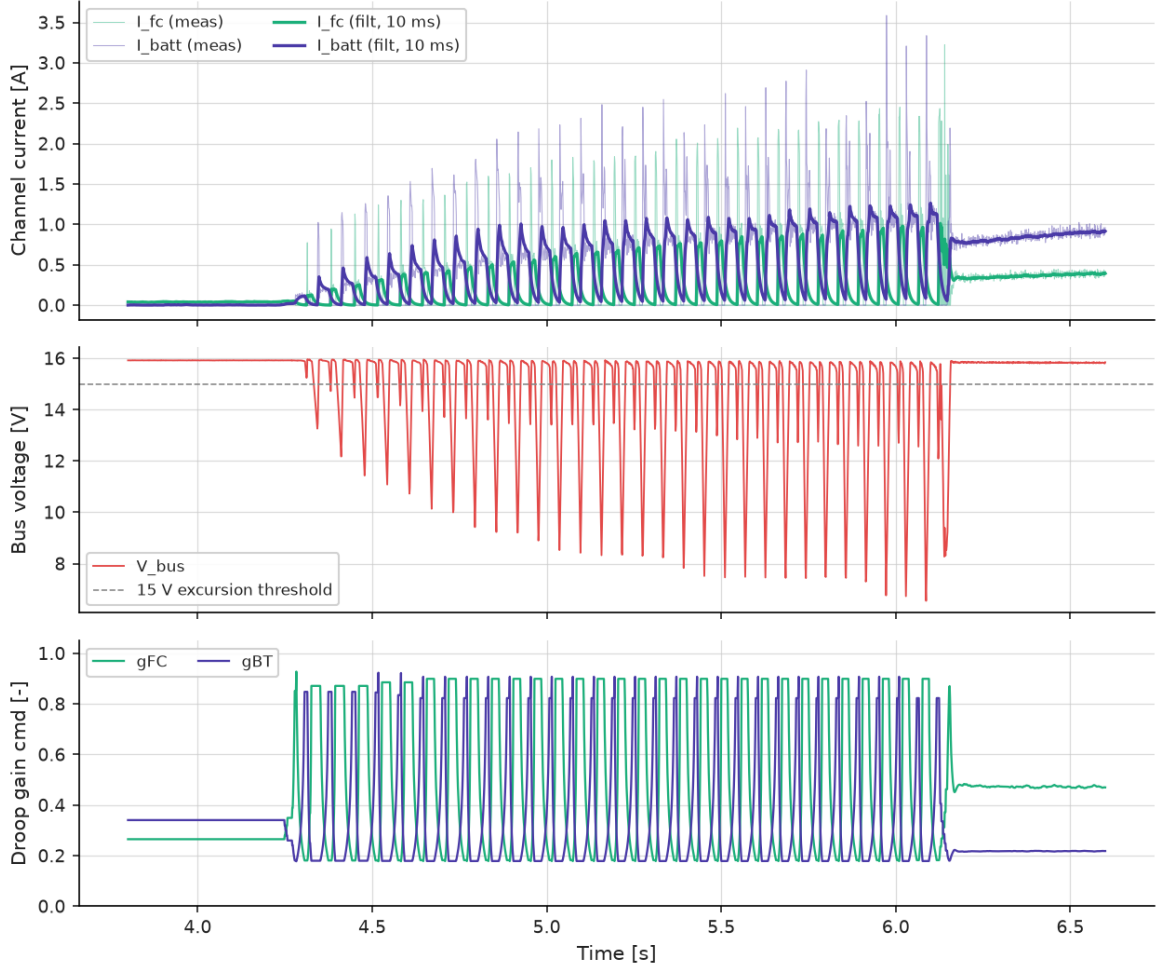


Figure 3: TP0010 limit-cycle window. Top: channel currents alternate with reconnect spikes growing to 3.6 A as the load ramp deepens. Middle: 64 bus excursions below 15 V, reaching 6.55 V; sag depth grows monotonically with the commanded load. Bottom: the droop MDAC commands bang between their extremes in antiphase. The cycle self-clears at $t = 6.15$ s once total current exceeds ≈ 1.2 A, and the remainder of the run is clean.

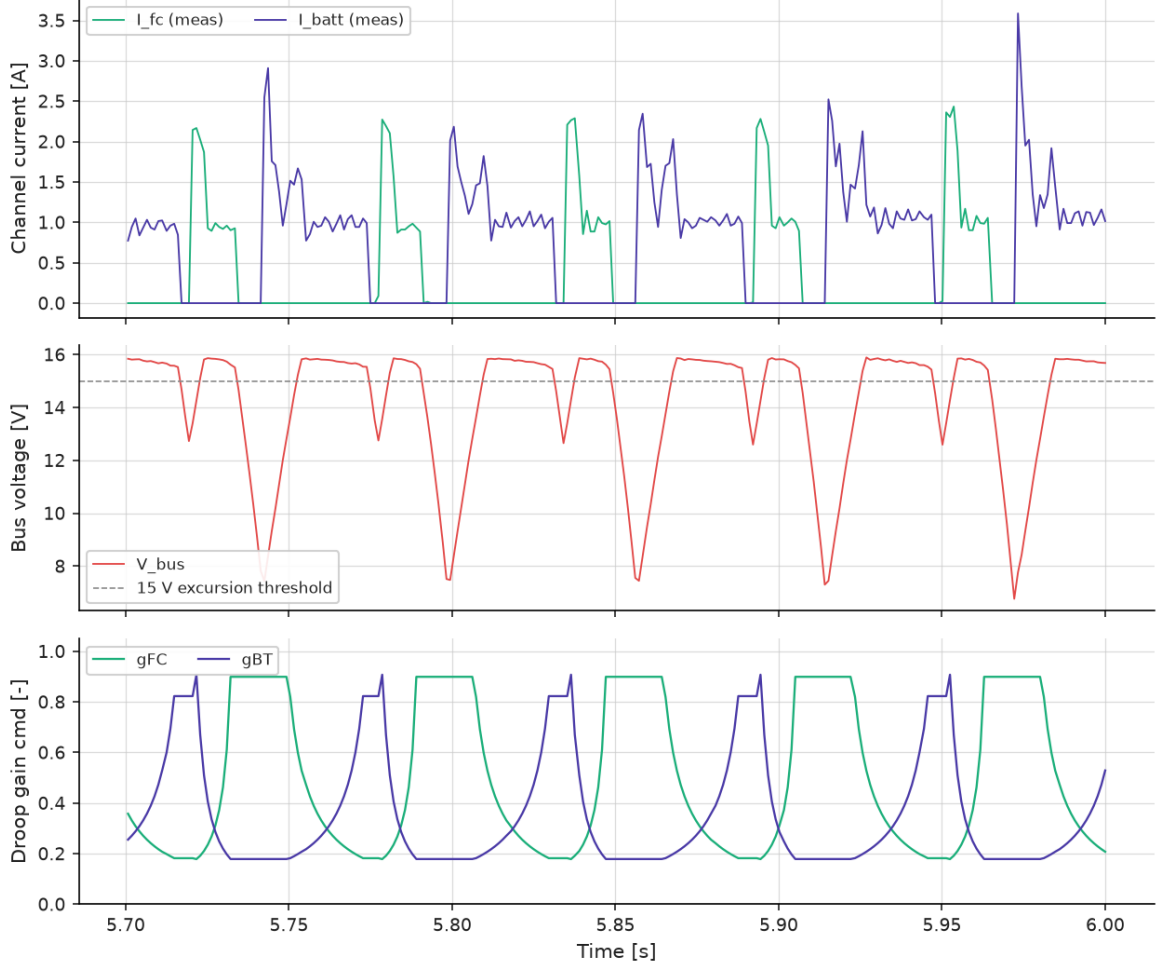


Figure 4: Five consecutive cycles of the TP0010 limit cycle. The two channels conduct *mutually exclusively* (both conducting in only 0.1 % of samples); each handoff includes a 10–18 ms window in which *both* channels read zero current and the bus — carrying only its $\approx 40\ \mu\text{F}$ of ceramics — falls as low as 6.5 V before the incoming channel reconnects with a 2–3.6 A spike.

Three features deserve emphasis. First, the collapse is real and repeated: 64 excursions below 15 V in 1.8 s, with sag depth scaling with the commanded load (13.3 V at $I_{\text{cmd}} = 4.4\text{ A}$ down to 6.5 V at 6 A). Second, *no fault was raised*: the `BENCH.TEST` build arms overvoltage checks only, and every excursion is downward — the event is invisible to `detectFaults()` as currently configured on the bench. Third, the cycle is self-limiting in this run: once the trapezoid pushes total current past $\approx 1.2\text{ A}$ the loop converges and the remainder of the run is indistinguishable from the clean runs ($\sigma = 0.011$, no saturation). A brief re-entry occurs on the low-current tail at $t \approx 13.5\text{ s}$.

3.2 Mild form: TP0013, $r^* = 0.85$

The mirror-side asymmetric setpoint shows the same signature at 18.5–18.7 Hz, but as minority-channel (battery) dropout chatter without bus collapse (Figure 5): during both ramps the BT channel repeatedly falls to exactly zero current (pinned there for 0.77 s of the 1.5 s ramp-up band and 1.36 s of the 2.1 s ramp-down band), the measured share slams to 1, and g_{BT} rails before the channel snaps back. Bus disturbance is limited to $\approx 100\text{ mV}$ notches. The run never meets the

strict settling criterion ($|e| < 0.03$ for 200 ms) anywhere; its mid-plateau is acceptable but has the worst steady-state spread of the sweep.

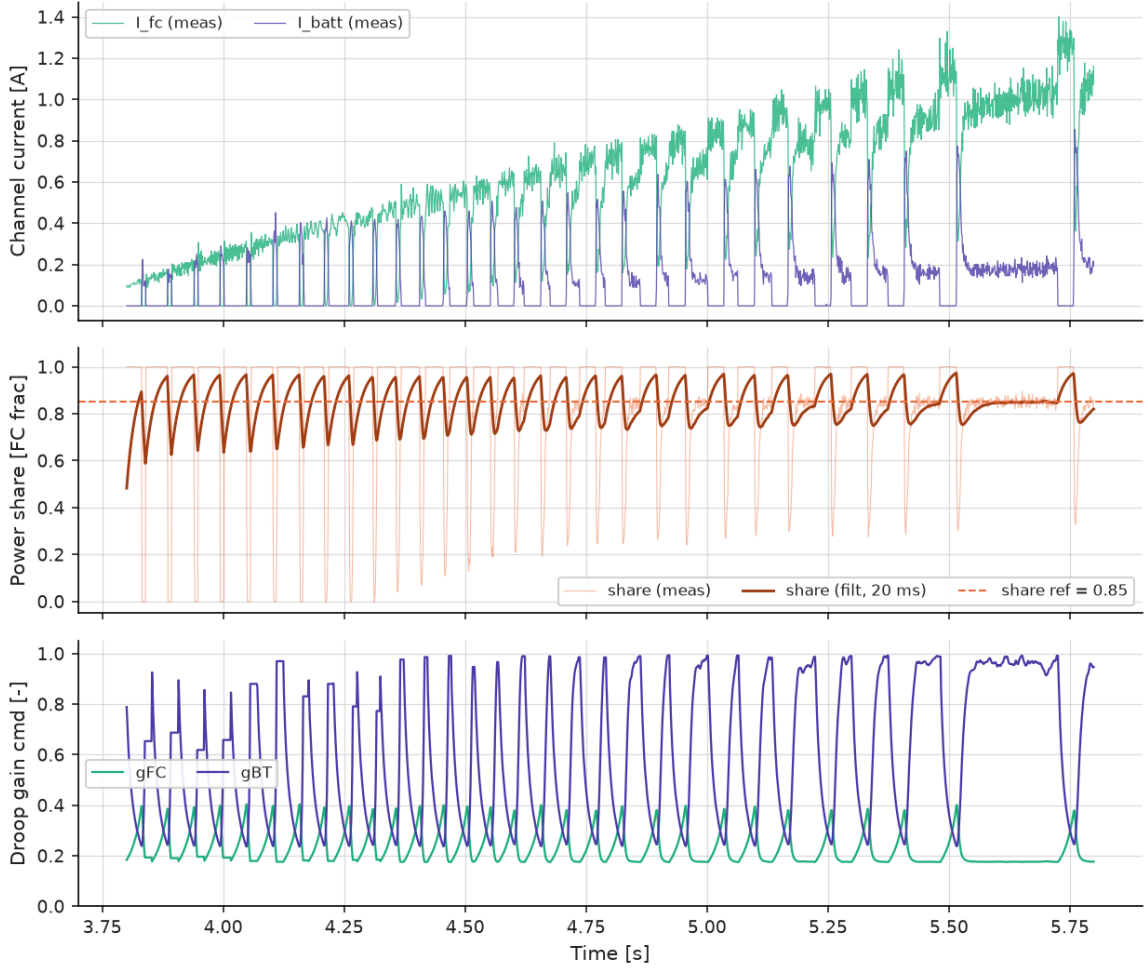


Figure 5: TP0013 ramp-up dropout band. The BT channel (violet) repeatedly drops out of conduction entirely; measured share (middle) saws between the setpoint and 1.0 at ≈ 18.5 Hz; g_{BT} (bottom) rails toward 1.0 on every dropout while g_{FC} sits pinned at its 0.175 floor. Note the events thin out as total current grows toward the plateau.

A separate measurement artifact compounds the picture at this setpoint: the commanded battery current ($\approx 15\%$ of ≈ 0.5 A ≈ 75 mA) is only ≈ 9 LSB of the 8.06 mA current-sense quantization, and I_{BT} quantizes to exactly zero for 23% of the loaded segment, pegging the computed share at exactly 1.0. Excluding those samples reveals a genuine -0.03 share bias at $r^* = 0.85$ that the raw mean coincidentally cancels. Setpoint 0.85 at these load levels is where the current-sense LSB begins to corrupt the share estimate itself.

3.3 Mechanism assessment

The data support a *starved-minority-channel dropout loop*: at low total current, the droop command needed to hold the minority channel at a small fraction pushes that channel out of conduction entirely (its RT1987 ideal diode blocks once the droop-raised source characteristic falls below the

bus); the measured share then slams to 0 or 1, the controller drives both MDACs toward their rails, the starved channel reconnects with a large spike, and the cycle repeats. This explains the frequency similarity between the two runs, the mutual exclusivity, the confinement to low total current, and the self-clearing once the minority channel’s commanded current rises above its conduction floor.

What that loop alone does *not* explain is TP0010’s 10–18 ms *both-channels-off* windows. Two candidates remain open, and the mechanism is explicitly **unconfirmed** pending a scope capture:

1. both boosts are simultaneously droop-commanded out of conduction during the crossover (a pure control-loop artifact of the antiphase rail-to-rail MDAC slew);
2. the RT1987 bus switches’ short-circuit-protection cut/retry participates: the 58–59 ms period is suspiciously close to the 64 ms `tSCP_RST` retry fingerprint documented in the board’s bring-up record (captures 9–10), and both bus switches have carried 100 nF soft-start capacitors since 2026-08-07, lengthening every reconnect.

A scope capture aimed at this question was taken on 2026-08-11 (capture 12 in the bring-up record; Figure 6): a repeat of the TP0010 condition with VBUS, V-MOT, and the battery-channel INA monitored, single-shot trigger on VBUS falling through 14 V. It *narrows* the question without closing it:

- **Confirmed: the events are total source-feed dropout windows.** VBUS and V-MOT sag *together* — slow linear ramps of $\approx 3\text{--}4$ V over tens of milliseconds at a 67.6 ms cursor period (14.8 Hz), each ended by a sharp recovery synchronized with a ≈ 1 A reconnect burst on the battery INA. Because the motor switch conducts throughout, the bus rides the combined $\approx 1\text{--}1.5$ mF motor+VESC capacitance during each window — which is why the decay is slow, and which independently corroborates the SD log’s 10–18 ms both-channels-off reading.
- **Ruled out: the VBUS→V-MOT switch as a cutting element** (the two nodes track through every dip).
- **Still open: candidates (1) vs (2).** Both predict exactly this bus signature, and the 67.6 ms period is consistent with either (the RT1987 retry timer is 64 ms; the SD-log median was 58–59 ms). The sharper discriminator, if needed: probe a *boost output* alongside VBUS during a dropout — reconnect at the voltage crossing indicates droop-commanded blocking, reconnect on a fixed 64 ms cadence indicates SCP.

Practically, the discrimination no longer gates the fix: both surviving candidates are downstream of the droop loop railing both MDACs antiphase, so the mitigation set of Section 9 (feasibility-gated integrator hold, MDAC slew limiting) is the correct next step under either mechanism.

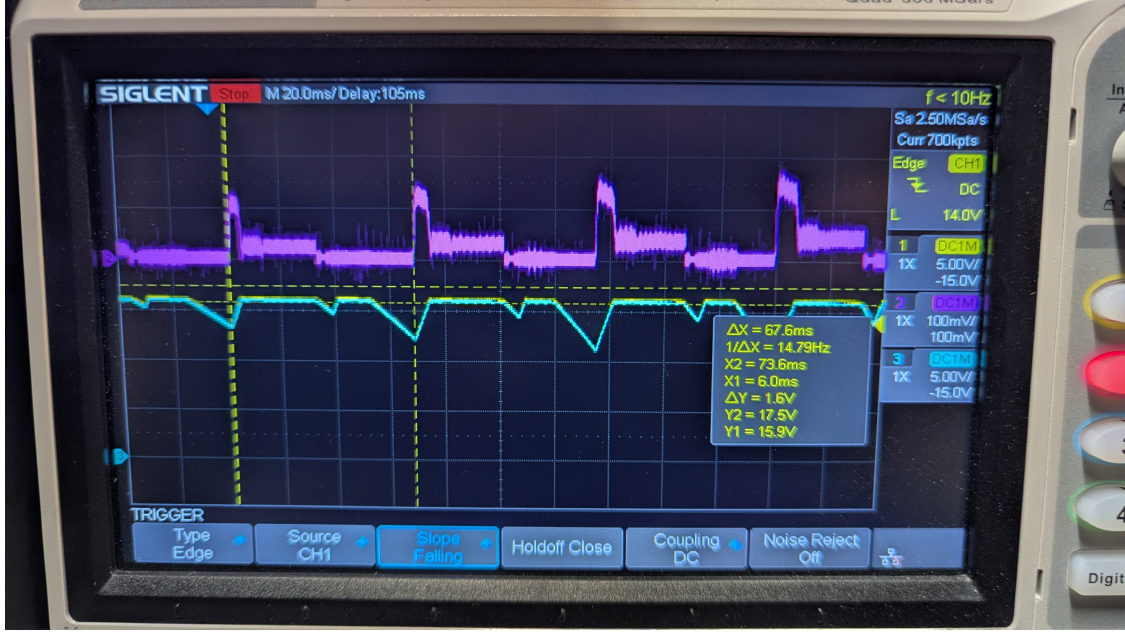


Figure 6: Capture 12 (2026-08-11): TP0010-condition repeat, 20 ms/div. CH1 VBUS (yellow, 5 V/div) and CH3 V-MOT (blue, 5 V/div) overlap and sag together in $\approx 3\text{--}4\text{ V}$ sawtooth ramps at a 67.6 ms period (cursors); CH2 battery INA (purple, 1 A/div) shows the dropout–reconnect–spike–conduction pattern synchronized with the voltage recoveries. The flat yellow line near 15.9 V is the Y1 measurement cursor, not the VBUS trace.

3.4 Why a nondestructive event matters

Each reconnect is a load-dump-class transient sourced by a boost converter, on a board whose failure history (five destroyed TPS61288 converters) traces to exactly this event class. The per-event energy here is far below the destructive episodes, and both boost converters carry the validated hot-loop bodge capacitors, which bounds the known overshoot mechanism — but TP0010 delivered ≈ 33 collapse/reconnect events in under two seconds, a duty cycle the power stage has not been characterized under. Capture 12 confirms the whole bus — sources to VESC — rides each dropout’s decay, so until the firmware mitigation lands, repeated runs at $r^* \approx 0.3$ with ramping load should be treated as a known stressor. The event is logged in `docs/boost-bringup-debug.md` with a corresponding safety rule and follow-up item.

4 Secondary observations

Low-load integrator windup (expected, mild). This firmware predates the planned minimum-load integrator hold. During the 30–41 % of each run spent below the share-measurement floor, the gain commands drift toward their extremes (0.90–0.99), producing load-return transients of up to $-0.85 / +0.70$ share error with 0.5–1.9 s recovery — worst in exactly the two runs that also limit-cycled. Note, however, that the limit cycle itself lives at total currents up to $\approx 1.2\text{ A}$, an order of magnitude above the planned 75 mA hold threshold: the pending fix as parameterized would *not* have suppressed it.

Controller state carries across runs. Each run’s initial MDAC pair equals the previous run’s final value (only TP0007, first after boot, starts from zero). This contaminates each run’s entry

transient and should be reset at profile entry.

Run-order drift. At the identical 6 A motor command, mean bus current during the hold climbs monotonically with session order — 1.20 A (TP0007) to 1.72 A (TP0013), +44 % (Figure 7) — consistent with battery depletion and/or motor heating across the session. Cross-run comparisons are therefore made at a slowly drifting operating point; future sweeps should interleave or randomize setpoint order.

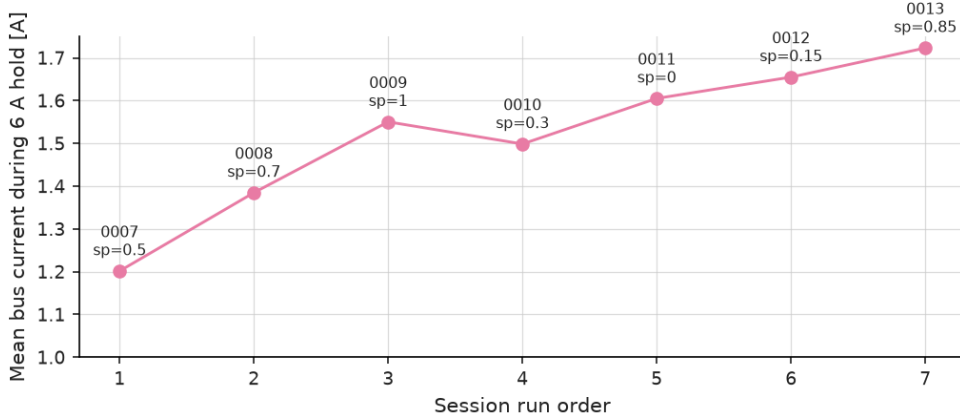


Figure 7: Session drift: mean bus current during the 6 A hold vs. run order. The +44 % monotonic climb tracks session order, not setpoint.

Comparison to the earlier runs. The five earlier captures (PS0001–PS0003 share-step profiles, TP0004–TP0005 trapezoids at $r^* = 0.5$) show clean step tracking (0.2/0.5/0.8 plateaus, settling within ≈ 1 s, no overshoot) and clean trapezoid tracking at 0.5, respectively. The new sweep reproduces that behavior at every operating point the old runs covered — there is no regression. The limit cycle appears only at asymmetric setpoints the earlier campaign never visited. (The earlier runs used less analog averaging; noise-level comparisons between the two groups are deliberately out of scope.)

5 Fix-validation sweep (firmware v3)

5.1 Mitigation set and sweep design

Following the analysis above, firmware v2/v3 added three mitigations to the share loop. First, a *setpoint governor* clips the effective in-band setpoint so the commanded minority-channel current stays at or above $I_{\min} = \text{SHARE_MINORITY_I_MIN_A} = 0.20$ A, computed against a low-pass estimate of total current; below $2I_{\min}$ of filtered total the effective setpoint collapses to 0.5. Setpoints outside the droop band $[0.15, 0.85]$ bypass the governor, on the design assumption that the channel-cutoff path owns them. Second, a *droop-ratio slew limit* of 0.02 per control tick replaces the rail-to-rail MDAC slams of Figure 3. Third, share-controller state is *reset at every profile start*, removing the cross-run contamination of Section 5.

The validation campaign ran on firmware v3 using the automated T-sweep extension: 25 trapezoid runs (TP0014–TP0038), identical T 6 3 1 profile, one run per setpoint on the ladder $\{0, 0.12, 0.15, 0.18, 0.20, 0.225, 0.25, 0.30, \dots, 0.84, 0.85, 0.87, 1.0\}$, with dense placement at both band

edges to map the failure boundary. Two W combined profiles (WP0039, WP0040) exercised the loop under a *moving* setpoint and load. All trapezoid captures are complete with clean trailers; WP0039 is truncated (Section 5.5).

5.2 Result: the limit cycle is eliminated across the governed band

Figure 8 summarizes the ladder. Every setpoint from 0.18 to 0.85 — including 0.30 and 0.85, the two original failure points — runs with zero dropout events, a flat bus (run minimum 15.72 V against a 15.9 V rail), and hold-window bias below 10^{-4} with $\sigma = 0.009$ –0.017. At the original severe point 0.30 (TP0021), the comparison against TP0010 is: 64 collapse events to zero; bus minimum 6.55 V to 15.73 V; peak reconnect current 3.6 A to 0.74 A.

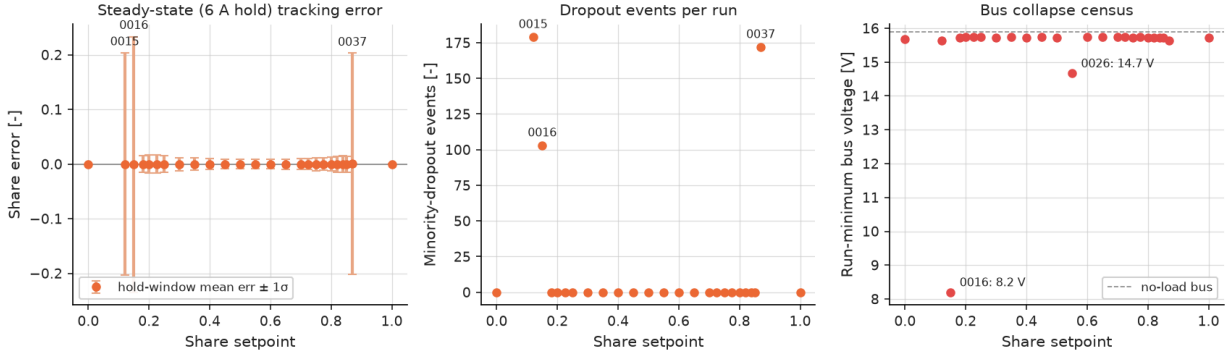


Figure 8: Validation-sweep summary, TP0014–TP0038 (firmware v3). Left: hold-window tracking error remains unbiased at every setpoint; the three inflated σ bars are the residual failure runs. Center: hysteretic dropout-event count — only 0.12, 0.15, and 0.87 cycle; the deep out-of-band endpoints 0 and 1 are clean latched cutoffs. Right: run-minimum bus voltage; only TP0016 (0.15) collapses the bus.

The governor’s mechanism is directly observable in the logs. In every clean asymmetric run the minority-channel current is pinned at 0.204–0.214 A — the 0.20 A floor held to within 5% — across a threefold span of total current, then released at the predicted crossover $I_{\text{tot}} = I_{\text{min}}/r^*$ plus the load-filter lag. The collapse-to-0.5 plateau below 0.40 A filtered total appears as a distinct shelf in every ramp. The slew limiter is respected exactly in all 27 runs (maximum per-record ratio step 0.0200) and saturates for substantial stretches, confirming it is load-bearing.

The moving-setpoint run WP0040 (Figure 9) extends the validation to simultaneous setpoint and load steps: across all sixteen table regions, the measured share tracks the *reconstructed governed setpoint* with residuals at or below 2×10^{-3} , including three regions where the governor clips a 0.65 command down to 0.54–0.57 at low current and two regions where it collapses a 0.30/0.65 command to 0.5. The apparent tracking “errors” against the raw table setpoint are therefore entirely commanded governor action. Region boundaries traverse ratio steps of up to 0.34 in about 20 slew-limited ticks with ≈ 0.06 overshoot and no bus disturbance beyond 0.20 V.

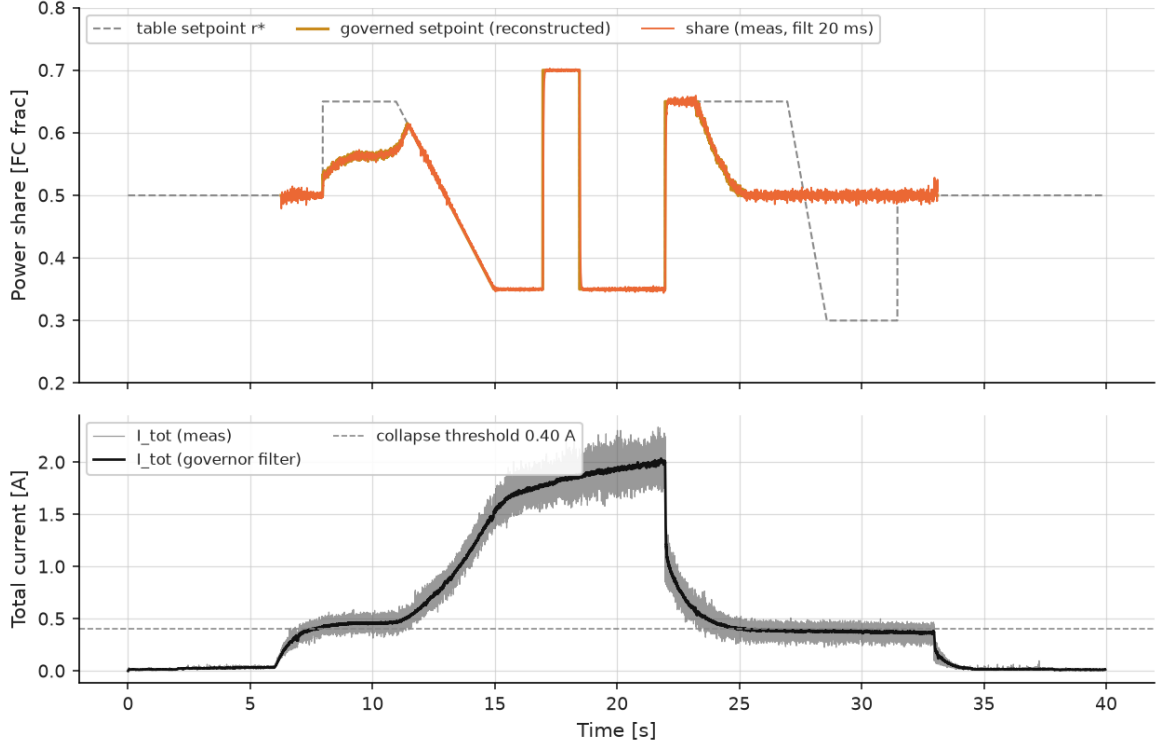


Figure 9: WP0040 (moving setpoint and load): measured share (orange) against the raw table setpoint (dashed) and the governed setpoint reconstructed from the firmware’s clip law (mustard). The measured share follows the governed command everywhere the share is measurable; the flat 0.5 stretches at $t = 25\text{--}33\text{ s}$ are the designed collapse below $2I_{\min}$ of filtered total current, not tracking failure.

5.3 Residual failure at the in-band boundary: TP0016, $r^* = 0.15$

The single in-band failure is the band-edge setpoint itself. TP0016 ignites the limit cycle at $t = 6.14\text{ s}$ — the precise instant the governor releases, when total current grows past $I_{\min}/0.15 = 1.33\text{ A}$ and the commanded minority current passes down through 0.20 A . Zero dropout events occur before that instant; the cycle then runs continuously through the hold (56 events at 19 Hz , bus intact) and deepens through the ramp-down (Figure 10): 44 bus excursions below 15 V , reaching **8.20 V**, with 2.4 A reconnect spikes and simultaneous both-channels-at-zero windows — the same total source-feed dropout signature as TP0010, at roughly three-quarters its event count and 1.6 V shallower minimum.

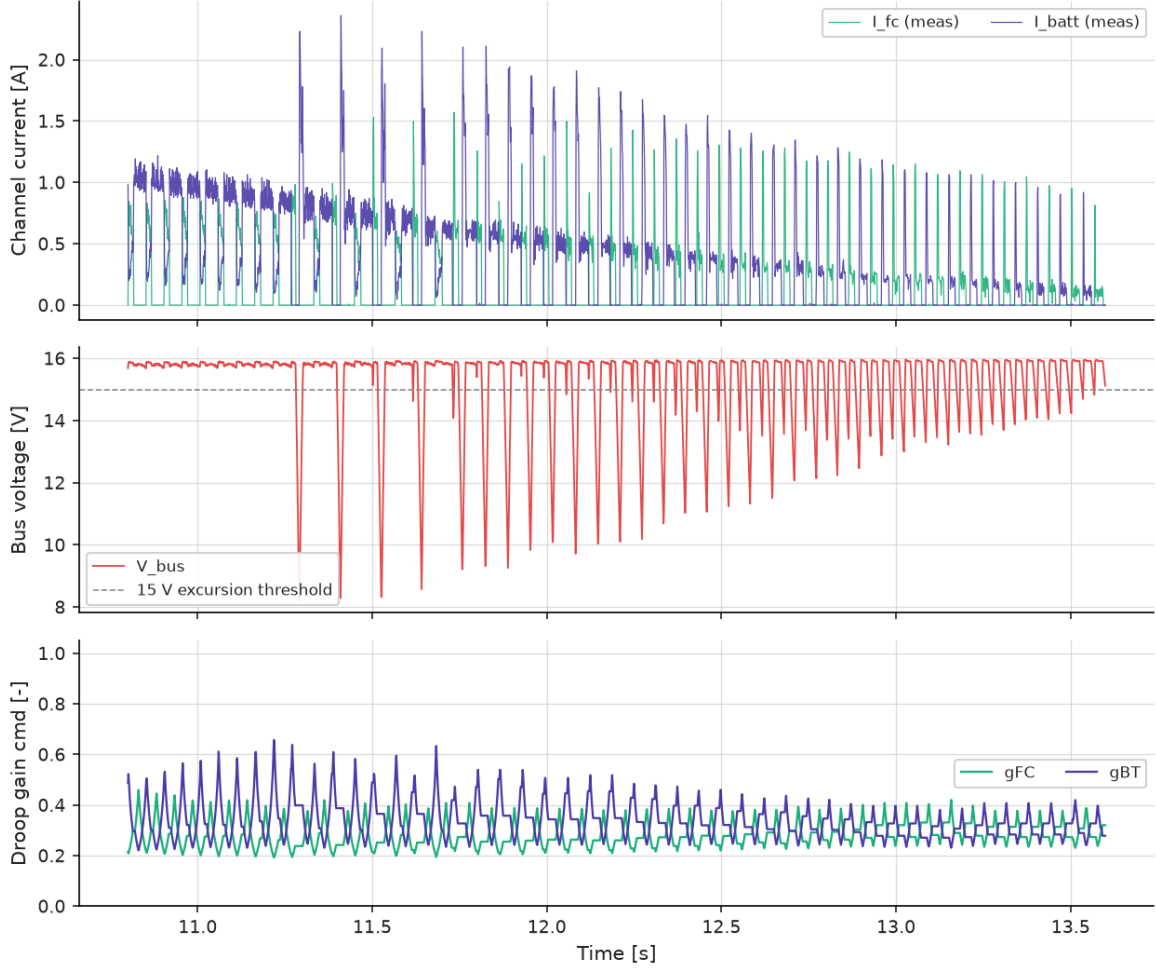


Figure 10: TP0016 ($r^* = 0.15$) ramp-down window. The limit cycle survives at the in-band boundary: mutually exclusive conduction with reconnect spikes to 2.4 A (top), bus collapse deepening to 8.2 V as commanded current falls (middle), and the droop-gain commands cycling in antiphase — now confined to 0.2–0.65 by the slew limiter rather than slamming rail-to-rail as in fw 0 (bottom).

Two independent quantities corner this setpoint. First, the governor floor at the hold’s 1.63 A is $0.20/1.63 = 0.122$, below the setpoint — so the governor correctly declines to clip, and the commanded minority current (0.245 A) is evidently still inside the dropout region: the empirical conduction floor lies between 0.245 A (cycles, this run) and 0.29 A (TP0017 at $r^* = 0.18$, clean). $I_{\min} = 0.20$ A therefore sits *on* the failure boundary rather than above it. Second, the commanded droop ratio in the hold tracks the setpoint to within 0.003 in every clean run, so $r^* = 0.15$ parks the actuator directly on the `DROOP_R_MIN` rail — TP0016’s minimum hold margin to the rail is +0.0005, inside the 0.01 cutoff re-entry hysteresis. Ignition coincides with the ratio touching the rail. Raising $I_{\min}$ alone addresses the first constraint; the second argues for narrowing the usable in-band span to approximately $[0.18, 0.82]$ independent of load.

5.4 The ungoverned setpoint window: TP0037, $r^* = 0.87$

TP0037 exposes a structural gap between the two mitigation paths. The setpoint 0.87 is outside the droop band, so the governor is bypassed by design — the cutoff path is assumed to own it. But

the cutoff fires on the *controller output* r , not on the setpoint, and the plant needs only $r \approx 0.84$ to realize a share of 0.87: extrapolating the clean runs' hold-window ratios (0.770/0.790/0.810/0.821 at $r^* = 0.80/0.82/0.84/0.85$) puts the required ratio just *below* the 0.85 cutoff threshold. The measured ratio confirms it: maximum 0.789, never crossing (Figure 11, bottom). Setpoint 0.87 is therefore governed by nothing and cut off by nothing, and it runs the original limit cycle unmitigated: 172 dropout–reconnect cycles at 19.5 Hz, the BT channel off the bus for $\approx 70\%$ of all loaded time at every current level — unlike fw 0, it does *not* self-clear above 1.2 A, because the ungoverned commanded minority current (0.13 of total) stays below the conduction floor at every point of this profile. Electrical severity stays low (bus ripple 0.33 V, spikes to 1.1 A), but the cycle is continuous. The unprotected window is approximately $0.85 < r^* \lesssim 0.88$, with a mirror on the low side — where it is compounded by a second mechanism: at $r^* = 0.12$ (TP0015) the controller output *does* cross the low threshold, the cutoff opens the FC switch, but the standing share error then winds the ratio back over the re-entry hysteresis and the loop *hunts* — duty-cycling FC_BUS_ENABLE at 19.8 Hz, about 190 ideal-diode switch cycles per 13 s run. The deep endpoints 0 and 1 (TP0014, TP0038) latch cleanly, because there the realized share equals the setpoint and the error vanishes: the hysteresis never re-arms.

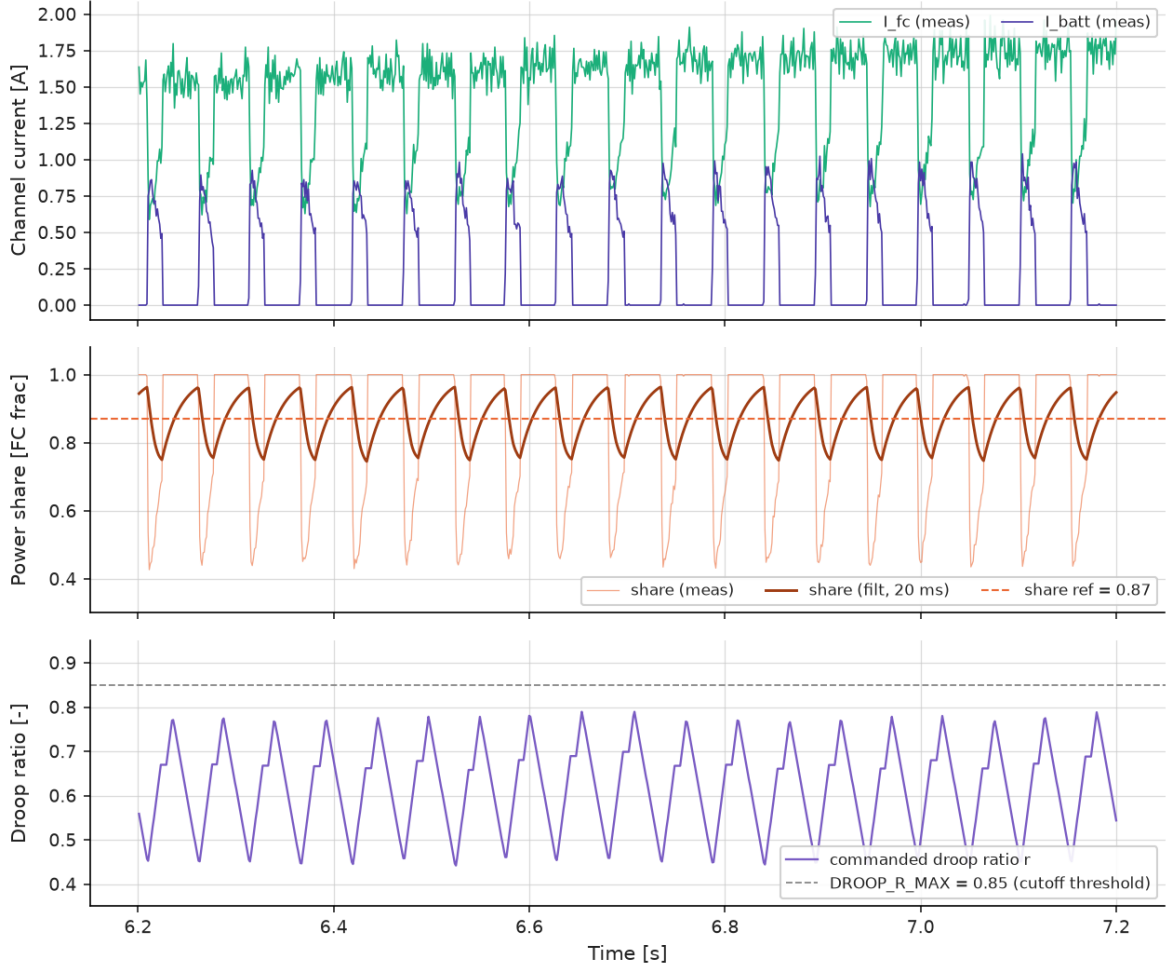


Figure 11: TP0037 ($r^* = 0.87$) during the 6 A hold: the unmitigated limit cycle in the ungoverned window. The BT channel duty-cycles at 19.5Hz (top), the filtered share saws around the setpoint (middle), and the commanded droop ratio sawtooths between 0.45 and 0.79 — never reaching the 0.85 cutoff threshold (dashed, bottom), so neither mitigation path ever engages.

5.5 WP0039: a brownout-terminated total-dropout ratchet

WP0039 (the first W combined profile, $I_{\max} = 5$ A) is the campaign’s one destructive-class event. The run is quiescent for 11.8s — total channel current 0.03–0.08 A despite motor commands up to 3.4 A, indicating the motor was not accepting load (cause unconfirmed; a VESC in its brownout band would fit) — and then enters a 34 Hz total source-feed dropout cut/retry cycle: both channels drop to zero simultaneously, the motor-node capacitance (≈ 1.6 mF inferred from the decay slope) discharges at ≈ 465 V/s, and one channel reconnects with a 1.4–3.2 A spike (Figure 12). The sag floor deepens monotonically from 13.9 V to 7.6 V over 89 cycles in 2.7 s, after which the bus enters free-fall and the log truncates mid-sample with no trailer — the signature of the board-powered Teensy browning out, not of an operator stop. No fault was latched at any point: the `BENCH_TEST` build arms overvoltage only, so 0.87 s of sub-14 V bus and ≈ 90 load-dump reconnects were invisible to `detectFaults()`. This is the capture-10/-12 event class (total source-feed dropout ratchet) rather than the minority-channel cycle the governor targets. One trigger correlation deserves a scope-armed re-entry: the share loop sat frozen below its 75 mA minimum-load threshold for the

whole quiescent stretch, unfroze at $t = 11.75$ s with a large standing error, and traversed the droop ratio at the full slew rate ($0.734 \rightarrow 0.394$ in ≈ 40 ms) — the first total dropout followed within 40 ms.

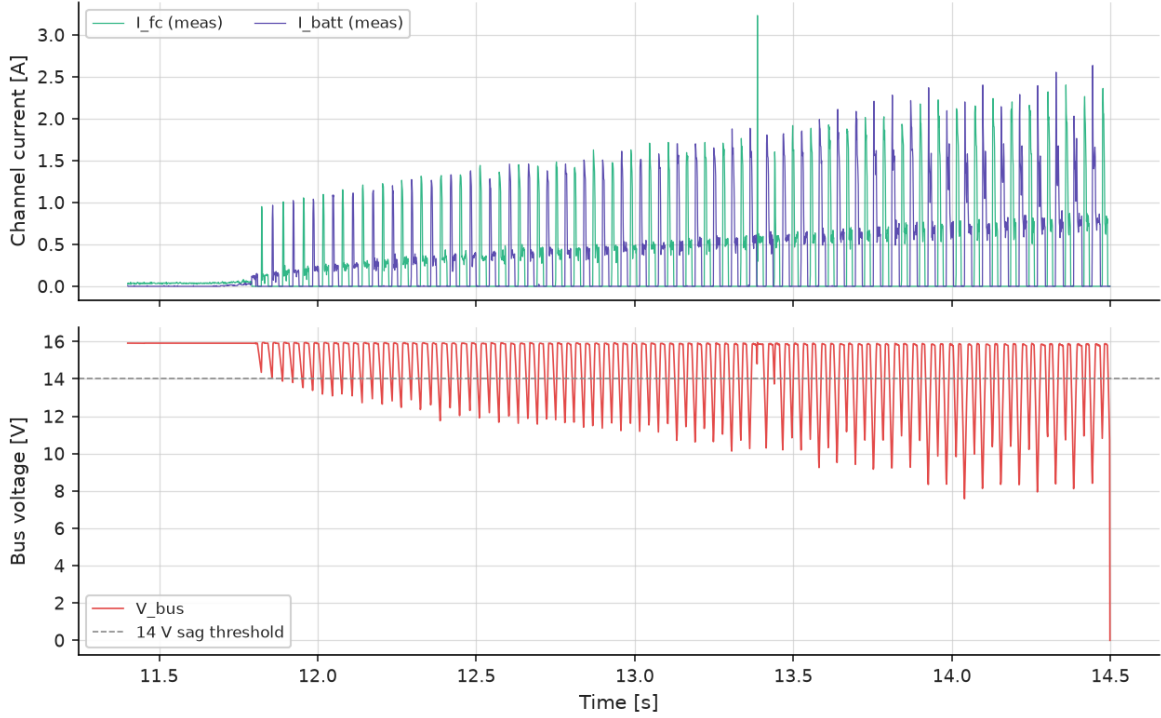


Figure 12: WP0039 final 3 s. Top: both channels drop out together and alternate 1.4–3.2 A reconnect spikes at 34 Hz. Bottom: the sag floor ratchets monotonically from 13.9 V to 7.6 V, then the bus free-falls and the log truncates mid-decay (no trailer) — consistent with an MCU brownout. `fault_flags` remained zero throughout.

5.6 Secondary observations from the validation campaign

TP0026 transient. The $r^* = 0.55$ run shows one brief total-dropout burst in the ramp-down tail: three cycles at ≈ 26 Hz over 71 ms at $I_{\text{cmd}} \approx 1.2$ A, with a single bus notch to 14.67 V. It is the same event class at roughly two orders of magnitude lower dose and did not recur at any neighboring setpoint; it is flagged for the boundary-mapping session rather than treated as a validation failure.

First-write MDAC step. WP0040 booted with both MDACs at code zero until the share loop’s first unfreeze at $t = 6.05$ s, whose first write is a ≈ 0.5 ratio jump that bypasses the slew limiter (it originates from the one-shot actuation path). Profile-entry reset does not force an MDAC write; runs inheriting gains from a prior run do not show the step.

Effective sample rate. Both campaigns log at ≈ 862 – 875 Hz (median interval 1.15–1.16 ms) against a 1 kHz nominal, with the decoder reporting zero missed periods — so the control tick itself, not the logger, runs $\approx 14\%$ slow. If confirmed, the effective slew limit is $\approx 17 \text{ s}^{-1}$ rather than the documented 20 s^{-1} ; the discrepancy is flagged for a firmware timing check.

6 Second validation sweep (firmware v4)

6.1 Mitigation set and sweep design

Firmware v4 implements the three actions recommended in Section 9 items 4–6. First, the governor floor `SHARE_MINORITY_I_MIN_A` rises from 0.20 to 0.30 A, above the (0.245, 0.29) A conduction bracket of Section 5.3; the collapse-to-0.5 threshold rises to 0.60 A of filtered total current accordingly. Second, the governor/cutoff structural gap closes with a *setpoint-latched cutoff*: any setpoint outside [0.15, 0.85] immediately opens the starved channel’s bus switch, freezes the share loop, and releases only on setpoint re-entry — replacing the output-ratio hysteresis that hunted at $r^* = 0.12$ and never fired at 0.87. Third, a persistence-filtered bus-undervoltage fault (`FAULT_UV_BUS`: 12.0 V limit, 10 ms plus three consecutive samples, 5 ms gap guard) is armed under `BENCH.TEST`.

The campaign comprises a 28-point trapezoid ladder (TP0041–TP0068, identical T 6 3 1 profile) spanning r^* from 0 to 1.0 with dense placement at both band edges and across 0.67–0.85, and five W combined profiles (WP0069–WP0073, $I_{\max} = 6$ A) that ladder the share-clip bound b from 0.35 down to 0.20. Six trapezoid runs latched `ERR_UV_BUS` and two W runs truncated without a trailer; the session structure matters for their interpretation. The first fault (TP0053, $r^* = 0.70$) struck on the thirteenth consecutive run of one automated session; the four bisection runs that followed (0.67–0.73) each ran on a fresh boot within 30 s of the previous fault’s power cycle. A source-state confound is therefore not excluded by the run order alone, but the bus at a fixed 2 A ramp point is 15.919–15.926 V across all 33 runs, and the mechanism evidence below does not require one.

6.2 The firmware v3 failure points are closed

Figure 13 summarizes the ladder. All three residual failure classes of Section 5 are eliminated:

- **Out-of-band hunting.** All seven out-of-band setpoints (0–0.12 and 0.88–1.0) latch once at the first loop tick and never cycle: the droop gains are constant from the first to the last sample, the cut channel’s current is pinned at the ADC noise floor, and the hysteretic event count is zero. At $r^* = 0.12$ the comparison against firmware v3 is 179 switch cycles to zero; at 0.88–0.90 (the former ungoverned window) it is a continuous 19.5 Hz limit cycle to a static latch. TP0066 (0.88) shows the one artifact of the scheme: its droop ratio inherited the previous run’s value, so the cutoff’s one-shot target landed 3.2 s into the run with a single 4.5 ms bus dip to 15.04 V — a one-shot settling transient, not a cycle.
- **The band edge.** TP0045 ($r^* = 0.15$), the firmware v3 bus collapse, is clean: zero dropout events, bus minimum 15.75 V, and the commanded minority current bottoms at exactly 0.3000 A — the raised floor holding on its design boundary. Measured share tracks the reconstructed governed setpoint with residual 0.0001 ± 0.019 , against an apparent raw-setpoint “error” of +0.137 that is entirely governor action.
- **The governed band.** Every completed in-band run tracks with hold bias below 10^{-3} where the governor is inactive, and matches the reconstructed clip elsewhere; the W profiles reproduce the governor law with residuals ≤ 0.0019 at every non-cycling region and respect the slew ceiling exactly (maximum per-record step 0.020000). The TP0026-class ramp-down burst did not recur at any setpoint.

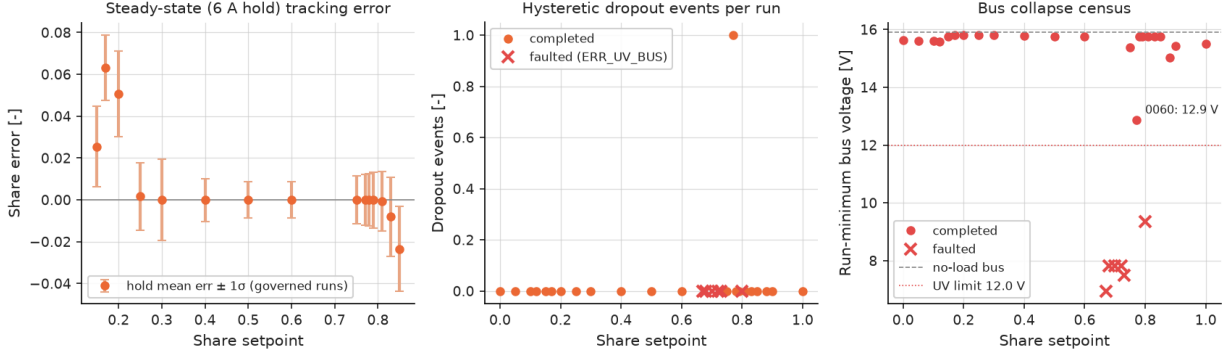


Figure 13: Firmware v4 ladder summary, TP0041–TP0068. Left: hold-window tracking error of the governed (in-band, completed) runs; the non-zero means at 0.15–0.20 and 0.83–0.85 are the raised governor floor clipping at hold, not loop error. Center: hysteretic dropout events — zero everywhere, including the six faulted runs, whose relay cycle never co-conducts and is therefore invisible to a minority-dropout counter. Right: run-minimum bus voltage; crosses mark the six `ERR_UV_BUS` latches, and TP0060 is the surviving near-miss at 12.9 V.

6.3 A new failure mode: the source-commutation relay cycle

Six runs at fuel-cell-heavy setpoints latched `ERR_UV_BUS` (Table 2), at setpoints that were clean on firmware v3. The mechanism is not the minority-channel dropout cycle: the channels *alternate exclusive ownership* of the bus. Figure 14 shows TP0053. One channel conducts alone for tens of milliseconds while its droop gain climbs; at a reproducible commanded-ratio threshold, ownership commutates through a 7–12 ms window in which *both* channels read zero and the ≈ 1 mF motor node discharges unopposed; the other channel then reconnects with a 2–3 A burst and the pattern mirrors. The full period is 16–20 Hz. Because co-conduction never occurs, the hysteretic minority-dropout counter of Figure 13 reads zero for these runs — the counter discriminates the two topologies.

Table 2: The six `ERR_UV_BUS` runs. “Relay onset” is the first exclusive-conduction handoff; “first <12 V” is the first bus sample under the fault limit; “latch delay” is from that sample to the end of the log.

Run	r^*	Relay onset [s]	First <12 V [s]	$V_{\text{bus min}}$ [V]	Latch delay [ms]
TP0055	0.67	3.48	3.96	6.95	1029
TP0054	0.68	3.30	3.88	7.83	1007
TP0053	0.70	3.54	3.93	7.82	1320
TP0056	0.72	3.47	3.88	7.83	1164
TP0057	0.73	3.39	3.87	7.49	1289
TP0059	0.80	4.08	4.38	9.35	413

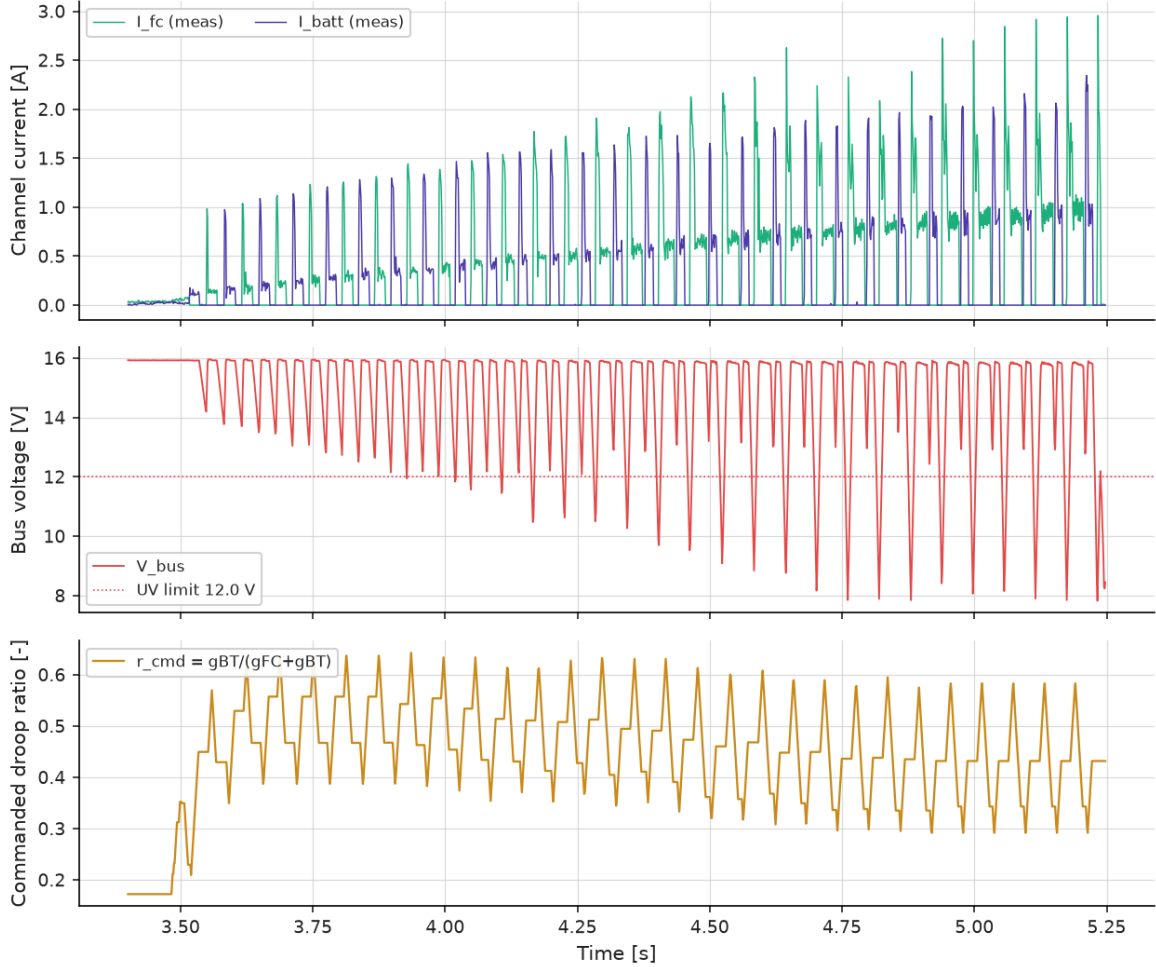


Figure 14: TP0053 ($r^* = 0.70$): the source-commutation relay cycle. Top: FC and BT alternate exclusive conduction with 2–3 A reconnect bursts; co-conduction never occurs. Middle: each both-channels-off handoff window discharges the motor node, and the troughs walk monotonically down through the 12 V fault limit as the load ramp steepens the discharge slope. Bottom: the commanded droop ratio sawtooths between reproducible commutation thresholds at the slew-limited rate.

The entry condition is the governor’s own fallback. The share loop wakes at `SHARE_I_TOT_MIN_A` = 0.075 A of total current, and the governor filter — reset at profile start — reads well under the 0.60 A collapse threshold, so the effective setpoint is 0.5 in every run at wake. At 0.1–0.5 A of total current, however, a 0.5 split commands 0.05–0.25 A per channel — *below the 0.30 A floor the governor exists to enforce* — against a droop authority of order 20 mV, which the channel offset voltage ΔV_0 exceeds. The split is physically unachievable; the controller saturates at the slew limit and commutates ownership instead of sharing. The collapse-to-0.5 fallback therefore commands, throughout the window $0.075 \leq I_{\text{tot}} \leq 0.60$ A, exactly the class of infeasible split whose avoidance is its purpose.

Why firmware v3 survived the identical setpoints and profile (TP0029–TP0033: zero events) is not settled. The leading candidate — **unconfirmed** — is the floor increase itself: on the fuel-cell-heavy side the raised clip demands 50 % more minority current through the whole escape window (at 0.6 A filtered total, v3 asks the battery channel for 0.20 A, v4 for 0.30 A), which plausibly explains failure to escape rather than entry. The asymmetry fits: below $r^* = 0.5$ the collapse pulls

toward the fuel-cell-dominant natural topology and all twelve runs are clean; the boundary within 0.67–0.81 is sharp but not monotonic (0.75 and 0.77–0.79 survive between faults at 0.73 and 0.80). TP0060 ($r^* = 0.77$) is the diagnostic near-miss: it entered the same relay at $t = 3.68$ s, ratcheted the bus to 12.88 V — 0.88 V above the limit — and escaped cleanly at $t = 3.92$ s once total current reached ≈ 0.25 A and droop authority overcame ΔV_0 , then tracked its setpoint without incident for the remaining eleven seconds.

6.4 The undervoltage fault: correct, and too slow for this waveform

The new fault behaved exactly as specified in all six events: raw `fault_flags` indication from the first sub-12 V sample, one clean latch, no re-arm, `close_reason=fault` with `error_code=9`. The specification, however, is mistuned for the relay waveform. The cycle holds the bus under 12 V for ≈ 9 ms and above it for ≈ 51 ms; each excursion falls just short of the 10 ms persistence window, and each 51 ms gap exceeds the 5 ms gap guard and resets the accumulator. The runs therefore endured 1.0–1.3 s and up to 24 excursions — to minima of 6.95 V — before a window finally bridged (TP0059 latched in 413 ms only because its final excursion never recovered). The filter also proved its other edge: WP0069 logged a genuine transient (13 both-channel dropout events over 208 ms, bus to 11.56 V, longest under-run 2.3 ms) that set the raw flag on seven samples and correctly did *not* latch, and the run completed. Recommended retuning: accumulate under-limit dwell in a leaky integrator (or extend the gap guard beyond one relay period ≈ 60 ms) so a repeating sub-limit waveform latches within a few cycles, while a single 2 ms notch still passes.

6.5 W-profile boundary: the floor law fails at higher load, and the MCU dies upstream of the bus

The five W runs ladder the clip bound b : 0.35, 0.30, and 0.25 complete cleanly; 0.20 and 0.22 truncate mid-run with no trailer — both at the same profile boundary, 18.470 and 18.477 s, where region R6 (share setpoint at the $1 - b$ bound, 6 A command) hands off to R7. Figure 15 shows the failure boundary directly: at $b = 0.25$ (setpoint 0.75, commanded minority 0.399 A) region R6 is a crisp step; at $b = 0.22$ (setpoint 0.78, commanded minority 0.381 A) the battery channel chops at 18.7 Hz for the full region. The clean/cycling bracket (0.381, 0.399) A sits *above* the 0.30 A floor — and above the firmware-v3 bracket (0.245, 0.29) A measured at ≈ 1.6 A total. A single constant-current floor cannot satisfy both datasets. Either the floor scales with total current (a ripple-clearance reading) or the true limit is a minority *fraction* of approximately 0.22–0.25, in which case the usable droop band is nearer [0.25, 0.75] than [0.15, 0.85]. The two readings are inseparable in this data — total current spanned only 1.59–1.73 A across the boundary — and a two-axis sweep ($I_{\max}$ at fixed setpoint, setpoint at fixed $I_{\max}$) is the highest-value next bench session.

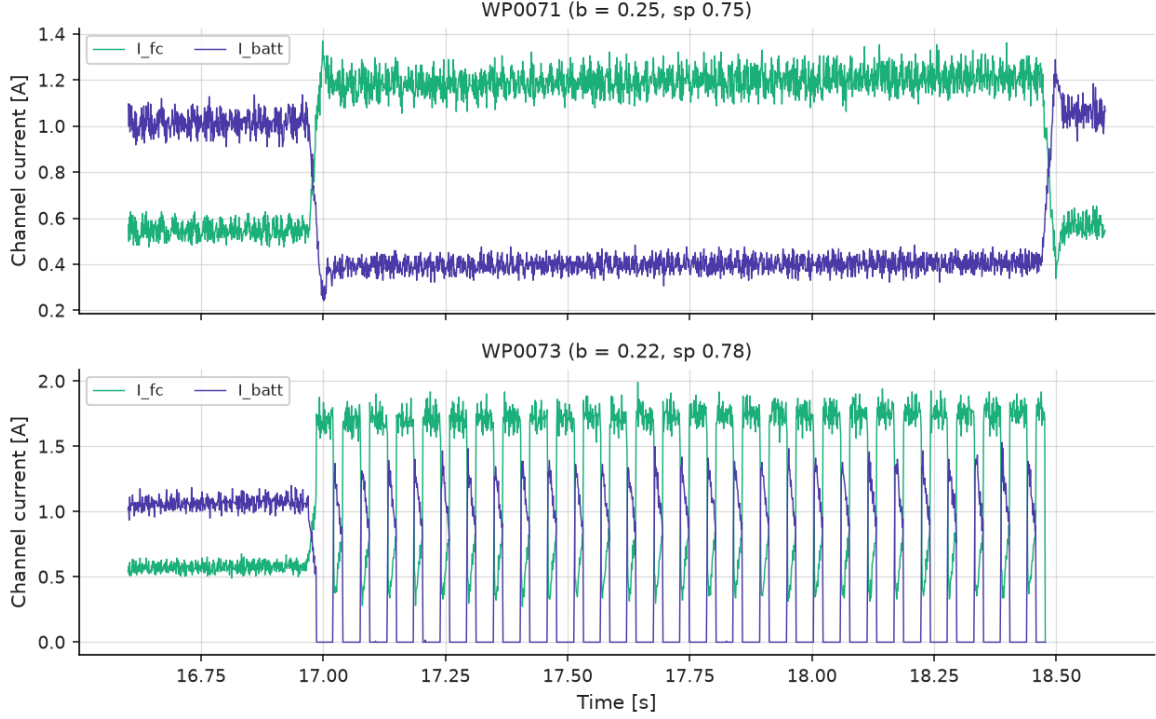


Figure 15: The floor-law failure boundary in region R6 of the W profile (share setpoint steps to $1 - b$ at 6 A command). Top: WP0071 ($b = 0.25$, commanded minority 0.399 A) — a clean step and steady co-conduction. Bottom: WP0073 ($b = 0.22$, commanded minority 0.381 A) — an 18.7 Hz single-channel dropout cycle for the entire region; the log truncates at 18.48 s.

The limit cycle itself (Figure 16) is the classical minority-dropout topology of Section 3, with one new observation: its frequency is set by the slow limiter. The commanded ratio traverses a 0.48-wide triangle at 0.02 per tick — 27.9 ms per leg, a 55.8 ms period — matching the observed 53.9 ms. The firmware-v2 slow limit converts the original bang-bang instability into a bounded triangle oscillation; it does not suppress it.

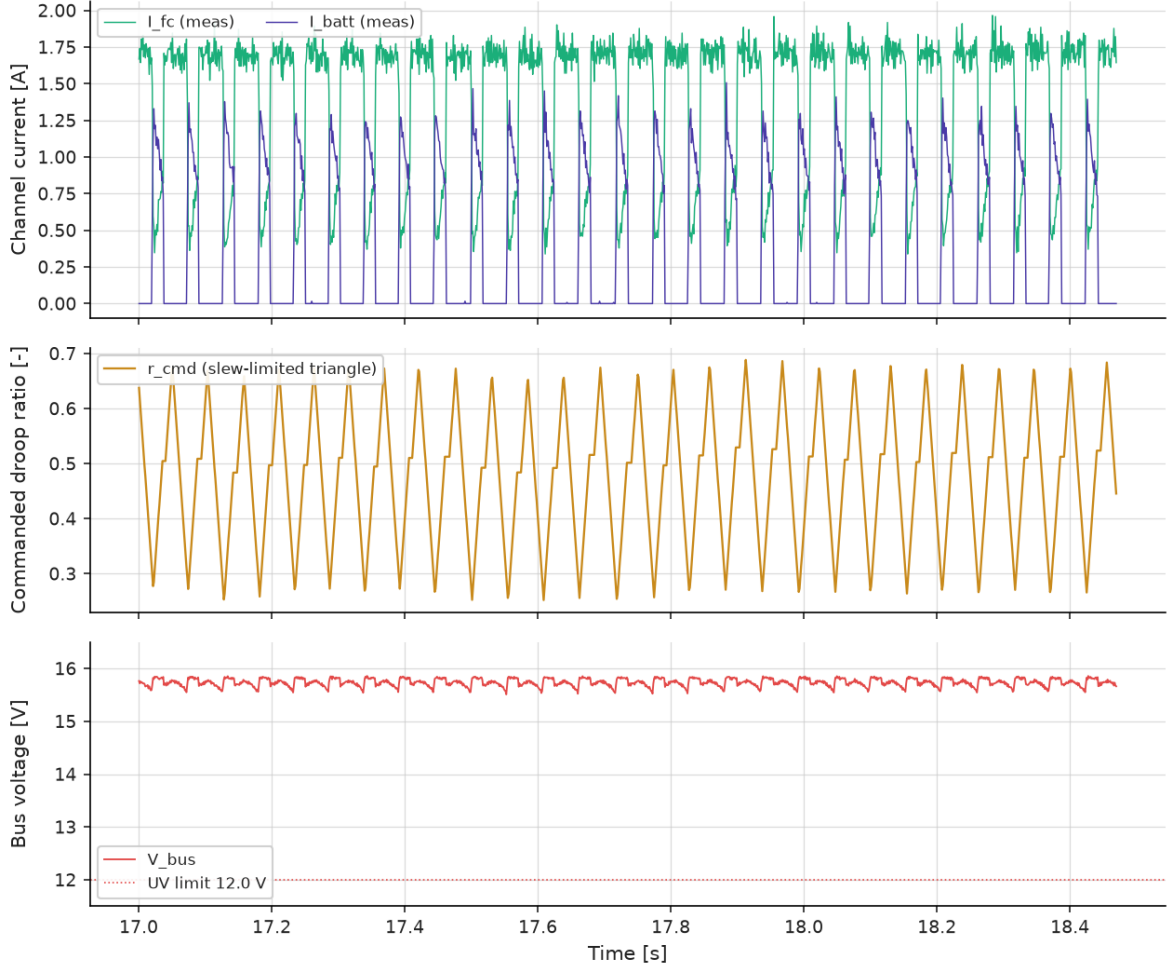


Figure 16: WP0072 ($b = 0.20$), final 1.5 s before truncation. Top: the battery channel drops and reconnects at 18.7 Hz while the fuel-cell channel absorbs the full load. Middle: the commanded droop ratio is a slew-rate-limited triangle — the 0.02-per-tick limit sets the 54 ms period. Bottom: the bus never leaves regulation (ripple 0.35 V, minimum 15.51 V); the MCU brownout that truncates the log is invisible on every logged channel.

The truncations themselves are the campaign’s most consequential result. In both runs the bus was in regulation at 15.7 V at the final record, `fault_flags` was zero throughout, the sample interval was nominal to the last sample, and the gains were still slewing — no fault latched, and no electrical precursor appears on any logged channel. The MCU (board-powered through the LM1084 from the battery source rail) browned out from an *upstream* collapse that the bus-referenced undervoltage fault is structurally incapable of observing. The reboot is confirmed by `start_millis`: WP0073 began 19.6 s after WP0072’s power cycle. Both deaths within 12 ms of the same region boundary — with the reconnect burst still 8–15 ms away — implicate the setpoint step itself, through a channel this log does not instrument. Two actions follow: instrument the source rails (the BT.VOLTAGE ADC input exists and is not logged) and consider a source-rail undervoltage fault; and scope VBT and the LM1084 input across an R6→R7 step before further $b \leq 0.22$ runs.

7 Third validation sweep (firmware v5)

7.1 Mitigation set and sweep design

Firmware v5 implements the three actions recommended in Section 9 items 9, 11, and 12. First, the governor’s collapse-to-0.5 fallback is deleted. The loop is now bimodal on the filtered total current: closed-loop control engages above 0.60 A and releases below 0.55 A. Below the threshold the loop runs *open-loop*: if closed-loop control has not yet run, the raw in-band setpoint is fed forward through the 0.02-per-tick slew limiter; otherwise the last applied ratio is held frozen. Out-of-band setpoints are never actuated by the feedforward. Second, the undervoltage persistence window is replaced by a *leaky dwell integrator*: time under 12.0 V accumulates at full rate (capped at 5 ms per tick), time above it leaks off at 5 %, and 20 ms of net dwell latches the fault. Third, the log format now records the four source-side rails (FC_VOLTAGE, BT_VOLTAGE, CHG_VOLTAGE, RGN_VOLTAGE) at the full 1 kHz rate, closing the instrumentation gap identified after the firmware v4 brownouts.

The campaign comprises a 21-point trapezoid ladder (TP0074–TP0094, identical T 6 3 1 profile) run as two automated batches within one boot — setpoints 0 to 0.50 ascending, then 0.90 down to 0.60 — and seven W combined profiles (WP0095–WP0101, $I_{\max} = 6$ A) at share-clip bounds $b = 0.30, 0.20, 0.15$ ($\times 3$), and 0 ($\times 2$). The bound b is not recorded in the log header; it is recovered here from the clipped setpoint itself, $b = 1 - \max(\text{share_sp})$, a method that reproduces both operator-confirmed labels. Every trapezoid run completed cleanly. Five of the seven W runs failed at the same profile event (Section 7.3); each failure forced a power cycle, so WP0097–WP0101 are single-run or short fresh-boot sessions.

7.2 The trapezoid ladder is clean end to end

Figure 17 summarizes the ladder: 21 of 21 runs complete, zero fault flags in every sample, and no bus sample below 14.89 V anywhere in the campaign. The firmware v4 relay region is closed. Table 3 compares the four relay-cycle setpoints directly.

Table 3: The firmware v4 relay-cycle setpoints, re-run on firmware v5. Firmware v4 columns aggregate TP0053–TP0057 and TP0059; firmware v5 columns are TP0090–TP0093.

Metric	firmware v4	firmware v5
Faults	ERR_UV_BUS, every run	none
Bus minimum	7–9 V	15.71–15.73 V
Exclusive-conduction fraction	≈ 100 %	0 %
Both-channels-off gaps in hold	7–12 ms, repeating	none ≥ 3 ms
Commutation signature	16–20 Hz	no 14–24 Hz spectral peak
Hold-window share error (mean)	undefined (commutating)	$\leq 3 \times 10^{-5}$

Tracking bias in the 6 A hold window is below 10^{-3} at every in-band setpoint from 0.18 to 0.82. The two band-edge runs show the governor clip, not a tracking failure: at $r^* = 0.15$ the floor raises the effective setpoint to 0.169 and the measured share lands $+1.5 \times 10^{-3}$ from it ($+0.020$ from the raw value); at $r^* = 0.85$ the clip is active in the other direction (-0.013 from the raw value). The five out-of-band runs ($r^* \in \{0, 0.10, 0.12, 0.88, 0.90\}$) latch a hard single-channel cut: the starved channel’s measured current is exactly zero for the whole run, the controller stays frozen, and the isolated dropout-counter events in Figure 17 are threshold-crossing artifacts at the ramp edges, not cycling. The spectral check is negative everywhere: over every hold window the 14–24 Hz band

carries 4–6 % of the residual energy with no peak.

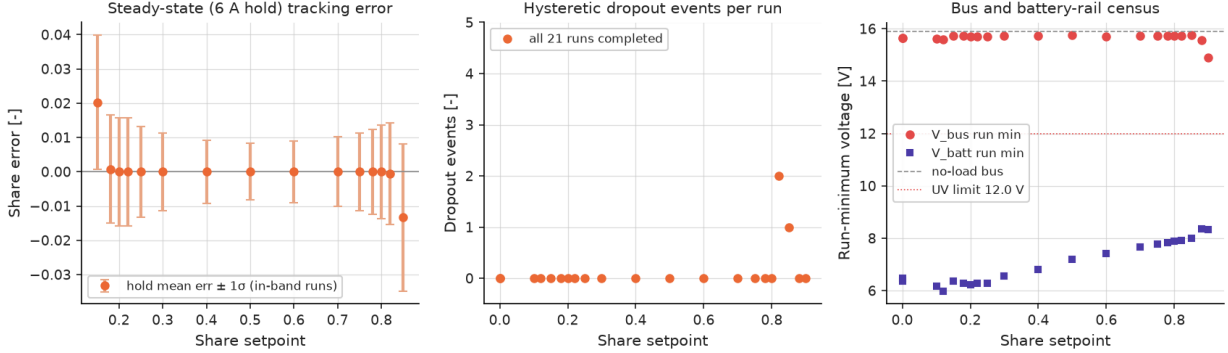


Figure 17: Firmware v5 trapezoid ladder (TP0074–TP0094). Left: hold-window tracking error versus the raw setpoint; the two outliers at 0.15 and 0.85 are the governor clip acting as designed. Center: dropout events; the two nonzero counts (1 at 0.85, 2 at 0.82) are ramp-edge threshold crossings, with zero events inside any hold window. Right: run-minimum bus and battery-rail voltages; the battery rail dips lowest where the battery is the sole source (setpoints ≤ 0.12), reaching 5.98 V at $r^* = 0.12$.

The governor’s new machinery is directly observable in the logs. The open-loop feedforward appears as an exact 0.02-per-tick staircase that lands on the raw setpoint to four decimal places; each run inherits its predecessor’s final ratio as the staircase seed, confirming that the slow tracker survives the per-profile state reset as designed. Every in-band run shows exactly two mode edges — closed-loop entry at 0.60–0.73 A of total current on the ramp-up, release to hold at 0.40–0.52 A on the ramp-down — with zero chatter, and the held ratio is frozen to numerical exactness for the remaining 2.5 s of every run.

Three residual observations temper the pass. First, the open-loop feedforward applies the *raw* setpoint while closed-loop control applies the *floor-clipped* setpoint, so the handover at 0.60 A commands a discontinuous step; at $r^* = 0.15$ the effective setpoint jumps from 0.15 to 0.50 and roughly 0.25 A commutates between the sources over ≈ 17 ticks. No run showed any consequence, but the step is unnecessary — the clip can be applied to the feedforward as well. Second, the floor bounds the commanded minority current only: measured minority current dips to 0.193 A at $r^* = 0.15$ and 0.20–0.24 A at 0.82–0.85, inside the old cycling bracket, without igniting anything. Third, the battery rail is the soft one (≈ 0.9 – 1.0 V/A source slope, versus ≈ 0.28 V/A for the fuel-cell side), and battery-sole-source runs push it hardest: $r^* = 0.12$ reached 5.98 V and the $r^* = 0$ repeat spent 3.6 s below 7.0 V. These runs are the brownout-risk case for any higher-current session.

7.3 The R6 share-bound excursion is the W-profile failure generator

All five W failures occur at the same profile event: entry into region R6 at $t \approx 17.0$ s, where the profile steps the share command to 1.00 (clipped to $1 - b$) while the motor axis remains at the full 6 A command — the only region that combines peak load with an extreme share. Nothing about the current command changes at the boundary; the share step alone is lethal, and its severity is ordered monotonically by the clipped target (Table 4).

Table 4: W-profile outcomes, firmware v5, ordered by the R6 clipped setpoint $1 - b$. Total current entering R6 is 1.8–2.0 A in every run. “Time in R6” is from region entry to the last record.

Run	b	R6 target	R6 behaviour	Outcome	Time in R6
WP0095	0.30	0.70	converges, minority 0.54 A	complete	(full 1.5 s)
WP0100	0.15	0.85	18.8 Hz dropout cycle, 28 episodes	complete	(full 1.5 s)
WP0096	0.20	0.80	dropout cycle, 4 episodes	truncation	197 ms
WP0098	0.15	0.85	dropout cycle, 2 episodes	truncation	86 ms
WP0099	0.15	0.85	dropout cycle, 5 episodes	truncation	254 ms
WP0097	0	1.00	setpoint latch cuts BT under load	ERR_UV_BUS	43 ms
WP0101	0	1.00	setpoint latch cuts BT under load	ERR_UV_BUS	39 ms

Target 0.70: feasible. WP0095 converges to $r \approx 0.68$ with the battery channel at 0.54–0.68 A and completes the region with a flat bus. No incipient cycling is visible at any sensitivity.

Targets 0.80–0.85: the firmware v4 dropout cycle, in band. The setpoint is inside $[0.15, 0.85]$, so no latch fires and the closed loop stays live. The equilibrium it is asked for is infeasible, and the loop limit-cycles: the battery channel stops conducting, the controller walks the ratio back down at the slew ceiling, the channel reconnects, and the cycle repeats at 18.8 Hz — the period set by the 0.02-per-tick limit walking the ratio triangle (Figure 18). This is the firmware v4 pre-brownout mode, not the relay cycle: the fuel-cell channel conducts continuously and there are no both-off gaps. The governor is structurally inert here — at 2 A total the floor clips only outside $[0.15, 0.85]$, so targets 0.80 and 0.85 pass through unmodified — and the channel drops out at a *commanded* minority current of 0.55–1.04 A, two to three times the 0.30 A floor.

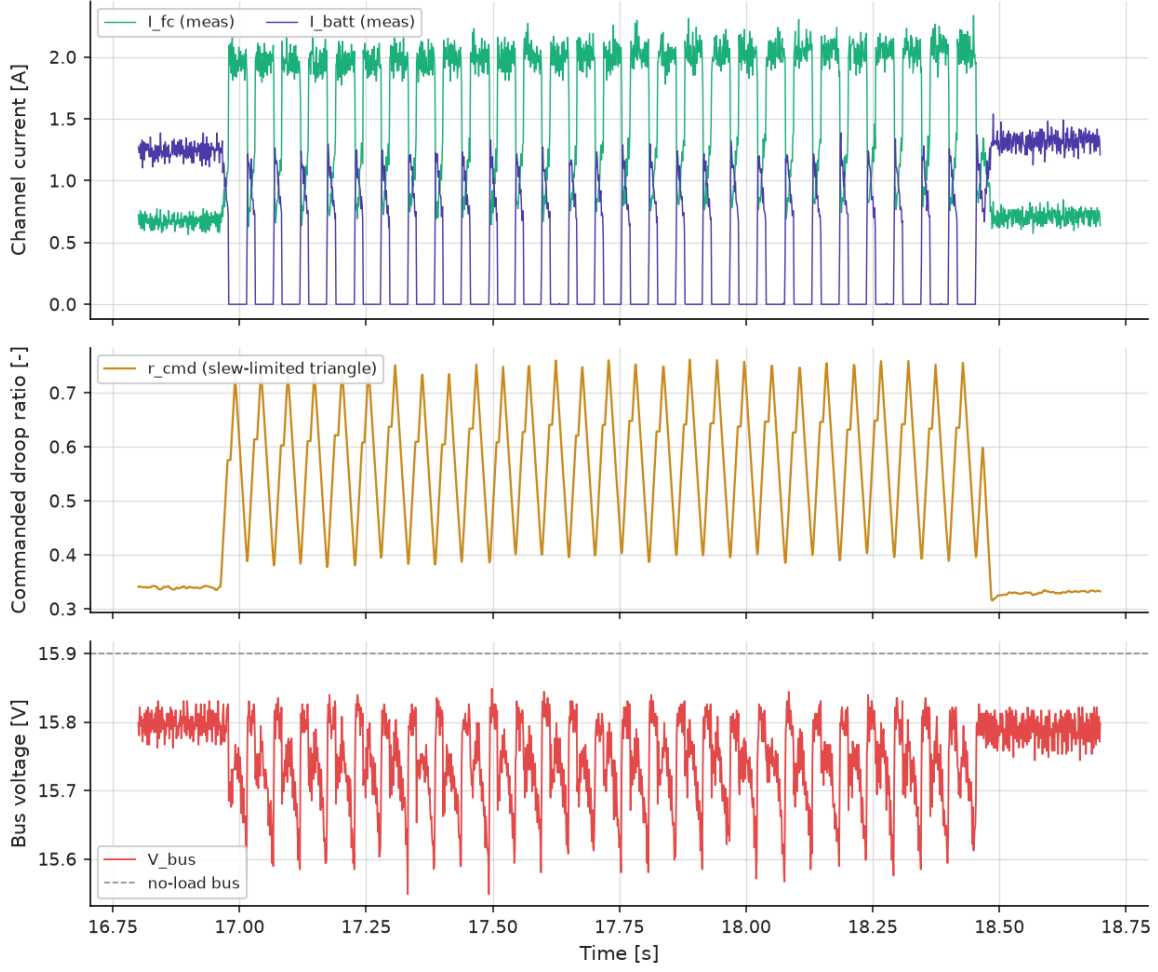


Figure 18: WP0100 ($b = 0.15$), region R6. Top: the battery channel drops out and reconnects 28 times at 18.8Hz while the fuel-cell channel carries the full ≈ 2 A. Middle: the commanded droop ratio is the slew-limited triangle between ≈ 0.39 and ≈ 0.75 . Bottom: the bus notches by ≈ 0.25 V per episode but never approaches the 12 V limit. The cycle self-terminates the instant R7 steps the setpoint back to 0.35.

Whether a run at target 0.80–0.85 survives is decided not by the cycle itself but by the fuel-cell source. During each battery-off half-cycle the fuel-cell input carries the whole load, and the source exhibits a hard knee at ≈ 2.1 A: WP0100 ran 28 consecutive solo episodes at 1.96–2.08 A with the rail flat at 7.8 V, while WP0096, WP0098, and WP0099 drew 2.11–2.19 A and the rail collapsed within two to five episodes (Figure 19). Roughly 0.1 A of motor load separates the clean run from the three deaths. Once the rail falls, the boost demands more input current to hold the bus — logged fuel-cell current spikes reach 6.1 A as the rail passes below 5 V — a positive-feedback source-collapse runaway. Whether the knee is bench-supply current foldback or source droop is not distinguishable from the logs.

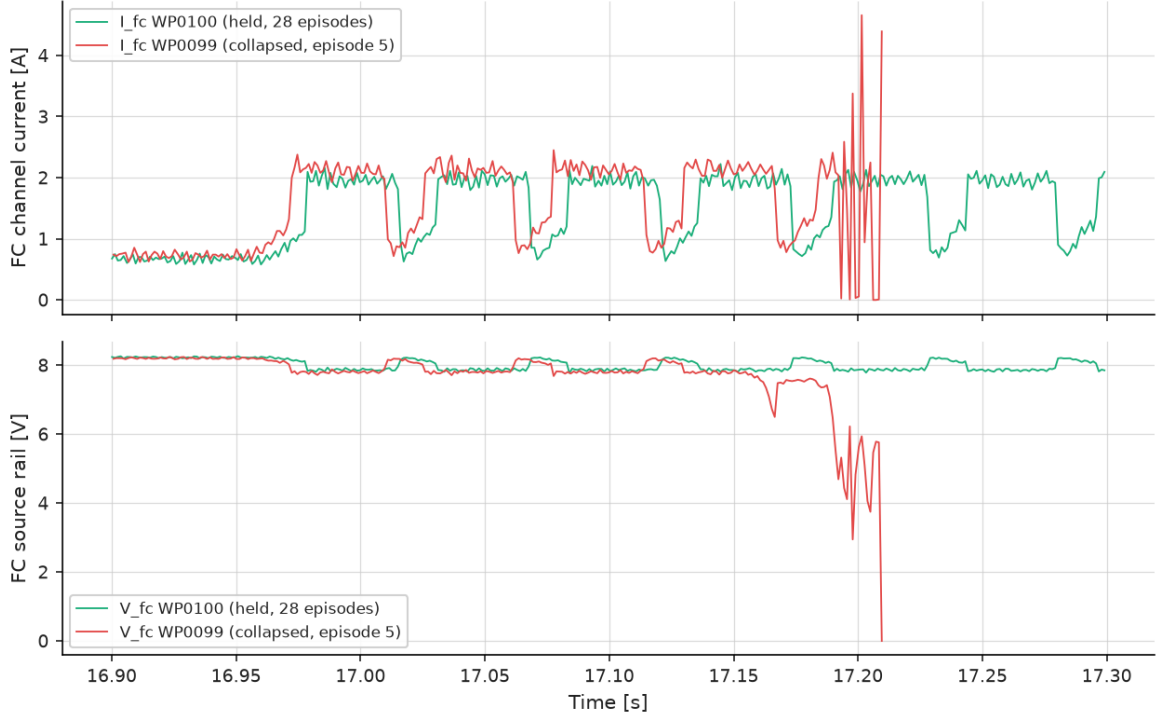


Figure 19: The fuel-cell source knee. WP0100 (green) and WP0099 (red) run the same $b = 0.15$ profile; their solo-episode fuel-cell currents differ by ≈ 0.1 A. WP0100 holds 7.8 V through 28 episodes; WP0099’s rail collapses on its fifth episode and the input current runs away.

Target 1.00: the setpoint latch becomes the killer. With $b = 0$ the R6 command exceeds `DROOP_R_MAX`, and the setpoint-latched cutoff — introduced in firmware v4 to *prevent* switch cycling — opens the battery bus switch in one tick under 2 A of load (Figure 20). The battery current steps to zero in one sample and its rail rebounds to the unloaded 8.4 V; the fuel-cell source, alone above its knee, collapses from 7.8 V through 3.4 V within 23 ms; the bus falls out of regulation and the undervoltage fault latches. Both $b = 0$ runs die this way in under 45 ms — the fastest failure in the campaign, and a direct demonstration that an under-load channel cut is itself a hazardous actuation when the surviving source cannot carry the total.

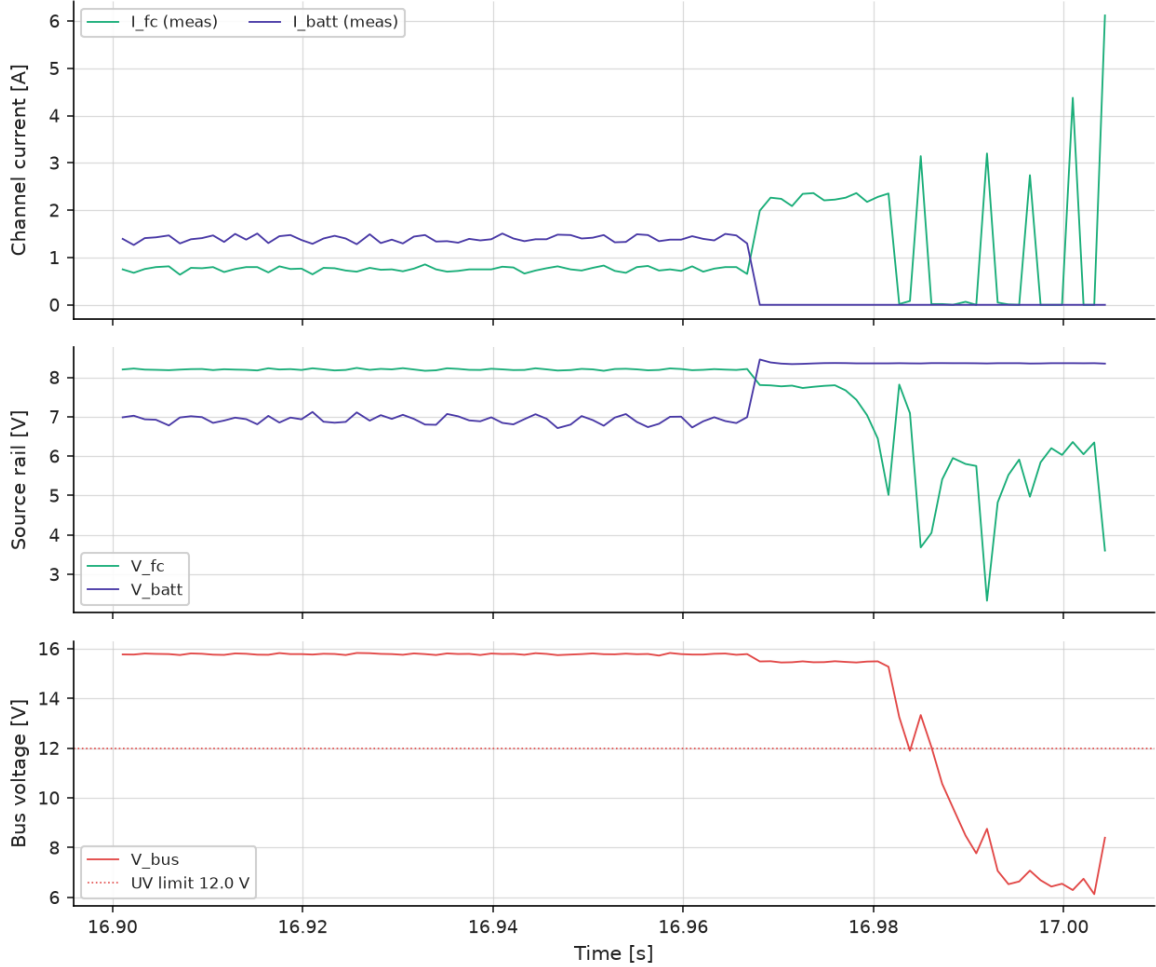


Figure 20: WP0101 ($b = 0$), R6 entry. Top: the setpoint latch cuts the battery channel in one sample; the fuel-cell channel steps to the full load and then runs away as its source collapses. Middle: the battery rail rebounds to its unloaded 8.4 V — the battery is healthy and disconnected — while the fuel-cell rail falls to 2.3 V. Bottom: the bus leaves regulation ≈ 15 ms after the cut and the dwell-filtered undervoltage fault latches ≈ 20 ms later.

7.4 The dwell filter is vindicated; the source rail is still unguarded

The reworked undervoltage filter performed exactly as designed. In both ERR_UV_BUS runs the reconstructed dwell integrator crosses 20 ms within 18–21 ms of the first sub-12 V sample — against 1.0–1.3 s of evasion for the firmware v4 window on the same class of waveform. No spurious latch occurred anywhere in the 28-run campaign.

The three truncation runs, however, beat the filter by dying upstream of it. In WP0096 and WP0098 the bus had spent only 3.4 ms below 12.0 V when the MCU stopped; four samples earlier it was in regulation at 15.7 V. The fuel-cell rail tells the real story the bus cannot: it had been below 7 V for ≈ 10 ms and below 5 V for ≈ 3 ms while the bus still read 15.7 V. A source-rail undervoltage fault — the action deferred from the firmware v4 round — would have latched WP0098 roughly 7 ms before the bus moved at all. The new rail logging also overturns the working hypothesis for the MCU stops: the battery rail read 8.37, 8.37, and 7.89 V at the three truncation instants — unloaded in two of them — so a battery-rail brownout through the logic regulator is unsupported

at the 870 Hz log rate. The stop mechanism is therefore unconfirmed; either a sub-millisecond transient invisible to the log, or a path other than the battery rail, stops the processor. Oscilloscope captures 13 and 14 (taken under the WP0101 condition) corroborate the logged chronology — the battery current envelope collapses in one step, the battery rail recovers upward to 8.4 V, and the motor node decays 15.9 to 8.4 V over 19.4 ms — and capture 14 additionally resolves what the log cannot: late in the decay, as the motor node falls through the battery-rail level, the battery rail dips ≈ 0.9 division below its 8.4 V baseline at 5 V per division — to ≈ 4 –5 V — for under a millisecond, within ≈ 2 ms of a full-scale battery-current spike. A battery-rail transient of that depth is below the LM1084 dropout for the logic rail, and its sub-millisecond width is invisible at the 870 Hz log rate — which reconciles the healthy logged battery rail with the observed stops. The inferred mechanism (the collapsing node reaching the battery rail and drawing reconnect inrush through the source impedance) is unconfirmed; the settling measurement is a capture on the LM1084 input and output through a truncation event.

7.5 The floor law, revisited with source-rail data

The W cluster sharpens Section 9 item 11 into a structural statement: no absolute-current floor can separate the stable region from the cycling region, because the boundary is not a current level. WP0100 dropped out 28 times at a cycle-averaged operating point — 15.81 V bus, 0.69 A battery current — that is indistinguishable, to within 27 mV of bus voltage, from the point WP0095 held stably for the full region. At 0.7 A the droop offset is only ≈ 0.23 V, and the measured channel-offset envelope $\Delta V_0 = \pm 0.10$ V is 40 % of that authority, so conduction is decided by a sub-100 mV race between the bus and the starved channel’s effective reference. The effect is also one-sided: the fuel-cell channel held 0.63–0.72 A as the minority in regions R5 and R7 of every run with zero dropouts, while the battery channel dropped out at 0.55–1.04 A. The asymmetry implicates a channel-specific offset (the ΔV_0 sign, the battery channel’s compensator rework, or layout) rather than a symmetric conduction floor, and the corrected mitigation should be referred to the bus-versus-reference margin, not to a current constant. The two-axis sweep recommended previously should therefore be run per channel direction.

8 Fourth validation sweep (firmware v6)

8.1 Mitigation set and sweep design

Firmware v6 implements five changes derived from Section 7. First, a *load-aware handoff guard* conditions the setpoint-latched channel cutoff on the current carried by the channel about to be cut: above $I_{\text{handoff}}^{\text{max}} = 0.50$ A the cut is refused and *deferred*, the closed-loop reference is clipped onto the band edge to migrate the load away, and the ratio-based cutoff is suppressed on that side. Second, a dwell-filtered fuel-cell undervoltage fault is added (trip 6.0 V, arm 7.0 V, 20 ms dwell), placed above the bus undervoltage block so that a simultaneous crossing names the upstream cause. Third, the closed-loop reference itself is slew-limited at 0.02 per tick, removing the step that the open-loop-to-closed-loop handover previously applied. Fourth, the W profile regions R5–R7 are de-rated: the share-bound excursion R6 now runs at $0.3 I_{\text{max}}$ instead of full command. Fifth, the log header records the per-run profile parameters I_{max} and the share-clip bound b directly.

The campaign comprises a 19-point trapezoid ladder (TP0102–TP0120, T 6 3 1) and four W combined profiles (WP0121–WP0124). The entire set is a single boot: the absolute log timestamps run monotonically from 66 s to 1340 s with no reset, in two automated batches separated by a 508 s idle gap. The header change removes the inference step used in Section 7: b and I_{max} are now read

directly, giving $b = 0.30, 0.20, 0.00, 0.00$ and $I_{\max} = 6, 6, 6, 8$ A for the four W runs. The last of these is the first run of the campaign at an $I_{\max}$ above 6 A.

8.2 The targeted fixes all hold

Every firmware-v6 mechanism performed as specified, verified directly in the logged data.

- **Reference slew.** The largest sample-to-sample step in the commanded droop ratio across all 23 runs is 0.0200, exactly the limit, with no exceedance anywhere. The handover step is eliminated.
- **Governor floor.** Measured hold share equals $\max(r^*, 0.30 \text{ A}/I_{\text{tot}})$ to within 10^{-3} at every setpoint. Figure 21 (left) shows that the apparent standing bias at $r^* = 0.15$ and 0.17 is entirely this clip: referred to the governed setpoint the error collapses to $\leq 2 \times 10^{-3}$.
- **Bimodal governor.** Exactly two mode transitions per governed run, entry at 0.65–0.75 A and release at 0.40–0.50 A of instantaneous total, zero chattering, and no stranded hold state.
- **Fuel-cell undervoltage fault.** Armed throughout its first flight with zero false trips, including in the six runs where the fuel-cell channel is latched off the bus.

`fault_flags` is zero in every sample of all 23 runs, and the census of total source dropouts — both channels dark while the pair was conducting immediately before — returns **one event in nineteen ladder runs**. That event is TP0115, and it is the subject of Section 8.4.

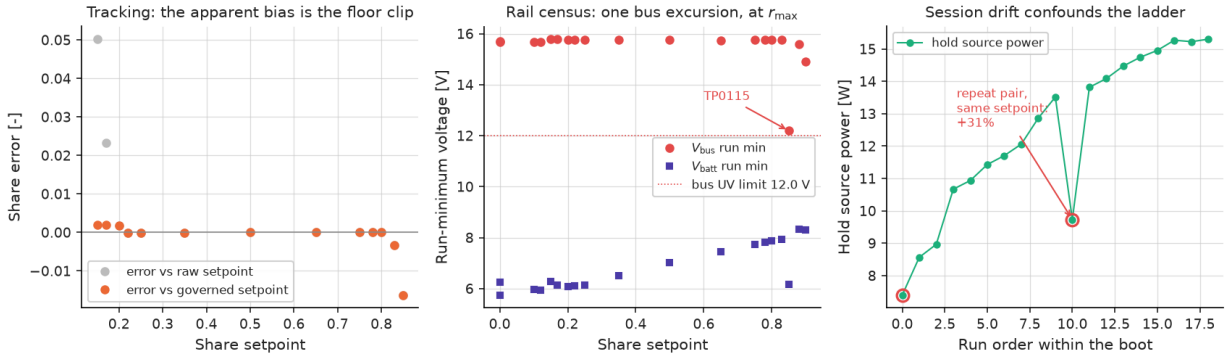


Figure 21: Firmware-v6 trapezoid ladder. Left: tracking error against the raw and the governed setpoint; the two apparently biased points are the floor clip, not loop error. Centre: run-minimum rails; a single bus excursion, at $r^* = r_{\max}$. Right: hold source power against run order within the boot, with the two repeat runs at $r^* = 0$ ringed — the ladder’s monotonic +82 % rise is session drift, not a setpoint effect.

8.3 The W-profile de-rating closes the firmware-v5 failure

The R5–R7 de-rating is decisive. Table 5 compares the share-bound excursion across the two firmware versions.

Table 5: The W -profile share-bound excursion (R6), firmware v5 versus firmware v6. Currents are measured channel totals inside the region.

Run	fw	b	R6 command	R6 I_{tot} med/max	R6 V_{bus} min	Outcome
WP0100	v5	0.15	$1.0 I_{\text{max}}$	2.01 / 2.53 A	15.55 V	28-episode dropout cycle
WP0101	v5	0.00	$1.0 I_{\text{max}}$	2.09 / 6.12 A	6.13 V	ERR_UV_BUS at 36 ms
WP0121	v6	0.30	$0.3 I_{\text{max}}$	0.14 / 0.38 A	15.92 V	clean
WP0122	v6	0.20	$0.3 I_{\text{max}}$	0.16 / 0.40 A	15.92 V	clean
WP0123	v6	0.00	$0.3 I_{\text{max}}$	0.22 / 0.50 A	15.87 V	clean

Measured total current in R6 falls by a factor of approximately 9.5, from 2.09 A to 0.22 A — substantially more than the nominal $0.3\times$ on the command, because the bench load is strongly nonlinear in commanded current. The region now runs an order of magnitude below the fuel-cell source knee identified in Section 7. All three runs at $I_{\text{max}} = 6$ A complete the full 40 s profile across the entire span of b , against two of seven in firmware v5.

The consequence is that b **no longer predicts survival**. In firmware v5 the clip bound was the whole story; here it selects only which mechanism owns R6, and all owners are benign at 0.2 A. Two qualifications follow. The de-rating pushed R6 below the 0.60 A closed-loop threshold, so closed-loop occupancy in that region is zero: R6 no longer exercises the share controller at an extreme command, and safety was bought by removing the interaction rather than by surviving it. Across the whole profile, closed-loop occupancy at $I_{\text{max}} = 6$ A is only 17–20 %.

8.4 A residual at the band edge: TP0115, $r^* = 0.85$

The single dropout of the ladder occurs at $r^* = 0.85$, exactly $r_{\text{max}} = \text{DROOP_R_MAX}$, and it is the one place where firmware v6 is worse than firmware v5. Table 6 states the comparison.

Table 6: The band-edge setpoint on the two firmwares, same profile and same setpoint.

Metric	firmware v5 (TP0088)	firmware v6 (TP0115)
V_{bus} minimum	15.75 V	12.19 V
V_{batt} minimum	8.01 V	6.17 V
Total source dropout	none	5.9 ms
Fault latched	none	none

Figure 22 resolves the event. It is not a limit cycle and not a measurement artifact: five consecutive samples carry both channels at hard zero while the bus decays monotonically at 0.31 V ms^{-1} , after which the battery channel reconnects at 1.81 A and pulls its own rail from 8.35 V to 6.17 V. The sequence is ordered. The battery channel stops conducting one sample after the closed-loop mode edge; the controller, seeing a measured share of unity against its reference, drives the ratio down at the full slew limit; 24 ms later the fuel-cell channel also drops out, leaving the bus unfed.

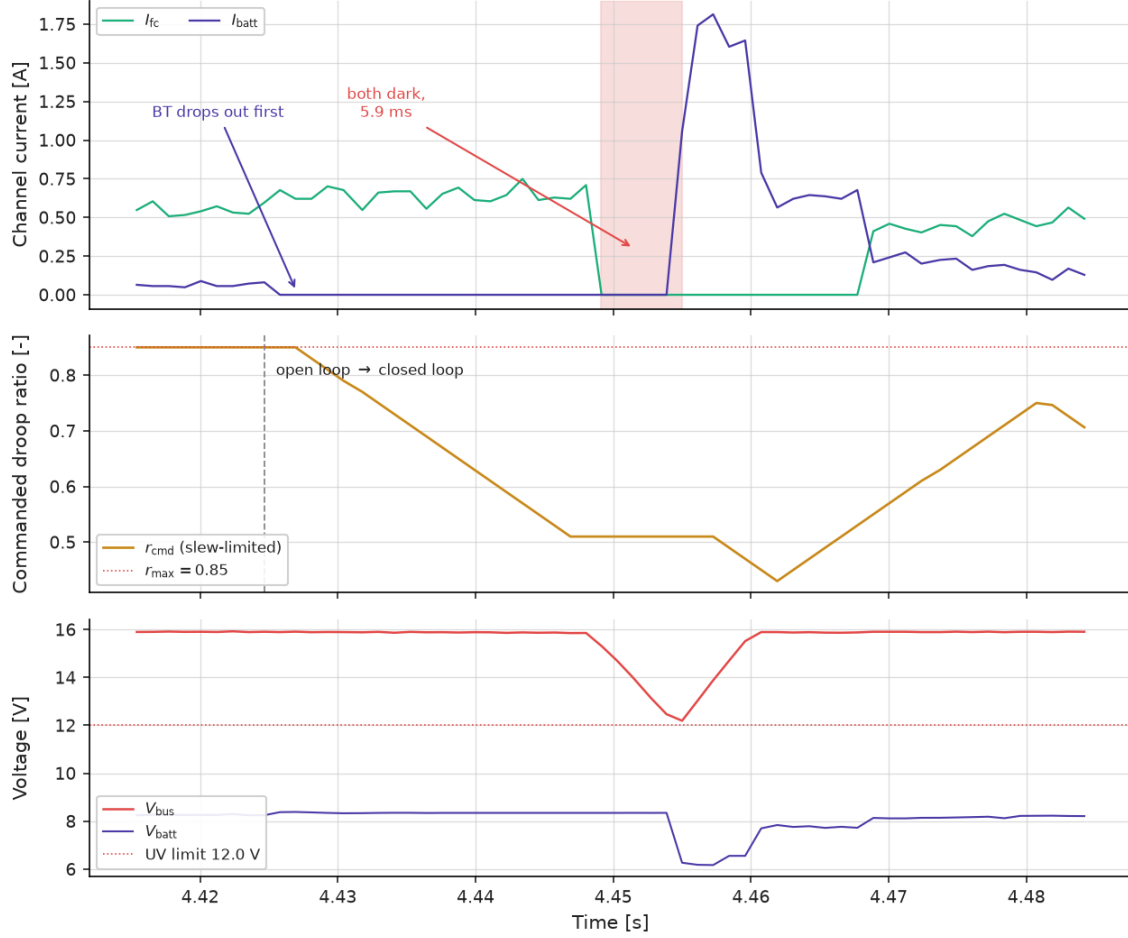


Figure 22: TP0115, $r^* = 0.85$: a 5.9 ms total source dropout at the open-loop-to-closed-loop handover. Top: both channels dark, the battery channel first. Centre: the commanded ratio slewing at its 0.02-per-tick limit. Bottom: the bus decaying to 12.19 V and the battery rail collapsing on reconnection. Window 70 ms of a 15 s run.

The mechanism generalises, and the ladder contains its mirror image. Both dropouts observed anywhere in the campaign — TP0115 at $r_{\max}$ and a smaller fuel-cell-only event in TP0105 at $r_{\min} = 0.15$, which the bus rode out at 15.89 V — occur at the open-loop-to-closed-loop handover, and both at an exact band edge. Every run crosses into closed loop at the same 0.6 A total, where the 0.30 A floor demands half the total current from a channel the open-loop feedforward has been running at 61 mA. The discriminator is monotonic in setpoint: measured minority current in the 50 ms before the crossing is 0.061 A at $r^* = 0.85$, 0.072 A at 0.83, and 0.179 A at 0.65.

Firmware v6 slewed the reference *rate*; the exposure is the reference *magnitude*. A swing of 0.42 in commanded share, applied at 0.6 A total, is enough to open both channels at once however slowly it is applied. The argument in Section 7 against clipping the open-loop feedforward remains sound, so the remaining lever is the crossing point itself: engaging closed-loop control at a current where the floor’s clip is less violent.

8.5 WP0124: the failure mode moves to the source rail

WP0124 is the first run of the campaign at $I_{\max} = 8$ A. Its log ends at $t = 14.60$ s of a 40 s profile with no trailer record — the signature of an MCU stop rather than any firmware path. Two things distinguish it from every previous truncation.

First, it died in R4, not in the share-bound excursion, and **the share loop is a bystander**. The setpoint is 0.38, mid-band; measured share tracks it to ± 0.02 ; both channels conduct; the bus is flat at 15.75 V; no latch, cutoff, deferral, or dropout occurs anywhere after $t = 4.95$ s; `fault_flags` is zero and the closed-loop mode flags are set continuously to the last record.

Second, and unlike every earlier stop, **the collapse is fully resolved on the logged timescale**. The battery rail walks down monotonically with load — 7.16 V at $t = 13.1$ s, 6.55 V at 13.9 s, 5.99 V at 14.5 s, minimum 5.54 V — and the walk is ohmic, not dynamic. A least-squares fit over the region gives

$$V_{\text{batt}} = 8.52 - 1.35 I_{\text{batt}}, \quad R^2 = 0.982, \quad (1)$$

against $V_{\text{fc}} = 8.40 - 0.30 I_{\text{fc}}$ on the fuel-cell side. Figure 23 shows both. **The bench battery source is approximately four times softer than the fuel-cell source**, at $1.01\text{--}1.35\ \Omega$ against $0.26\text{--}0.30\ \Omega$. Because the Teensy is board-powered through an LM1084 linear regulator fed from the battery rail, drawing 1.9 A from a $1.35\ \Omega$ source walks the microcontroller’s own supply into regulator dropout.

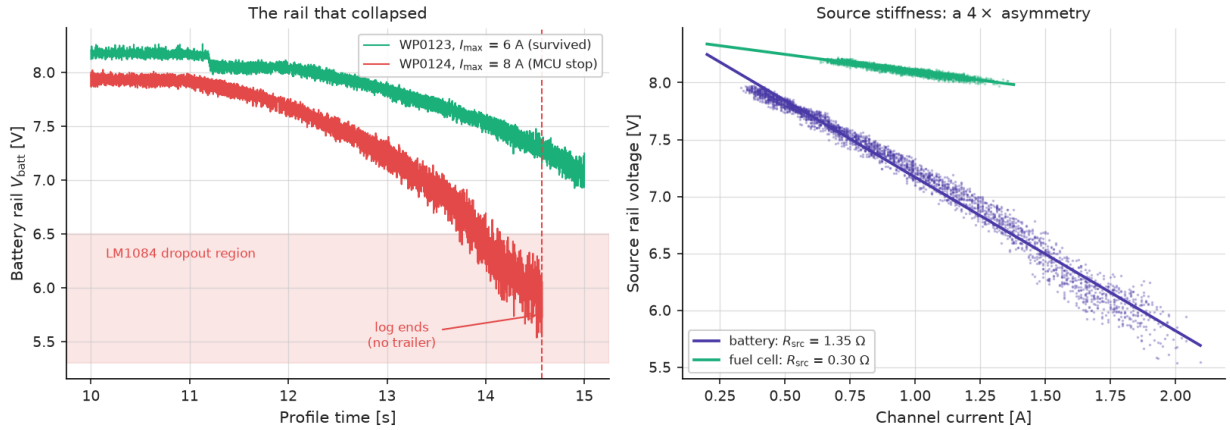


Figure 23: WP0124 against its surviving twin. Left: the battery rail through region R4; WP0123 runs the same profile and the same b at $I_{\max} = 6$ A and bottoms at 6.93 V, while WP0124 at 8 A enters the LM1084 dropout region and the log ends. Right: source stiffness measured over the same window.

The comparison with WP0123 is close to controlled: same profile, same $b = 0$, same firmware, differing only in $I_{\max}$. At matched profile time the 8 A run draws 1.83 times the battery current and its rail sits 1.28 V lower. The causal chain is therefore $I_{\max} \rightarrow I_{\text{batt}} \rightarrow V_{\text{batt}} \rightarrow$ logic rail, with the share loop uninvolved — structurally different from the firmware-v5 stops, which were share-mediated fuel-cell source-knee runaways.

This finding subsumes rather than contradicts the oscilloscope evidence of Section 7: the direct-current operating point had already walked into the region where the sub-millisecond dip resolved in capture 14 lands far below the dropout threshold. It remains inference. Neither the regulator output nor the Teensy 3.3 V rail is logged or was probed through this stop.

8.6 Why no battery-rail undervoltage threshold is proposed

The obvious remedy is the battery-side counterpart of the new fuel-cell undervoltage fault. The data does not support one on this bench, and the reason is itself informative.

Replaying the firmware-v6 leaky-dwell filter against the logged battery rail of every run in the campaign gives Figure 24. Healthy trapezoid runs in which the battery is the sole source sag as low as 5.75 V and complete without incident, while WP0124 died at 5.54 V. A trip at 6.8 V or 6.5 V latches six healthy runs; a trip at 6.0 V still latches TP0112; a trip at 5.7 V catches nothing at all, including the truncation.

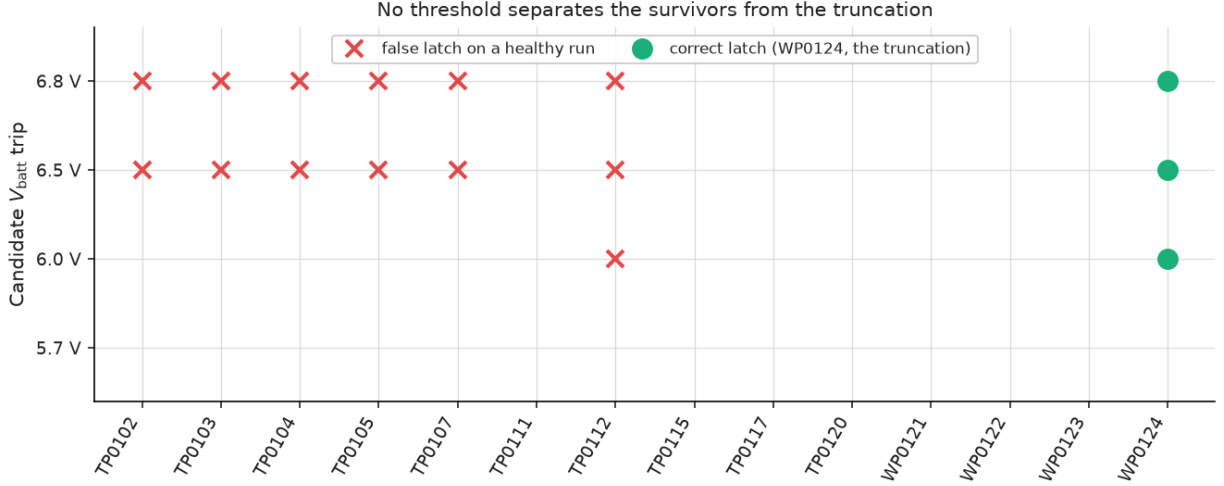


Figure 24: The firmware-v6 leaky-dwell filter replayed against the logged battery rail at four candidate trip voltages. No row separates the truncation from the healthy runs.

A separation of roughly 0.2 V across a hard survive-or-die boundary is the signature of a *cliff* — the regulator dropout knee — rather than of a gradual margin. It follows that the logged direct-current level under-determines the outcome, and that the real discriminator is the sub-millisecond ripple depth riding on it, which is precisely what capture 14 resolves and what an 870 Hz log cannot see. A threshold fitted to this data would therefore encode bench conditions rather than the failure mechanism. The blocking measurement is unchanged from Section 7: the LM1084 input and output, probed together through a truncation.

8.7 Two limits on what this campaign can conclude

The headline mechanism of firmware v6 remains unvalidated on the bench. The deferral branch of the load-aware handoff guard did not engage in any of the 23 runs. Every setpoint latch in the campaign handed off 0.06–0.24 A, far below the 0.50 A threshold, so only the permitting branch executed. $I_{\text{handoff}}^{\text{max}}$ is still bracketed only between an observed-clean 0 A and an observed-fatal 1.3 A. The de-rating has made this harder to test, not easier: it removed the only condition that previously produced a loaded out-of-band setpoint. The new fuel-cell undervoltage fault is likewise untested — correct and silent, but with the rail never closer than 1.67 V to its trip.

Session drift confounds the ladder. The two repeat runs at $r^* = 0$, 914 s apart within the same boot, differ by +31 % in hold source power at a fixed setpoint, and hold power rises monotonically by 82 % across the ladder (Figure 21, right). Because setpoint was swept monotonically with

run order, the setpoint effect and the drift are not separable in this campaign. The interleaving recommended after the firmware-v2 round was not applied. Since the total current sets the governor's own clip threshold, the per-setpoint operating points are not directly comparable across the ladder.

9 Conclusions and recommended actions

From the discovery sweep (firmware 0):

1. **The share controller is validated across the full setpoint span at steady load:** unbiased ($< 10^{-3}$) at all seven setpoints, $\sigma \approx 0.01$ at interior points, no saturation for $r^* \in [0.15, 0.7]$.
2. **A 17–18.5 Hz minority-channel dropout limit cycle exists at asymmetric setpoints under low total current,** severe at $r^* = 0.3$ (bus to 6.5 V, 3.6 A spikes) and mild at $r^* = 0.85$. Capture 12 confirms the events are total source-feed dropouts (motor switch conducting, whole bus decaying together); droop-commanded blocking vs. source-switch SCP remains open but no longer gates the fix.

From the validation sweep (firmware v3):

3. **The mitigation set works where it applies.** All 20 in-band runs from $r^* = 0.18$ to 0.85 — the two original failure points included — are free of dropout events, with unbiased tracking and a flat bus; the moving-setpoint run WP0040 tracks the governed command with residuals $\leq 2 \times 10^{-3}$ through simultaneous setpoint and load steps. The governor floor is directly observable holding the minority channel at 0.20 A $\pm 5\%$.
4. **$I_{\min} = 0.20$ A sits on the failure boundary, not above it.** TP0016 ignites at the exact governor release instant; the empirical conduction floor lies in (0.245, 0.29) A. Raise `SHARE_MINORITY_I_MIN_A` to ≈ 0.30 A. Independently, the band-edge setpoint parks the actuator on the `DROOP_R_MIN` rail inside the cutoff hysteresis; treat the usable in-band span as $\approx [0.18, 0.82]$.
5. **Close the governor/cutoff structural gap.** The governor bypass tests the *setpoint* while the cutoff tests the *controller output*; setpoints in $\approx (0.85, 0.88]$ (mirror $\approx [0.12, 0.15]$) engage neither and run the original cycle unmitigated (TP0037). Either extend the governor to the full span and let the cutoff take over only once it actually latches, or gate the bypass on the cutoff state (`shareIsoFC/shareIsoBT`) rather than on the setpoint. The near-band cutoff *hunting* at $r^* = 0.12$ (19.8 Hz switch duty-cycling) additionally argues for latching the cutoff while the setpoint remains out-of-band, releasing on setpoint change rather than on the ratio's re-entry hysteresis.
6. **Arm a bus-undervoltage fault on the bench.** Both TP0016 and WP0039 put the bus below 9 V repeatedly with `fault_flags = 0`; WP0039 ended in an uncommanded MCU brownout. A persistence-filtered UV check (mirroring the existing OV filter) would have latched both runs into State 99 long before the ratchet deepened.
7. **Scope-armed follow-ups:** re-enter the WP0039 condition to test the unfreeze-slew-traverse trigger correlation and identify why the motor accepted no load for 11.8 s; probe a boost output alongside VBUS during a TP0016 hold to close the droop-blocking vs. SCP discrimination; check the $\approx 14\%$ control-tick slowdown against the firmware timing.

Items 4–6 were implemented as firmware v4. From the second validation sweep (firmware v4):

8. **The setpoint-latched cutoff and the raised floor close every firmware v3 failure point.** All out-of-band setpoints latch once with zero switch cycling (0.12: 179 cycles to zero; 0.88–0.90: continuous limit cycle to a static latch), and the band edge 0.15 holds its commanded minority at exactly 0.3000 A with a flat bus. The governed band tracks with bias below 10^{-3} and the W profiles reproduce the governor law to $\leq 2 \times 10^{-3}$.
9. **Redesign the governor’s low-current fallback.** The collapse-to-0.5 branch commands 0.05–0.25 A per channel across $I_{\text{tot}} \in [0.075, 0.60]$ A — below the floor it exists to enforce — and ignited a bus-collapsing source-commutation relay cycle in six runs at $r^* \geq 0.67$ (Section 6.3). The fallback should command an *achievable* split at low current: hold the measured share (freeze the loop, as the setpoint latch already does out-of-band) or bias toward the natural topology, rather than force 0.5. Why firmware v3 survived the identical conditions is unconfirmed; the floor increase acting through the escape window is the leading candidate.
10. **The constant-current floor law is wrong.** At region R6 the firmware v4 clean/cycling bracket of (0.381, 0.399) A contradicts the firmware v3 bracket of (0.245, 0.29) A; either the floor scales with total current or the true limit is a minority fraction of ≈ 0.22 –0.25. A two-axis sweep (I_{max} at fixed setpoint, setpoint at fixed I_{max}) separates the two readings and sets the corrected law.
11. **Extend fault coverage upstream and retune the UV filter.** The UV fault latched all six relay events but tolerated 1.0–1.3 s of 7–8 V excursions first (the 9 ms-under/51 ms-over duty evades the 10 ms window and 5 ms gap guard); a leaky-integrator dwell or a $\gtrsim 60$ ms gap guard latches within a few cycles. More consequentially, two MCU brownouts occurred with the bus in regulation at 15.7 V: the source rail feeding the logic regulator is unobserved. Log BT_VOLTAGE, consider a source-rail undervoltage fault, and scope VBT/LM1084 across the R6→R7 setpoint step before further $b \leq 0.22$ runs.

Items 9, 11 (in part), and 12 were implemented as firmware v5. From the third validation sweep (firmware v5):

12. **The open-loop fallback closes the relay cycle.** The four firmware v4 relay setpoints run clean — zero exclusive conduction, no 14–24 Hz signature, bus flat at 15.7 V — and the feedforward, hold-freeze, and mode hysteresis are each directly observable in the logs with zero chatter. One tidy-up remains: apply the governor clip to the feedforward path so the handover at 0.60 A does not step the effective setpoint discontinuously.
13. **The W-profile R6 excursion is a test-design hazard and a finding in one.** It is the only region combining peak load with an extreme share command, and it generated all five failures. Do not run W/Y profiles with $b < 0.30$ until the region drops its motor axis; record b and I_{max} in the log header. Separately, the $b = 0$ case shows the setpoint-latched cutoff acting as an under-load channel cut that collapses the surviving source in 40 ms — the latch needs a load-aware guard (defer the cut, or ramp it, when the surviving channel cannot carry the measured total).
14. **The floor law is structurally wrong, not miscalibrated.** The battery channel drops out at commanded minority currents of 0.55–1.04 A — two to three times the 0.30 A floor

— while the fuel-cell channel holds 0.63 A as minority with no dropout, and 27 mV of bus voltage separates a 28-dropout operating point from a stable one. The boundary is a bus-versus-reference margin, one-sided toward the battery channel; replace the current constant with a reference-referred guard and run the two-axis sweep per channel direction.

15. **The dwell filter is validated; the missing fault is upstream.** Both latching runs latch within ≈ 20 ms of first excursion (firmware v4: 1.0–1.3 s), with no spurious latch in 28 runs. The three MCU stops beat the filter from the source side: the fuel-cell rail sat below 5 V while the bus still read 15.7 V, and the battery rail read 7.9–8.4 V at every truncation instant — so a source-rail undervoltage fault (dwell-filtered, on the logged rails) is the highest-value protection now missing. Oscilloscope capture 14 resolves a sub-millisecond battery-rail dip to ≈ 4 –5 V, coincident with a battery-current spike as the collapsing node reaches the battery-rail level — the leading MCU-stop candidate, below the LM1084 dropout and invisible to the log — pending confirmation by a capture on the LM1084 input and output through a truncation event.

Items 13–15 were implemented as firmware v6. From the fourth validation sweep (firmware v6):

16. **The profile de-rating and the reference slew are validated.** The share-bound excursion carries 0.22 A instead of 2.09 A, an order of magnitude below the source knee; all three combined-profile runs at $I_{\max} = 6$ A complete across the full span of b , which no longer predicts survival. The commanded ratio never moves faster than its 0.02-per-tick limit in any of the 23 runs, and the governor floor is exact to 10^{-3} . Note the cost: the de-rated region now runs entirely below the closed-loop threshold, so it no longer tests the share controller at an extreme command. If that case still needs characterising it needs a separate, deliberately bounded region.
17. **Move the closed-loop engagement point, not the reference rate.** The one dropout of the ladder — 5.9 ms with both channels dark and the bus at 12.19 V — occurs at the open-loop-to-closed-loop handover at the exact upper band edge, and its mirror appears at the lower edge. The floor demands half the total current from a channel carrying 61 mA at the crossing; a 0.42 swing in commanded share at 0.6 A total opens both channels however slowly it is applied. Raising `SHARE_GOV_OL_HYST_A` so closed-loop control engages where the clip is less violent addresses the magnitude; the firmware v6 slew addressed only the rate.
18. **Stiffen the battery source or power the logic independently.** The bench battery source measures 1.01–1.35 Ω against 0.26–0.30 Ω on the fuel-cell side, and the sole truncation of the campaign is an ohmic collapse of that rail into the logic regulator’s dropout region with the share loop tracking to ± 0.02 and the bus in regulation. On this bench $I_{\max}$ is bounded by the logic rail rather than by anything in the control law, and the bound was reached at 8 A.
19. **Do not fit a battery-rail undervoltage threshold to this data.** Replaying the dwell filter across the campaign, healthy runs sag to 5.75 V and complete while the truncation died at 5.54 V; every trip that catches the truncation also latches healthy runs. A 0.2 V separation across a survive-or-die boundary indicates a regulator dropout cliff, so the logged operating point under-determines the outcome and the discriminator is the sub-millisecond ripple depth. The blocking measurement is unchanged: LM1084 input and output probed together through a truncation.

20. **The load-aware handoff guard is still unvalidated, and the de-rating made it harder to test.** Its deferral branch did not engage in any of the 23 runs; every latch handed off 0.06–0.24 A against a 0.50 A threshold, so only the permitting branch ran. $I_{\text{handoff}}^{\text{max}}$ remains bracketed between an observed-clean 0 A and an observed-fatal 1.3 A. Exercising it now requires a deliberately constructed loaded out-of-band setpoint, since the de-rated excursion no longer produces one. The new fuel-cell undervoltage fault is likewise correct but untested, its rail never closer than 1.67 V to trip.
21. **Interleave the setpoint order.** The two repeat runs at $r^* = 0$ differ by +31 % in hold source power within one boot, and hold power rises monotonically by 82 % across the ladder. Setpoint was swept monotonically with run order, so the setpoint effect and the session drift are not separable in this campaign — and since total current sets the governor’s own clip threshold, the per-setpoint operating points are not comparable across it. This hygiene was recommended after the firmware-v2 round and has still not been applied.