
COMPONENT SIDE · USB right

Insulated loops · form with 4 mm bend radius

Row 01 stays at the top. Hole names do not change when the board is flipped.



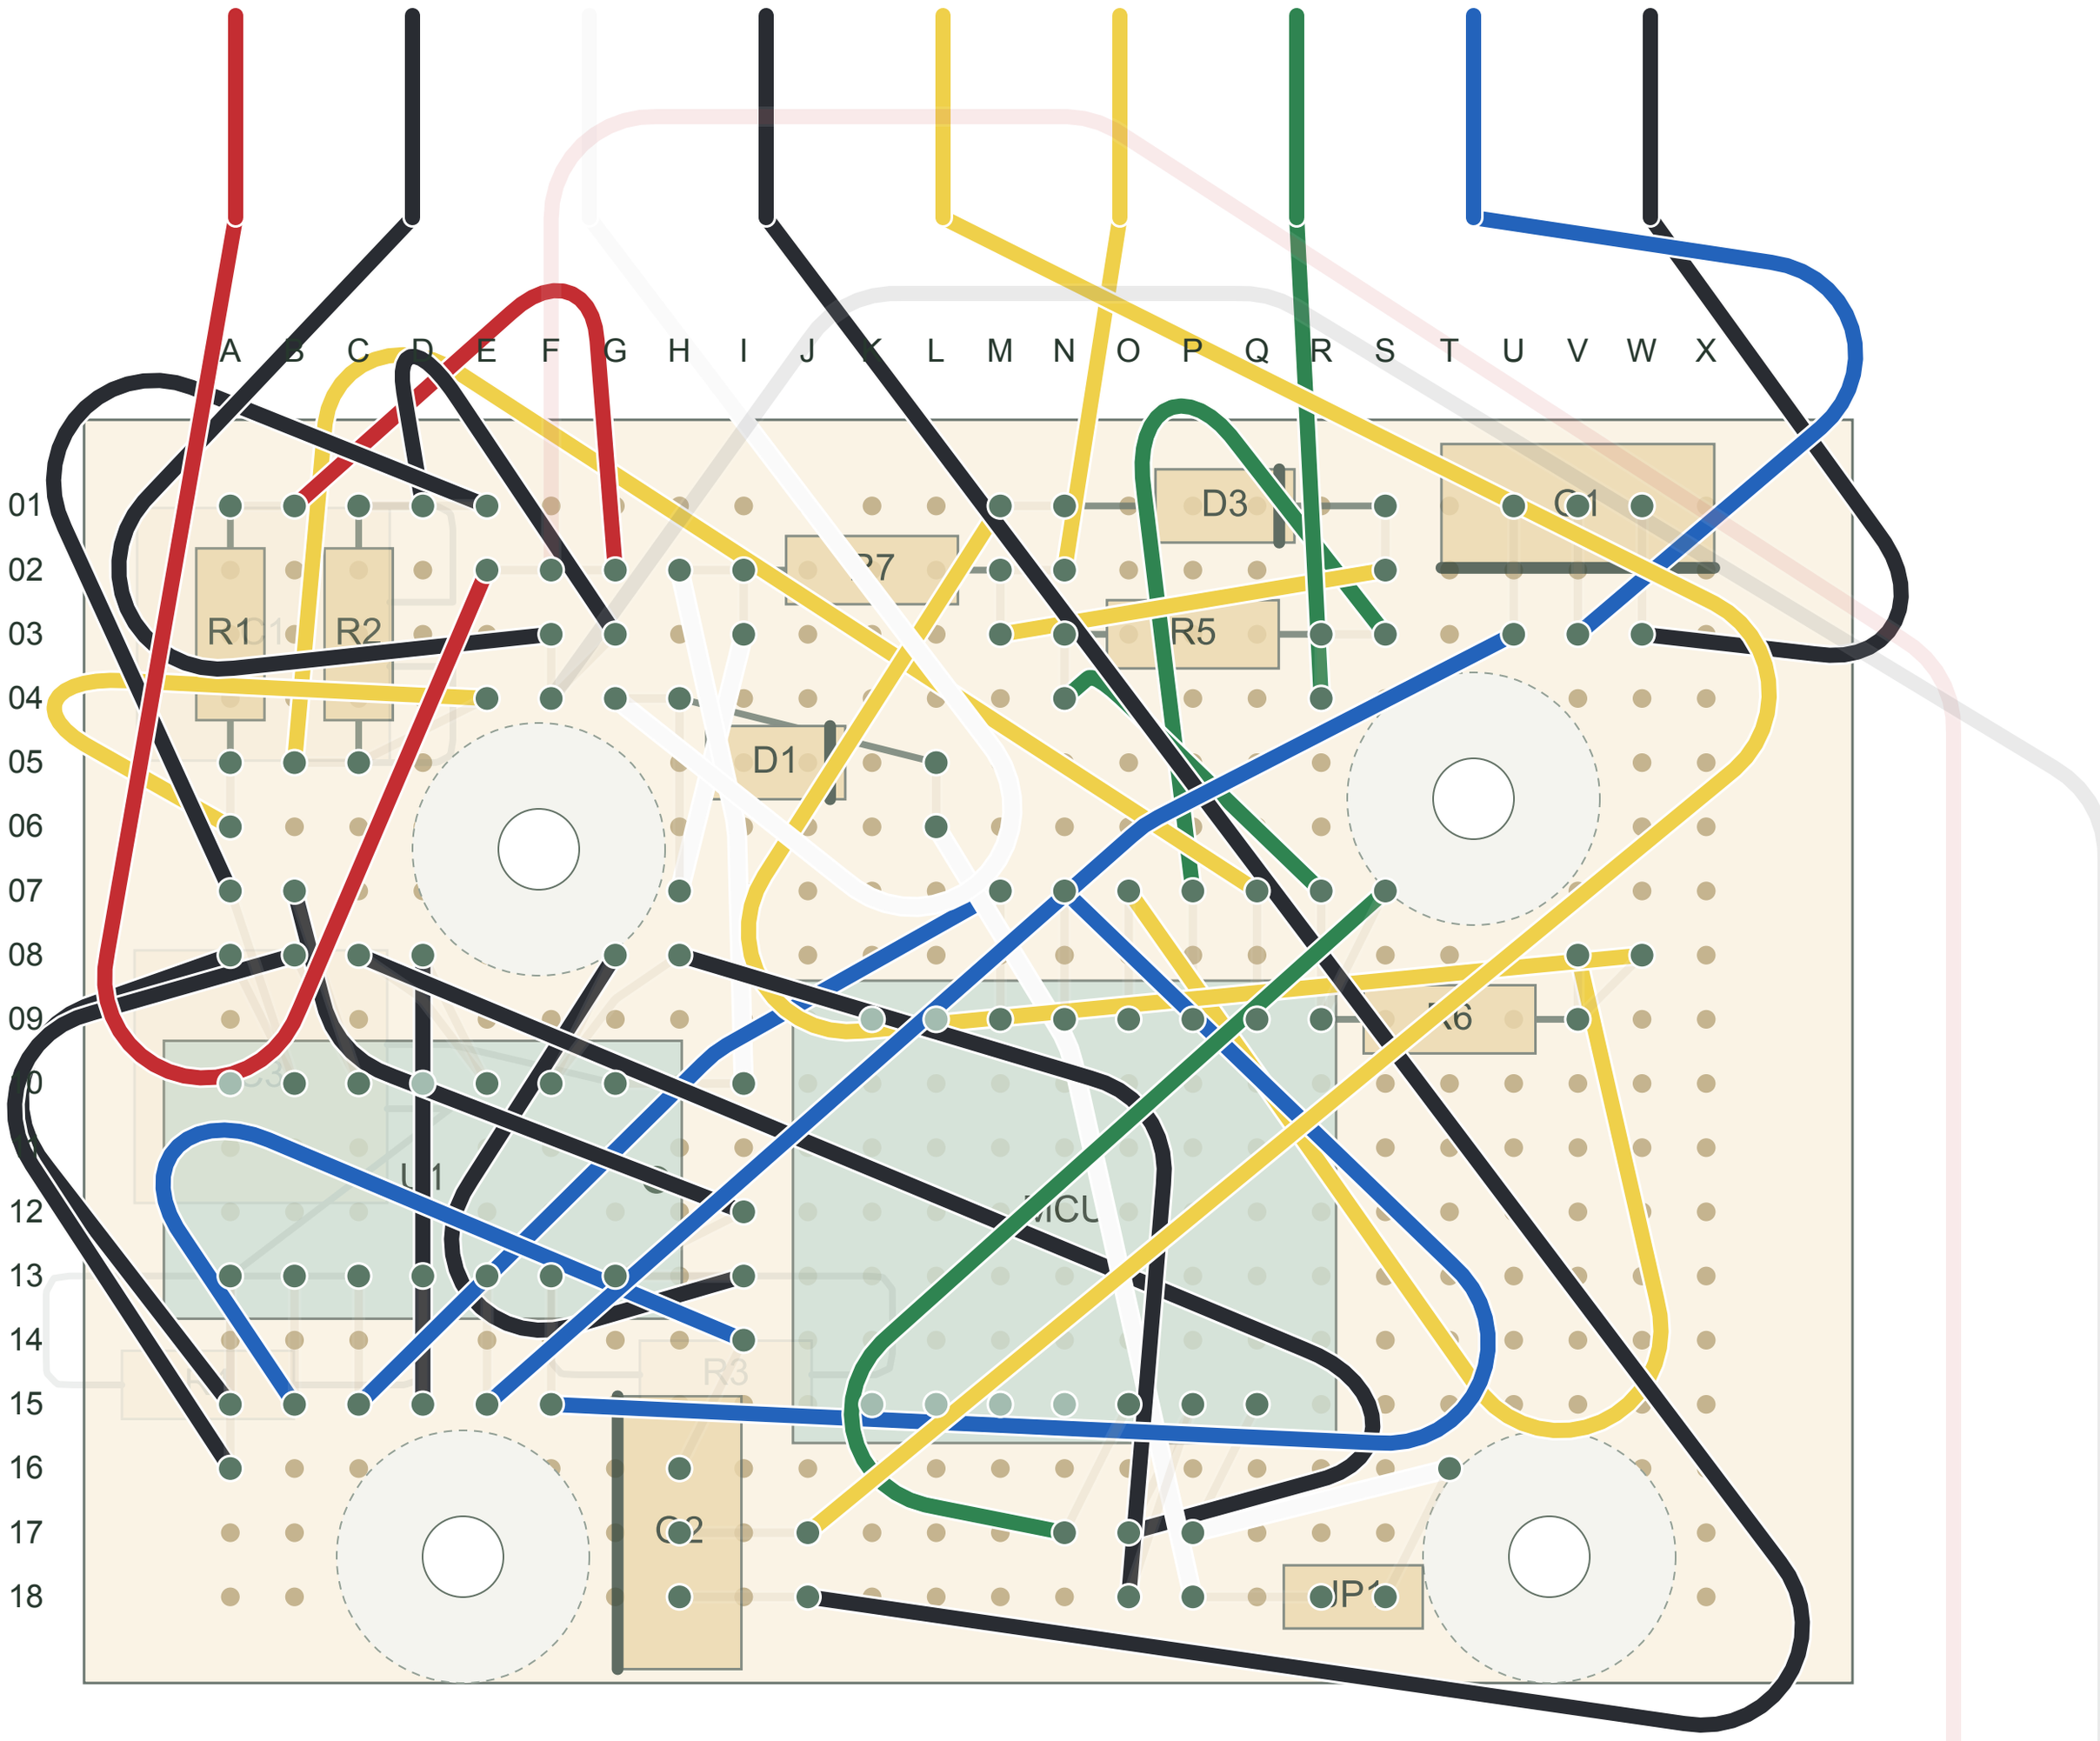


C2 sits on the battery, under its existing strap. Both case ends stay clear.

70 × 50 mm board · two M3 nuts per hole · M3×10 screws · unchanged printed parts

SOLDER SIDE · mirrored

Short stripped ends and underside parts

Row 01 stays at the top. Hole names do not change when the board is flipped.

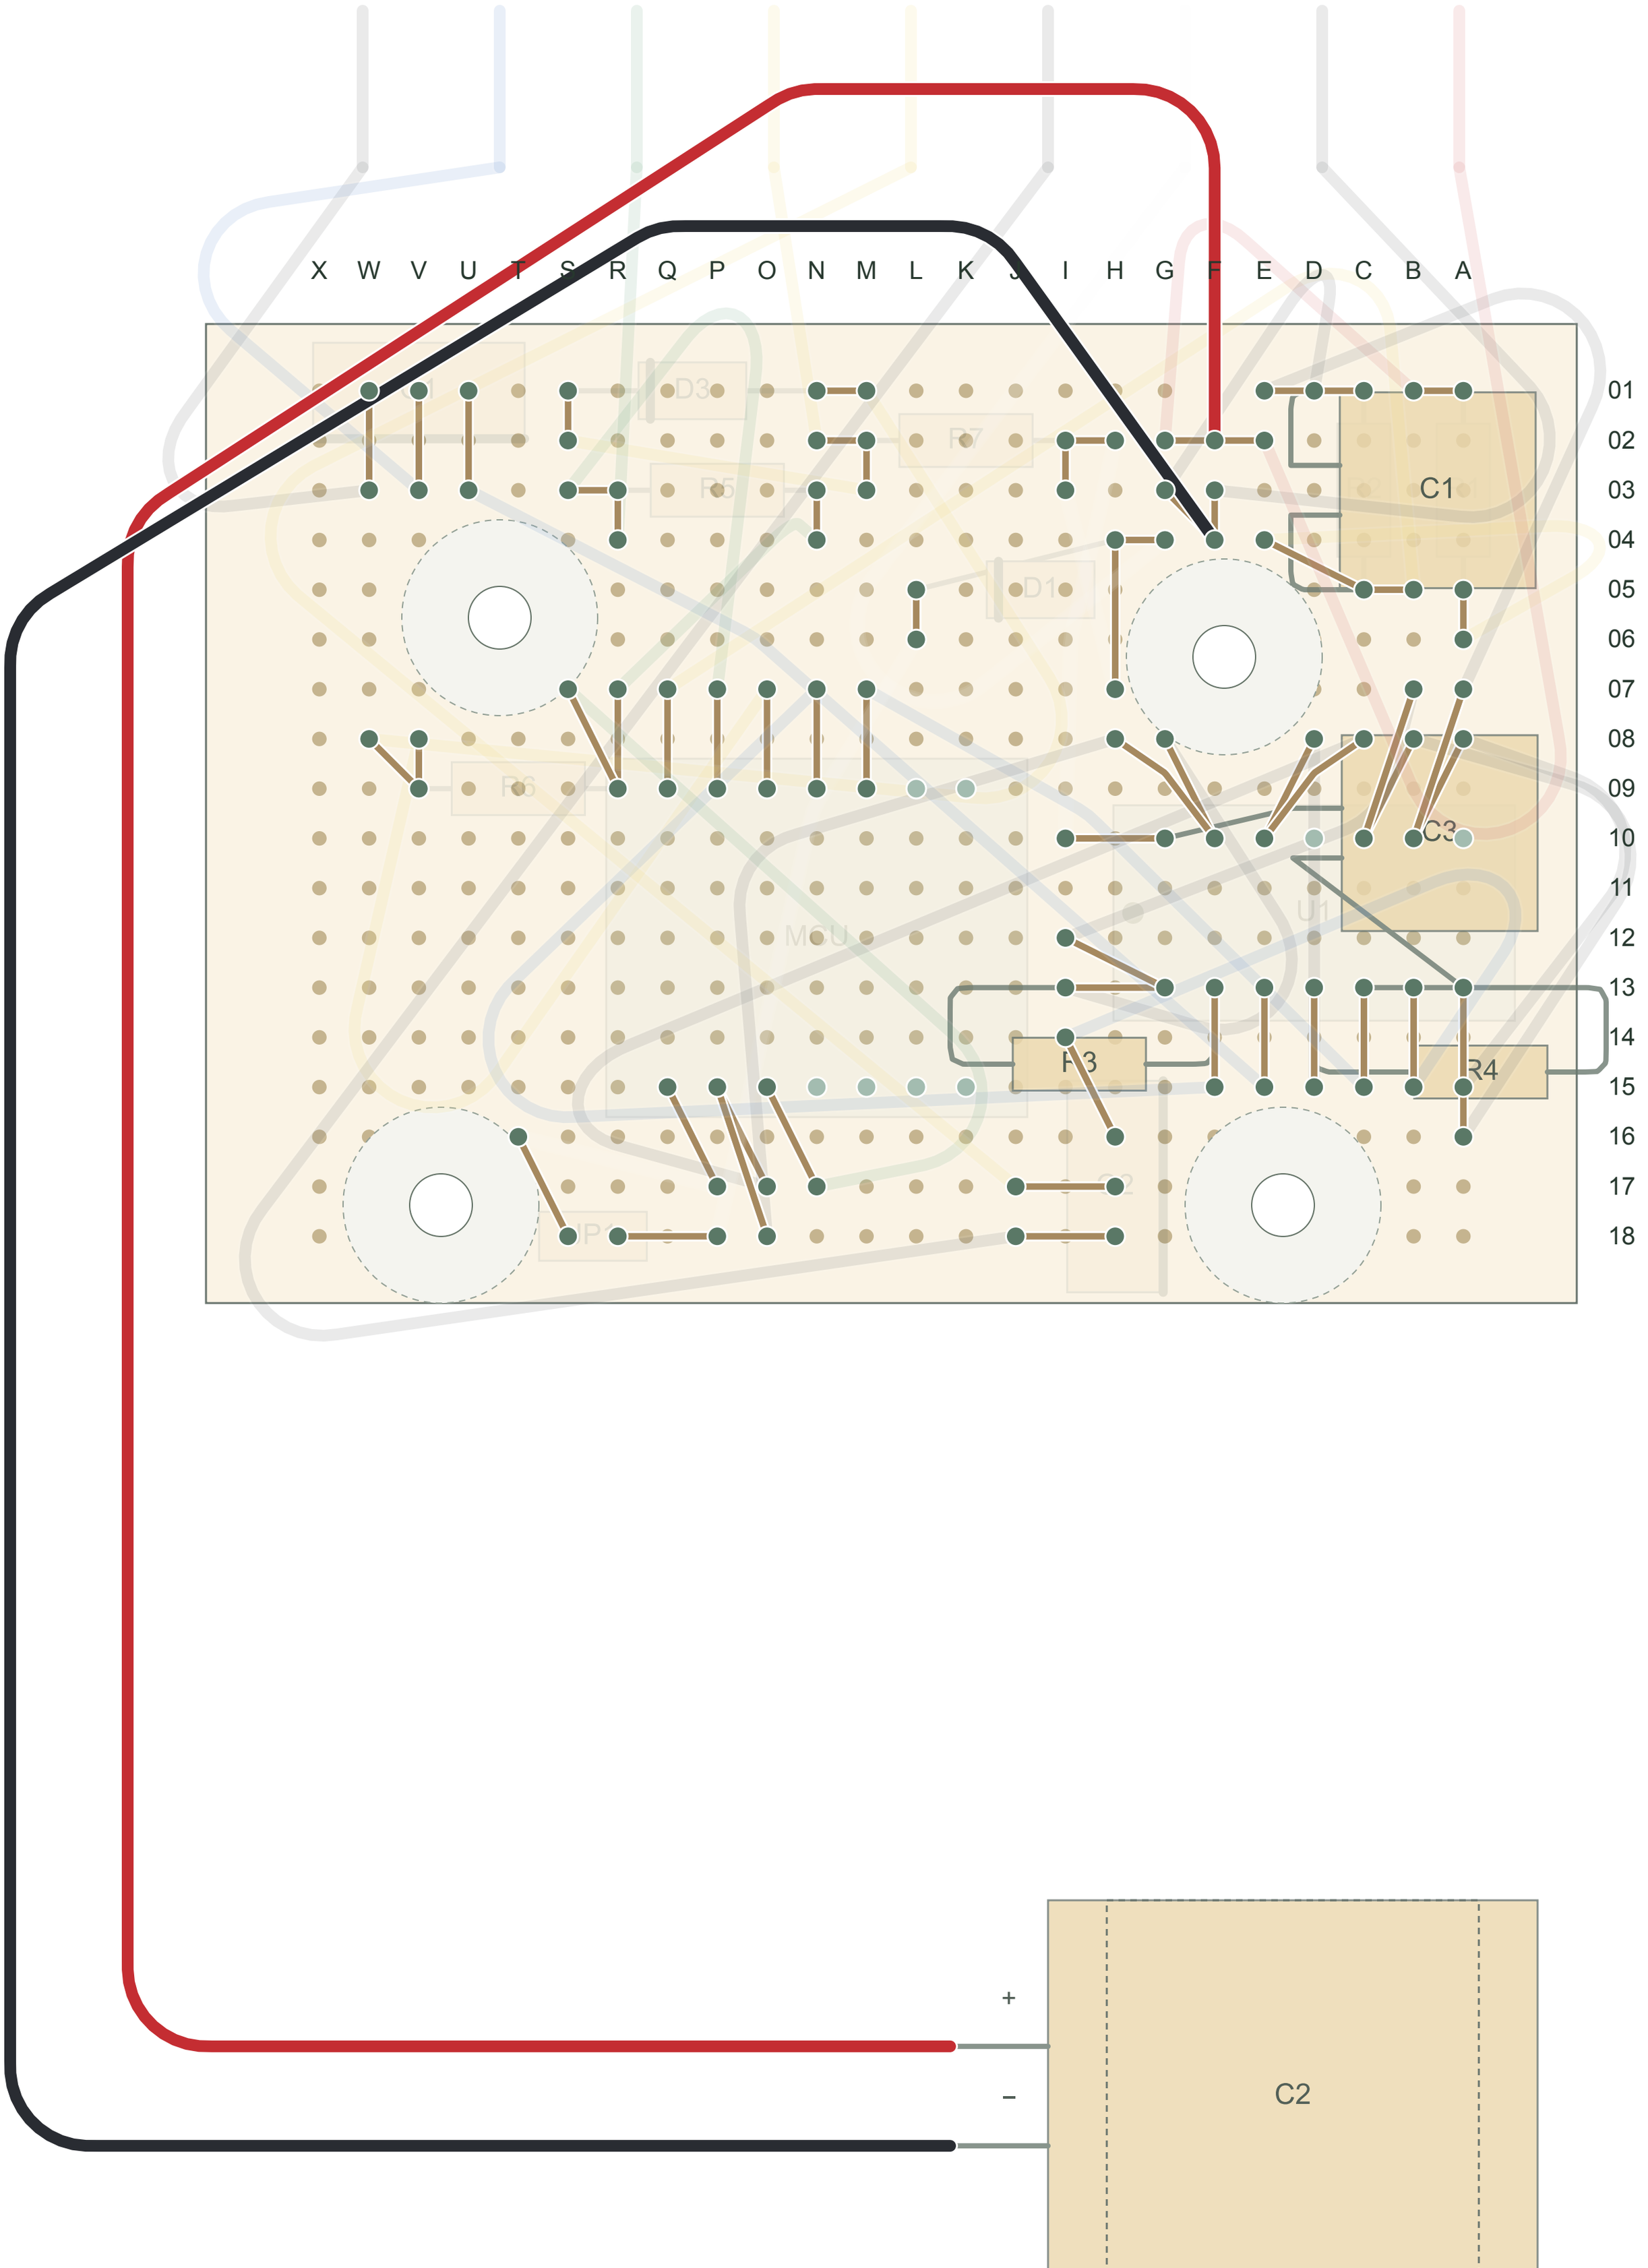

C2 sits on the battery, under its existing strap. Both case ends stay clear.

70 × 50 mm board · two M3 nuts per hole · M3×10 screws · unchanged printed parts

WIRE CUTS AND SOLDER POINTS

W01 · white · P17 → Q15 → T16 → S18 · start 45 mm

W04 · black · A08 → B10 → A15 → A13 · start 74 mm

W07 · black · I13 → G13 → G08 → F10 · start 74 mm

W15 · green · P07 → P09 → S03 → R03 · start 78 mm

W25 · yellow · M03 → M02 → S02 → S01 · start 67 mm

W16 · yellow · O07 → O09 → V08 → V09 · start 100 mm

W22 · white · H07 → H04 → I03 → I02 · start 43 mm

H03 · black · W03 → W01 · start 81 mm + measured external run

H08 · yellow · N02 → M02 · start 87 mm + measured external run

W05 · black · A16 → A13 → B08 → C10 · start 99 mm

W10 · black · D08 → E10 → D15 → D13 · start 68 mm

H09 · green · R04 → R03 · start 90 mm + measured external run

W23 · white · H02 → I02 → I10 → G10 · start 62 mm

H05 · blue · V03 → V01 · start 117 mm + measured external run

W13 · yellow · Q07 → Q09 → B05 → C05 · start 104 mm

W24 · red · B01 → A01 → G02 → F02 · start 70 mm

W19 · blue · M07 → M09 → C15 → C13 · start 92 mm

W12 · green · N04 → N03 → R07 → R09 · start 74 mm

W14 · yellow · E04 → C05 → A06 → A05 · start 74 mm

W06 · black · B07 → C10 → I12 → G13 · start 96 mm

W09 · black · O17 → P15 → C08 → E10 · start 116 mm

W26 · white · L06 → L05 → P18 → R18 · start 83 mm

W21 · blue · B15 → B13 → I14 → H16 · start 104 mm

W02 · black · G03 → F04 → D01 → C01 · start 86 mm

W03 · black · E01 → C01 → A07 → B10 · start 102 mm

W17 · yellow · W08 → V09 → M01 → N01 · start 115 mm

H02 · black · F03 → F04 · start 112 mm + measured external run

W08 · black · H08 → F10 → O18 → P15 · start 113 mm

H04 · black · J18 → H18 · start 191 mm + measured external run

H07 · white · G04 → H04 · start 126 mm + measured external run

Trim after forming. Spare cut length is not an extra loop to leave on the board.

WIRE CUTS AND SOLDER POINTS

H01 · red · E02 → F02 · start 145 mm + measured external run

W18 · blue · N07 → N09 → F15 → F13 · start 133 mm

W11 · green · N17 → O15 → S07 → R09 · start 119 mm

W20 · blue · E15 → E13 → U03 → U01 · start 133 mm

H06 · yellow · J17 → H17 · start 178 mm + measured external run

C2_1 · red · F02 → C2.1 · start 235 mm

C2_2 · black · F04 → C2.2 · start 240 mm

Trim after forming. Spare cut length is not an extra loop to leave on the board.