
COMPONENT SIDE · USB right

Insulated loops · form with 4 mm bend radius

Row 01 stays at the top. Hole names do not change when the board is flipped.

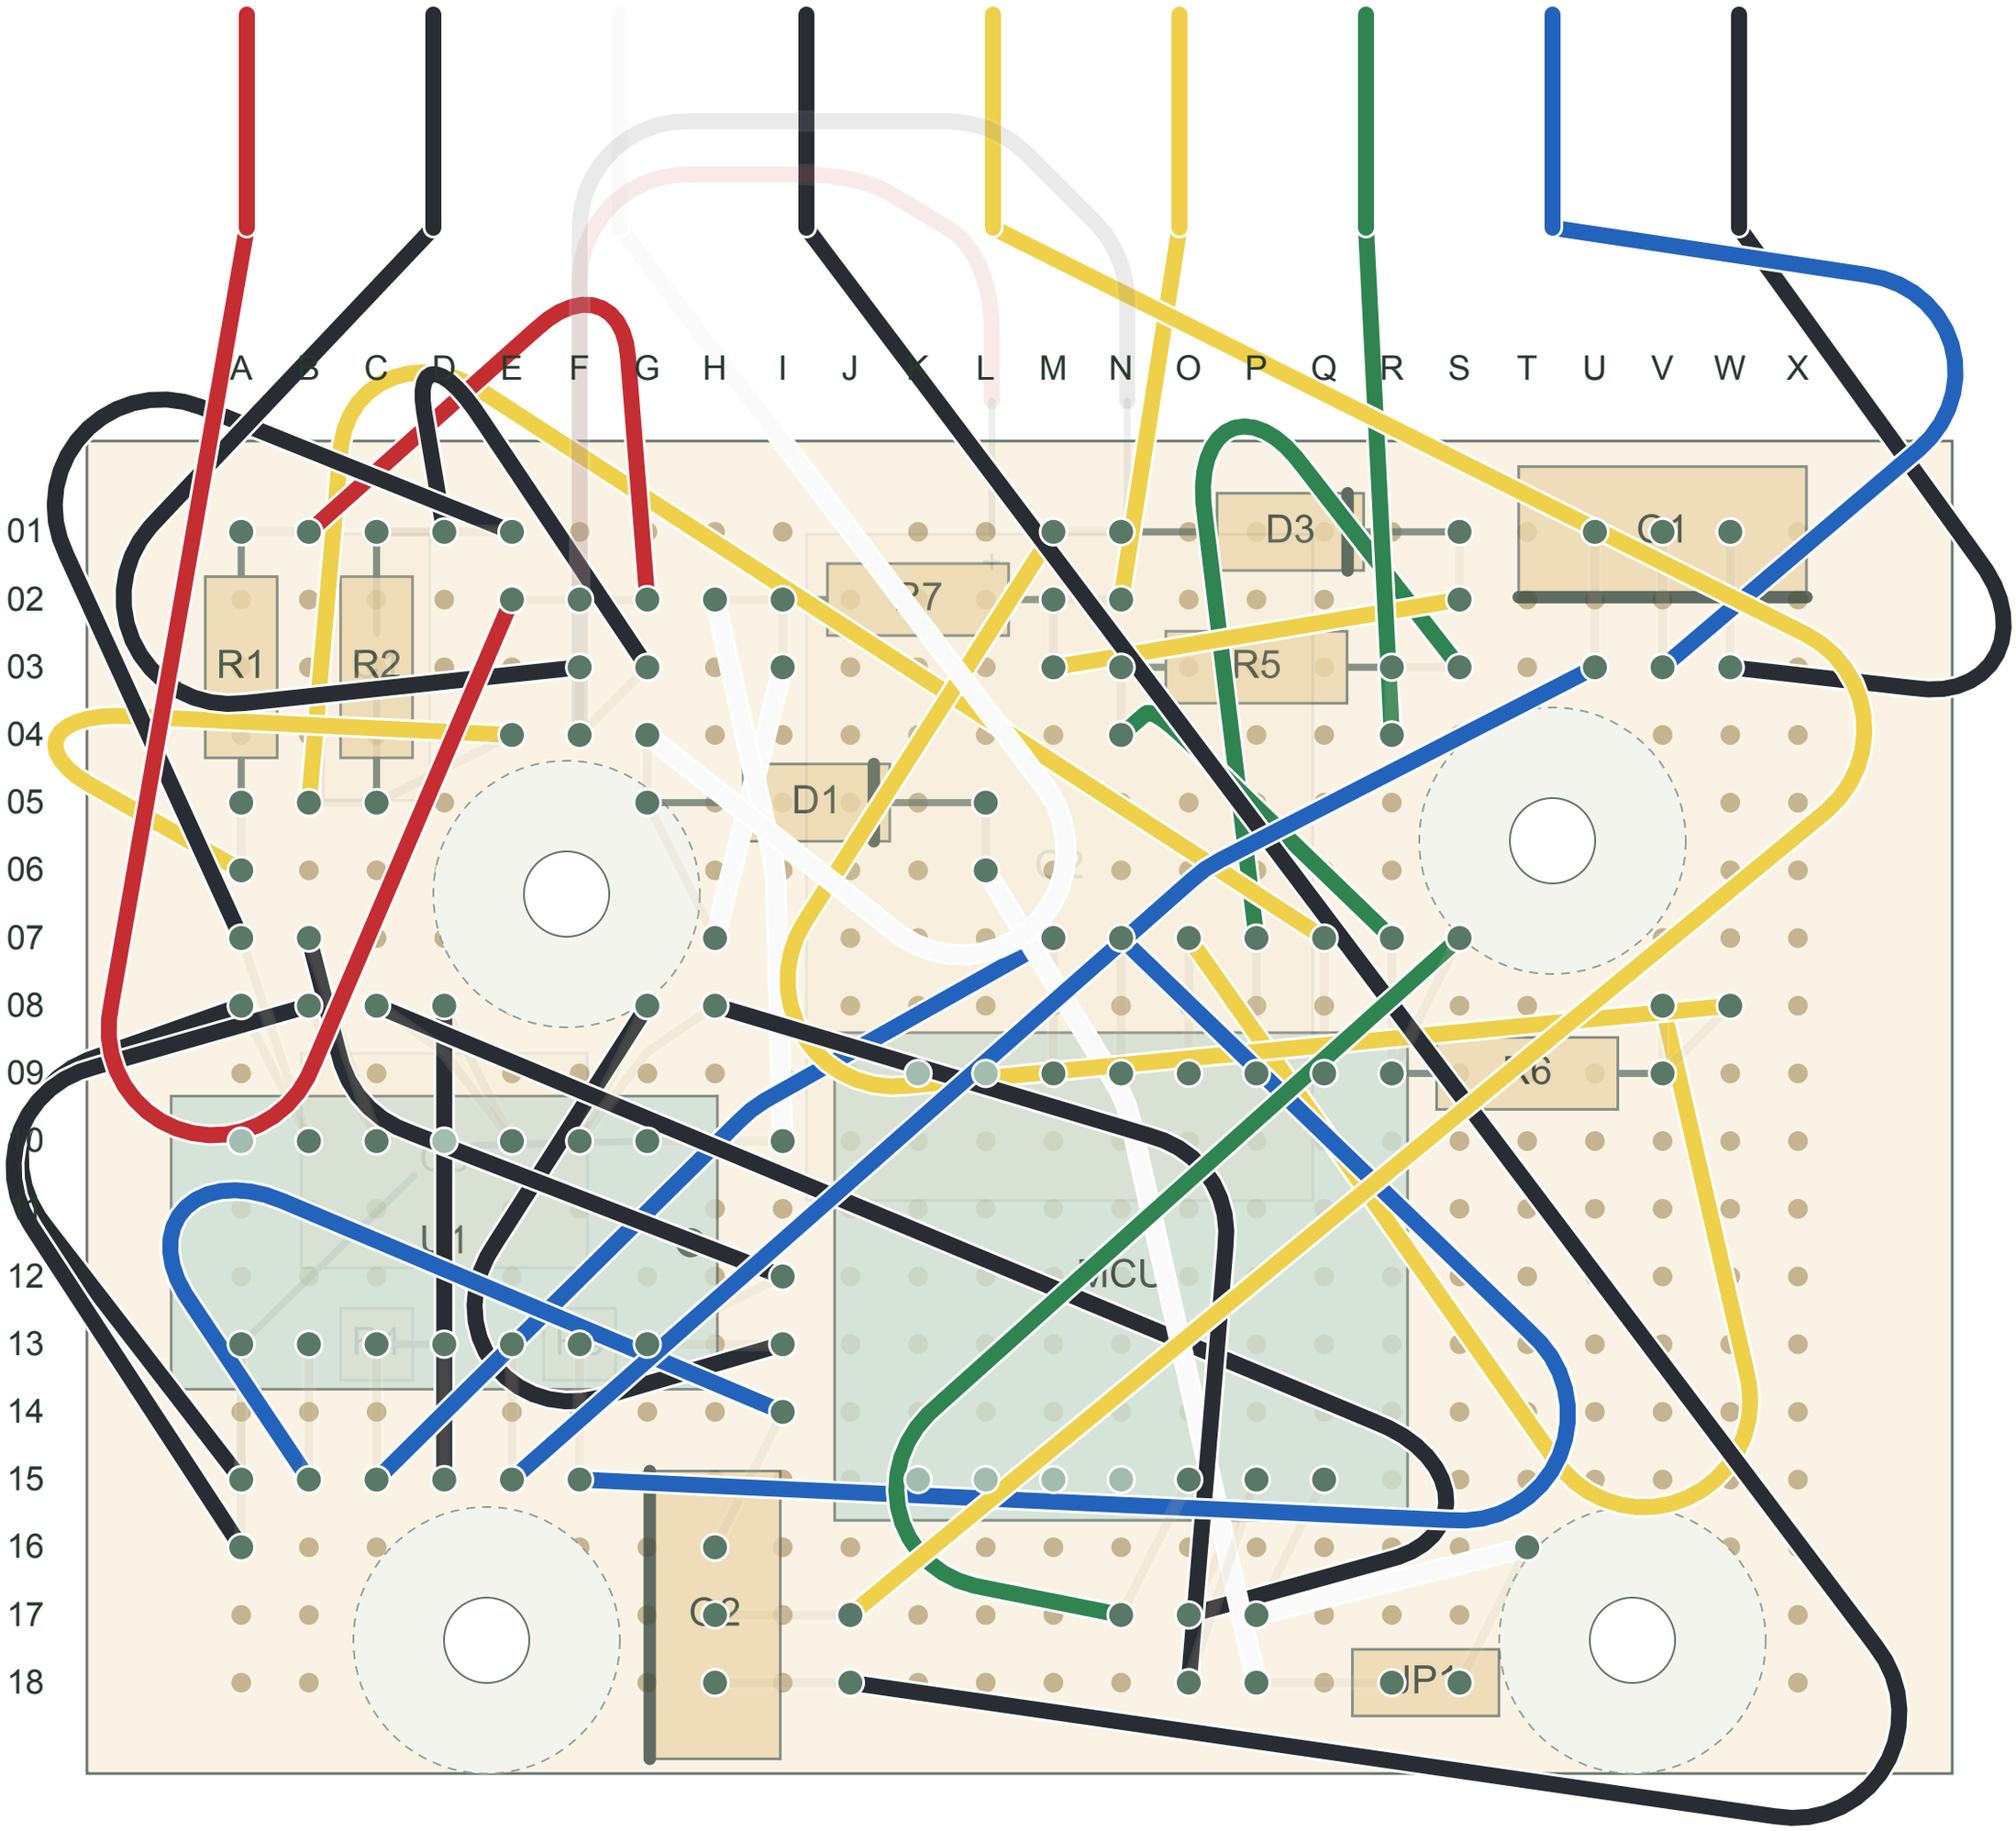


70 × 50 mm board · existing mounting holes · 20 mm removable spacers

C2 mounts on a tie base on the floor. Check actual part sizes before soldering.

SOLDER SIDE · mirrored

Short stripped ends and underside parts

Row 01 stays at the top. Hole names do not change when the board is flipped.

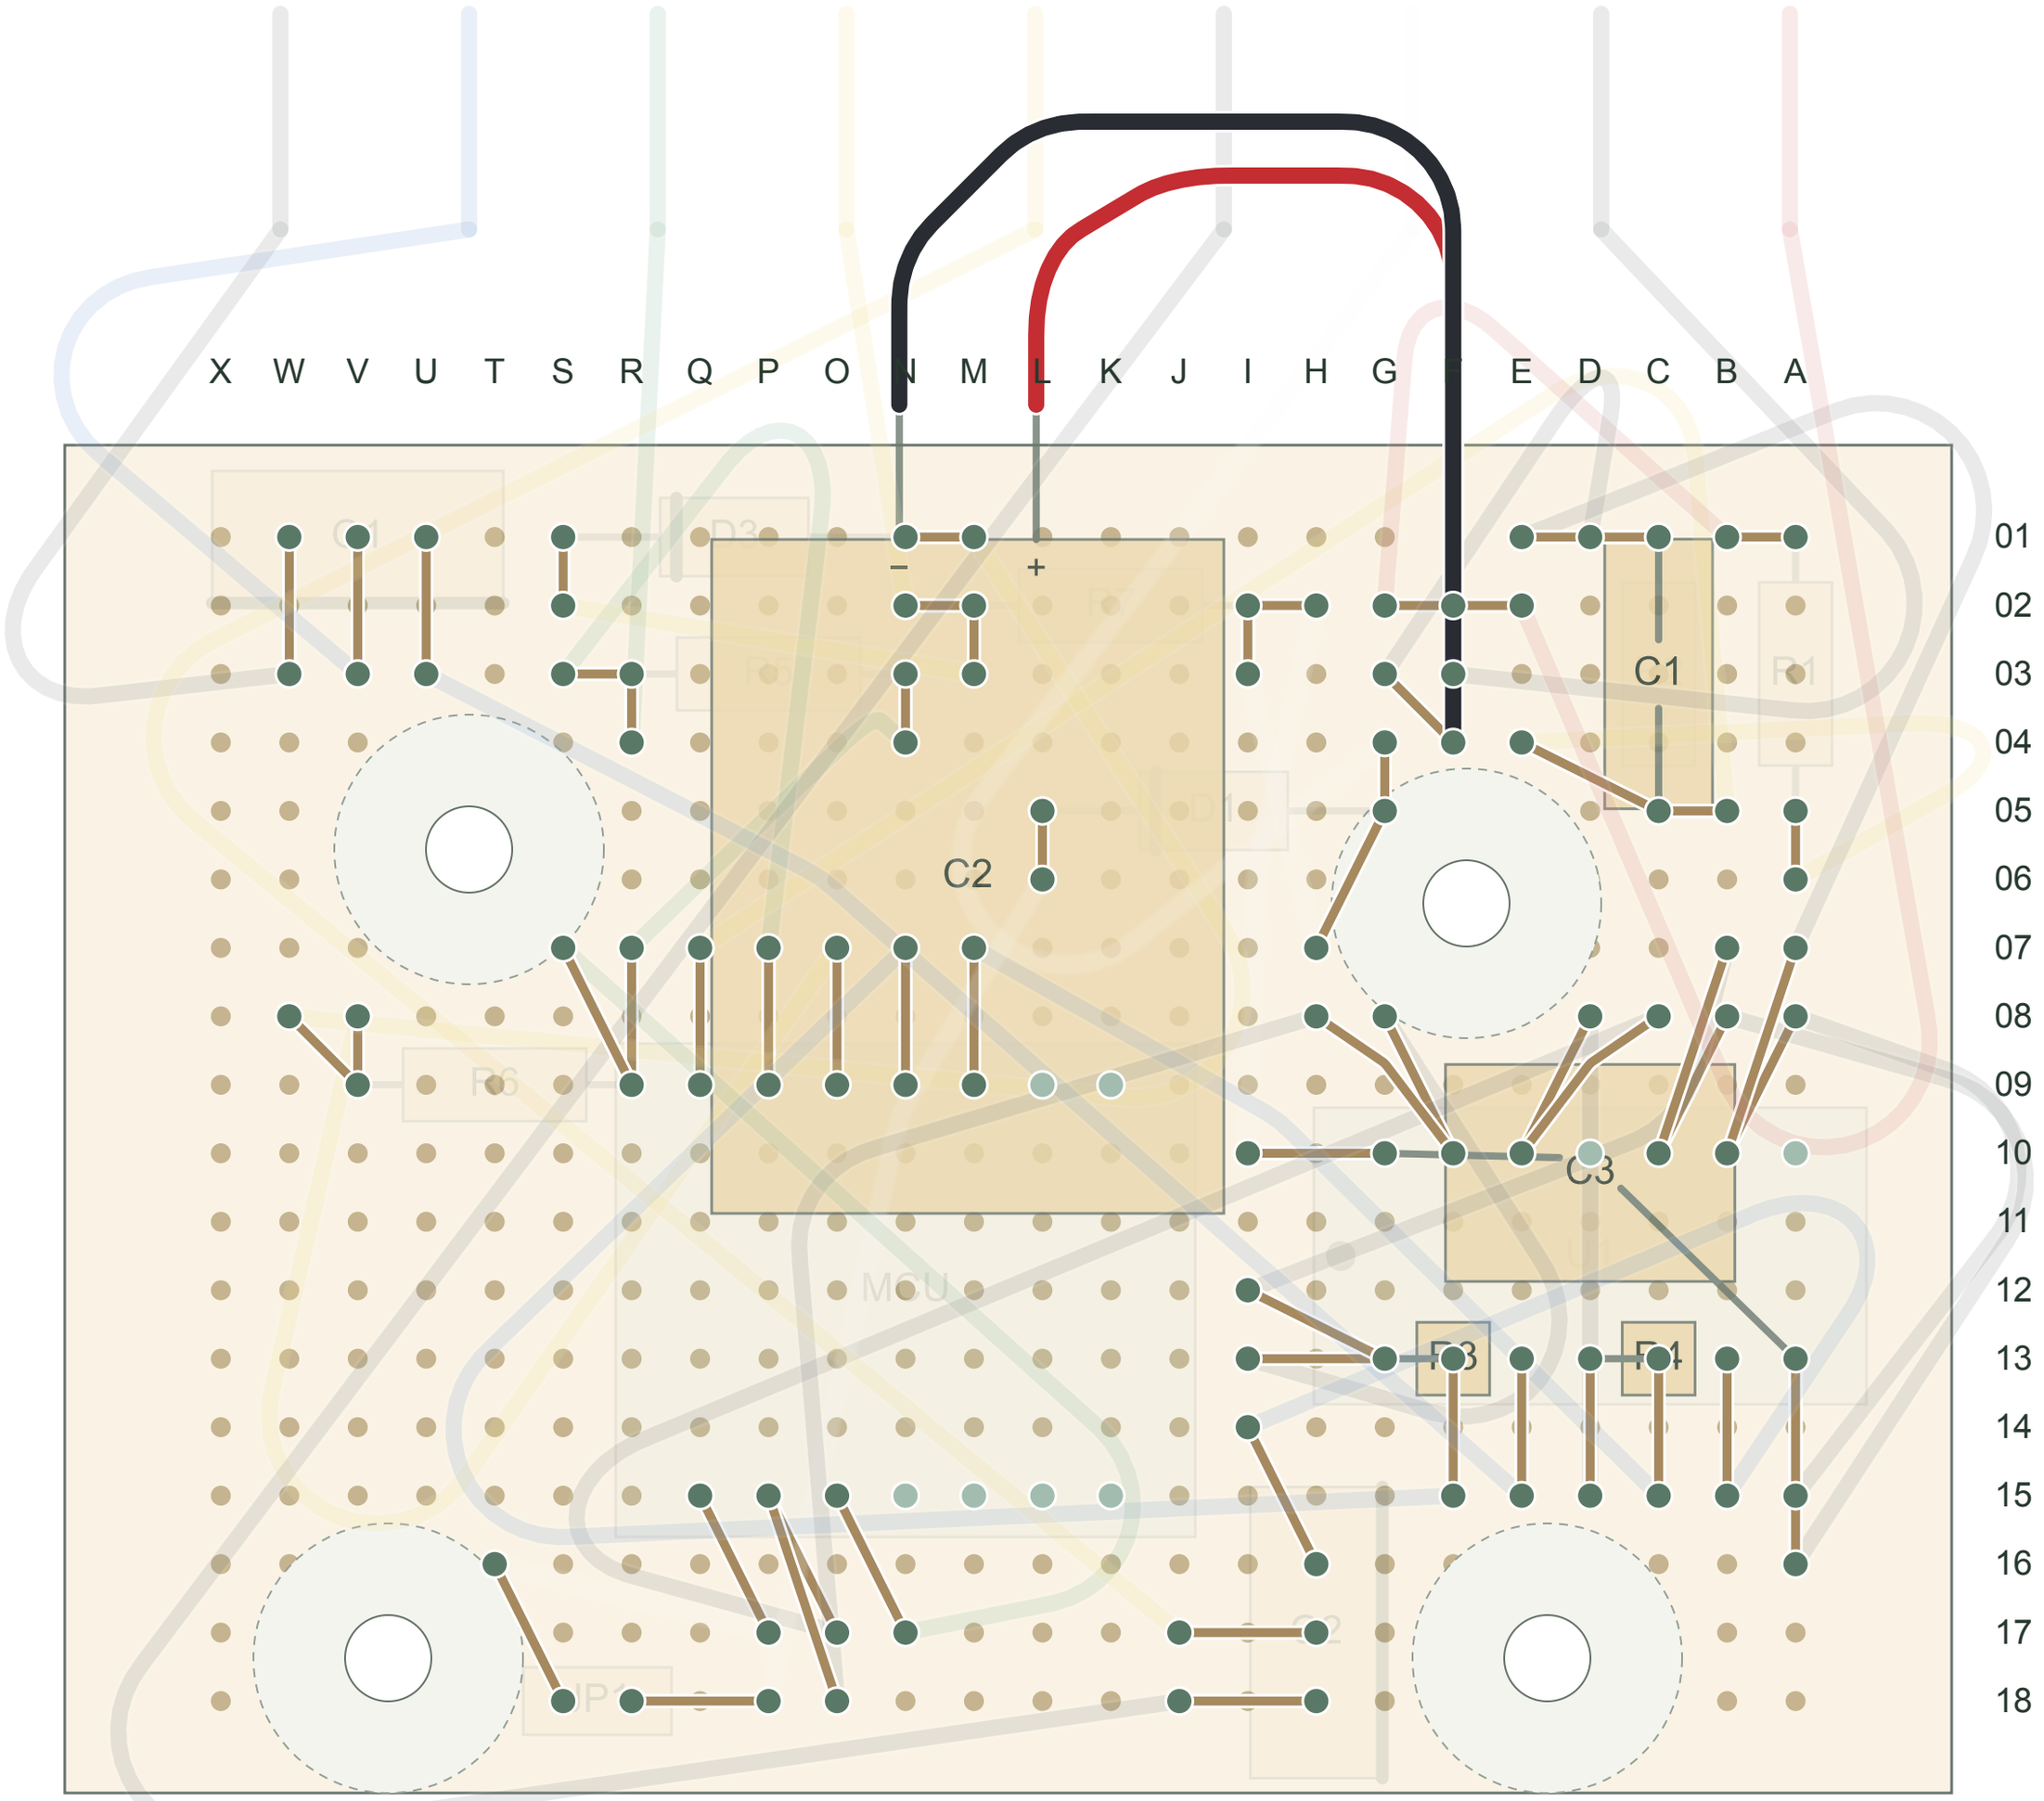

70 × 50 mm board · existing mounting holes · 20 mm removable spacers

C2 mounts on a tie base on the floor. Check actual part sizes before soldering.

WIRE CUTS AND SOLDER POINTS

W01 · white · P17 → Q15 → T16 → S18 · start 45 mm

W04 · black · A08 → B10 → A15 → A13 · start 74 mm

W07 · black · I13 → G13 → G08 → F10 · start 74 mm

W15 · green · P07 → P09 → S03 → R03 · start 78 mm

W25 · yellow · M03 → M02 → S02 → S01 · start 67 mm

W16 · yellow · O07 → O09 → V08 → V09 · start 100 mm

W22 · white · H07 → G05 → I03 → I02 · start 42 mm

H03 · black · W03 → W01 · start 92 mm + measured external run

H08 · yellow · N02 → M02 · start 98 mm + measured external run

W05 · black · A16 → A13 → B08 → C10 · start 99 mm

W10 · black · D08 → E10 → D15 → D13 · start 68 mm

H09 · green · R04 → R03 · start 101 mm + measured external run

W23 · white · H02 → I02 → I10 → G10 · start 62 mm

H05 · blue · V03 → V01 · start 128 mm + measured external run

W13 · yellow · Q07 → Q09 → B05 → C05 · start 104 mm

W24 · red · B01 → A01 → G02 → F02 · start 70 mm

W19 · blue · M07 → M09 → C15 → C13 · start 92 mm

W12 · green · N04 → N03 → R07 → R09 · start 74 mm

W14 · yellow · E04 → C05 → A06 → A05 · start 74 mm

W06 · black · B07 → C10 → I12 → G13 · start 96 mm

W09 · black · O17 → P15 → C08 → E10 · start 116 mm

W26 · white · L06 → L05 → P18 → R18 · start 83 mm

W21 · blue · B15 → B13 → I14 → H16 · start 104 mm

W02 · black · G03 → F04 → D01 → C01 · start 86 mm

W03 · black · E01 → C01 → A07 → B10 · start 102 mm

W17 · yellow · W08 → V09 → M01 → N01 · start 115 mm

H02 · black · F03 → F04 · start 123 mm + measured external run

W08 · black · H08 → F10 → O18 → P15 · start 113 mm

H04 · black · J18 → H18 · start 202 mm + measured external run

H07 · white · G04 → G05 · start 137 mm + measured external run

Trim after forming. Spare cut length is not an extra loop to leave on the board.

WIRE CUTS AND SOLDER POINTS

H01 · red · E02 → F02 · start 156 mm + measured external run

W18 · blue · N07 → N09 → F15 → F13 · start 133 mm

W11 · green · N17 → O15 → S07 → R09 · start 119 mm

W20 · blue · E15 → E13 → U03 → U01 · start 133 mm

H06 · yellow · J17 → H17 · start 189 mm + measured external run

C2_1 · red · F02 → C2.1 · start 55 mm

C2_2 · black · F04 → C2.2 · start 70 mm

Trim after forming. Spare cut length is not an extra loop to leave on the board.