

# **PDX-2000**

## **Modification Manual**

**February 18, 2003**

Vestax Corporation

## **Description:**

When the platter is pushed down and a fair amount of pressure is applied (during scratch play), the platter may generate a vibration. This problem occurs on units produced in the first few batches.

## **Applicable serial numbers:**

230V: 07N010201 – 23N380500

120V: 07U010401 – 23U380700


100V: 07F010001 – 22F370300

## **Solution:**

Following modification will solve the problem.

1. On the main PCB (the largest PCB located besides the motor), remove the following six diodes; D705, D706, D735, D736, D765 and D766.
2. Replace the following resistors (from 820 ohm to 470 ohm); R709, R739 and R769.

Please refer to attached figure #1.

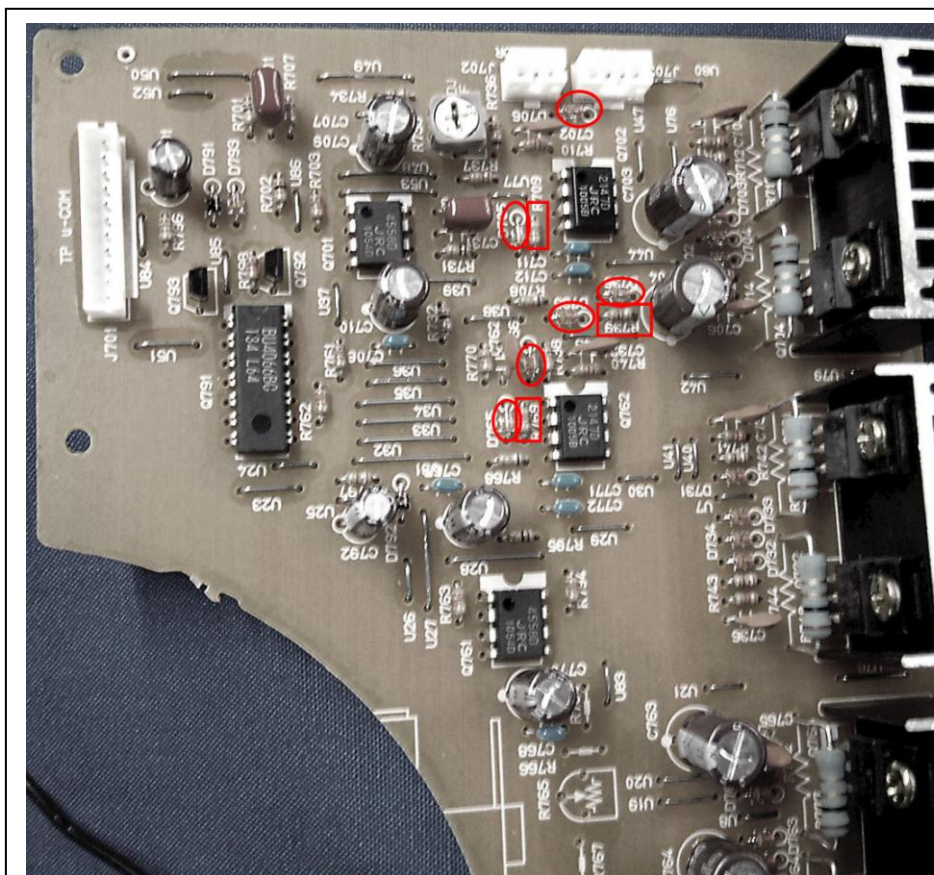

**Remove**

D705, D706

D735, D736

D765, D766

**Replace**  
820  $\Omega$  — 470  $\Omega$

R709

R739

R769