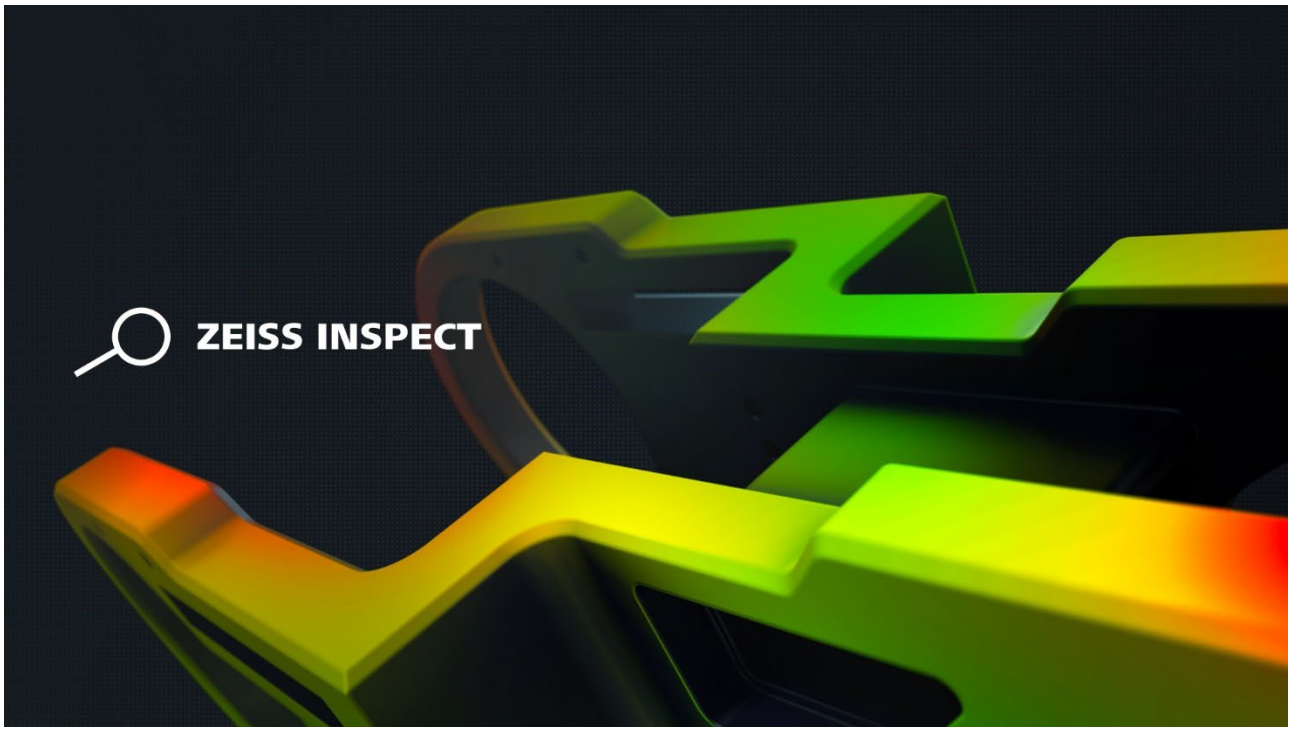

ZEISS INSPECT 2026 Service Pack 1

Release notes

Product version: 2026.3.0.984

Table of contents

About this release 1
Duty of care 1
System requirements 1
Notes for upgrading from ZEISS INSPECT 2025 2
- Licenses 2
- Firmware and drivers 2
- Discontinued sensor support 2
- Information for inspection kernel 2
- Release notes ZEISS INSPECT 2025 2

ZEISS INSPECT third party notices 3
Necessary drivers for sensors 3
ZEISS INSPECT 2026 Service Pack 1 4
- Improvements 4
- Fixed bugs 4
- INSPECT Optical 3D 5
  - Improvements 5
  - Fixed bugs 5
  - Known bugs 5
- INSPECT X-Ray 5
  - Fixed bugs 5
- INSPECT VMM and INSPECT CMM 6
  - Known bugs 6
- CORRELATE 6
  - Improvements 6
  - Fixed bugs 6
- Version information 7
  - Reverting to an earlier release version 7

ZEISS INSPECT 2026 8
- Improvements 8
- Fixed bugs 8
- Known bugs 8
- INSPECT Optical 3D 8
  - Improvements 8
  - Fixed bugs 9
  - Known bugs 9

INSPECT X-Ray 9
Fixed bugs 9
Known bugs 9
INSPECT VMM and INSPECT CMM 10
Known bugs 10
CORRELATE 10
Improvements 10
Fixed bugs 10
Known bugs 10
Version Information 10
Contact 11

About this release

ZEISS INSPECT is a comprehensive metrology solution combining several individual software products. We continuously improve our features. This release document contains improvements and bug fixes for the individual products as well as general improvements. Refer to the section "ZEISS INSPECT 2026 Service Pack 1" and to your individual product to get all relevant information.

You can find all new feature descriptions in the Tech Guide section What's New.

Duty of care

The user shall update all systems required for the operation of the ZEISS software to the latest version. To meet the responsibility for the safe operation of the PC hardware and software (operating system, virus scanner, firewall, ...), we strongly recommend you to secure the systems according to the current standards.

This includes:

- Installing updates
- Activating the virus scanner
- Activating the firewall and closing all ports not required for system operation

Normal user rights (default user) suffice to run the software. Extended or administrator rights are not required. Back up your systems regularly.

System requirements

The following system requirements are valid for ZEISS INSPECT Optical 3D, ZEISS INSPECT X-Ray, ZEISS INSPECT VMM, ZEISS INSPECT CMM and ZEISS CORRELATE. For the initial installation, administrator rights are needed. To use the complete ZEISS Quality Suite functionalities, an internet connection and ZEISS ID are required.

Required disc space for installation**:** ~ 100 GB

Below you will find both the minimum requirements and the recommended requirements for an optimal setup:

	Minimum requirements	Recommended requirements[1]
Processor	8 (logical) cores	12 (logical) cores or more
RAM	16 GB	64 GB or more
Graphics card[2]	OpenGL 4.5-compatible 4 GB VRAM	Certified graphics card (CUDA-compatible and Compute Capability 7.5 or more) 6 GB VRAM or more
Storage	User profile (main location for newly created projects) on SSD drive	User profile (main location for newly created projects) on NVMe SSD drive with 1 TB capacity or more
Operating system	Windows 10 (64-bit as minimum version 1607)	Windows 11 (64-bit 24H2)

Note: Use only supported Windows versions. For further details, refer to the official Windows lifecycle policy:

- Windows 10 Release Information
- Windows 11 Release Information

[1] Depend on used applications and projects.

[2] In the ZEISS Quality Tech Guide (ZEISS ID required) you can find a list of certificated graphic boards.

Notes for upgrading from ZEISS INSPECT 2025

Licenses

The ZEISS INSPECT 2026 requires a new license. This license update feature is only available for customers with a valid software maintenance agreement (SMA).

Do you use a ZEISS INSPECT 2025 or ZEISS CORRELATE 2025 license?

- Easily update it in the ZEISS portal.
- Need help? Check out our tutorial video and manual.

Are you using ZEISS INSPECT 2023 or ZEISS CORRELATE 2023 (or older versions)?

- Please contact your sales representative, who will assist you with the update process.
- If you encounter any issues during the update process, feel free to contact us.

Firmware and drivers

ZEISS INSPECT 2026 contains several new firmware and drivers compared with ZEISS INSPECT 2025:

- New sensor firmware for ATOS Q
- New sensor firmware for ATOS 5, ATOS 5X, ATOS Airfoil, ATOS LRX
- New sensor firmware for ATOS Capsule
- New sensor firmware for GOM Scan 1
- New ARAMIS controller firmware
- New sensor firmware for Varex PaxScan X-ray detectors under Windows 11

Discontinued sensor support

The following sensors are no longer supported in ZEISS INSPECT 2026:

- ATOS II Triple Scan Rev.02
- ATOS II Triple Scan Rev.02.1
- ATOS Triple Scan 12M
- ATOS III (+)

To work with these sensors, use ZEISS INSPECT 2025 or older.

Information for inspection kernel

With ZEISS INSPECT 2023, we have optimized our calculation methods regarding the best-fit calculation. This affects inspections plans created from version 2023 onwards. Inspection plans created with previous versions, will be computed using the original calculation methods.

The new numerical methods are operating the same class of the smallest deviations as described by PTB.

Release notes ZEISS INSPECT 2025

To download the Release notes for ZEISS INSPECT 2025, click here.

ZEISS INSPECT third party notices

An overview of third-party software used in the product is documented in the ZEISS_INSPECT_2026_third_party_notices.html file, which can be found in the installation folder of ZEISS INSPECT 2026 (C:\Program Files\Zeiss\INSPECT\2026\, when the default installation folder is used). You can also obtain this overview from the software via "Help" > "About ZEISS INSPECT" > "Licensing Information" > "Open Source Licensing Conditions".

Necessary drivers for sensors

The following tables contain information about drivers which must be installed for the usage with different sensors (depending on the licenses).

For the driver versions used to be with specific ZEISS INSPECT 2026 versions please refer to section Version Information in the respective release versions.

Table 1: ZEISS INSPECT Optical 3D

✓ must be installed ⊖ must not be installed	ZEISS Hardware Service	ZEISS Hardware Service (Remote)	Image acquisition driver[3]	colin3D	T-SCAN hawk
General case (IPC Driver license does not exist): • **ATOS Sensors** Licenses: Sensor Driver ATOS, Sensor Driver ATOS Core 2M, Sensor Driver ATOS Q for eMotors, Sensor Driver ATOS Q, Sensor Driver GOM Scan 1, Sensor Driver ATOS LRX • **ARAMIS Sensors** Driver ARAMIS, Sensor Driver ARAMIS 2D, Sensor Driver ARAMIS 5M • **T-SCAN hawk 2** License: Sensor Driver T-SCAN hawk 2 • **PONTOS Live** License: Sensor Driver PONTOS Live	✓		✓		⊖
General case (IPC Driver license does not exist): • **Photogrammetry** License: Sensor Driver Photogrammetry	✓				
General case (IPC Driver license does not exist): • **T-SCAN hawk** License: Sensor Driver T-SCAN hawk	✓		⊖		✓
General case (IPC Driver license does not exist): • **T-SCAN** License: Sensor Driver T-SCAN	✓			✓	
IPC Driver license exists: • **ATOS Q** • **ATOS Core**		✓			⊖

Table 2: ZEISS INSPECT X-Ray

✓ must be installed ⊖ must not be installed	ZEISS Hardware Service	Image acquisition driver[3]	Varex XRD runtime[4]	Varex Paxscan driver	Viscom driver collection	T-SCAN hawk
Sensor Driver METROTOM 6	✓	✓	✓			⊖
Sensor Driver METROTOM 1	✓	✓		✓		⊖
Sensor Driver Bosello MAX	✓		✓	✓		

[3] In the driver archive which may be downloaded from the ZEISS Download Center (ZEISS ID Required) this driver is named "InstallGigE-VERSION.exe" and located in the "InstallGigE" subfolders.

[4] The Varex XRD detector driver requires the Visual C++ Redistributable Packages für Visual Studio 2013, which is not included inside the Varex XRD Runtime installation. To solve this, download vcredist_x64.exe and vcredist_x86.exe from the website https://www.microsoft.com/de-de/download/details.aspx?id=40784 and run vcredist_x64.exe and vcredist_x86.exe to install on the computer.

✓ must be installed ⊖ must not be installed	ZEISS Hardware Service	Image acquisition driver[3]	Varex XRD runtime[4]	Varex Paxscan driver	Viscom driver collection	T-SCAN hawk
Sensor Driver METROTOM 800, Sensor Driver METROTOM 1500	✓			✓	✓	
Sensor Driver VoluMax 9 titan	✓			✓		

Table 3: ZEISS INSPECT VMM and ZEISS INSPECT CMM

✓ must be installed ⊖ must not be installed	ZEISS Hardware Service	CMM-OS NEO
• **CMM / VMM systems** such as ZEISS O-DETECT, ZEISS DuraMax License: Sensor Driver Multisensor CMM	✓	✓

Table 4: ZEISS CORRELATE

✓ must be installed ⊖ must not be installed	ZEISS Hardware Service	Image acquisition driver[3]	Camera driver ARAMIS 24M[5]	T-SCAN hawk
• **ATOS Sensors** Licenses: Sensor Driver ATOS, Sensor Driver ATOS Q for eMotors, Sensor Driver ATOS Q, Sensor Driver GOM Scan 1, Sensor Driver ATOS LRX • **ARAMIS Sensors** Licenses: Driver ARAMIS, Sensor Driver ARAMIS 2D, Sensor Driver ARAMIS 5M	✓	✓		⊖
• **ARAMIS 24M** License: Sensor Driver ARAMIS 24M	✓	✓	✓	⊖
• **Photogrammetry** License: Sensor Driver Photogrammetry	✓			

ZEISS INSPECT 2026 Service Pack 1

Improvements

With ZEISS INSPECT 2026 Service Pack 1, a new sensor firmware for ATOS Q sensors is provided.

Fixed bugs

The following bugs have been fixed in software version 2026 Service Pack 1:

Case No.	Description
8103487056	When exporting a mesh from clipboard as *.zelements file with "Export Selected Elements Only" twice, the software crashed.
-	When exporting a mesh, the Status Bar stayed visible when finished.
8103579884, CNR-426238-M7Y5L5, CNR-680797-Q0S9Y2	In a Double Robot Cell or a ScanCobot with an IPC, the initialization of the ATOS sensor failed when a proxy server was defined.
-	The software crashed when the Workflow Assistant was dragged out of the main window while a workflow step was active.

[5] In the driver archive which may be downloaded from ZEISS Download Center (ZEISS ID required) this driver is named "ARAMIS_24M_Emergent_driver-VERSION.exe" and located in the "ARAMIS_24M_Emergent_driver" subfolders.

8103610288	Mouse movements such as moving the camera were ignored when the main window was maximized and the Windows taskbar was set to automatically hide.
8103630899	For certain projects, the software crashed when using the Mirror Project Elements App 1.0.2.
8103680973, 8103652711	The robot connection via fieldbus did not work.
8103705222	When opening or recovering certain damaged projects, the software crashed.

INSPECT Optical 3D

Improvements

T-SCAN hawk 2:

- Improved feature preservation in polygonization, especially for fine resolution
- Reduced noise in polygonization, especially for fine resolution
- Reduced mesh size, recalculation time and project size

Fixed bugs

The following bugs have been fixed in software version 2026 Service Pack 1:

Case No.	Description
CNR-522625-Z5V0B2	Kiosk Interface – Hyperscale calibration: The Kiosk did not execute an unconditional hyperscale calibration before starting ATOS measurements.

Known bugs

The following bug is known in software version 2026 Service Pack 1:

Case No.	Description
CNR-581910-R8H2P7	Using Motion Replay for an automated calibration series with the ATOS Compact Scan, in conjunction with the Tilt and Swivel Unit and automated exposure time computation, is currently not functioning as intended. Calibrate the sensor manually in the "Set up" workspace.

INSPECT X-Ray

Fixed bugs

The following bugs have been fixed in software version 2026 Service Pack 1:

Case No.	Description
8103358474	In rare cases, the volume quality of CT scans was not as expected, the volume showed rings unrelated to the real object.
8103481822	When the setting "Safe move to loading position and flat-field position" was enabled, large parts could collide with the mover mechanics when rotating on the safe position.

INSPECT VMM and INSPECT CMM

Known bugs

The following bugs are known in software version 2026 Service Pack 1:

Description
2026 projects are not compatible with ZEISS CONNECTED QUALITY and cannot be converted.

CORRELATE

Improvements

TRITOP and ARGUS

- New supported camera for photogrammetric measurements: Canon EOS R1

Fixed bugs

The following bugs have been fixed in software version 2026 Service Pack 1:

Case No.	Description
CNR-627973-N0Y1X6	Stages in deformation measurements sporadically had missing A/D values and fell back to system timestamps when using an A/D delay. The mixed-up timestamps also caused a wrong stage order in the timeline.
-	The user could not define, calibrate or use an HD measuring volume with the SRX sensor. Remaining restriction: After the sensor has been declared in the Setup workspace, a reinitialization of the sensor must be done once manually.
-	In rare cases, sensors could not be connected to the software.
-	During a multi-device measurement, the analog values from the primary controller were overwritten by those from the secondary controller. To prevent issues, only the analog values from the primary device will be used in multi-device measurements.

Version information

The table below lists the versions of additional software/drivers which comes with the ZEISS INSPECT software or is needed by it (depending on licenses, see section Necessary Drivers for Sensors). This software may be installed by using the ZEISS Quality Suite or may be downloaded from the ZEISS Portal for manual installation.

During the installation of ZEISS INSPECT 2026, ZEISS Quality Suite and Microsoft ASP.Net Core Runtime will be installed if necessary.

ZEISS INSPECT	2026 Release 2026.3.0.984 Build 2026-03-04
ZEISS Quality Suite[1]	7.0.02778.0
ZEISS Hardware Service[2]	1.0.2.1
Image acquisition driver[2]	14.01.011
Camera driver ARAMIS 24M[2]	2.44.02
colin3D[2]	9.1.0.36
T-SCAN hawk[2]	3.0.5
Varex XRD runtime[2]	33.7.2145.26883[3]
Varex Paxscan driver[2]	3.1
Viscom driver collection[2]	2026.1.0.1
ZEISS Hardware Service (Remote)[2]	2026.3.0.984
Microsoft ASP.Net Core Runtime[4]	8.0.24
ZEISS CMM-OS NEO[5]	3.6

Reverting to an earlier release version

If you have the newest version of ZEISS INSPECT 2026 installed and you want to revert to an earlier release version, you must first uninstall the currently installed version. Once the software is removed, you can proceed to install the earlier release version of ZEISS INSPECT 2026.

[1] Bundled within the ZEISS INSPECT Installer.

[2] Can be installed via ZEISS Quality Suite when the system is connected to the Internet or when a local update source is used. Otherwise, they may be installed directly using the installers within the corresponding driver archive, which is available here: ZEISS Download Center (ZEISS ID required). Company administrators may contact the software support for further information about installation using company internal update sources or refer to the Tech Guide (ZEISS ID required).

[3] The Varex XRD detector driver requires the Visual C++ Redistributable Packages für Visual Studio 2013, which is not included inside the Varex XRD Runtime installation. To solve this, download vcredist_x64.exe and vcredist_x86.exe from the website https://www.microsoft.com/de-de/download/details.aspx?id=40784 and run vcredist_x64.exe and vcredist_x86.exe to install on the computer.

[4] Bundled within the ZEISS INSPECT Installer. Update/Installation is done directly over the ZEISS INSPECT update/installation.

[5] ZEISS CMM-OS NEO is available in the ZEISS Download Center (ZEISS ID required).

ZEISS INSPECT 2026

Improvements

ZEISS INSPECT now offers an offline help to support offline users with function descriptions. To access the help articles, press F1 with the respective function open or use the help guidance via "Help > Help".

For more content and high image quality, visit our ZEISS Quality Tech Guide.

Fixed bugs

The following bugs have been fixed in software version 2026:

Case No.	Description
CNR-186951-F5H5C7	In projects with GD&T tolerances, recalculating report elements caused other reports to be invalidated, preventing updates to individual reports.
8103218904	In GD&T, the ASME standard did not use the orientation plane.
CNR-218765-V3T9T3	When a label was pulled out and the label template was switched to ISO-3D, blue pull-out lines appeared.
CNR-479855-P3N1F4	Loading damaged projects caused a crash.
CNR-488885-R0N9B0	When adding a new check to the original element of a cluster, the check was not copied to existing cluster copies.
CNR-178718-F2R8L4	When importing multiple XML files and choosing to create new stages, imported elements were not correctly moved to their respective file's stage.
CNR-522921-T4R2J3	When the App content name contained a dot, the App content was not read correctly.
CNR-118279-P0J1J7	In projects without professional license, a single element transformation using the prealignment function was not possible.

Known bugs

The following bugs are known in software version 2026:

Case No.	Description
-	When exporting a mesh, the Status Bar stays visible when finished.
8103579884, CNR-426238-M7Y5L5	In a Double Robot Cell or a ScanCobot with an IPC, the initialization of the ATOS sensor can fail if a proxy server is defined.

INSPECT Optical 3D

Improvements

- T-SCAN hawk 2 Satellite Mode: New mode to continuously capture images with a configurable interval.
- T-SCAN hawk 2 Surface Measurement
    - The detail scan mode is replaced by an adaptive resolution.
    - The detail factor (x2, x4, x8) can be changed directly during the scanning process. It is no longer necessary to scan an object with base resolution first, and then select a specific area where a higher resolution is needed and scan again.

- New 'automatic' mode detects edges and increases the resolution automatically, if necessary.

Fixed bugs

The following bugs have been fixed in software version 2026:

Case No.	Description
CNR-399344-N8L9Z1, CNR-388787-V2K2H7, CNR-429439-Z1G7P0, CNR-459334-M7Y7J2, CNR-455968-H0W5H1	The internal minimum selection depth was introduced. For not diagonally punched holes the base plane computation method was switched to Gaussian best-fit 5 sigma. For existing projects, the change back is applied by executing "Edit Creation Parameters" on the measuring principle.
CNR-617638-Z7H5C0	Automatically computed exposure times for photogrammetry were too short.

Known bugs

The following bugs are known in software version 2026:

Case No.	Description
CNR-581910-R8H2P7	Using Motion Replay for an automated calibration series with the ATOS Compact Scan, in conjunction with the Tilt and Swivel Unit and automated exposure time computation, is currently not functioning as intended. Calibrate the sensor manually in the “Set up” workspace.
CNR-522625-Z5V0B2	Kiosk Interface – Hyperscale calibration: The Kiosk currently does not execute an unconditional hyperscale calibration before starting ATOS measurements. Necessary execution of full calibrations and hyperscale calibration due to temperature drift are not affected by this.

INSPECT X-Ray

Fixed bugs

The following bugs have been fixed in software version 2026:

Case No.	Description
8103354673	The evaluation did not work because the folder structure of App Evaluation.addon was wrong.
8103324472	The software crashed when opening "Volume cropping" from "Capture Volume" or "Reconstruct Volume From Images" dialogs that are pinned in the UI.
8103378373, 8103408301	Capturing volume data into project templates with existing empty volume elements was not possible.

Known bugs

The following bugs are known in software version 2026:

Case No.	Description
8103358474	In rare cases, the volume quality of CT scans is not as expected, the volume shows rings unrelated to the real object.

8103481822	When the setting "Safe move to loading position and flat-field position" is enabled, large parts can collide with the mover mechanics when rotating on the safe position.

INSPECT VMM and INSPECT CMM

Known bugs

The following bug is known in software version 2026:

Description
2026 projects are not compatible with ZEISS CONNECTED QUALITY and cannot be converted.

CORRELATE

Improvements

- Integration of Illumination B45-15
    - Pulsing Mode: Allows users to minimize the amount of light energy directed at specimens, reducing potential interference and improving the accuracy of results.
      Usage Note: Be cautious when using low frequencies ranging from 3 to 30 Hz, as they may cause a stroboscopic effect, potentially leading to discomfort for users.
    - Dimming Mode: Provides flexibility in energy usage, allowing users to adjust the light intensity according to their needs. When not actively measuring, dimming can reduce glare, making it easier to work with the system. Users can select partial power settings for certain tests to minimize energy input or opt for full power when necessary.
- Enhanced ARAMIS Controller Lamp Outputs: Users can now configure the lamp outputs of the ARAMIS Controller, offering greater adaptability in experimental setups and lighting conditions.

Fixed bugs

The following bug has been fixed in software version 2026:

Case No.	Description
CNR-521222-H4P9B6	Tracking spots could not be used with ZEISS CORRELATE 2025. Flash durations were not set properly.

Known bugs

The following bug is known in software version 2026:

Case No.	Description
CNR-627973-N0Y1X6	Stages in deformation measurements can sporadically have missing A/D values and fall back to system timestamps when using an A/D delay. The mixed-up timestamps also cause a wrong stage order in the timeline.

Version Information

The table below lists the versions of additional software/drivers which comes with the ZEISS INSPECT software or is needed by it (depending on licenses, see section Necessary Drivers for Sensors). This software may be installed by using the ZEISS Quality Suite or may be downloaded from the ZEISS Portal for manual installation.

During the installation of ZEISS INSPECT 2026, ZEISS Quality Suite and Microsoft ASP.Net Core Runtime will be installed if necessary.

ZEISS INSPECT	2026 Release 2026.2.0.1091 Build 2025-10-10
ZEISS Quality Suite[1]	7.0.2770.0
ZEISS Hardware Service[2]	1.0.2.1
Image acquisition driver[2]	14.01.006
Camera driver ARAMIS 24M[2]	2.44.02
colin3D[2]	9.1.0.36
T-SCAN hawk[2]	3.0.5
Varex XRD runtime[2]	33.7.2145.26883[3]
Varex Paxscan driver[2]	3.1
Viscom driver collection[2]	2026.1.0.0
ZEISS Hardware Service (Remote)[2]	2026.2.0.1091
Microsoft ASP.Net Core Runtime[4]	8.0.17
ZEISS CMM-OS NEO[5]	3.6

Contact

Carl Zeiss GOM Metrology GmbH

Schmitzstraße 2

38122 Braunschweig

Germany

Phone: +49 531 390 290

support.optical.metrology@zeiss.com

[1] Bundled within the ZEISS INSPECT Installer.

[2] Can be installed via ZEISS Quality Suite when the system is connected to the Internet or when a local update source is used. Otherwise, they may be installed directly using the installers within the corresponding driver archive, which is available here: ZEISS Download Center (ZEISS ID required). Company administrators may contact the software support for further information about installation using company internal update sources or refer to the Tech Guide (ZEISS ID required).

[3] The Varex XRD detector driver requires the Visual C++ Redistributable Packages für Visual Studio 2013, which is not included inside the Varex XRD Runtime installation. To solve this, download vcredist_x64.exe and vcredist_x86.exe from the website https://www.microsoft.com/de-de/download/details.aspx?id=40784 and run vcredist_x64.exe and vcredist_x86.exe to install on the computer.

[4] Bundled within the ZEISS INSPECT Installer. Update/Installation is done directly over the ZEISS INSPECT update/installation.

[5] ZEISS CMM-OS NEO is available in the ZEISS Download Center (ZEISS ID required).