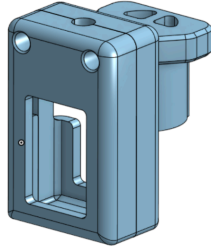


Cub - Vernier Go Direct Mount, *Mounting Instructions*

Revision History.

Rev. No	Title	Image	BOM
0	<i>Cub - Vernier Go Direct Mount</i>		See Appendix 1

NOTE: The CubXL - Vernier Go Direct Mount was designed to be used in conjunction with the following component(s):


Item No.	Title	Qty.	Image	Link
1	<i>Vernier Go Direct Force and Acceleration Sensor</i>	1		https://www.vernier.com/product/go-direct-force-and-acceleration-sensor/

Printing Cub - Vernier Go Direct Mount

NOTE: The Cub - Vernier Go Direct Mount was originally printed using a *Bambu Labs X1-Carbon* 3D Printer, with *Bambu Lab PLA Basic* filament.

NOTE: The default print settings were used with the exception of support generation being turned ON in order to support overhangs. See Figure 1 for a screenshot of support settings.

Figure 1.

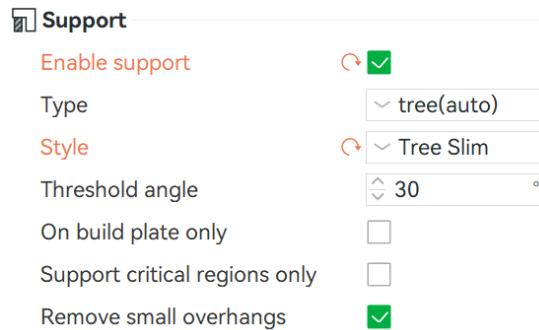

NOTE: The values in orange were changed from the default settings

Installation of Cub - Vernier Go Direct Mount

Required Components.

Item No.	Name	Rev.	Picture	Quantity
1	<i>Cub - Vernier Go Direct Mount</i>	0	See Revision History	1
3	<i>18-8 SS Button Head Screw, M5, 15mm</i>	N/A		2
4	<i>Zinc Plated Steel Hex Nut, M5</i>	N/A		2

STEP 1. Place the Vernier Go Direct Force and Acceleration Sensor into the rectangular opening of the back half of the Vernier Go Direct Mount, (item no. 1 in BOM). See Figure 2 for orientation of the sensor.

Figure 2.




STEP 2. Place the cover of the Vernier Go Direct Mount (item no. 2 in BOM) onto the assembled sensor and mount, See Figure 3 for reference.

Figure 3.



STEP 3. Place the two (2) 18-8 SS Button Head Screws, M5, 15mm into the two (2) corresponding holes of the Vernier Go Direct Mount (above the sensor). Then place two (2) Zinc Plated Steel Hex Nut, M5 into the hexagon cavities on the backside of the Vernier Go Direct Mount (above the sensor). Using the 3mm Allen Wrench, tighten the two (2) 18-8 SS Button Head Screw, M5, 15mm to the two (2) Zinc Plated Steel Hex Nut, M5 until they are snug and clamping the mount around the force sensor. See Figure 4 for reference.

Figure 4.

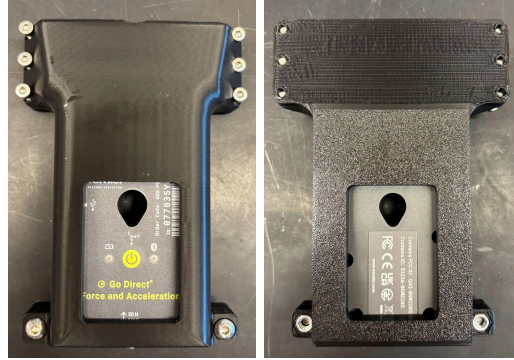

STEP 4. Align the dovetail on the back of the Vernier Go Direct Mount (Base) into the dovetail slot on the Cub - 3018 Mount. See Figure 5 for reference.

Figure 5.

STEP 5. Slide the assembly of the Cub - Vernier Go Direct Mount into the circular clamp on the z-axis of the gantry. Ensure that the assembly is inserted as far as it can go into the circular clamp. See Figure 6 for reference.




Figure 6.

STEP 6. Using the 3mm Allen Wrench, tighten the screw on the circular clamp to ensure the assembly is snug. Then plug in the provided cable for the Vernier Go Direct Force and Acceleration sensor into the side of the sensor.

Appendix 1

Cub - Vernier Go Direct Mount_REV. 0 BOM

Item No.	Title	Image	Revision
----------	-------	-------	----------

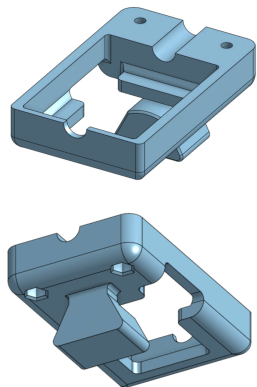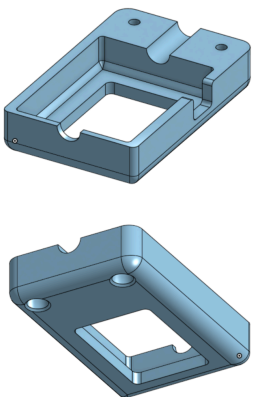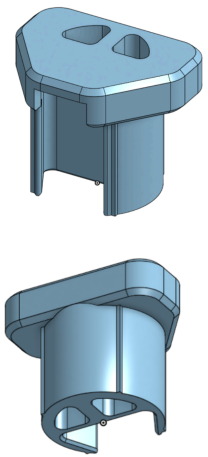1	<i>Cub - Vernier Go Direct Mount (Base)</i>		0
2	<i>Cub - Vernier Go Direct Mount (Cover)</i>		0
3	<i>Cub - 3018 Mount</i>		0