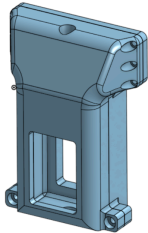


CubXL - Vernier Go Direct Mount, *Mounting Instructions*

Rev. No	Title	Image	BOM
4	<i>CubXL - Vernier Go Direct Mount</i>		See Appendix 1

NOTE: The CubXL - Vernier Go Direct Mount was designed to be used in conjunction with the following component(s):


Item No.	Title	Qty.	Image	Link
1	<i>Vernier Go Direct Force and Acceleration Sensor</i>	1		https://www.vernier.com/product/go-direct-force-and-acceleration-sensor/

3D Printing CubXL - Vernier Go Direct Mount

NOTE: The CubXL - Vernier Go Direct Mount was originally printed using a *Bambu Labs X1-Carbon* 3D Printer, with *Bambu Lab PLA Basic* filament.

NOTE: The default print settings were used with the exception of support generation being turned ON in order to support overhangs. See Figure 1 for a screenshot of support settings.


Figure 1.

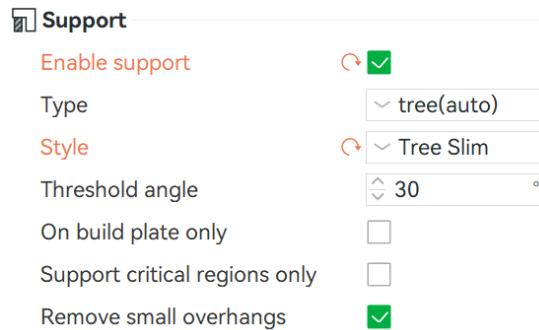

NOTE: The values in orange were changed from the default settings

Installation of CubXL - Vernier Go Direct Mount

Required Components.

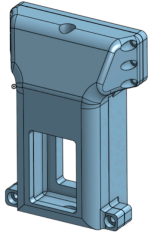Item No.	Name	Rev.	Picture	Quantity
1	CubXL - Vernier Go Direct Mount	4		1
2	18-8 SS Socket Head Screw, M4, 16mm	N/A		6

3	<i>18-8 SS Button Head Screw, M5, 15mm</i>	Only required if using REV. 4		2
4	<i>Zinc Plated Steel Hex Nut, M5</i>	Only required if using REV. 4		2

STEP 1. Place the Vernier Go Direct Force and Acceleration Sensor into the rectangular opening of the back half of the Vernier Go Direct Mount, (item no. 1 in BOM). See Figure 2 for orientation of the sensor.

Figure 2.




STEP 2. Place the cover of the Vernier Go Direct Mount (item no. 2 in BOM) onto the assembled sensor and mount, See Figure 3 for reference.

Figure 3.




STEP 3. Place the six (6) 18-8 SS Socket Head Screws, M4, 16mm into the six (6) corresponding holes of the Vernier Go Direct Mount (above the sensor). Then place the two (2) 18-8 SS Button Head Screw, M5, 15mm into the two (2) corresponding holes of the Vernier Go Direct Mount (below the sensor). Place two (2) Zinc Plated Steel Hex Nut, M5 into the hexagon cavities on the backside of the Vernier Go Direct Mount (below the sensor). Using the 3mm Allen Wrench, tighten the two (2) 18-8 SS Button Head Screw, M5, 15mm to the two (2) Zinc Plated Steel Hex Nut, M5 until they are snug and clamping the mount around the force sensor. See Figure 4 for reference.

Figure 4.

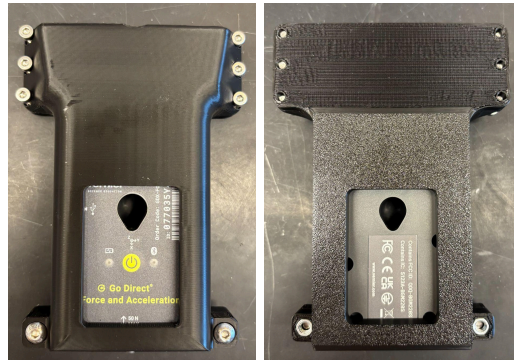



STEP 4. Align the six (6) 18-8 SS Socket Head Screws, M4, 16mm to the six (6) holes on the X-Axis Module w/ XZ Axis Module/Z-Axis Motor and tighten with the 3mm Allen Wrench until snug. Then plug in the provided cable for the Vernier Go Direct Force and Acceleration sensor into the side of the sensor. See Figure 5 for reference.

Figure 5.

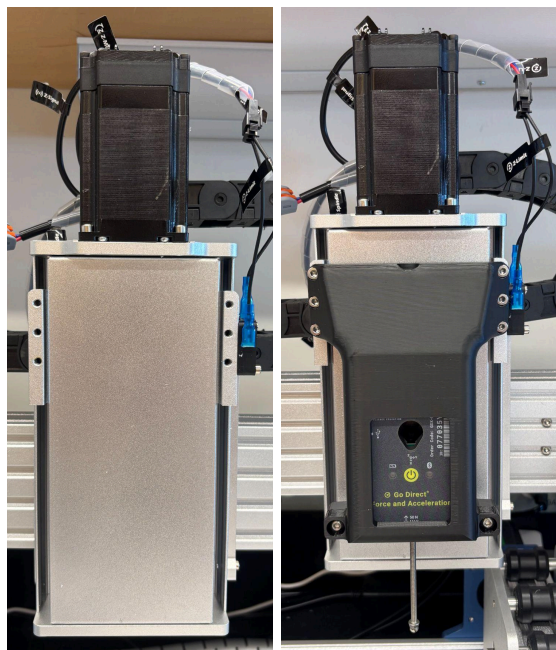

Appendix 1

CubXL - Vernier Go Direct Mount_REV. 4 BOM

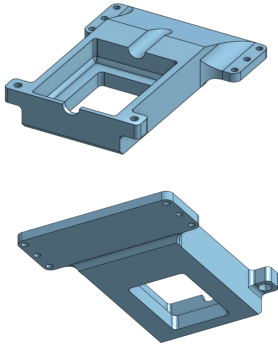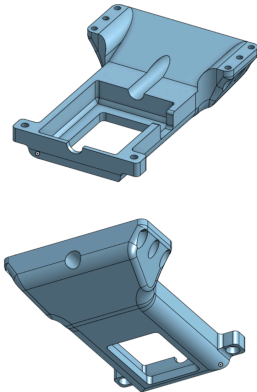Item No.	Title	Image	Revision
1	<i>Vernier Go Direct Mount (Base)</i>		4
2	<i>Vernier Go Direct Mount (Cover)</i>		4