

# NIST Handbook 133 Checking the Net Contents of Packaged Goods

as adopted by the 89th National Conference on Weights and Measures 2004

Editors:

Tom Coleman Linda Crown Kathryn M. Dresser

Henry V. Oppermann, Chief NIST Weights and Measures Division Gaithersburg, MD 20899-2600

**U.S. Department of Commerce**Donald L. Evans, Secretary

**Technology Administration**Phillip J. Bond, Under Secretary
of Commerce for Technology

National Institute of Standards and Technology Hratch G. Semerjian, Acting Director

NIST Handbook 133

Fourth Edition January 2005

Supersedes NIST Handbook 133, Third Edition, 1998; Supplement 1, 1990; Supplement 2, 1991; Supplement 3, 1992; Supplement 4, 1994; Fourth Edition

January 2002; Revised 2004)

Certain commercial entities, equipment, or materials may be identified in this document in order to describe an experimental procedure or concept adequately. Such identification is not intended to imply recommendation or endorsement by the National Institute of Standards and Technology, nor is it intended to imply that the entities, materials, or equipment are necessarily the best available for the purpose.

National Institute of Standards and Technology Handbook 133, 2005 Edition Natl. Inst. Stand. Technol. Handb. 133, 2005 Ed. 109 Pages (Dec. 2004) CODEN: NIHAE2

U.S. GOVERNMENT PRINTING OFFICE WASHINGTON: 2004

ternet: bookstore.gpo.gov Phone: toll free (866) 512-1800; DC area (202) 512-1800 Fax: (202) 512-2250 Mail: Stop SSOP, Washington, DC 20402-0001

#### **Foreword**

This handbook has been prepared as a procedural guide for the compliance testing of net content statements on packaged goods. Compliance testing of packaged goods is the determination of the conformance of the results of the packaging, distribution, and retailing process (the packages) to specific legal requirements for net content declarations. This handbook has been developed primarily for the use of government officials. However, it should also be useful to commercial and industrial establishments in the areas of packaging, distribution, and sale of commodities.

In conducting compliance testing, the conversion of quantity values from one measurement system to another (e.g., from the metric system to the avoirdupois system) should be handled with careful regard to the implied correspondence between the accuracy of the data and the number of digits displayed. In all conversions, the number of significant digits retained should ensure that accuracy is neither sacrificed nor exaggerated. For this 4<sup>th</sup> edition of Handbook 133 all dimensions for test procedures, devices, or environments have been rounded to two significant digits (e.g., 2.5 cm to 1.0 in) or to a precision level applicable to the test equipment (e.g., 200 kPa for 25 psi and 35 MPa for 5,000 psi).

# Table of Contents for the 4<sup>th</sup> Edition of Handbook 133 (2005)

Forewordll			
200	02 Amendments Table	vii	
Cha	apter 1 – General Information	1	
	Scope		
1.2	Package Requirements	2	
	Sampling Plans	3	
1.4	Other Regulatory Agencies Responsible for Package Regulations and Applicable Requirements	4	
1.5	Assistance in Testing Operations.		
	Health and Safety		
	Good Measurement Practices		
Cha	apter 2 – Basic Test Procedure – Gravimetric Testing	7	
2.1	Considerate in Took Durandows for Charlein of the Nat Constants of Daylored Conde	7	
2.1	Gravimetric Test Procedure for Checking the Net Contents of Packaged Goods Measurement Standards and Test Equipment	/	
	Basic Test Procedure		
	Borax		
	The Determination of Drained Weight		
2.5	Drained Weight for Glazed or Frozen Foods	20 21	
2.0	Drained Weight for Glazed of Frozen Foods		
Ch	apter 3 – Test Procedures – For Packages Labeled by Volume	24	
3.1	Scope	24	
	Gravimetric Test Procedure for Liquids		
	Volumetric Test Procedures for Liquids		
	Other Volumetric Test Procedures		
	Mayonnaise and Salad Dressing		
	Goods Labeled by Capacity – Volumetric Test Procedure		
	Pressed and Blown Glass Tumblers and Stemware		
	Volumetric Test Procedures for Paint, Varnish, and Lacquers – Non Aerosol		
	Testing Viscous Materials – Such as Caulking Compounds and Pastes		
3.10	Peat Moss	38	
3.11	1 Mulch and Soils Labeled by Volume	40	
	2 Ice Cream Novelties		
3.13	3 Fresh Oysters Labeled by Volume	45	
	4 Determining the Net Contents of Compressed Gas in Cylinders		
	5 Volumetric Test Procedures for Packaged Firewood with a		
	Labeled Volume of 113 L (4 ft3) or Less	49	
	5 Boxed Firewood	50	
3.17	7 Crosshatched Firewood	51	
3 18	R Rundles and Rags of Firewood	51	

Ch	apter 4 – Test Procedures - Packages Labeled by Count, Linear			
	Measure, Area, Thickness, and Combinations of Quantities	53		
4.1		<b>5</b> 2		
4.1	Scope			
	Packages Labeled by Count			
	Packages Labeled with 50 Items or Less			
	Packages Labeled by Count of More than 50 Items			
	Paper Plates and Sanitary Paper Products	57		
4.6	Special Test Requirements for Packages Labeled by Linear or			
	Measure (Area)			
	Polyethylene Sheeting			
4.8 Packages Labeled by Linear or Square (Area) Measure				
4.9 Bailer Twine – Test Procedure for Length				
4.10	Procedure for Checking the Area Measurement of Chamois	65		
Ind	ex	69		
A n:	pendix A Tables	A 1		
Ap	pendix A Tables	A-1		
Ap	pendix B Random Number Tables	B-1		
1.	•			
Ap	pendix C Glossary			
Δn	pendix D Acknowledgments and References	D-1		
ΔP.	pendia D Acknowledgments and References			
Ap	pendix E Model Inspection Report Forms	E-1		

# Handbook 133, Fourth Edition (2005) 2004 Amendments

The following table lists the laws and regulations amended by the 89th NCWM. As appropriate, the text on the cited pages indicates the changes to the section or paragraph as "Added 2004" or "Amended 2004." Unless otherwise noted, the effective date of the information "Added" or "Amended" in 2004 is January 1, 2005.

L&R Committee Item No.	Chapter, Section, And Title	Action	Page
None			

# Handbook 133, Fourth Edition (2005) 2004 Editorial Corrections

Chapter, Section, And Title	Action	Page
Chapter 3, Section 3.2: <i>Test Procedure</i> .	Amended step 3, volumetric measure selection for milk.	26
Appendix A., Tables 2-5, 2-6, 2-8, and 2-10.	Amended SI values to more closely correspond to inch-pound values.	A-6 – A-12
Appendix A, Table 2-11	Table corrected by including inspection lot sizes from Table 2-1.	A-13
Appendix E., Standard Package Inspection Report and Standard Inspection Report – Example	Amended title of Box 9 (R <sub>c</sub> ) to match Random Package Inspection Report.	E-4, E-5

# **Chapter 1. General Information**

#### 1.1 Scope

Routine verification of the net contents of packages is an important part of any weights and measures program to facilitate value comparison and fair competition. Consumers have the right to expect packages to bear accurate net content information. Those manufacturers whose products are sold in such packages have the right to expect that their competitors will be required to adhere to the same standards.

The procedures in this handbook are recommended for use to verify the net quantity of contents of packages kept, offered, or exposed for sale, or sold by weight, measure (including volume, and dimensions), or count at any location (e.g., at the point-of-pack, in storage warehouses, retail stores, and wholesale outlets).

#### When and where to use these procedures?

An effective program will typically include testing at each of the following levels.

#### Point-of-pack

Testing packages at the "point-of-pack" has an immediate impact on the packaging process. Usually, a large number of packages of a single product are available for testing at one place. This allows the inspector to verify that the packer is following current good packaging practices. Inspection at the point-of-pack also provides the opportunity to educate the packer about the legal requirements that products must meet and may permit resolution of any net content issues or other problems that arise during the testing. Point-of-pack testing is not always possible because packing locations can be in other States or countries. Work with other State, county, and city jurisdictions to encourage point-of-pack inspection on products manufactured in their geographic jurisdictions. Point-of-pack inspections cannot entirely replace testing at wholesale or retail outlets, because point-of-pack inspections do not include imported products or the possible effects of product distribution and moisture loss. Point-of-pack inspections only examine the manufacturing process. Therefore, an effective testing program will also include testing at wholesale and retail outlets.

#### Wholesale

Testing packages at a distribution warehouse is an alternative to testing at the point-of-pack with respect to being able to test large quantities of and a variety of products. Wholesale testing is a very good way to monitor products imported from other countries and to follow up on products suspected of being underfilled based on consumer complaints or findings made during other inspections, including those done at retail outlets.

#### Retail

Testing packages at retail outlets evaluates the soundness of the manufacturing, distributing, and retailing processes of the widest variety of goods at a single location. It is an easily accessible, practical means for State, county and city jurisdictions to monitor packaging procedures and to detect present or potential problems. Generally, retail package testing is not conducive to checking large quantities of individual products of any single production lot. Therefore, follow-up inspections of a particular brand or lot code number at a number of retail and wholesale outlets, and ultimately at the point-of-pack are extremely important aspects in any package-checking scheme. After the evaluation of an inspection lot is completed, the jurisdiction should consider what, if any, further investigation or follow-up is warranted. At the point-of-sale, a large number of processes may affect the quality or quantity of the product. Therefore, there may be many reasons for any inspection lot being out of compliance. A shortage in weight or measure may result from mishandling the product in the store, or the retailer's failure to rotate stock. Shortages may also be caused through mishandling by a distributor, or failure of some part of the packaging process. Shortages may also be

caused by moisture loss (desiccation) if the product is packaged in permeable media. Therefore, being able to determine the cause of an error in order to correct defects is more difficult when retail testing is used. (Amended 2002)

#### What products can be tested?

Any commodity sold by weight, measure, or count may be tested. The product to be tested may be chosen in several ways. The decision may be based on different factors, such as (1) marketplace surveys (e.g., jurisdiction-wide surveys of all soft drinks or breads), (2) surveys based on sales volume, or (3) audit testing (see Section 1.3) to cover as large a product variety as possible at food, farm, drug, hardware stores, or specialty outlets, discount and department stores. Follow-up of possible problems detected in audit testing or in review of past performance tends to concentrate inspection resources on particular commodity types, brand names, retail or wholesale locations, or even particular neighborhoods. The expected benefits for the public must be balanced against the cost of testing. Expensive products should be tested because of their cost per unit. However, inexpensive items should also be tested because the overall cost to individual purchasers may be considerable over an extended period. Store packaged items, which are usually perishable and not subject to other official monitoring, should be routinely tested because they are offered for sale where they are packed. Products on sale and special products produced for local consumption should not be overlooked because these items sell quickly in large amounts.

Regardless of where the test occurs, remember that it is the inspector's presence in the marketplace through routine unannounced testing that ensures equity and fair competition in the manufacturing and distribution process. Finally, always follow up on testing to ensure that the problems are corrected; otherwise, the initial testing may be ineffective.

#### 1.2 Package Requirements

The net quantity of content statement must be "accurate," but reasonable variations are permitted. Variations in package contents may be a result of deviations in filling. The limits for acceptable variation are based on current good manufacturing practices in the weighing, measuring, and packaging process. The first requirement is that accuracy is applied to the average net contents of the packages in the lot. The second requirement is applied to negative errors in individual packages. These requirements apply simultaneously to the inspection of all lots of packages except as specified in "Exceptions to the Average and Individual Package Requirements" in this section.

#### Inspection Lot

An "inspection lot" (called a "lot" in this handbook) is defined as a collection of identically labeled (except for quantity or identity in the case of random packages) packages available for inspection at one time. The collection of packages will pass or fail as a whole based on the results of tests on a sample drawn from this collection. This handbook describes procedures to determine if the packages in an "inspection lot" contain the declared net quantity of contents and if the individual packages variations are within acceptable limits.

#### Average Requirement

In general, the average net quantity of contents of packages in a lot must at least equal the net quantity of contents declared on the label. Plus or minus variations from the declared net weight, measure, or count are permitted when they are caused by unavoidable variations in weighing, measuring, or counting the contents of individual packages that occur in current good manufacturing practice. Such variations must not be permitted to the extent that the average of the quantities in the packages of a particular commodity or a lot of the commodity that is kept, offered, exposed for sale, or sold, is below the stated quantity. (See Section 3.7, "Pressed and Blown Glass Tumblers and Stemware" and Section 4.3, "Packages Labeled by Count of 50 Items or Less" for exceptions to this requirement.)

#### Individual Package Requirement

The variation of individual package contents from the labeled quantity must not be "unreasonably large." In this handbook, packages that are underfilled by more than the Maximum Allowable Variation specified for the package are considered unreasonable errors. Unreasonable shortages are not generally permitted, even when overages in other

packages in the same lot, shipment or delivery compensate for such shortage. This handbook does not specify limits of overfilling, which is usually controlled by the packer.

#### Maximum Allowable Variation

The limit of "reasonable variation" for an individual package is called a "Maximum Allowable Variation" (MAV). An MAV is a deviation from the labeled weight, measure, or count of an individual package beyond which the deficiency is considered unreasonable. Each sampling plan limits the number of negative package errors permitted to be greater than the MAV.

#### Deviations Caused by Moisture Loss or Gain

Deviations from the net quantity of contents caused by the loss or gain of moisture from the package are permitted when they are caused by ordinary and customary exposure to conditions that normally occur in good distribution practice and that unavoidably result in change of weight or measure. According to regulations adopted by the U.S. Environmental Protection Agency, no moisture loss is recognized on pesticides. (See Code of Federal Regulations 40 CFR 156.10.)

#### Why do we allow for moisture loss or gain?

Some packaged products may lose or gain moisture and, therefore, lose or gain weight or volume after packaging. The amount of lost moisture depends upon the nature of the product, the packaging material, the length of time it is in distribution, environmental conditions, and other factors. Moisture loss may occur even when manufacturers follow good distribution practices. Loss of weight "due to exposure" may include solvent evaporation, not just loss of water. For loss or gain of moisture, apply the moisture allowances to both the maximum allowable variations permitted for individual packages and the average net quantity of contents before determining the conformance of a lot.

This handbook provides "moisture allowances" for some meat and poultry products, flour, and dry pet food. (See "Moisture Allowances" in Chapter 2.) These allowances are based on the premise that when the average net weight of a sample is found to be less than the labeled weight, but not by an amount that exceeds the allowable limit, either the lot is declared to be within the moisture allowance, or more information must be collected before deciding lot compliance or noncompliance.

Test procedures for flour, some meat, and poultry are based on the concept of a "moisture allowance" also known as a "gray area" or "no decision" area. (See Section 2.3, Basic Test Procedure, Calculations, "How is the Maximum Allowable Variation corrected for the Moisture Allowance/How is the Average Error for Moisture Allowance corrected?") When the average net weight of a sample is found to be less than the labeled weight, but not more than the boundary of the "gray area," the lot is said to be in the "gray" or "no decision area." The gray area is not a tolerance. More information must be collected before lot compliance or noncompliance can be decided. Appropriate enforcement should be taken on packages found short weight and outside of the "moisture allowance" or "gray area." (Amended 2002)

#### Exceptions to the Average and Individual Package Requirements

There is an exemption from the average requirement for packages labeled by count of 50 or fewer items. The reason for this exemption is that the package count does not follow a "normal" distribution even if the package is designed to hold the maximum count indicated by the label declaration (e.g., egg cartons and packages of chewing gum). Another exception permits an "allowable difference" in the capacity of glass tumblers and stemware because mold capacity doesn't follow a normal distribution.

#### 1.3 Sampling Plans

This handbook contains two sampling plans to use to inspect packages: **Category A** and **Category B**. Use the **Category B** Sampling Plans to test meat and poultry products at point-of-pack locations that are subject to U. S. Department of Agriculture Food Safety and Inspection Service (FSIS) requirements. When testing all other packages, use the **Category A** Sampling Plan.

#### Why is sampling used to test packages?

Inspections by weights and measures officials must provide the public with the greatest benefit at the lowest possible cost. Sampling reduces the time to inspect a lot of packages, so a greater number of items can be inspected. Net content inspection, using sampling plans for marketplace surveillance, protects consumers who cannot verify the net quantity of contents. This ensures fair trade practices and maintains a competitive marketplace. It also encourages manufacturers, distributors, and retailers to follow good manufacturing and distribution practices.

# Why is the test acceptance criteria statistically corrected, and what are the confidence levels of the sampling plans?

Testing a "sample" of packages from a lot instead of every package is efficient, but the test results have a "sampling variability" that must be corrected before determining if the lot passes or fails. The Category A sampling plans give acceptable lots a 97 % or better probability of passing. An "acceptable" lot is defined as one in which the "average" net quantity of contents of the packages equals or exceeds the labeled quantity. The Category B sampling plans give acceptable lots at least a 50 % probability of passing. The sampling plans used in this handbook are statistically valid. That means the test acceptance criteria are statistically adjusted, so they are both valid and legally defensible. This handbook does not discuss the statistical basis, risk factors, or provide the operating characteristic curves for the sampling plans. For information on these subjects, see explanations on "acceptance sampling" in statistical reference books.

#### Why random samples?

A randomly selected sample is necessary to ensure statistical validity and reliable data. This is accomplished by using random numbers to determine which packages are chosen for inspection. Improper collection of sample packages can lead to bias and unreliable results.

#### May audit tests and other shortcuts be used to identify potentially violative lots?

Shortcuts may be used to speed the process of detecting possible net content violations. These audit procedures may include the following: using smaller sample sizes, spot checks using tare lists provided by manufacturers, selecting samples without collecting a random sample. These and other shortcuts allow spot checking of more products than is possible with the more structured techniques, but do not take the place of Category A or B testing.

#### Can audit tests and other shortcuts be used to take enforcement action?

No. Do not take enforcement action using audit test results.

If, after an audit test, there is suspicion that a lot of packages is not in compliance, use the appropriate Category A or Category B sampling plan to determine if the lot complies with the package requirements.

#### 1.4 Other Regulatory Agencies Responsible for Package Regulations and Applicable Requirements

In the United States, several Federal agencies issue regulations regarding package labeling and net contents. The U.S. Department of Agriculture regulates meat and poultry. The Food and Drug Administration regulates food, drugs, cosmetic products, and medical devices under the Food, Drug, and Cosmetic Act (FDCA) and the Fair Packaging and Labeling Act (FPLA). The Federal Trade Commission regulates most non-food consumer packaged products as part of the agency's responsibility under the FPLA. The Environmental Protection Agency regulates pesticides. The Bureau of Alcohol, Tobacco, and Firearms in the U.S. Department of the Treasury promulgates regulations for packaged tobacco and alcoholic beverages as part of its responsibility under the Federal Alcohol Administration Act.

Packaged goods produced for distribution and sale also come under the jurisdiction of State and local weights and measures agencies that adopt their own legal requirements for packaged goods. Federal statutes set requirements that preempt State and local regulations that are or may be less stringent or not identical to Federal regulation depending on the Federal law that authorizes the Federal regulation. The application of Handbook 133 procedures occurs in the context of the concurrent jurisdiction among Federal, State, and local authorities. Therefore, all agencies using this handbook should keep abreast of the revisions to Federal agency regulations that may contain sampling or testing information not in the

regulations at the time of publication of this handbook. See Table 1-1. in Appendix A for information on the responsible agencies for package regulations and the requirements of this handbook that must be used when testing products concurrently subject to pre-emptive federal regulations.

#### 1.5 Assistance in Testing Operations

If the storage, display, or location of any lot of packages requires special equipment or an abnormal amount of labor for inspection, the owner or the operator of the business must supply the equipment and/or labor as required by the weights and measures official.

# 1.6 Health and Safety

This handbook cannot address all of the health and safety issues associated with its use. The inspector is responsible for determining the appropriate safety and health practices and procedures before starting an inspection (e.g., contact the establishment's health and safety official). Comply with all handling, health, and safety warnings on package labels and those contained in any associated material safety data sheets. The inspector must also comply with Federal, State, or local health and safety laws or other appropriate requirements in effect at the time and location of the inspection. Contact your supervisor to obtain information regarding your agencies safety and health policies and to obtain appropriate safety equipment.

#### 1.7 Good Measurement Practices

The procedures in this handbook are designed to be technically sound and represent good measurement practices. To assist in documenting tests, we have included "model" inspection report forms designed to record the information.

Traceability Requirements for Measurement Standards and Test Equipment

Each test procedure presented in this handbook includes a list of the equipment needed to perform the inspection. The scales and other measurement standards used (e.g., balances, mass standards, volumetric, and linear measures) to conduct any test must be traceable to the National Institute of Standards and Technology (NIST). Standards must be used in the manner in which they were designed and calibrated for use.

Certification Requirements for Standards and Test Equipment

All measurement standards and test equipment identified in this handbook or associated with the test procedures must be calibrated or standardized before initial use. This must be done according to the instructions found in NIST Handbook 145, "Handbook for the Quality Assurance of Metrological Measurements," or other recognized procedures (e.g., those adopted for use by a State weights and measures laboratory). After initial certification, the standards must be routinely recertified according to your agency's measurement assurance policies.

This page left intentionally blank.

# **Chapter 2.** Basic Test Procedure – Gravimetric Testing

#### 2.1 Gravimetric Test Procedure for Checking the Net Contents of Packaged Goods

The gravimetric test method uses weight measurement to determine the net quantity of contents of packaged goods. This handbook includes general test methods to determine the net quantity of contents of packages labeled in terms of weight and special test methods for packages labeled in terms of fluid measure or count. Gravimetric testing is the preferred method of testing most products because it reduces destructive testing while maximizing inspection resources.

#### 2.2 Measurement Standards and Test Equipment

#### What type of scale is required to perform the gravimetric test method?

Use a scale (for this handbook the term scale includes balances) that has at least 100 scale divisions. It must have a load-receiving element of sufficient size and capacity to hold the packages during weighing. It also requires a scale division no larger than 1/6 of the Maximum Allowable Variation (MAV) for the package size being weighed. The MAV/6 requirement is crucial to ensure that the scale has adequate resolution to determine the net contents of the packages. Subsequent references to product test criteria agreeing within one scale division are based on scale divisions that are equal to or only slightly smaller than the MAV/6.

**Example:** The MAV for packages labeled 113 g (0.25 lb) is 7.2 g (0.016 lb) (See Table 2.5.) MAV/6 is 1.2 g (0.002 lb). In this example, a 1 g (0.002 lb) scale division would be the largest unit of measure appropriate for weighing these packages.

#### How often should I verify the accuracy of a scale?

Verify the accuracy of a scale before each initial daily use, each use at a new location, or when there is any indication of abnormal equipment performance (e.g., erratic indications). Recheck the scale accuracy if it is found that the lot does not pass, so there can be confidence that the test equipment is not at fault.

# Which accuracy requirements apply?

Scales used to check packages must meet the acceptance tolerances specified for their accuracy class in the current edition of NIST Handbook 44, "Specifications, Tolerances, and Other Technical Requirements for Weighing and Measuring Devices" (NIST HB 44). The tolerances for Class II and Class III digital scales are presented in Section 2.20, Scales, NIST HB 44.

**Note:** If the package checking scale is not marked with a "class" designation, use NIST HB 44 Table 1-1. to determine the applicable tolerance.

# What considerations affect measurement accuracy?

Always use good weighing and measuring practices. For example, be sure to use weighing and measuring equipment according to the manufacturer's instructions and make sure the environment is suitable. Place scales and other measuring equipment (e.g., flasks and volumetric measures) on a rigid support and maintain them in a level condition if being level is a requirement to ensure accuracy.

#### In testing, which tolerances apply to the scale?

Do not use a scale if it has an error that exceeds the specified tolerance in any of the performance tests described in the following section.

1. Determine the total number of divisions (i.e., the minimum increment or graduation indicated by the scale) of the scale by dividing the scale's capacity by the minimum division.

**Example:** A scale with a capacity of 5 000 g and a minimum division of 0.1 g has 50 000 divisions.

2. From Table 1-1. determine the class of the scale using the minimum scale division and the total number of scale divisions.

**Example:** On a scale with a minimum division of 0.1 g and 50 000 total scale divisions the appropriate class of scale is "II."

**Note:** If a scale is used where the number of scale divisions is between 5 001 and 10 000 and the division size is 0.1 g or greater and is not marked with an accuracy Class II marking, Class III scale tolerances apply.

Table 1-1. Class of Scale			
Value of Scale Division <sup>1</sup>	Minimum and Total Number of Divisions	Class of Scale	
1 mg to 0.05 g	At least 100, but not more than 100 000	II	
0.1 g or more	More than 5 000, but not more than 100 000	II	
0.1 g to 2 g 0.000 2 lb to 0.005 lb 0.005 oz to 0.125 oz	More than 100, but not more than 10 000	III	
5 g or more 0.01 lb or more 0.25 oz or more	More than 500, but not more than 10 000	III	

 $^1$ On some scales, manufacturers designated and marked the scale with a verification division (e) for testing purposes (e = 1 g and d = 0.1 g). For scales marked Class II, the verification division is larger than the minimum displayed division. The minimum displayed division must be differentiated from the verification scale division by an auxiliary reading means such as a vernier, rider, or at least significant digit that is differentiated by size, shape, or color. Where the verification division is less than or equal to the minimum division, use the verification division instead of the minimum division. Where scales are made for use with mass standards (e.g., an equal arm balance without graduations on the indicator) the smallest mass standard used for the measurement is the minimum division.

3. Determine the tolerance from Table 1-2. in divisions appropriate for the test load and class of scale.

**Example:** Determine the number of divisions for any test load by dividing the value of the mass standard being applied by the minimum division indicated by the scale. For example, if the scale has a minimum division of 0.1 g and a 1 500 g mass standard is applied, the test load is equal to 15 000 divisions (1 500/0.1). On a Class II scale with a test load between 10 000 and 20 000 divisions, Table 1-2. indicates the tolerance is plus or minus one division.

Table 1-2. Acceptance Tolerances for Class of Scale based on Test Load in Divisions		
Test Load in Divisions		
Class II Scale	Class III Scale	Tolerance
0 to 5 000	0 to 500	Plus or Minus 0.5 Division
5 001 to 20 000	501 to 2 000	Plus or Minus 1 Division
20 001 or more	2 001 to 4 000	Plus or Minus 1.5 Divisions
Not Applicable	4 001 or more	Plus or Minus 2.5 Divisions

#### Which performance tests should be conducted to ensure the accuracy of a scale?

Use the following procedures to verify the scale. The following procedures, based on those required in NIST Handbook 44, have been modified to reduce the amount of time required for testing scales in field situations.

#### Increasing-Load Test

Use certified mass standards to conduct an "increasing-load test" with all test loads centered on the load-receiving element. Start the test with the device on zero and progress with increasing test loads to a "maximum test load" of at least 10 percent more than the gross weight of the packages to be tested. Use at least three different test loads of approximately equal value to test the device up to the "maximum test load." Verify the accuracy of the device at each test load. Include the package tare weight as one of the test points.

#### Decreasing-Load Test

For all types of scales, other than one with a beam indicator or equal-arm balance, conduct a "decreasing-load test" with all test loads centered on the load-receiving element. Use the same test loads used in the "increasing-load test" of this section, and start at the "maximum test load." Remove the test loads in the reverse order of the increasing-load test until all test loads are removed. Verify the accuracy of the scale at each test load.

#### Shift Test

Use a test load equal to one-half of the "maximum test load" used for the "increasing-load test." For bench scales (see Diagram 1) place the test load in the center of four separate quadrants, equidistant between the center and edge of the load-receiving element and determine the accuracy in each quadrant for equal-arm balances. For example, where the load-receiving element is a rectangular or circular shape, place the test load in the center of the area represented by the shaded boxes in the following diagrams.

Diagram 1. Bench Scales


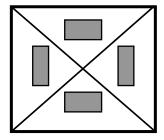


Diagram 2. Equal-Arm Balance

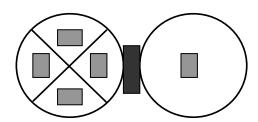

Return to Zero

Conduct the return to zero test whenever all the test weights from the scale are removed, check to ensure that it returns to a zero indication.

# Which standards apply to other test equipment?

Specifications, tolerances, and other technical requirements for the other measurement standards and test equipment cited in this handbook are specified in the following NIST publications. These publications may be obtained from the Office of Weights and Measures or the U.S. Government Printing Office.

- Mass Standards Use NIST Handbook 105-1, "Specifications and Tolerances for Reference Standards and Field Standard Weights and Measures-Field Standard Weights (NIST Class F)" (1990)
- Volumetric Flasks and Cylinders Use NIST Handbook 105-2, "Specifications and Tolerances for Reference Standards and Field Standard Weights and Measures-Field Standard Measuring Flasks" (1996)

- Stopwatches Use NIST Handbook 105-5, "Specifications and Tolerances for Reference Standards and Field Standard Weights and Measures-Field Standard Stopwatches" (1997)
- Thermometers Use NIST Handbook 105-6, "Specifications and Tolerances for Reference Standards and Field Standard Weights and Measures-Specifications and Tolerances for Thermometers" (1997)

#### 2.3 Basic Test Procedure

The following steps apply when gravimetrically testing any type of packaged product except Borax and glazed or frozen foods. If the tested products contain Borax, refer to Section 2.4, Borax. If glazed or frozen food is tested, refer to Section 2.6, Drained Weight for Glazed or Frozen Foods.

#### The Basic Test Procedure:

- 1. Identify and define the inspection lot.
- 2. Select the sampling plan.
- 3. Select the random sample.
- 4. Measure the net contents of the packages in the sample.
- 5. Evaluate compliance with the Maximum Allowable Variation (MAV) requirement.
- 6. Evaluate compliance with the average requirement.

#### **Define the Inspection Lot**

The official defines which packages are to be tested and the size of the inspection lot. The lot may be smaller or larger than the production lot defined by the packer. Only take action on the packages contained in the lot that has been defined.

**Note:** Normally, there will never be access to the entire "production lot" from a manufacturer. The "inspection lot" is selected from packages that are available for inspection/test at any location in the distribution chain.

**Example:** An inspection lot should consist of all of the cans of a single brand of peach halves, labeled with a net quantity of 453 g (1 lb). When packages are tested in retail stores, it is not necessary to sort by lot code. If lot codes are mixed during retail testing, be sure to record the lot codes for all of the packages included in the sample so that the inspector and other interested parties can follow up on the information. For special reasons, such as a large number of packages or the prior history of problems with the product or store, the inspector may choose to define a lot as only one type of packaged product (e.g., ground beef). Another reason to narrowly define the lot is if the results of an audit test indicate the possibility of a shortage in one particular lot code within a particular product.

#### What is the difference between standard and random weight packages?

Standard packages are those with identical net content declarations such as containers of soda in 2 L bottles and 2.26 kg (5 lb) packages of flour. "Random packages" are those with differing or no fixed patterns of weight, such as packages of meat, poultry, fish, or cheese.

#### **Sampling Plans**

#### Where are sampling plans located for Category A inspections?

Use Table 2-1., Sampling Plans for Category A, in Appendix A to conduct Category A inspections.

#### Where are sampling plans located for Category B inspections?

Use Table 2-2., Sampling Plans for Category B, in Appendix A to conduct Category B inspections.

# **Basic Inspection Procedure and Record Keeping**

#### How are the specific steps of the Basic Test Procedure documented?

Use an official inspection report to record the inspection information. Attach additional worksheets, test notes, and other information as needed. This handbook provides random and standard packaged products model inspection report forms in Appendix E. The references to box numbers in these instructions refer to the random and standard package reports in Appendix E. Modify the model reports and the box numbers to meet your agency's needs. Other formats that contain more or less information may be acceptable.

**Note:** Inspection reports should be legible and complete. Good record keeping practices typically include record retention for a specified period of time (e.g., 1 to 3 years).

- > Record the product identity, packaging description, lot code, location of test, and other pertinent data.
- Record the labeled net quantity of contents in box 1. Record both metric and inch-pound declarations if they are provided on the package label.

**Example:** If the labeled weight is 453 g (1 lb), record this in box 1.

When the declaration of net quantity on the package includes both the International System of Units (SI) (metric) and inch-pound units, the larger of the two declarations must be verified. The rounding rules in the Uniform Packaging and Labeling Regulation in NIST Handbook 130 permit packers to round declarations up or down based on their knowledge of their package filling targets and the accuracy of packaging equipment.

Determine the larger of the values by converting the SI declaration to inch-pound units, or vice versa, using conversion factors that are accurate to at least six places. Compare the values, and use the larger value in computing the nominal gross weight (see later steps). Indicate on the report which of the declarations are being verified when packages labeled with two units of measure are encountered.

**Example:** If the net weight declared on a package is 1 lb, the metric equivalent (accurate to six significant digits) is 453.592 g. Do not round down or truncate values in the calculations until the nominal gross weight is determined and recorded. If the package is also labeled 454 g, then the metric declaration is larger than the inch-pound declaration and should be used to verify the net contents of the package. The Basic Test Procedure does not prohibit the use of units of weight instead of dimensionless units when recording package errors, nor does it prohibit the use of net content computer programs to determine product compliance. Record the unit of measure in box 2. The unit of measure is the minimum division of the unit of measurement used to conduct the test. If a scale is used that reads to thousandths of a pound, the unit of measure is 0.001 lb even if the scale division is 0.002 lb or 0.005 lb.

**Example:** If the scale has a scale division of 0.5 g, the unit of measure is 0.1 g. If a weighed package that has an error of "- 0.5 g," record the error as "- 5" using "dimensionless units." If the scale indicates in increments of 0.002 lb, the unit of measure is 0.001 lb. If a weighed package has an error of "+ 0.016," record the error as "+ 16" using "dimensionless units." When using dimensionless units, multiply package errors by the unit of measure to obtain the package error in weight.

Enter the appropriate MAV value in box 3 for the type of package (weight, volume, etc.), the labeled net contents, and the unit of measure.

#### Where are Maximum Allowable Variations found?

Find the MAV values for packages labeled by weight, volume, count, and measure in the tables listed below in Appendix A.

•	packages labeled by	y weight	See Table 2-5.
---	---------------------	----------	----------------

• packages labeled by volume liquid or dry

See Table 2-6.

• packages labeled by count See Table 2-7.

• packages labeled by length, (width), or area See Table 2-8.

packages bearing a USDA seal of inspection – Meat and Poultry

• textiles, polyethylene sheeting and film, mulch and soil labeled by volume, packaged firewood, and packages labeled by count with less than 50 items

See Table 2-10.

# How is the value of an MAV found?

Refer to the appropriate table of MAVs and locate the declared quantity that is on the package label in the column marked "Labeled Quantity." Read across the table to find the value in the column titled "Maximum Allowable Variation." Record this number in box 3. Determine the MAV in dimensionless units and record in box 4 on the Standard Package Report Form (a dimensionless unit is obtained by dividing the MAV recorded in box 3 by the unit of measure recorded in box 2). Refer to Appendix C, "The Glossary," for the definition of dimensionless units.

#### How many MAVs are permitted in a sample?

To find out how many minus package errors are permitted to exceed the MAV, see Column 4 in either Table 2-1. (Category A) or Table 2-2. (Category B). Record this number in box 8.

#### **Random Sample Selection**

#### How are the sample packages selected?

Randomly select a sample from the inspection lot. Random number tables (see Appendix B) or a calculator that is able to generate random numbers may be used to identify the sample. If the packages for the sample are not randomly selected, the test results may not be statistically valid.

**Note:** If the inspector and the party that is ultimately responsible for the packing and declaration of net weight for the product agree to an alternative method of sample selection, document how the sample packages were selected as part of the inspection record.

#### How is the size of the "Lot" determined?

Count the number of packages comprising the inspection lot or estimate the size to within 5 % and record the inspection lot size in box 5.

#### How is the sample size determined?

Refer to Table 2-1. or Table 2-2. to determine the sample size. In Column 1, find the size of the inspection lot (the number recorded in box 5 of the report form). Read across from Column 1 to find the appropriate sample size in Column 2 and record this number in box 6 of the report form.

#### **Tare Procedures**

# What types of tare may be used to determine the net weight of package goods?

This handbook defines three types of tare for the inspection of packaged goods. The tare weight may vary considerably from package to package as compared with the variability of the package net contents, even for packages in the same production lot. Although this is not common for most packaging, the basic test procedure in this handbook considers the variation for all tare materials.

#### Used Dry Tare

Used Dry Tare is defined as follows: Used tare material that has been air dried, or dried in some manner to simulate the unused tare weight. It includes all packaging materials that can be separated from the packaged product, either readily (e.g., by shaking) or by washing, scraping, ambient air drying, or other techniques involving more than "normal" household recovery procedures, but not including laboratory procedures like oven drying. Labels, wire closures, staples, prizes, decorations, and such are considered tare. Used Dry Tare is available regardless of where the packages are tested. The net content procedures described in this handbook reference Used Dry Tare.

#### Unused Dry Tare

If testing packages in retail store locations where they are packaged, and sold in small quantities to the ultimate consumers, the basic test procedure may be modified by using samples of the packaging material available in the store. Unused dry tare is defined as:

All unused packaging materials (including glue, labels, ties, etc.) that contain or enclose a product. It includes prizes, gifts, coupons, or decorations that are not part of the product.

#### Wet Tare

If the jurisdiction uses wet tare to determine net weight, follow the procedures described below that reference Used Dry Tare, except make no effort to dry the tare material. If Wet Tare is used to verify the net weight of packages of fresh poultry, hot dogs, and franks that are subject to the USDA regulations, the inspector must allow for moisture loss. Wet Tare is defined as: Used tare material where no effort is made to dry the tare material. Free-flowing liquids are considered part of the tare weight.

#### How is a tare weight determined?

Except in the instance of applying unused dry tare, select the packages for the initial tare sample from the sample packages. Mark the first two (three or five) packages in the order the random numbers were selected; these packages provide the initial tare sample. Determine the gross weight of each package and record it in block a, "Gross Wt," under the headings "Pkg. 1," "Pkg. 2," "Pkg. 3," etc. on the report form. Except for aerosol or other pressurized packages, open the sample packages, empty, clean, and dry them as appropriate for the packaging material.

# Does the inspection of aerosol containers require special procedures?

Yes, aerosol containers are handled differently for two reasons. First, regulations under the Uniform Packaging and Labeling Regulation in NIST HB 130 require that packages designed "to deliver" the product under pressure, "must state the net quantity of the contents that will be expelled when the instructions for use as shown on the container are followed." This means that any product retained in aerosol containers after full dispersion is included in the tare weight. Second, aerosol containers must not be opened because they are pressurized; for safety reasons they should not be punctured or opened. When emptying aerosol containers to determine a tare weight, exhaust them in a well-ventilated area (e.g., under an exhaust hood or outdoors) at least 15 m (50 ft) from any source of open flame or spark.

To ensure that the container properly dispenses the product, read and follow any dispensing instructions on the package. If shaking during use is specified in the instructions, periodically shake (at least two or three times during

expulsion of the product). If directions are not given, shake the container five times with a brisk wrist twisting motion. If the container has a ball agitator, continue the shaking procedure for one minute after the ball has shaken loose.

### How is the tare of vacuum-packed coffee determined?

The gross weight of a can of vacuum-packed coffee will be more after the seal is broken and air enters the can. In the procedure to determine the tare weight of the packaging material, correct the gross weight determined for unopened cans as follows. Use the initial tare sample packages, weigh, and record the gross weight of the product-filled cans before and after breaking the vacuum seal. Compute the average gross weight difference (open weight minus sealed weight) and record this in box 13a of the report form. The nominal gross weight equals the average tare weight minus the average difference in gross weights plus the labeled weight (box 14): box 13 - box 13a + box 1.

#### How is it determined how many packages to select for the initial tare sample?

For the initial tare sample size, see Column 5 under initial tare sample size in Table 2-1., or Column 3 under initial tare sample size in Table 2-2. Record the initial tare sample size in box 7 on the report form.

**Note:** The initial tare sample size is considered the total tare sample size when the sample size is less than 12.

#### How are the tare sample and tare weight of the packaging material determined?

- 1. Except for unused dry tare at the point-of-pack, first determine the tare weight for each package in the initial tare sample and record the value in row b, "Tare Wt." under the appropriate package number column.
- 2. For sample sizes of 12 or more, subtract the individual tare weights from the gross weights (block a, minus block b, on the report form) to obtain the net weight for each package and record these values in block c, "Net Wt," on the report form.

Determine and record the "range of package errors" (called  $R_c$ ) for the initial tare sample in box 9 on the report form. (The range is the difference between the package errors.) (Amended 2002)

- 3. Determine and record the "range of tare weights" (called  $R_t$ ) in box 10.
- 4. Compute the ratio  $R_c/R_t$  by dividing the value in box 9 by the value in box 10. Record the resulting value in box 11. ( $R_c$  and  $R_t$  must both be in the same unit of measure or both in dimensionless units.)
- 5. Determine and record in box 12 the total number of packages to be opened for the tare determination from either Table 2-3., for a Category A test or Table 2-4., for a Category B test.
  - In the first column (titled Ratio of  $R_c/R_t$ ), locate the range in which the computed  $R_c/R_t$  falls. Then, read across to the column headed with the appropriate sample size.
  - > If the total number of packages to open equals the number already opened go to Step 6.
  - ➤ If the total number of packages to open is greater than the number of packages already opened, compute the number of additional packages to open for the tare determination and go to Step 6. Enter the total number of tare samples in box 12.
- 6. Determine the average tare weight using the tare weight values for all the packages opened and record the average tare weight in box 13.

#### When and where is unused dry tare used, and how is it used to determine an average tare weight?

You may determine the average tare weight using samples of unused dry tare when testing meat, poultry, or any other products that are not subject to regulation of the Food and Drug Administration (FDA). You may use unused dry tare samples when conducting inspections at locations where the point-of-pack and sale are identical (e.g., store-packed products in a supermarket meat case). To determine unused dry tare at the point-of-sale, randomly select two (2) samples of unused dry tare, and weigh each separately. If there is no measurable variation in weight between the samples, proceed with the test using the weight of one of the samples. If the weight of the two (2) initial samples vary, randomly select three (3) additional tare samples and determine the average weight of all five (5) samples. Use this value as the average tare weight. (Amended 2002)

#### **Determine Nominal Gross Weight and Package Errors for Tare Sample**

# What is a nominal gross weight?

A nominal gross weight is used to simplify the calculation of package errors. To compute the nominal gross weight, add the average tare weight (recorded in box 13) to the labeled weight (recorded in box 1). To obtain the package error, subtract a package's gross weight from the nominal gross weight. The nominal gross weight is represented by the formula:

Nominal gross weight = average tare + labeled weight

#### How are individual package errors determined for the tare sample packages?

Determine the errors of the packages opened for tare by subtracting the nominal gross weight recorded in box 14 from the individual package gross weights recorded for each package ("Pkg 1," "Pkg 2," etc.) in block a, "Gross Wt." The nominal gross weight must be used, rather than the actual net weight, for each package to determine the package error. This ensures that the same average tare weight is used to determine the error for every package in the sample, not just the unopened packages.

- For standard packages, record the package error in the appropriate plus or minus column on the report form for each package opened for tare.
- For random packages, determine the package error for the tare sample using a nominal gross weight for each package so that all of the package errors are determined with the same tare weight value. Record the package error on the Random Package Report Form in the appropriate plus or minus column under Package Errors.

**Note:** Converting the package error to dimensionless units allows the inspector to record the package errors as whole numbers disregarding decimal points and zeroes in front and unit of measure after the number.

**Example:** If weighing in 0.001 lb increments, the unit of measure is also 0.001 lb. If the package error for the first package opened for tare is + 0.008 lb, instead of recording 0.008 lb in the plus column, record the error as "8" in the plus column. If the second package error is + 0.060 lb, record the package error as "60" in the plus column, and so on. (This section does not prohibit the use of units of weight or computer programs instead of dimensionless units.)

#### How are individual package errors determined for the other packages in the sample?

Compare the gross weight of each of the unopened sample packages with the nominal gross weight (box 14). Record the package errors in the "Package Errors" section of the report form using either units of weight (lb or g) or dimensionless units.

#### How is the total package error computed?

Add all the package errors for the packages in the sample. Be sure to subtract the minus package errors from the plus package errors and to record the total net error in box 15.

### **Evaluating Results**

#### How is it determined if a sample passes or fails?

The following steps lead the inspector through the process to determine if a sample passes or fails. If the product is subject to moisture allowance, follow the procedures under "Moisture Allowances" in this chapter to correct the MAV.

# How is it determined if packages exceed the Maximum Allowable Variation?

Compare each minus package error with the MAV recorded in box 3 or box 4 (if using dimensionless units). Circle the package errors that exceed the MAV. These are "unreasonable errors." Record the number of unreasonable minus errors found in the sample in box 16.

# How is it determined if the negative package errors in the sample exceed the number of MAVs allowed for the sample?

Compare the number in box 16 with the number of unreasonable errors allowed (recorded in box 8.) If the number found exceeds the allowed number, the lot fails. Record in box 17 whether the number of unreasonable errors found is less or more than allowed.

**Note**: If the total error recorded in box 15 is a plus value and box 17 is "No", then the number of unreasonable errors is equal to or less than the number allowed (recorded in box 8) and the lot passes.

#### How is the average error of the sample determined and does the inspected lot pass or fail the average requirement?

Determine the average error by dividing the total error recorded in box 15 by the sample size recorded in box 6. Record the average error in box 18 if using dimensionless units or in box 19 if using units of weight. Compute the average error in terms of weight (if working in dimensionless units up to this time) by multiplying the average error in dimensionless units by the unit of measure and record the value in box 19.

- 1. If the average error is positive, the inspection lot passes the average requirement.
- 2. If the average error is negative, the inspection lot fails under a Category B test. Record in box 20.
- 3. If the average error is a negative value when testing under the Sampling Plans for Category A, compute the Sample Error Limit (SEL) as follows:
  - ➤ Compute the Sample Standard Deviation and record it in box 21.
  - ➤ Obtain the Sample Correction Factor from Column 3 of Table 2-1. For Category A test. Record this value in box 22.
  - > Compute the Sample Error Limit using the formula:

Sample Error Limit (box 23) = Sample Standard Deviation (box 21) x Sample Correction Factor (box 22)

- 4. Compliance Evaluation of the Average Error:
  - > If the value of the Average Error (box 18) is smaller than the SEL (box 23), the inspection lot passes.

➤ If the value of the Average Error (disregarding the sign) (box 18) is larger than the SEL (box 23) the inspection lot fails. However, if the product is subject to moisture loss, the lot does not necessarily fail. Follow the procedures under "Moisture Allowances" in this chapter.

#### **Moisture Allowances**

#### How is reasonable moisture loss allowed?

If the product tested is subject to moisture loss, provide for the moisture allowance by following the steps listed below.

Determine the value of the moisture allowance if the product is listed below.

# What is the moisture allowance for flour and dry pet food?

The moisture allowance for flour and dry pet food is 3 % of the labeled net weight.

**Note:** Dry pet food means all extruded dog and cat foods and baked treat products packaged in kraft paper bags and/or cardboard boxes with a moisture content of 13 % or less at the time of pack.

What moisture allowance is used with Used Dry Tare when testing packages that bear a USDA Seal of Inspection?

There is no moisture allowance when inspecting meat and poultry from a USDA inspected plant when Used Dry Tare and a Category A sampling plan are used.

What moisture allowance is used with wet tare when testing packages bearing a USDA seal of inspection?

- Use the following guideline when testing meat and poultry from any USDA inspected plant using Wet Tare and a Category A sampling plan.
- For packages of fresh poultry that bear a USDA seal of inspection, the moisture allowance is 3 5 of the labeled net weight. For net weight determinations, only, fresh poultry is defined as poultry above 3 °C (26 °F). This is a product that yields or gives when push with the thumb.
- For packages of franks or hotdogs that bear an USDA seal of inspection, the moisture allowance is 2.5 % of the labeled net weight.
- For packages of bacon, fresh sausage, and luncheon meats that bear a USDA seal of inspection, there is no moisture allowance if there is no free-flowing liquid or absorbent materials in contact with the product and the package is cleaned of clinging material. Luncheon meats are any cooked sausage product, loaves, jellied products, cured products, and any sliced sandwich style meat. This does not include whole hams, briskets, roasts, turkeys, or chickens requiring further preparation to be made into ready-to-eat sliced product. When there is no free-flowing liquid inside the package and there are no absorbent materials in contact with the product, Wet Tare and Dried Used Tare are equivalent.

When there is free flowing liquid or absorbent packaging materials in contact with the product, all free liquid is part of the wet tare.

#### Calculations

#### How is moisture allowance computed and applied to the average error?

To compute moisture allowance, multiply the labeled quantity by the decimal percent value of the allowance.

**Example:** Labeled net quantity of flour is 907 g (2 lb)

Moisture Allowance is 3 % (0.03)

Moisture Allowance = 907 g (2 lb) x 0.03 = 27 g (0.06 lb) record this value in box 13a.

#### How is the Maximum Allowable Variation corrected for the moisture allowance?

• Adjust the MAV by adding the moisture allowance to the MAV.

**Example:** 907 g (2 lb) package of flour: moisture allowance added to the MAV = 31.7 g (0.07 lb) (MAV for 907 g [2 lb] package) + 27 g (0.06 lb) moisture allowance = a corrected MAV of 58.7 g (0.13 lb)

Correct MAV in dimensionless units by converting the moisture allowance to dimensionless units = 0.06 lb ÷ 0.001 lb = 60. Go to box 4 and add the moisture allowance in dimensionless units to the MAV in dimensionless units.

**Example:** MAV = 70 (MAV for 2 lb where the unit of measure = 0.001 lb) + 60 (moisture allowance in dimensionless units) = 130. Minus package errors must exceed the MAV + gray area before they are declared "unreasonable errors."

 If the number of unreasonable errors exceeds the allowed number (recorded in box 8) the inspection lot fails.

#### How is the average error for the moisture allowance corrected?

If the minus average error (box 18) is larger (disregarding the sign) than the SEL (box 23) and moisture loss applies, compare the difference between box 18 and box 23 with the moisture allowance recorded in box 13a. (Make sure that all the values are in units of weight or in dimensionless units before making this comparison.) If box 13a is larger than the difference between box 18 and 23, then the lot is considered to be in the gray area.

**Example:** Box 13a for 2 lb flour is 60 (dimensionless units); box 18 is 2 (dimensionless units); box 23 is 0.550 (dimensionless units). The difference between box 18 and box 23 is 1.450 (dimensionless units). Since box 13a is 60 (dimensionless units), 13a is larger than the difference between box 18 and box 23, the lot is considered to be in the gray area and further investigation is necessary before ruling out moisture loss as the reason for shortweight.

When the average error of a lot of fresh poultry, franks, or hot dogs from a USDA-inspected plant is minus, but does not exceed the established "moisture allowance" or "gray area," contact the appropriate USDA official and/or plant management personnel to determine what information is available on the lot in question. Questions to the USDA official and/or plant management representative may include:

- (a) Is a quality control program in place?
- (b) What information is available concerning the lot in question?
- (c) If net weight checks were completed, what were the results of those checks?
- (d) What adjustments, if any, were made to the target weight?

**Note:** If USDA or plant management has data on the lot, such data may help to substantiate that the "lot" met net content requirements at the point of manufacture.

This handbook provides "moisture allowances" for some meat and poultry products, flour, and dry pet food. These allowances are based on the premise that when the average net weight of a sample is found to be less than the labeled weight, but not by an amount that exceeds the allowable limit, either the lot is declared to be within the moisture allowance or further investigation can be conducted.

Deviations from net quantity of contents caused by the loss or gain of moisture from the package are permitted when caused by ordinary and customary exposure to conditions that occur under good distribution practices. If evidence is obtained and documented to prove that the lot was shipped from the packaging plant in a shortweight condition or was distributed under inappropriate or damaging distribution practices, appropriate enforcement action should be taken. (Amended 2002)

#### 2.4 Borax

#### How is it determined if the net weight labeled on packages of borax is accurate?

Use the following procedures to determine if packages of borax are labeled correctly. This procedure applies to packages of powdered or granular products consisting predominantly (more than 50 %) of borax. Such commodities are labeled by weight, but borax can lose more than 23 % of its weight due to moisture loss. However, it does not lose volume upon moisture loss, and this property makes possible a method of volume testing based on a density determination in the event that the net weight of the product does not meet the average or individual package requirements. This method may be used for audit testing to identify possible short-filling by weight at point-of-pack. Since the density of these commodities can vary at point-of-pack, further investigation is required to determine whether, such short filling has occurred.

# **Test Equipment**

- Metal density cup with a capacity of 550.6 mL or (1 dry pt).
- Metal density funnel with slide-gate and stand.
- Scale or balance having a scale division not larger than 1 g or (0.002 lb).
- Rigid straightedge or ruler
- Pan suitable for holding overflow of density cup

#### **Test Procedure**

Follow Chapter 2, Section 2.3, Basic Test Procedures. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following test procedure to determine product compliance.

- 1. If the lot does not comply by weight with the sampling plan requirements (either the average or individual package requirements), select the lightest package and record the net weight of this package.
- 2. Determine the weight of the density cup.
- 3. Place the density cup in the pan and put the funnel on top of the density cup. Close the funnel slide-gate.
- 4. Pour sufficient commodity into the funnel so that the density cup can be filled to overflowing.
- 5. Quickly remove the slide-gate from the funnel, allowing the commodity to flow into the density cup.
- 6. Carefully, without agitating the density cup, remove the funnel and level off the commodity with the ruler or straight edge. Hold the ruler or straight edge at a right angle to the rim of the cup, and carefully draw it back across the top of the density cup to leave an even surface.
- 7. Weigh the filled density cup. Subtract the weight of the density cup from the gross weight of the commodity plus the density cup to obtain the net weight of commodity in the cup.

#### How is the volume determined?

- 1. Multiply the net weight (in pounds) as found for the package under test by 550.6.
- 2. Divide the answer just obtained by the weight of the commodity in the density cup, step (7). The result is the net volume of commodity in the package in milliliters.
- Compare the net volume of the commodity in the package with the volume declared on the package. The volume declaration is not located on the principal display panel. The following example is how the declaration of volume should appear.

# Volume 2530 cm<sup>3</sup> per NIST Handbook 133

Note.  $(1 \text{ mL} = 1 \text{ cm}^3)$ 

# What action can be taken based on the results of the density test?

If the net volume of commodity in the lightest package equals or exceeds the declared volume on the package, treat the lot as being in compliance based on volume and take no further action. If the net volume of borax in the lightest package is less than the declared volume on the package, further compliance testing will be necessary. Take further steps to determine if the lot was in compliance with net weight requirements at point-of-pack or was short-filled by weight. To determine this, perform a laboratory moisture loss analysis to ascertain the weight of the original borax product when it was fully hydrated; obtain additional data at the location of the packager; and/or investigate the problem with the packager of the commodity.

#### 2.5 The Determination of Drained Weight

Since the weight per unit volume of a drained product is of the same order of magnitude as that of the packaging liquid that is drained off, an "average nominal gross weight" cannot be used in checking packages of this type. The entire sample must be opened. The procedure is based upon a test method accepted by the U.S. Food and Drug Administration.

A tare sample is not needed because all the packages in the sample will be opened and measured.

The weight of the container plus drained-away liquid is determined. This weight is then subtracted from the gross weight to determine the package error.

# **Equipment**

- Scales and weights recommended in Section 2.2 are suitable for the determination of drained weight.
- Sieves
  - For drained weight of 1.36 kg or (3 lb) or less, one 20 cm or (8 in) No. 8 mesh U.S. Standard Series Sieve, receiving pan, and cover
  - For drained weight greater than 1.36 kg or (3 lb), one 30 cm or (12 in) sieve, with same specifications as above
- Stopwatch

#### **Test Procedure**

Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A or a Category B sampling plan in the inspection (depending on the location of test); select a random sample; then use the following test procedure to determine lot compliance.

- 1. Fill out boxes 1 through 8 on the standard pack report form on page E-4. Select the random sample. Determine and record on a worksheet the weight of the receiving pan.
- 2. Determine and record on a worksheet the gross weight of each individual package comprising the sample.
- 3. Pour the contents of the first package into the dry sieve with the receiving pan beneath it, incline sieve to an angle between 17° to 20° from horizontal to facilitate drainage, and allow the liquid from the product to drain into receiving pan for 2 minutes [Do not shake or shift material on the sieve.] Remove sieve and product.
- 4. Weigh the receiving pan, liquid, wet container, and any other tare material. [Do not include sieve and product.] Record this weight as tare and receiving pan.
- 5. Subtract the weight of the receiving pan, determined in step 1, from the weight obtained in step 4 to obtain the package tare weight (which includes the weight of the liquid).
- 6. Subtract the tare weight, found in step 5, from the corresponding package gross weight determined in step 2 to obtain the drained weight of that package. Determine the package error (drained weight labeled drained weight).
- 7. Repeat steps 3 through 6 for the remaining packages in the sample, cleaning and drying the sieve and receiving pan between measurements of individual packages.
- 8. Transfer the individual package errors to the standard pack report form, page E-4.
- 9. To determine lot conformance, return to Chapter 2, Section 2.3., Evaluating Results".

#### 2.6 Drained Weight for Glazed or Frozen Foods

# How is the drained weight of frozen shrimp and crabmeat determined?

When determining the net weight of frozen shrimp and crabmeat, use the test equipment and procedure provided below. Immerse the product directly in water in a mesh basket or open container to thaw (e.g., it is not placed in a plastic bag). Direct immersion does not result in the product absorbing moisture because the freezing process causes the tissue to lose its ability to hold water. Maintain the water temperature between 23 °C to 29 °C (75 °F to 85 °F). This is accomplished by maintaining a constant flow of warm water into the container holding the product (e.g., place a bucket in a sink to catch the overflow, and feed warm water into the bottom of the bucket through a hose). After thawing, drain the product on a sieve for 2 minutes and then weigh it.

#### **Equipment**

- Partial immersion thermometer or equivalent with 1 °C (2 °F) graduations and a -35 °C to +50 °C (-30 °F to +120 °F) accurate to  $\pm 1$  °C ( $\pm 2$  °F)
- Water source and hose with a 4 L to 15 L (1 gal to 4 gal) per minute flow rate
- Sink or other receptacle [i.e., 15 L (4 gal) bucket]

- A wire mesh basket or other container that is large enough to hold the contents of 1 package [e.g., 2.27 kg or (5 lb) box of shrimp] and has openings small enough to retain all pieces of the product (e.g., an expanded metal test tube basket lined with standard 16 mesh screen)
- Number 8 mesh, 20 cm (8 in) or 30 cm (12 in) sieve
- Stopwatch

#### **Test Procedure**

Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A or a Category B sampling plan in the inspection (depending on the location of test); select a random sample; then use the following test procedure to determine lot compliance.

- 1. Place the unwrapped frozen shrimp or crabmeat in the wire mesh basket and immerse in a 15 L (4 gal) or larger container of fresh water at a temperature between 23 °C to 29 °C (75 °F to 85 °F). Submerge the basket so that the top of the basket extends above the water level.
- 2. Maintain a continuous flow of water into the bottom of the container to keep the temperature within the specified range.
- 3. As soon as the product thaws, determined by loss of rigidity, transfer all material to a sieve (20 cm [8 in] for packages less than 453 g [1 lb]) and distribute it evenly over the sieve.
- 4. Without shifting the product, incline the sieve 30° from the horizontal position to facilitate drainage, and drain for 2 minutes.
- 5. At the end of the drain time, immediately transfer the product to a tared pan for weighing to determine the net weight.

#### How is the net weight of glazed raw seafood and fish determined?

For glazed seafood and fish, determine the net weight after removing the glaze using the following procedure. Use this method for any frozen glazed food product.

# **Equipment**

Use the equipment listed in Section 2.6.

#### **Test Procedures**

Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; and use the following test procedure to determine lot compliance.

- 1. Fill out a report form and select the random sample. A tare sample is not needed.
- 2. Weigh sieve and receiving pan. Record this weight on a worksheet as "sieve weight."
- 3. Remove each package from low temperature storage; open it immediately and place the contents under a gentle spray of cold water. Carefully agitate the product to avoid breaking the product. Continue the spray until all ice glaze that is seen or felt is removed. In general, the product should remain rigid; however, the ice glaze on certain products, usually smaller sized commodities, sometimes cannot be removed without defrosting the product. Nonetheless, remove the glaze, because it is a substantial part of the package weight. (Amended 2002)

- 4. Transfer the product to the weighed sieve. Without shifting the product, incline the sieve to an angle of 17° to 20° to facilitate drainage and drain (into waste receptacle or sink) for exactly 2 minutes.
- 5. Place the product and sieve on the receiving pan and weigh. Record this weight on a worksheet as the "sieve + product weight."
- 6. The net weight of product is equal to the weight of the pan plus the sieve plus the product (recorded in step 5) minus the "sieve weight" (recorded in step 2). Record the product net weight on the worksheet. The package error is equal to the net weight of the product as measured minus the labeled weight. Record the package error on the worksheet and transfer it to the report form.
- 7. Repeat steps 3 through 6 for each package in the sample, cleaning and drying the sieve and the receiving pan between package measurements.

#### **Evaluation of Results**

Follow the procedures in Chapter 2, Section 2.3., Evaluating Results

# **Chapter 3.** Test Procedures – For Packages Labeled by Volume

#### 3.1 Scope

#### What types of packaged goods can be tested using these procedures?

Use this procedure to determine the net contents of packaged goods labeled in fluid volume such as milk, water, beer, oil, paint, distilled spirits, soft drinks, juices, liquid cleaning supplies, or liquid chemicals. This chapter also includes procedures for testing the capacities of containers such as paper cups, bowls, glass tumblers, and stemware.

# What types of packages are not covered by these procedures?

These procedures do not cover berry baskets and rigid-dry measures that are covered by specific code requirements in NIST Handbook 44.

# When can the gravimetric test procedure be used to verify the net quantity of contents of packages labeled by volume?

The gravimetric procedure may be used to verify the net quantity of contents of packages labeled in volume when the density (density means the weight of a specific volume of liquid determined at a reference temperature) of the product being tested does not vary excessively from one package to another.

#### What procedure is followed if the gravimetric test procedure cannot be used?

Test each package as described in Section 3.3, Volumetric Test Procedure for Liquids.

#### What considerations besides density affect measurement accuracy?

In addition to possible package-to-package variations in product density, the temperature of the liquid will affect the volume of product. The product will expand or contract based on a rise or fall in product temperature.

**Example:** The volume of a liquid cleaning product might be 5 L (1.32 gal) at 20 °C (68 °F) and 5.12 L (1.35 gal) at 25 °C (77 °F), which represents a 2.2 % change in volume.

**Note:** This extreme example is for illustrative purposes, a 2.2 % volume change will not occur in normal testing.

# What reference temperature should be used to determine the volume of a liquid?

Use the reference temperature specified in Table 3-1., Reference Temperatures for Liquids to determine volume. When checking liquid products labeled by volume using the gravimetric procedure, maintain the packages used to determine product densities at reference temperatures. If testing the packages in a sample volumetrically, each package in the sample must be maintained at or corrected to the reference temperature when its volume is determined.

**Note.** When checking liquid products using a volumetric or gravimetric procedure, the temperature of the samples must be maintained at the reference temperature  $\pm 2$  °C ( $\pm 5$  °F).

Table 3-1. Reference Temperatures for Liquids			
	If the Liquid Commodity is	Then, the reference temperature is	
1	Frozen food labeled by volume (e.g., fruit juice)	-18 °C (0 °F)	
2	Beer	3.9 °C (39.1 °F)	
3	Food that must be kept refrigerated (e.g., milk and other dairy products. Usually labeled "Keep Refrigerated")	4.4 °C (40 °F)	
4	Distilled spirits or petroleum	15 °C (60 °F)	
5	Unrefrigerated products (e.g., includes liquids sold unchilled, such as soft-drinks and wine)	20 °C (68 °F)	

#### 3.2 Gravimetric Test Procedure for Liquids

### **Equipment**

• A scale that meets the requirements in Chapter 2, Section 2.2, Measurement Standards and Test Equipment.

**Note:** To verify that the scale has adequate resolution for use, it is first necessary to determine the density of the liquid; next verify that the scale division is no larger than MAV/6 for the package size under test. The smallest graduation on the scale must not exceed the weight value for MAV/6.

**Example:** Assume the inspector is using a scale with 1 g (0.002 lb) increments to test packages labeled 1 L (33.8 fl oz) that have an MAV of 29 mL (1 fl oz). Also, assume the inspector finds that the weight of 1 L of the liquid is 943 g (2.078 lb). This will result in an MAV/6 value in weight of 4.715 g (0.010 lb):

29  mL/6 = 4.8  mL	(1  fl oz/6 = 0.166 6  fl oz)
943 g/1 000 mL= 0.943 g/mL	$(2.07 \ 8 \ lb/33.6 \ fl \ oz = 0.061 \ 8 \ lb/fl \ oz)$
4.8  mL x  0.943  g/mL = 4.5264  g	$(0.166 6 \text{ fl oz } \times 0.061 \text{ 8 lb/fl oz} = 0.010 \text{ lb})$

In this example, the  $1\,\mathrm{g}$  (0.002 lb) scale division is smaller than the MAV/6 value of 4.5264 g (0.10 lb) so the scale is suitable for making a density determination.

- A partial immersion thermometer (or equivalent) with a range of -35 °C to +50 °C (30 °F to 120 °F), at least 1 °C (1 °F) graduations, and with a tolerance of  $\pm 1$  °C ( $\pm 2$  °F)
- Volumetric measures

**Example:** When checking packages labeled in SI units, flask sizes of 100 mL, 200 mL, 500 mL, 1 L, 2 L, 4 L, and 5 L and a 50 mL cylindrical graduate with 1 mL divisions may be used. When checking packages labeled in inch-pound units the use of measuring flasks and graduates with capacities of gill, half-pint, pint, quart, half-gallon, gallon, and a 2 fl oz cylindrical graduate, graduated to ½ fluid dram is recommended.

• Defoaming agents may be necessary for testing liquids such as beer and soft drinks that effervesce or are carbonated. Two such products are Hexanol or Octanol (Capryl Alcohol).

**Note:** The mention of trade or brand names does not imply that these products are endorsed or recommended by the U.S. Department of Commerce over similar products commercially available from other manufacturers.

- Bubble level at least 15.24 cm (6 in) in length
- Stopwatch

#### **Test Procedure**

- 1. Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection. Select a random sample; then use the following procedure to determine lot compliance.
- 2. Bring the sample packages and their contents to the reference temperature as specified in Table 3-1., Reference Temperatures for Liquids. To determine if the liquid is at its reference temperature, immerse the thermometer in the liquid before starting the test. Verify the temperature again immediately after the flask and liquid is weighed. If the product requires mixing for uniformity, mix it before opening in accordance with any instructions specified on the package label. Shaking liquids, such as flavored milk, often entraps air that will affect volume measurements, so use caution when testing these products. Often, less air is entrapped if the package is gently rolled to mix the contents.
- 3. For milk, select a volumetric measure equal to or one size smaller than the label declaration. For all other products, select a volumetric measure that is one size smaller than the label declaration. For example, if testing a 1 L bottle of juice or a soft drink, select a 500 mL volumetric measure.

  (Amended 2004)

**Note:** When determining the density of milk, if the product from the first container does not fill the volumetric measure to the nominal capacity graduation, product may be added from another container as long as product integrity is maintained (i.e., brand, identity, lot code, and temperature).

- 4. Prepare a clean volumetric measure to use according to the following procedures:
  - Because flasks are ordinarily calibrated on a "to deliver" basis, they must be "wet down" before using. Immediately before use, fill the volumetric flask(s) or graduate with water. The water should be at the reference temperature of the product being tested. Fill the flask(s) with water to a point slightly below the top graduation on the neck. The flask should be emptied in 30 seconds (± 5 seconds). Tilt the flask gradually so the flask walls are splashed as little as possible as is emptied. When the main flow stops, the flask should be nearly inverted. Hold the flask in this position for 10 seconds more and touch off the drop of water that adheres to the tip. If necessary, dry the outside of the flask. The flask or graduate is then ready to fill with liquid from a package. This is called the "wet down" condition.

**Note:** When using a volumetric measure that is calibrated "to contain," the measure must be dry before each measurement.

- ➤ If the liquid effervesces or foams when opened or poured (such as carbonated beverages), add two drops of a defoaming agent to the bottom of the volumetric measure before filling with the liquid. If working with a carbonated beverage, make all density determinations immediately upon placing the product into the standard. This reduces the chance of volume changes occurring from the loss of carbonization.
- ➤ Before making additional measurements of a liquid, use water to wash or rinse and prepare the volumetric measure. Between each two measurements of liquid from the sample packages, prepare the volumetric measure as described above, dry the outside of the flask, and drain the volumetric measure as described in earlier paragraphs of this section, as appropriate.
- 5. If the flask capacity is equal to the labeled volume, pour the liquid into the volumetric measure tilting the package to a nearly vertical position. If the flask capacity is smaller than the package's labeled volume, fill the flask to its nominal capacity graduation. If conducting a volumetric test, drain the container into the volumetric measure for 1 minute after the stream of liquid breaks into drops.

- 6. Position the volumetric measure on a level surface at eye level. For clear liquids, place a material of some dark color outside the flask immediately below the level of the meniscus. Read the volume from the lowest point of the meniscus. For opaque liquids, read volume from the center top rim of the liquid surface.
- 7. Use the gravimetric procedure to determine the volume if the limit specified for the difference in density is not exceeded.
  - Select a volumetric measure equal to or one size smaller than the labeled volume (depending on the product) and prepare it as described in paragraph 4 of this section. Then determine and record its empty weight.
  - Determine acceptability of the liquid density variation, using two packages selected for tare according to Chapter 2 as follows:
    - > Determine the gross weight of the first package.
    - Pour the liquid from the first package into a volumetric measure exactly to the nominal capacity marked on the neck of the measure.
    - Weigh the filled volumetric measure and subtract its empty weight to obtain the weight of the liquid. Determine density by dividing the weight of the liquid by the capacity of the volumetric measure.
    - > Determine the weight of the liquid from a second package using the same procedure.
    - ➤ If the difference between the densities of the two packages exceeds one division, use the volumetric procedure in Section 3.3., Volumetric Test Procedure for Liquids.

#### How is "nominal gross weight" determined?

Determine the "nominal gross weight" as follows:

- 1. Determine the Average Used Dry Tare Weight of the sample according to provisions of Section 2.3.
- 2. Calculate the Average Product Density by adding the densities of the liquid from the two packages and dividing the sum by two.
- 3. Calculate the "nominal gross weight" using the following formula if the flask capacity is equal to the labeled volume:

```
Nominal Gross Weight = (Average Product Density [in weight units]) + (Average Used Dry Tare Weight)
```

**Note:** If the flask size is smaller than the labeled volume, the following formula is used:

Nominal Gross Weight = (Average Product Density x [Labeled Volume/ Flask Capacity]) + (Average Used Dry Tare Weight)

# How are the errors in the sample determined?

1. Weigh the remaining packages in the sample.

Subtract the nominal gross weight from the gross weight of each package to obtain package errors in terms of weight. All sample packages are compared to the nominal gross weight.

2. To convert the average error or package error from weight to volume, use the following formula:

Package Error in Volume = Package Error in Weight/Average Product Density
Per Volume Unit of Measure

#### **Evaluation of Results**

Follow the procedures in "Evaluating Results" in Chapter 2, Section 2.3, to determine lot conformance.

#### 3.3 Volumetric Test Procedure for Liquids

#### How is the volume of liquid contained in a package determined volumetrically?

Follow steps 1 through 6 in Section 3.2., Gravimetric Test Procedure for Liquids for each package in the sample.

#### How are the errors in the sample determined?

Read the package errors directly from the graduations on the measure. The reference temperature must be maintained within  $\pm$  2 °C ( $\pm$  5 °F) for the entire sample.

#### **Evaluation of Results**

Follow the procedures in Chapter 2, Section 2.3, Evaluating Results to determine lot conformance.

#### 3.4 Other Volumetric Test Procedures

#### What other methods can be used to determine the net contents of packages labeled by volume?

Depending on how level the surface of the commodity is, use one of two headspace test procedures. Use the first headspace test procedure to determine volume where the liquid has a smooth surface (e.g., oils, syrups, and other viscous liquids). Use the second procedure to determine volume where the commodity does not have a smooth surface (e.g., mayonnaise and salad dressing).

#### **Test Procedure**

Before conducting any of the following volumetric test procedures, follow Section 2.3, Basic Test Procedure in Chapter 2. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following procedure to determine lot compliance.

# **Test Equipment**

- Micrometer depth gage (ends of rods fully rounded) 0 mm to 225 mm (0 in to 9 in) or longer
- Level (at least 15 cm (6 in) in length)
- Laboratory pipets and/or buret
  - Class A 500 mL buret that conforms to ASTM E 287-94, "Standard Specification for Laboratory Glass Graduated Burets"

- Class A Pipets, calibrated "to deliver" that conform to ASTM E 969-95, "Standard Specification for Glass Volumetric (Transfer) Pipets"
- Volumetric measures
- Water
- Rubber bulb syringe
- Plastic disks that are 3 mm (1/8 in) thick with diameters equal to the seat diameter or larger than the brim diameter of each container tested. The diameter tolerance for the disks is 50 μm (± 0.05 mm [± 0.002 in]). The outer edge should be smooth and beveled at a 30° angle with the horizontal to 800 μm (0.8 mm [1/32 in]) thick at the edge. Each disk must have a 20 mm (3/4 in) diameter hole through its center and a series of 1.5 mm (1/16 in) diameter holes 25 mm (1 in) from the outer edge.
- Stopwatch

# How is the volume of oils, syrups, and other viscous liquids that have smooth surfaces determined?

- 1. Make all measurements on a level surface
- 2. Bring the temperature of both the liquid and the water to be used to measure the volume of the liquid to the reference temperature specified in Table 3-1., Reference Temperatures for Liquids.
- 3. Measure the headspace of the package at the point of contact with the liquid using a depth gauge with a fully rounded, rather than a pointed, rod end. If necessary, support the package to prevent the bottom of the container from distorting.
- 4. Empty, clean, and dry the package.
- 5. Refill the container with water measured from a volumetric standard to the original liquid headspace level measured in paragraph (3) of this section until the water touches the depth gauge.
- 6. Determine the amount of water used in paragraph (5) of this section to obtain the volume of the liquid and calculate the "package error" based on that volume.

#### **Evaluation of Results**

Follow the procedures in "Evaluating Results" in Chapter 2, Section 2.3, to determine lot conformance.

#### 3.5 Mayonnaise and Salad Dressing

# **Volumetric Headspace Test Procedure**

Use the volumetric headspace procedure described in this section to determine volume when the commodity does not have a smooth surface (e.g., mayonnaise, salad dressing, and other water immiscible products without a level liquid surface). The procedure guides the inspector to determine the amount of headspace above the product in the package and the volume of the container. Determine the product volume by subtracting the headspace volume from the container volume. Open every package in the sample.

- 1. Make all measurements on a level surface.
- 2. Bring the temperature of both the commodity and the water used to measure the volume to the appropriate temperature designated in Table 3-1., Reference Temperatures for Liquids.
- 3. Open the first package and place a disk larger than the package container opening over the opening.

#### 4. Measurement Procedure

- Deliver water from a flask (or flasks), graduate, or buret, through the central hole in the disk onto the top of the product until the container is filled. If it appears that the contents of the flask may overfill the container, do not empty the flask. Add water until all of the air in the container has been displaced and the water begins to rise in the center hole of the disk. Stop the filling procedure when the water fills the center disk hole and domes up slightly due to the surface tension. Do not add additional water after the level of the water dome has dropped.
- If the water dome breaks on the surface of the disk, the container has been overfilled and the test is void; dry the container and start over.
- 5. To obtain the headspace capacity, record the volume of water used to fill the container and subtract 1 mL (0.03 fl oz), which is the amount of water held in the hole in the disk specified.
- 6. Empty, clean, and dry the package container.
- 7. Repeat steps 4 and 5 of this section. Refill the package container with water measured from a volumetric measure to the maximum capacity of the package, subtract 1 mL (0.03 fl oz), and record the amount of water used as the container volume; and
- 8. From the container volume determined in paragraph 7 of this section, subtract the headspace capacity in paragraph (5) of this section to obtain the measured volume of the product and calculate the "package error" for that volume where "package error" equals labeled volume minus the measured volume of the product.

# **Evaluation of Results**

Follow the procedures in Chapter 2, Section 2.3., Evaluating Results to determine lot conformance.

# 3.6 Goods Labeled by Capacity - Volumetric Test Procedure

#### What type of measurement equipment is needed to perform the headspace test procedures?

Use the test equipment in Section 3.4. (except for the micrometer depth gage) to perform these test procedures.

#### How is it determined if goods labeled by capacity meet the average and individual requirements?

Before conducting any of the following volumetric test procedures, refer to Chapter 2, Section 2.3., Basic Test Procedure. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following test procedure to determine lot compliance.

- 1. Make all measurements on a level surface.
- 2. When testing goods labeled by capacity, use water at a reference temperature of 20 °C  $\pm$  2 °C (68°F  $\pm$  5 °F).
- 3. Select a sample container and place a disk larger than the container opening over the opening.

#### 4. Measurement Procedure

- Add water to the container using flask (or flasks), graduate, or buret corresponding to labeled capacity of the container. If it appears that the contents of the flask may overfill the container, do not empty the flask. Add water until all of the air in the container has been displaced and the water begins to rise in the center hole of the disk. Stop filling the container when the water fills the center disk hole and domes up slightly due to the surface tension.
- If the water dome breaks on the surface of the disk, the container has been overfilled and the test is void; dry the container and start over.
- > Record the amount of water used to fill the container and subtract 1 mL (0.03 fl oz) (this is the amount of water held in the hole in the disk specified) to obtain the total container volume.
- 5. Test the other containers in the sample according to the procedures in paragraph (4) of this section.
- 6. To determine package errors, subtract the total container volume obtained in paragraphs (4) and (5) from the labeled capacity of the container.

#### **Evaluation of Results**

Follow the procedures in Chapter 2, Section 2.3., Evaluating Results to determine lot compliance.

#### 3.7 Pressed and Blown Glass Tumblers and Stemware

#### What requirements apply to pressed and blown glass tumblers and stemware?

This handbook provides a tolerance to the labeled capacity of glass tumblers and stemware. The average requirement does not apply to the capacity of these products. See Table 3-2., Allowable Differences for Pressed and Blown Glass Tumblers and Stemware.

# How is it determined if tumblers and stemware meet the individual package requirement?

Follow the Basic Test Procedure in Section 2.3. Define the inspection lot and determine which sampling plan to use in the inspection, select a random sample, and then use the following volumetric test procedure to determine container capacity and volume errors.

# What type of measuring equipment is needed to perform the test procedures?

Use the equipment specified in Section 3.4., (except for the micrometer depth gage) to perform these test procedures.

# What are the steps of the test procedure?

Follow steps 1 through 6 in 3.6, Goods Labeled by Capacity - Volumetric Test Procedure.

# How is it determined if the samples conform to the allowable difference?

Compare the individual container error with the allowable difference that applies in Table 3-2., Allowable Differences for Pressed and Blown Glass Tumblers and Stemware. If a package contains more than one container, all of the containers in the package must meet the allowable difference requirements in order for the package to pass.

Table 3-2. Allowable Differences for Pressed and Blown Glass Tumblers and Stemware						
Unit of measure						
If the capacity in metric units is:	Then the allowable difference is:					
200 mL or less	± 10 mL					
More than 200 mL	± 5 % of the labeled capacity					
If the capacity in inch-pound units is:	Then the allowable difference is:					
5 fluid ounces or less	± 1/4 fluid ounce					
More than 5 fluid ounces	$\pm$ 5 % of the labeled capacity					

#### **Evaluation of Results**

Count the packages in the sample with volume errors greater than the allowable difference and compare the resulting number with the number given in Column 3 of Table 2-11., in Appendix A.

- ➤ If the number of containers in the sample with errors exceeding the allowable difference exceeds the number allowed in Column 3, the lot fails.
- ➤ If the number of packages with errors exceeding the allowable difference is less than or equal to the number in Column 3, the lot passes.

**Note:** The average capacity error is not calculated because the lot passes or fails based on the individual volume errors. Act on the individual units containing errors exceeding the allowable difference individually even though the lot passes the requirement.

#### 3.8 Volumetric Test Procedure for Paint, Varnish, and Lacquers – Non-aerosol

# How is the volume of paint, varnish, and lacquers contained in a package determined?

Use one of three different test methods depending upon the required degree of accuracy and the location of the inspection. The procedures include both retail and in-plant audits and a "possible violation" method, which is designed, for laboratory or in plant use because of cleanup and product collection requirements. The procedures are suitable to use with products labeled by volume and packaged in cylindrical containers with separate lids that can be resealed.

# **Equipment**

- A scale that meets the requirements in Chapter 2, Section 2.2., Measurement Standards and Test Equipment
- Volumetric measures
- Micrometer depth gage (ends of rods fully rounded), 0 mm to 225 mm (0 in to 9 in)
- Diameter (Pi) tape measure, 5 cm to 30 cm (2 in to 12 in)
- Spanning bar, 2.5 cm by 2.5 cm by 30 cm or (1 in by 1 in by 12 in)
- Rule, 30 cm (12 in)
- Paint solvent or other solvent suitable for the product being tested
- Cloth, 30 cm (12 in) square
- Wood, 5 cm (2 in) thick, by 15 cm (6 in) wide, by 30 cm (12 in) long
- Rubber mallet

- Metal disk, 6.4 mm (1/4 in) thick and slightly smaller than the diameter of package container bottom.
- Rubber spatula
- Level at least 15 cm (6 in) in length
- Micrometer (optional)
- Stopwatch

# What test procedure is used to conduct a retail audit test?

Conduct a retail audit using the following test procedure that is suitable for checking cylindrical containers up to 4L (1 gal) in capacity. Use step 2 in the retail audit test procedure with any size container, but step 3 must be used for containers with capacities of 4L (1 gal). The method determines the volume of a single can in the sample selected as most likely to contain the smallest volume of product. Do not empty any containers because only their critical dimensions are being measured.

#### How accurate is the dimensional test procedure?

The configuration of the bottom of the can, paint clinging to the lid, and slight variations in the wall and label thicknesses of the paint container may produce an uncertainty estimated to be at least 0.6 % in this auditing procedure. Therefore, this method is recommended solely to eliminate from more rigorous testing those packages that appear to be full measure. Use the violation procedures when the volume determined in step 10 is less than the labeled volume or in any case where short measure is suspected.

#### What worksheets make data recording easier?

Use the following format to develop worksheets to perform audits and determine the volume when checking paint. Follow the procedure and it will indicate the column in which the various measurements made can be recorded.

Example: Audit Worksheet for Checking Paint – Add additional rows as needed									
1. Can Height	Can Diameter			6. Avg Liquid Diameter	7. Avg Liquid Level	8. Avg Container Depth	9. Avg Liquid Depth	10. Volume*	
	2. Top	3. Middle	4. Bottom	5. Average					
*10. Volu	*10. Volume = 0.7854 x 6 x 6 x 9								

**Note:** When the following instructions require recording a measurement, refer to the numbered columns in the "Audit Worksheet for Checking Paint" shown above.

#### How is a retail audit test performed?

- 1. Select a random sample. A tare sample is not needed.
- 2. For containers less than 4 L or (1 gal): measure the outside diameter of each container near its middle to the closest 0.02 mm (0.001 in). Use a diameter tape measure to record the measurements in Column 3. Place the containers on a level surface and using the micrometer depth gage, record their heights in Column 1 on the worksheet. If the range of outside diameters exceeds 0.125 mm (0.005 in) or the range in heights exceeds 1.58 mm (0.062 5 in), do

not use this procedure. If the ranges are within the specified limits, weigh all cans in the sample, select the container with the lightest gross weight, and remove its lid. Continue with step 4 below.

- 3. For 4 L (1 gal) containers: gross weigh each package in the sample. Select the package with the lightest gross weight and remove its lid.
- 4. Use a direct reading diameter tape measure to measure the outside diameter of the selected container near its top, middle (already measured if step 2 was followed), and bottom to the closest 0.02 mm (0.001 in). Record these measurements in Columns 2, 3, and 4. Add the three diameter values and divide by three to obtain the average diameter and record this value in Column 5.
- 5. If a micrometer is available, measure the wall and the paper label thickness of the container; otherwise, assume the wall and label thicknesses given in Table 3-3. Thickness of Paint Can Walls and Labels below:

Table 3-3. Thickness of Paint Can Walls and Labels					
Can Size	Wall Thickness				
4 L (1 gal)	250 μm (0.25 mm) [0.010 in]				
2 L (1/2 gal)	250 μm (0.25 mm) [0.010 in]				
1 L (1 qt)	230 μm (0.23 mm) [0.009 in]				
500 mL (1 pt)	230 μm (0.23 mm) [0.009 in}				
250 mL	200 μm (0.20 mm) [0.008 in]				
Label Thickness* for all can sizes: 100 μm (0.10 mm) [0.004 in]					
(*Paper only – ignore labels lithographed directly onto the container)					

Subtract twice the thickness of the wall of the can and paper label from the average can diameter (step 4) to obtain the average liquid diameter. Record the liquid diameter in Column 6.

- 6. On a level surface, place the container on the circular metal disk that is slightly smaller in diameter than the lower rim of the can so the bottom of the container nests on the disk to eliminate any "sag" in the bottom of the container.
- 7. Place the spanning bar and depth gage across the top of the paint can and mark the location of the spanning bar on the rim of the paint container. Measure the distance to the liquid level, to the nearest 20 µm (0.02 mm) (0.001 in), at three points in a straight line. Take measurements at points approximately 1 cm (3/8 in) from the inner rim for cans 12.5 cm (5 in) in diameter or less (and at 1.5 cm [1/2 in] from the rim for cans exceeding 12.5 cm [5 in]) in diameter and at the center of the can. Add the three readings and divide by three to obtain the average distance to the liquid level in the container. Record the average distance to the liquid level in Column 7.
- 8. Measure the distance to the bottom of the container at three points in a straight line in the same manner as outlined in step 7. Add the three readings and divide by three to obtain the average height of the container and record it in Column 8.
- 9. Subtract the average distance to the liquid level (Column 7) from the average height of the container (Column 8) to obtain the average height of the liquid column and record it in Column 9.
- 10. Determine the volume of paint in the container by using the following formula:

$$Volume = 0.7854 D^2H$$

Where D = average liquid diameter (Column 6) and H = average liquid height (Column 9)

11. Record this value in Column 10. If the calculated volume is less than labeled volume, go to the Violation Procedure.

#### How is an in-plant audit conducted?

Use the following procedures to conduct an in-plant audit inspection. This method applies to a container that probably contains the smallest volume of product. Duplicate the level of fill with water in a can of the same dimensions as the one under test. Use this method to check any size of package if the liquid level is within the measuring range of the depth gage. If any paint is clinging to the sidewall or lid, carefully scrape the paint into the container using a rubber spatula.

- 1. Follow steps 1 through 6 of the retail audit test.
- 2. Place the spanning bar and depth gage across the top of the paint can. Measure the liquid level at the center of the surface and record the level in Column 7.
- 3. Select an empty can with the same bottom configuration as the container under test and with a diameter and height equal to that of the container under test within plus or minus the following tolerances:
  - a. For 500 mL or (1 pt) cans within 25  $\mu$ m (0.025 mm) (0.001 in)
  - b. For 1 L or (1 qt) cans within 50 μm (0.05 mm) (0.002 in)
  - c. For 2 L or (1/2 gal) cans within 75 $\mu$ m (0.075 mm) (0.003 in)
  - d. For 4 L or (1 gal) cans within 100 μm (0.1 mm) (0.004 in)

Set the empty can on a level work surface with a circular metal disk that is slightly smaller in diameter than the bottom can rim underneath the can to eliminate sag. Set up the spanning bar and depth gage as in step 2 above. Fill the container with water from a volumetric measure of the same volume as the labeled volume. Measure the distance to the liquid level at the center of the container and record this level in Column 7 below the reading recorded in step 2. If this distance is equal to or greater than the distance determined in step 2, assume that the package is satisfactory. If the distance is less than the distance determined in step 2, the product may be short measure. Use the possible violation procedure given in the next section when the audit test indicates that short measure is possible.

# **Violation Procedure**

#### How is it determined if the containers meet the package requirements?

Use the following method if the liquid level is within the measuring range of the micrometer. The first step is to follow the Basic Test Procedure in Section 2.3. Define the inspection lot to determine which Category A sampling plan to use; select a random sample; and then use the following procedure. The steps noted with an (\*) are required if there is paint adhering to the lid and it cannot removed by scraping into the can.

1. Do not shake or invert the containers selected as the sample. Determine the gross weight of these packages and record in Column 2 of the "Example Worksheet for Possible Violation in Checking Paint" below.

Example Worksheet for Possible Violation in Checking Paint – Add additional rows as needed								
1. Labeled Volume	2. Gross Weight	3. Lid Paint Weight (Wet - Dry)	4. Liquid Level	5. Tare	6. Water Volume	7. Net Wt. = 2 - 5	8. Weight of Labeled Volume = 7 x 1÷ 6	9. Package Volume = 6 + [(3 ÷7) x 6)]

Record the labeled volume of the first tare sample package in Column 1 of the worksheet. Use a circular metal disk to eliminate can "sag" and remove the lid. If paint clings to the lid of the container, scrape it off with a spatula.

- 2.\* If paint that adheres to the lid cannot be completely removed by scraping the paint into the can, determine the weight of the lid plus any adhering paint. Clean the paint lid with solvent and weigh again. Subtract the clean lid weight from the lid weight with paint to determine the weight of the paint adhering to the lid. Record this weight in Column 3.
- 3. Place the spanning bar and depth gage across the top of the paint can. Mark the location of the spanning bar on the rim of the paint container. Measure the distance to the liquid level at the center of the container to the nearest 20 µm (0.02 mm) (0.001 in). Record the distance in Column 4.
- 4. Empty and clean the sample container and lid with solvent; dry and weigh the container and lid. Record the tare weight in Column 5.
- 5. Set up the container in the same manner as in step 1.
- 6. Place the spanning bar at the same location on the rim of the paint container as marked in step 3. With the depth gage set as described in step 3, deliver water into the container in known amounts until the water reaches the same level occupied by the paint as indicated by the depth gage. Record this volume of water (in mL or fl oz) in Column 6 of the worksheet. This is the volume occupied by the paint in the container. Follow steps, 7a, 8a, and 9a if scraping does not remove the paint from the lid. In order to determine if gravimetric testing can be used to test the other packages in the sample, follow only steps 7, 8, and 9 when no paint adheres to the lid.
- 7. Subtract the weight of the container (Column 5) from the gross weight (Column 2) to arrive at the net weight of paint in the selected container. Record the net weight in Column 7 of the worksheet.
  - 7a\* Subtract the weight of the container (Column 5) and the weight of product on the lid (Column 3) from the gross weight (Column 2) to arrive at the net weight of paint in the container. Record in Column 7 (excluding the weight of the paint on the lid).
- 8. Calculate the weight of the labeled volume of paint (for the first package opened for tare = on the lid).

net weight (Column 7) x labeled volume (Column 1) ÷ volume of paint in can (Column 6)

Record this value in Column 8.

8a\* Calculate the package volume =

volume in can (Column 6) + [lid paint weight (Column 3) x volume in can (Column 6) / net weight (Column 7)]

Record it in Column 9 of the worksheet.

9. Calculate the package error. Use the following formula if paint does not adhere to the lid:

Package error = (Column 6 value) - (labeled volume)

9a\* Use the following formula if paint does adhere to the lid and will not come off by scraping.

Package error = (Column 9 value) - (labeled volume)

10. Repeat steps 1 through 9 for the second package chosen for tare.

#### When can a gravametric procedure be used?

A gravimetric procedure is used if the weights of the labeled volume for the first two packages do not differ from each other by more than one division on the scale (if they meet this criterion, check the rest of the sample gravimetrically and record in Column 8).

#### How is "nominal gross weight" determined?

Determine the "nominal gross weight" for use with Chapter 2, Section 2.3. as follows:

The nominal gross weight equals the sum of the average weight of the labeled volume (average of values recorded in Column 8) plus the average tare (average of values recorded in Column 3) for the packages selected for tare. Note that the weight of a given volume of paint often varies considerably from container to container; therefore, volumetric measurements may prove necessary for the entire sample.

#### **Evaluation of Results**

Follow the procedures in "Evaluating Results" in Chapter 2, Section 2.3. to determine lot conformance.

# 3.9 Testing Viscous Materials - Such As Caulking Compounds and Pastes

#### How are viscous materials such as caulking compounds and paste tested?

Use the following procedure for any package of viscous material labeled by volume. It is suitable for very viscous materials such as cartridge packed caulking compounds, glues, pastes, and other similar products. It is best to conduct this procedure in a laboratory using a hood to ventilate solvent fumes. If used in the field, use in a well ventilated area. Except for the special measurement procedures to determine the weight of the labeled volume, this procedure follows the basic test procedure. For each weight of a known volume determination, pack a portion of the packaged product into a pre-weighed cup of known volume (called a "density cup" or "pycnometer") and weigh. From the weight of the known volume, determine the weight of the labeled volume. Compare the nominal gross weight with the gross weight to determine the package error.

# What type of measurement equipment is needed to test packages of caulk, pastes, and glues?

- A scale that meets the requirements in Chapter 2, Section 2.2. Measurement Standards and Test Equipment.
- Pycnometer, a vessel of known volume used for weighing semifluids. The pycnometer can be bought or made. If it is made, refer to it as a "density cup." To make a 150 mL or 5 fl oz density cup, cut off the lip of a 150 mL beaker with an abrasive saw and grind the lip flat on a lap wheel. The slicker plate is available commercially. Calibrate the density cup gravimetrically with respect to the contained volume using the procedure in ASTM E 542–94, "Standard Practice for Calibration of Laboratory Volumetric Apparatus."
- Appropriate solvents (water, Stoddard solvent, kerosene, alcohol, etc.)
- Caulking gun (for cartridge packed products)

#### How is a pycnometer prepared for use?

Before using, weigh and calibrate the pycnometer (or the density cup and slicker plate) with respect to volume (mL or fl oz). If applicable, comply with any special instructions furnished by the manufacturer to calibrate a pycnometer that has not been calibrated. It is not necessary to reweigh or recalibrate for each test; however, mark the pieces of each unit to prevent interchange of cups and slicker plates.

# How is it determined if the containers meet the package requirements?

- 1. First, follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then, use the following procedure to determine lot compliance.
- 2. Weigh a calibrated pycnometer and slicker plate and record as "pycnometer weight" and record this weight and the volume of the pycnometer.
- 3. Determine the gross weight of the first package and record the weight value. Open the package and transfer the product to the pycnometer by filling it to excess. Use a caulking gun to transfer product from the caulking cartridges. If using a pycnometer, cover it with a lid and screw the cap down tightly. Excess material will be forced out through the hole in the lid, so the lid must be clean. If using a density cup, place the slicker plate over 3/4 of the cup mouth, press down and slowly move the plate across the remainder of the opening. With the slicker plate in place, clean all the exterior surfaces with solvent and dry.
- 4. Completely remove the product from the package container; clean the package container with solvent; dry and weigh it to determine the tare weight.
- 5. Weigh the filled pycnometer or filled density cup with slicker plate and record this weight. Subtract the weight of the empty pycnometer from the filled weight to determine the net weight of the product contained in the pycnometer and record this weight.
- 6. Clean the pycnometer and repeat steps 3, 4, and 5 for the second package in the tare sample.

Determine acceptability of the density variation on the two packages selected for tare. If the difference between the densities of both packages exceeds one division of the scale, do not use the gravimetric procedure to determine the net quantity of contents. Instead, use the procedure in steps 9 and 10.

**Note:** If the gravimetric procedure can be used perform steps 8 and 10.

7. Calculate the weight of product corresponding to the labeled volume of product according to the following formula:

Weight of Product in Pycnometer ÷ Pycnometer Volume = Product Density

- 8. Test each package individually by determining the product density in each package using the pycnometer and record the gross, tare, and net weight of each package. Subtract the weight of the labeled volume (determined for each package) from the net weight of product to arrive at each individual package error in units of weight.
- 9. Convert the package errors to units of volume using the following formula:

Package Error (volume) = (Package Error [weight] x Pycnometer Volume) ÷ (Weight of Product in Pycnometer)

10. Record the package errors on the report form using an appropriate unit of measure.

#### **Evaluation of Results**

Follow the procedures in "Evaluation Results" in Chapter 2, Section 2.3 to determine lot conformance.

#### 3.10 Peat Moss

How are packages of peat and peat moss labeled by compressed volume tested?

Measure the dimensions of the compressed material to determine if it contains the labeled quantity.

# How are packages of peat and peat moss labeled by uncompressed volume tested?

Use the following method to test peat moss sold using an uncompressed volume as the declaration of content. The procedure is based on ASTM D 2978-90, "Standard Method of Test for Volume of Processed Peat Materials."

# Equipment

- 12.7 mm (or ½ in) sieve.
- Use one of the following measures as appropriate for the package size. (See Table 3-4., "Specifications for Test Measures for Mulch and Soils" for additional information on test measure construction.)
  - ➤ 28.3 L (1 ft³) measure with inside dimensions of 30.4 cm (12 in) by 30.4 cm (12 in) by 30.4 cm (12 in). Mark the inside of the measure with horizontal lines every 1.2 cm (1/2 in) so that package errors can be directly determined.
  - ➤ 100 L (3.5 ft³) measure with inside dimensions of 50 cm (19.68 in) by 50 cm (19.68 in) by 40 cm (15.74 in). The inside of the measure should be marked with horizontal lines every 1.2 cm (1/2 in) so that package errors can be directly determined.
- Straight edge, 50.8 cm (20 in) in length.
- Sheet for catching overflow of material.
- Level (at least 15.24 cm (6 in) in length).

# How is it determined if the packages meet the requirements in this handbook?

- 1. Follow Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then, use the following procedure to determine lot compliance.
- 2. Open each package in turn, remove the contents, and pass them through the sieve directly into the measuring container (overfilling it). Use this method for particulate solids (such as soils or other garden materials) labeled in cubic dimensions or dry volume. Some materials may not pass through the sieve for peat moss; in these instances, separate the materials by hand (to compensate for packing and settling of the product after packaging) before filling the measure.

**Note:** Separated material (product not passing through the sieve) must be included in the product volume.

Shake the measuring container with a rotary motion at one rotation per second for 5 seconds. Do not lift the measuring container when rotating it. If the package contents are greater than the measuring container capacity, level the measuring container with a straight edge using a zigzag motion across the top of the container. Empty the container. Repeat the filling operations as many times as necessary, noting the partial fill of the container for the last quantity delivered using the interior horizontal markings as a guide. Record the total volume.

3. To compute each package error, subtract the labeled quantity from the total volume and record it.

#### **Evaluation of Results**

Follow the procedures in "Evaluating Results" in Chapter 2, Section 2.3 to determine lot conformance.

#### 3.11 Mulch and Soils Labeled by Volume

# What products are defined as mulch and soil?

- Mulch is defined as "any product or material except peat or peat moss that is advertised, offered for sale, or sold for primary use as a horticultural, above-ground dressing, for decoration, moisture control, weed control, erosion control, temperature control, or other similar purposes."
- Soil is defined as "any product or material, except peat or peat moss that is advertised or offered for sale, or sold for primary use as a horticultural growing media, soil amendment, and/or soil replacement."

#### What type of measurement equipment is needed to test packages of mulch and soil?

• A test measure appropriate for the package size that meets the specifications for test measures in Table 3-4.

Table 3-4. Specifications for Test Measures for Mulch and Soils								
Nominal Volume of Test Measure	Interi	or Wall Dimen	sions*	Marked Intervals on Interior Walls ***	Volume Equivalent of Marked Intervals			
	Length	Width	Height**					
30.2 L (1.07 ft <sup>3</sup> ) for testing packages that contain less than 28.3 L (1 ft <sup>3</sup> or 25.7 dry qt)	20.32 cm (8 in)	20.32cm (8 in)	73.66 cm (29 in)	1.27 cm (1/2 in)	524.3 mL (32 in <sup>3</sup> )			
28.3 L (1 ft <sup>3</sup> )	30.48 cm (12 in)	30.48 cm (12 in)	30.48 cm (12 in)	1.27 cm (1/2 in)	1 179.8 mL (72 in <sup>3</sup> )			
56.6 L (2 ft <sup>3</sup> )	40.64 cm (16 in)	22.86 cm (9 in)	121.92 cm (48 in)	1.27 cm (1/2 in)	1 179.8 mL (72 in <sup>3</sup> )			
84.9 L (3 ft <sup>3</sup> )	40.64 cm (16 in)	22.86 cm (9 in)	121.92 cm (48 in)	1.27 cm (1/2 in)	1 179.8 mL (72 in <sup>3</sup> )			

Measures are typically constructed of 1.27 cm (1/2 in) marine plywood. A transparent sidewall is useful for determining the level of fill, but must be reinforced if it is not thick enough to resist distortion. If the measure has a clear front, place the level gage at the back (inside) of the measure so that the markings are read over the top of the mulch.

#### **Notes**

- Drop cloth/polyethylene sheeting for catching overflow of material.
- Level (at least 15 cm (6 in) in length).

# How is it determined if the packages meet the package requirements?

Use the following procedure:

1. Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection, select a random sample, then, use the following procedure to determine lot conformance.

<sup>\*</sup> Other interior dimensions are acceptable if the test measure approximates the configuration of the package under test and does not exceed a base configuration of the package cross-section.

<sup>\*\*</sup>The height of the test measure may be reduced, but this will limit the volume of the package that can be tested.

<sup>\*\*\*</sup> When lines are marked in boxes, they should extend to all four sides of the measure if possible to improve readability. It is recommended that a line indicating the MAV level also be marked to reduce the possibility of reading errors when the level of the mulch is at or near the MAV.

2. Open each package in turn. Empty the contents of the package into a test measure and level the contents by hand. Do not rock, shake, drop, rotate, or tamp the test measure. Read the horizontal marks to determine package net volume.

**Note:** Some types of mulch are susceptible to clumping and compacting. Take steps to ensure that the material is loose and free flowing when placed into the test measure. Gently roll the bag before opening to reduce the clumping and compaction of material.

3. Exercise care in leveling the surface of the mulch/soil and determine the volume reading from a position that minimizes errors caused by parallax.

#### How are package errors determined?

Determine package errors by subtracting the labeled volume from the package net volume in the measure. Record each package error.

Package Error = Package Net Volume Labeled Volume

#### **Evaluation of Results**

Follow the procedures in Chapter 2, Section 2.3., Evaluating Results to determine lot conformance.

**Note:** In accordance with Table 2-10., in Appendix A, apply an MAV of 5 % of the declared quantity to mulch and soil sold by volume. When testing mulch and soil with a net quantity in terms of volume, one package out of every 12 in the sample may exceed the 5 % MAV (e.g., one in a sample of 12 packages; two in a sample of 24 packages; four in a sample of 48 packages.) However, the sample must meet the average requirement of the Category A Sampling Plan.

#### 3.12 Ice Cream Novelties

Note: The following procedure can be used to test packaged products that are solid or semisolid and that will not dissolve in, mix with, absorb, or be absorbed by the fluid into which the product will be immersed. For example, ice cream labeled by volume can be tested using ice water or kerosene as the immersion fluid.

How are ice cream novelties inspected to see if the labeled volume meets the package requirements?

Use the following volume displacement procedure that uses a displacement vessel specifically designed for ice cream novelties such as ice cream bars, ice cream sandwiches, or cones. The procedure determines the volume of the novelty by measuring the amount of water displaced when the novelty is submerged in the vessel. Two displacements per sample are required to subtract the volume of sticks or cups.

The procedure first determines if the densities of the novelties are the same from package to package (in the same lot) so that a gravimetric test can be used to verify the labeled volume. If a gravimetric procedure is used, compute an average weight for the declared volume from the first two packages and weigh the remainder of the sample. If the gravimetric procedure cannot be used, use the volume displacement procedure for all of the packages in the sample.

# **Equipment**

- A scale that meets the requirements in Chapter 2, Section 2.2. Measurement Standards and Test Equipment.
- Volumetric measures

• Displacement vessel with dimensions that are appropriate for the size of novelties being tested. Figure 3-1., shows an example of a displacement vessel. It includes an interior baffle that reduces wave action when the novelty is inserted and the downward angle of the overflow spout reduces dripping. Other designs may be used.

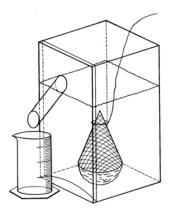


Figure 3-1. Example of a Displacement Vessel

**Note:** This displacement vessel can be constructed or similar devices may be obtained from any Laboratory Equipment or Science Education suppliers. The U.S. Department of Commerce does not endorse or recommend any particular device over similar commercially available products from other manufacturers.

- Thin wire, clamp, or tongs
- Freezer or ice chest and dry ice
- Single-edged razor or sharp knife (for sandwiches only)
- Ice water/kerosene maintained at 1 °C (33 °F) or below
- Indelible marker (for ice pops only)
- Level, at least 15.24 cm (6 in) in length
- A partial immersion thermometer (or equivalent) with a range of -1 °C to +50 °C (30 °F to 120 °F), at least 1 °C (1 °F) graduations, and with a tolerance of ±1 °C (±2 °F)
- A table-top, laboratory-type jack of sufficient size to hold the displacement vessel
- Stopwatch

#### **Test Procedure**

Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following procedure to determine lot compliance.

1. Maintain the samples at the reference temperature for frozen products that is specified in Table 3-1. Reference Temperatures for Liquids in this chapter [i.e., -18 °C (0 °F)]. Place the samples in the freezer or ice chest until they are ready to be tested, and then remove packages from the freezer one at a time.

- 2. According to the type of novelty, prepare the sample products as follows:
  - ➤ Ice-pop. Mark on the stick(s) with the indelible marker the point to which the pop will be submerged in the ice water. (After the ice-pop contents have been submerged, remove the novelty to determine the volume of the stick.)
  - Cone. Make a small hole in the cone below the ice cream portion to allow air to escape.
  - Sandwich. Determine whether the declared volume is (a) the total volume of the novelty (that is, including the cookie portion) or (b) the volume of the ice-cream-like portion only. If the declared volume is the volume of only the ice-cream-like portion, shave off the cookie with a razor or knife, leaving some remnants of cookie to ensure that no ice cream is accidentally shaved off. Work quickly, and return the novelty to the freezer before the sandwich softens.
  - Cup. Remove the cap from the cup. (After the cup and novelty contents have been submerged, remove the novelty from the cup to determine the volume of the cup.)

#### How is it determined if the ice cream novelty packages meet the requirements in this handbook?

- 1. Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following procedure to determine lot compliance.
- 2. Fill the displacement vessel with ice water until it overflows the spout. Allow it to sit until dripping stops. Raise the displacement vessel as necessary and place the graduate beneath the spout.
- 3. Remove a package from the freezer, determine its gross weight and record it.
- 4. Submerge the novelty as suggested until it is below the surface level of the water.
  - ➤ Ice-pop. Use a clamp, tongs, or your fingers to hold the stick(s) and submerge the pop to the level marked in Step 2 of the Test Procedures.
  - Cone. Shape the wire into a loop, and use it to push the cone, headfirst (ice cream portion first) into the ice water. Do not completely submerge the cone immediately: let water fill the cone through the hole made in Step 2 of the Test Procedures before completely submerging the novelty.
  - Sandwich or cup. Skewer the novelty with the thin wire or form a loop on the end of the wire to push the sandwich or ice-cream-portion or cup completely below the liquid level.
- 5. Record the total water volume in the graduate. For a cone or sandwich, record the water volume as the net volume and go to step (7). For ice-pops or cups, record the water volume in the graduate as the gross volume and go to step (6).
- 6. Refill the displacement vessel with water to overflowing and reposition the empty graduate under the spout.
  - ➤ Ice-pop. Melt the ice pop off the stick or sticks. Submerge the stick or sticks to the line marked in step (4). Record the volume of tare material (i.e., stick) by measuring the water displaced into the graduate. The net volume for the ice-pop is the gross volume recorded in step (5) minus the volume of the tare materials in this step. Record this volume as the "volume of novelty." To determine the error in the package, subtract the labeled quantity from the volume of novelty.
  - > Cup. Remove the novelty from the cup. Rinse the cup, and then submerge it in the displacement vessel. Small pinholes in the base of the cup can be made to make submersion easier. Record the volume of water displaced into the graduate by the cup as the volume of tare material. The net volume for the novelty is the gross volume determined in step (5) minus the volume of the tare materials determined in

this step. Record this as the net volume of the novelty. To determine the error in the package, subtract the labeled quantity from the volume of novelty.

- 7. Clean and air-dry the tare materials (sticks, wrappers, cup, lid, etc.). Weigh and record the weight of these materials for the package.
- 8. Subtract the tare weight from the gross weight to obtain the net weight and record this value.
- 9. Compute the weight of the labeled volume for the package using the following formula and then record the weight:

Product Density = (weight in item 3) ÷ (the total water volume in item 5) Weight of labeled volume = (labeled volume) x (Product Density)

- 10. Repeat steps (3) through (9) for a second package.
- 11. If the weight of the labeled volume in steps (9) and (10) differ from each other by more than one division on the scale, the gravimetric test procedure cannot be used to test the sample for compliance. If this is the case, steps (2) through (6) for each of the remaining packages in the sample must be used to determine their net volumes and package errors. Then go to evaluation of results.

# How is "nominal gross weight" determined?

- 1. Determine the Average Used Dry Tare Weight of the sample according to provisions in Chapter 2, Section 2.3.
- 2. Using the weights determined in step (11) calculate the Average Product Weight by adding the densities of the liquid from the two packages and dividing the sum by two.
- 3. Calculate the "nominal gross weight" using the formula:

Nominal Gross Weight = Average Product Weight + Average Used Dry Tare Weight

#### How are the errors in the sample determined?

- 1. Weigh the remaining packages in the sample.
- 2. Subtract the nominal gross weight from the gross weight of each package to obtain package errors in terms of weight.

**Note:** Compare the sample packages to the nominal gross weight.

3. Follow the Basic Test Procedure in Section 2.3.

To convert the average error or package error from weight to volume, use the following formula:

Package Error in Volume = (Package Error in Weight) ÷ (Product Density)

#### **Evaluation of Results**

Follow the procedures in Chapter 2, Section 2.3., Evaluating Results to determine lot conformance.

#### 3.13 Fresh Oysters Labeled by Volume

#### What requirements apply to packages of fresh oysters labeled by volume?

Packaged fresh oysters removed from the shell must be labeled by volume. The maximum amount of permitted free liquid is limited to 15 % by weight. Testing the quantity of contents of fresh oysters requires the inspector to determine total volume, total weight of solids and liquid, and the weight of the free liquid.

# **Equipment**

- A scale that meets the requirements in Chapter 2, Section 2.2 Measurement Standards and Test Equipment
- Volumetric measures
- Micrometer depth gage (ends of rods fully rounded), 0 mm to 228 mm (0 in to 9 in)
- Strainer for determining the amount of drained liquid from shucked oysters. Use as a strainer a flat bottom metal pan or tray constructed to the following specifications:
  - > Sides: 5.08 cm (2 in)
  - Area:  $1,935 \text{ cm}^2 (300 \text{ in}^2)$  or more for each 3.78 L (1 gal) of oysters
  - Perforations:

Diameter: 6.35 mm (1/4 in)

Location: 3.17 cm (1 1/4 in) apart in a square pattern, or perforations of equivalent area and

distribution.

- Spanning bar, 2.54 cm by 2.54 cm by 30.48 cm (1 in by 1in by 12 in)
- Rubber spatula
- Level, at least 15.24 cm (6 in) in length
- Stopwatch

# How is it determined if the containers meet the package requirements?

Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then, use the following test procedure to determine lot compliance.

- 1. Determine and record the gross weight of a sample package.
- 2. Set the container on a level surface and open it. Use a depth gage to determine the level of fill. Lock the depth gauge. Mark the location of the gauge on the package.
- 3. Weigh a dry 20.32 cm or 30.48 cm (8 in or 12 in) receiving pan and record the weight. Set strainer over the receiving pan.
- 4. Pour the contents from the container onto the strainer without shaking it. Tip the strainer slightly and let it drain for 2 minutes. Remove strainer with oysters. It is normal for oysters to include mucous (which is part of the

product) that will not pass through the strainer, so do not force it.

- 5. Weigh the receiving pan and liquid and record the weight. Subtract the weight of the dry receiving pan from the weight of pan and liquid to obtain the weight of free liquid and record the value.
- 6. Clean, dry, and weight the container and record the tare weight. Subtract the tare weight from the gross weight to obtain the total weight of the oysters and liquid and record this value.
- 7. Determine and record the percent of free liquid by weight as follows:

Percent of free liquid by weight = [(weight of free liquid) ÷ (weight of oysters + liquid)] x 100.

8. Set up the depth gauge on the dry package container as in step 2. Pour water from the flasks and graduate as needed to re-establish the level of fill obtained in step 2. Add the volumes delivered as the actual net volume for the container and record the value.

**Note:** Some containers will hold the declared volume only when filled to the brim; they may have been designed for other products, rather than for oysters. If the net volume is short-measure (per step 8), determine if the container will reach the declared volume only if filled to the brim. Under such circumstance, the package net volumes will all be short measure because the container cannot be filled to the brim with a solid and liquid mixture. A small headspace is required in order to get the lid into the container without losing any liquid.

#### **Evaluation of Results**

Follow the procedures in "Evaluating Results" in Chapter 2, Section 2.3, to determine lot conformance.

#### 3.14 Determining the Net Contents of Compressed Gas in Cylinders

#### What type of compressed gases may be tested with these procedures?

These procedures are for industrial compressed gas. Compressed gas may be labeled by weight (for example, Liquefied Petroleum [LP] gas, or carbon dioxide) or by volume. Acetylene, liquid; oxygen, nitrogen, nitrous oxide, and argon are all filled by weight. Acetylene is sold by liters or by cubic feet. Helium, gaseous oxygen, nitrogen, air, and argon are filled according to pressure and temperature tables.

#### What type of test procedures must be used?

Checking the net contents of compressed gas cylinders depends on the method of labeling; those labeled by weight are generally checked by weight. Cylinders filled by using pressure and temperature charts must be tested using a pressure gauge that is connected to the cylinder. Determine the volume using the pressure and temperature of the cylinder.

# Should any specific safety procedures be followed?

Yes, be aware of the hazards of the high pressure found in cylinders of compressed gas. An inspector should handle compressed gas only if the inspector has been trained and is knowledgeable regarding the product, cylinder, fittings, and proper procedures (see *Compressed Gas Association [CGA] pamphlet P-1, "Safe Handling of Compressed Gases in Containers,"* for additional information). Additional precautions that are necessary for personal safety are described in the CGA Handbook of Compressed Gases. All personnel testing compressed gases should have this manual for reference and be familiar with its contents. It is essential that the inspector be certain of the contents before connecting to the cylinder. Discharging a gas or cryogenic liquid through a system for which the material is not intended could result in a fire and/or explosion or property damage due to the incompatibility of the system and the product. Before connecting a cylinder to anything, be certain of the following:

• Always wear safety glasses.

- The cylinder is clearly marked or labeled with the correct name of the contents and that no conflicting marks or labels are present. Do not rely on the color of the cylinder to identify the contents of a cylinder. Be extremely careful with all gases because some react violently when mixed or when coming in contact with other substances. For example, oxygen reacts violently when it comes in contact with hydrocarbons.
- The cylinder is provided with the correct Compressed Gas Association (CGA) connection(s) for the product. A proper connection will go together smoothly; so excessive force should not be used. Do not use an adapter to connect oxygen to non-oxygen cleaned equipment. When a cylinder valve is opened to measure the internal pressure, position the body away from the pressure gauge blowout plug or in front of the gauge if the gauge has a solid cast front case. If the bourdon tube should rupture, do not be in a position to suffer serious injuries from gas pressure or fragments of metal.
- Thoroughly know the procedure and place emphasis on safety precautions before attempting any tests. Do not use charts referred to in the procedure until the necessary training has been completed. When moving a cylinder, always place the protective cap on the cylinder. Do not leave spaces between cylinders when moving them. This can lead to a "domino" effect if one cylinder is pushed over.
- Open all valves slowly. A failure of the gauge or other ancillary equipment can result in injuries to nearby persons. Remember that high gas pressure can propel objects with great force. Gas ejected under pressure can also cause serious bodily injuries if someone is too close during release of pressure.
- One of the gauges will be reserved for testing oxygen only and will be prominently labeled "For Oxygen Use Only." This gauge must be cleaned for oxygen service and maintained in that "clean" condition. The other gauge(s) may be used for testing a variety of gases if they are compatible with one another.
- Observe special precautions with flammable gas in cylinders in addition to the several precautions necessary for the safe handling of any compressed gas in cylinders. Do not "crack" cylinder valves of flammable gas before connecting them to a regulator or test gauge. This is extremely important for hydrogen or acetylene.

#### What type of measurement equipment is needed to test cylinders of compressed gas?

- Use a scale that meets the requirements in Chapter 2, Section 2.2 Measurement Standards and Test Equipment. Use a wooden or non-sparking metal ramp to roll the cylinders on the scale to reduce shock loading.
- Two calibrated precision bourdon tube gauges or any other approved laboratory-type pressure-measuring device that can be accurately read within plus or minus 40 kPa (5 psi). A gauge having scale increments of 200 kPa (25 psi) or smaller shall be considered as satisfactory for reading within plus or minus 40 kPa (5 psi). The range of both gauges shall be a minimum of 0 kPa to 23 MPa (0 psi to 5 000 psi) when testing cylinders using standard industrial cylinder valve connections. These standardized connections are listed in "CGA Standard V-1, Standard for Compressed Gas Cylinder Valve Outlet and Inlet for use with Gas Pressures up to 21 MPa (3 000 psi)." For testing cylinders with cylinder valve connections rated for over 21 MPa (3 000 psi), the test gauge and its inlet connection must be rated at 14 MPa (2 000 psi) over the maximum pressure that the connection is rated for in CGA V-1. Note: there are standard high-pressure industrial connections on the market that are being used up to their maximum pressure of 52 MPa (7 500 psi).

**Note**: Any gauge or connectors used with oxygen cylinders must be cleaned for oxygen service, transported in a manner which will keep them clean, and never used for any other gas including air or oxygen mixtures. Oxygen will react with hydrocarbons and many foreign materials that may cause a fire or explosion.

An approved and calibrated electronic temperature measuring device or three calibrated mercury-in-glass
thermometers having either a digital readout or scale division of no more than 1 °F (0.5 °C). The electronic
device equipped with a surface temperature sensor is preferred over a mercury-in-glass thermometer because
of its shorter response time.

- Two box-end wrenches of 29 mm (1 1/8 in) for oxygen, nitrogen, carbon dioxide, argon, helium, and hydrogen and 22 mm (7/8 in) for some sizes of propane. All industrial CGA connections are limited to these two hex sizes. Avoid using an adjustable wrench because of the tendency to round the edges of the fittings, which can lead to connections not being tightened properly.
- Use a separate gauge and fitting for each gas to be tested. If adapters must be used, do not use on oxygen systems.

# Test Procedure for Cylinders Labeled by Weight

# How is it determined if the containers meet the package requirements using the gravimetric test procedure?

- 1. Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following test procedure to determine lot compliance.
- 2. The cylinder should be marked or stenciled with a tare weight. The marked value may or may not be used by the filling plant when determining the net weight of those cylinders sold or filled by weight. If there is a tare weight marked on the net contents tag or directly on the cylinder, then an actual tare weight was determined at the time of fill. If there is no tare weight marked on a tag or on the cylinder, then the stamped or stenciled tare weight is presumed to have been used to determine the net contents.

**Note:** Check the accuracy of the stamped tare weights on empty cylinders whenever possible. The actual tare weight must be within (a) 1/2 % of the stamped tare weight for 9.07 kg (20 lb) tare weights or less or (b) 1/4 % of the stamped tare weight for greater than 9.07 kg (20 lb) tare weights. (See NIST Handbook 130, Section 2.16, "Method of Sale Regulation.")

3. Place cylinder on scale and remove protective cap. The cap is not included in the tare weight.

Weigh the cylinder and determine net weight, using either the stamped or stenciled tare weight, or the tare weight marked on the tag. Compare actual net weight with labeled net weight, or use the actual net weight to look up the correct volume declaration (For Acetylene Gas), and compare that with the labeled volume.

**Note:** The acetone in acetylene cylinders is included in the tare weight of the cylinder. Therefore, as acetylene is withdrawn from the cylinder, some acetone will also be withdrawn, changing the tare weight.

Most producers will replace acetone in the cylinder before the cylinder is refilled, filling the cylinder with acetone to the stamped tare weight. Other producers, although not following recommended procedures, do not replace the acetone until it drops to a predetermined weight. In the latter situation, the refilling plant must note the actual tare weight of the cylinder and show it on the tag containing the net content statement or on the cylinder itself. Refer to tables for acetylene if necessary (if the acetylene is labeled by volume).

#### **Test Procedure for Cylinders Labeled by Volume**

# How is it determined if the containers meet the package requirements using the volumetric test procedure?

- 1. Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following test procedure to determine lot compliance.
- 2. Determine the temperature of the cylinders in the sample. Place the thermometer approximately halfway up a cylinder in contact with the outside surface. Take the temperature of three cylinders selected at random and use the average temperature of the three values.
- 3. Using the appropriate pressure gauge, measure the pressure of each cylinder in the sample.
- 4. Determine the cylinder nominal capacity from cylinder data tables or from the manufacturer. (These tables must be obtained in advance of testing.)

- 5. Using NIST Technical Note 1079 "Tables of Industrial Gas Container Contents and Density for Oxygen, Argon, Nitrogen, Helium, and Hydrogen" determine the value (SCF/CF) from the content tables at the temperature and pressure of the cylinder under test.
- 6. Multiply the cylinder nominal capacity by the value (SCF/CF) obtained from the content tables. This is the actual net quantity of gas.
- 7. Subtract the labeled net quantity from the actual net quantity to determine the error.

# **Evaluation of Results**

Follow the procedures in "Evaluating Results" in Chapter 2, Section 2.3 to determine lot conformance.

# 3.15 Volumetric Test Procedure for Packaged Firewood with a Labeled Volume of 113 L (4 Ft<sup>3</sup>) or Less

#### How are packages of firewood tested?

Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample, then use the test procedure provided in Section 3.17 to determine lot compliance.

# **Equipment**

- Linear Measure. Take all measurements in increments of 0.5 cm (3/16 in) or less and round up.
- Binding Straps. Binding Straps are used to hold wood bundles together if the bundles need to be removed from the package/wrapping material.

# How is it determined if the containers meet the package requirements?

Unless otherwise indicated, take all measurements without rearranging the wood or removing it from the package. If the layers of wood are crosshatched or not ranked in discrete sections in the package, remove the wood from the package re-stack and measure accordingly.

#### 3.16 Boxed Firewood

# How is the volume of firewood contained in a box determined?

Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following test procedure to determine lot conformance.

1. Open the box to determine the average height of wood within the box; measure the internal height of the box. Take three measurements (record as " $d_1$ ,  $d_2$ ...etc.") along each end of the stack. Measure from the bottom of a straight edge placed across the top of the box to the highest point on the two outermost top pieces of wood and the center-most top piece of wood. Round measurements down to the nearest 0.5 cm (1/8 in). If pieces are obviously missing from the top layer of wood, take additional height measurements at the highest point of the uppermost pieces of wood located at the midpoints between the three measurements on each end of the stack. Calculate the average height of the stack by averaging these measurements and subtracting from the internal height of the box according to the following formula.

Average Height of Stack = (Internal Height of Box) – (sum of measurements) ÷ (number of measurements)

2. Determine the average width of the stack of wood in the box by taking measurements at three places along the top of the stack. Measure the inside distance from one side of the box to the other on both ends and in the middle of the box. Calculate the average width.

Average Width = 
$$(W_1 + W_2 + W_3) \div (3)$$

3. To determine the average length of the pieces of wood, remove the wood from the box and select the five pieces with the greatest girth. Measure the length of each of the five pieces from center-to-center. Calculate the average length of the five pieces.

Average Length = 
$$(L_1 + L_2 + L_3 + L_4 + L_5) \div (5)$$

4. Calculate the volume of the wood within the box. Use dimensions for height, width, and length.

Volume in liters = (height in cm x width in cm x length in cm)  $\div$  (1 000)

Volume in cubic feet = (height in inches x width in inches x length in inches)  $\div$  (1 728)

5. For boxes of wood that are packed with the wood ranked in two discrete sections perpendicular to each other, calculate the volume of wood in the box as follows: (1) determine the average height, width, and length as in 1, 2 and 3 above for each discrete section, compute total volume, and (2) total the calculated volumes of the two sections. Take the width measurement for Volume 2 (V<sub>2</sub>) from the inside edge of the box adjacent to V<sub>2</sub> to the plane separating V<sub>1</sub> and V<sub>2</sub>. Compute total volume by adding Volume 1 (V<sub>1</sub>) and V<sub>2</sub> according to the following formula.

Total Volume = 
$$V_1 + V_2$$

6. Follow the procedures in Chapter 2, Section 2.3., Evaluating Results to determine lot conformance.

#### 3.17 Crosshatched Firewood

# How must the volume of stacked or crosshatched firewood be measured?

Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; and use the following test procedure to determine lot compliance.

- 1. Stack the firewood in a ranked and well-stowed geometrical shape that facilitates volume calculations (i.e., rectangular). The number of measurements for each dimension given below is the minimum that should be taken.
- 2. Determine the average measurements of the stack:
  - ➤ Height: Start at one end of the stack; measure the height of the stack on both sides at four equal intervals. Calculate and record the average height.
  - Length: Start at the base of the stack; Measure the length of the stack in four equal intervals. Calculate and record the average length.
  - Width: Select the five pieces with the greatest girth. Measure the length of the pieces, calculate and record the average piece length. (3)

Calculate Volume:

Volume in liters = (Avg. Height [cm] x Avg. Width [cm] x Avg. Length in [cm]) ÷ 1 000

Volume in cubic feet = (Avg. Height [in] x Avg. Width [in] x Avg. Length [in]) ÷ 1 728

3. Follow the procedures in Chapter 2, Section 2.3., Evaluating Results to determine lot conformance.

#### 3.18 Bundles and Bags of Firewood

# How is the volume of bundles and bags of firewood measured?

Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following test procedure to determine lot compliance.

- 1. Average area of ends: secure a strap around each end of the bundle or bag of wood to prevent movement during testing and to provide a definite perimeter. Use two or more straps to secure the wood.
- 2. Set one end of the bundle or bag on tracing paper large enough to cover the end completely. Draw a line around the perimeter of the bundle or bag on the tracing paper.
- 3. Transfer the tracing paper to a template graduated in square centimeters or square inches. Count the number of square centimeters or square inches that are enclosed within the perimeter line. Estimate portions of square centimeters or square inches not completely within the perimeter line to the nearest one-quarter square inch.
- 4. Repeat this process on the opposite end of the bundle or bag.
- 5. Calculate the Average Area.

Average Area = 
$$(Area 1 + Area 2) \div 2$$

6. Average length of the pieces of wood: select the five pieces with the greatest girth and measure the length of the pieces. Calculate the average length of the pieces of wood:

Average Length = 
$$(L_1 + L_2 + L_3 + L_4 + L_5) \div 5$$

# 7. Calculate Volume:

Volume in liters = (Average Area [cm $^2$ ] x Average Length [cm])  $\div 1000$ 

Volume in cubic feet = (Average Area [in²] x Average Length [in]) ÷ 1 728

# **Evaluation of Results**

Follow the procedures in Chapter 2, Section 2.3., Evaluating Results to determine lot conformance.

**Note:** Specified in Table 2-10., Appendix A, maximum allowable variations for individual packages are not applied to packages of firewood.

# Chapter 4. Test Procedures – Packages Labeled by Count, Linear Measure, Area, Thickness, and Combinations of Quantities

## 4.1 Scope

#### What types of packaged goods can be tested using these procedures?

Use these procedures to determine the net contents of products sold by count, area, thickness, and linear measure. If a package includes more than one declaration of quantity, each declaration must meet the package requirements.

# Can the gravimetric test procedure be used to verify the net quantity of contents of packages labeled by count and linear measure?

Use the gravimetric procedure to test products sold by measure or count if the density of the product does not vary excessively from one package to another.

#### What procedures may be used if the gravimetric test procedure cannot be used?

Open each package in the sample and measure or count the items.

# 4.2 Packages Labeled by Count

#### How are packages tested labeled by count?

If the labeled count, is 50 items or less, use Section 4.3. If the labeled count is, more than 50 items see Section 4.4.

#### Can a gravimetric test procedure be used to verify the labeled count of a package?

Yes, if the scale being used is sensitive enough to determine the weight of individual items. Use the following procedures to determine if the sample packages can be tested gravimetrically.

- 1. For packages labeled with a count of 84 or higher, calculate the weight equivalent for the MAV/6 for the labeled count of the package. MAV/6 must be at least equal to one-half scale division on a mechanical scale or one division on a digital scale.
- 2. For packages with a labeled count of 83 or fewer, when each unit weighs at least 2 scale divisions, consider the scale acceptable.

**Example:** According to Table 2-7., in Appendix A, the MAV is 7 for a package labeled with a count of 250 items. The scale should be capable of measuring differences corresponding to MAV/6 or, in this example, the weight of one item.

- > If the scale meets the appropriate requirement, gravimetric testing can be used to determine package count or,
- If the scale does not meet the criteria, count the content in each package in the sample.

# 4.3 Packages Labeled with 50 Items or Less

#### **Test Procedure**

- 1. Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following test procedure to determine lot compliance.
- 2. Open the packages and count the number of items in each. Record the number of packages that contain less than the labeled count.

#### **Evaluation of Results**

- 1. For the sample size indicated in Column 1 of Table 2-11., Accuracy Requirements for Packages Labeled by Low Count of (50 or less), refer to Column 2 to determine the number of packages that are allowed to contain less than the labeled count.
- 2. If the number of packages in the sample that contain less than the labeled count exceeds the number permitted in Column 2, the sample and the lot fail to meet the package requirement.

**Note:** For statistical reasons, the average requirement does not apply to packages labeled by count of 50 or fewer items, and the MAV does not apply to the lot. It only applies to the packages in the sample.

3. Maximum Allowable Variations: The MAVs listed in Table 2-7., MAVs for Packages Labeled by Count define the limits of reasonable variation for an individual package even though the MAV is not directly used in the sampling plan. Individual packages that are undercount by more than the MAV are considered defective. Even if the sample passes, these should be repacked, relabeled, or otherwise handled.

**Example:** If testing a lot of 160 packages of pencils labeled "50 pencils," choose a random sample of 12 packages from the lot. If the scale cannot discriminate between differences in count, open every package and count the pencils. For example, assume the 12 package counts are: 50, 52, 50, 50, 51, 53, 52, 50, 50, 50, 47, and 50.

Because only one package contains fewer than 50 pencils, the sample passes the test (Refer to Table 2-11.). However, the package containing 47 pencils should not be introduced into commerce even though the lot complies with the package requirements because it is undercount by more than the MAV (1 item) permitted in Table 2-7.

#### 4.4 Packages Labeled by Count of More than 50 Items

# **Test Procedures**

There are two procedures to determine count without opening all packages in the sample. Both use the weight of a counted number of items in the package. If the weight of discrete items or numbers of items in a package varies, the packaged items must be counted rather than weighed.

# **Equipment**

Use a scale that meets the requirements in Chapter 2, Section 2.2, Measurement Standards and Test Equipment.

#### **Audit Procedure**

Use this procedure to audit lots of packages labeled by count of more than 50 items, but the precision of this procedure is only  $\pm$  1 %. Determine the lot compliance based on actual count or the violation procedure.

- 1. Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following test procedure to determine lot compliance.
- 2. Select an initial tare sample according to Chapter 2, Section 2.3.
- 3. Gross weigh the first package in the tare sample and record this weight.
- 4. Select the number of items from the first tare package that weighs the greater:
  - > 10 % of the labeled count; or
  - > a quantity equal to at least 50 minimum divisions on the scale.

**Example:** Using a scale with 1 g divisions, the selected count must weigh at least 50 grams. If a scale with 0.001 lb divisions is used, the selected count must weigh at least 0.05 lb. Record the count and weight.

5. Calculate the weight of the labeled count using the following formula:

Weight of the Labeled Count = (labeled count x weight of items in step [4])  $\div$  (count of items in step [4])

Record the result as "labeled count weight."

- 6. Gross weigh the remaining packages of the tare sample and keep contents of opened packages separated in case all of the items must be counted.
- 7. Determine the Average Used Dry Tare Weight of the sample according to Chapter 2, Section 2.3.
- 8. The weight of the labeled count plus the average tare weight represents the "nominal gross weight."
- 9. Subtract the nominal gross weight from the gross weight of the individual packages and record the errors.

(Package error [weight]) = (actual package gross weight) (nominal gross weight)

10. Convert the package errors in units of weight to count:

Package error (count) = (Package error [weight] x labeled count) ÷ (labeled count weight)

Round any fractional counts up to whole items in favor of the packager. Record the package error in units of count. Compute the average error.

- If the average error is minus, go to the "procedure to use if the inspector suspects the lot violates the package requirements" below
- If the average error is zero or positive, the sample is presumed to conform to the package requirements.

# Procedures to use if the inspector suspects the lot violates the package requirements

If possible, use the gravimetric procedure to determine compliance. To minimize the number of packages to be opened, combine the measurement of the weight of the number of units in the package with the determination of tare.

Therefore, it will not be necessary to open more packages than the tare sample. If the audit procedure in this section has been used, the possible violation procedure below can be followed with the same sample if package contents have been kept separate and can still be counted. Use the following steps to determine if the sample passes or fails.

- 1. Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following test procedure to determine lot compliance. Use a scale that meets the criteria specified in 4.2.
- 2. Select an initial tare sample according to Chapter 2, Section 2.3.
- 3. Gross weigh the packages selected for the tare sample and record these weights. Open these packages and determine the tare and net weights of the contents, and count the exact number of items in the packages. Record this information.
- 4. Calculate and record the weights of the labeled counts for the first two packages using the formula:

Weight of labeled count = (labeled count) x (contents weight  $\div$  contents count)

To avoid round off errors, carry at least two extra decimal places in the calculation until the weight of the labeled count is obtained. To use the gravimetric procedure, the difference in weights of the labeled counts of the two packages must not exceed one scale division.

- If the difference in weights exceeds this criterion, determine the actual count per package for every package in the sample recording plus and minus errors. Then, follow the procedures in "Evaluating Results" in Chapter 2, Section 2.3, to determine lot conformance.
- If the difference is within the criterion, average the weights of the labeled count and go on to step (5).
- 5. Determine the Average Used Dry Tare Weight of the sample according to provisions in Chapter 2, Section 2.3.
- 6. Determine and record the nominal gross weight by adding the average weight of the labeled count of items in the package step (4) to the average tare weight step (5).
- 7. Weigh the remaining packages in the sample, subtract the nominal gross weight from the gross weight of the individual packages, and record the errors.

Package Error (weight) = (Actual Package Gross Weight) (Nominal Gross Weight)

8. Look up the MAV for the package size from Table 2-7. and convert it to weight using the formula:

MAV (weight) = (MAV (count) x Avg. Wt. of Labeled Count step [4]) ÷ (Labeled Count)

Convert the MAV to dimensionless units by dividing the MAV (weight) by the unit of measure and record.

#### **Evaluation of Results**

Follow the procedures in Chapter 2, Section 2.3., Evaluation Results to determine lot conformance.

Convert back to count when completing the report form using the following formula:

Avg. Pkg. Error (count) = (Avg. Pkg. Error [dimensionless units]) x (Unit of Measure) x (Labeled Count) ÷ (Avg. Weight of Labeled Count.)

#### 4.5 Paper Plates and Sanitary Paper Products

#### How are the labeled dimensions of paper plates and sanitary paper products verified?

Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following procedure to determine lot compliance.

The following procedures are used to verify the size of paper plates and other products. The following procedure may be used to verify the size declarations of other disposable dinnerware.

**Note:** Do not distort the item's shape during measurement.

The count of sanitary paper products cannot be adequately determined by weighing. Variability in sheet weight and core weight requires that official tests be conducted by actual count. However, weighing can be a useful audit method. These products often declare total area as well as unit count and sheet size. If the actual sheet size measurements and the actual count comply with the average requirements, the total area declaration is assumed correct.

# **Equipment**

 Steel tapes and rules. Determine measurements of length to the nearest division of the appropriate tape or rule.

#### Metric Units:

For labeled dimensions 40 cm or less, Linear Measure: 30 cm in length, 1 mm divisions; or a 1 m rule with 0.1 mm divisions, overall length tolerance of 0.4 mm.

For labeled dimensions greater than 40 cm, 30 m tape with 1 mm divisions.

# ➤ Inch pound Units:

For labeled dimensions 25 in or less, use a 36 in rule with 1/64 in or 1/100 in divisions and an overall length tolerance of 1/64 in.

For dimensions greater than 25 in, use a 100 ft tape with 1/16 in divisions and an overall length tolerance of 0.1 in.

# • Measuring Base

**Note:** A measuring base may be made of any flat, sturdy material approximately 38 cm (15 in) square. Two vertical side pieces approximately 3 cm (1 in) high and the same length as the sides of the measuring base are attached along two adjoining edges of the measuring base to form a 90° corner. Trim all white borders from two or more sheets of graph paper (10 divisions per centimeter or 20 divisions per inch). Place one sheet on the measuring base and position it so that one corner of graph paper is snug in the corner of the measuring base and vertical sides. Tape the sheet to the measuring base. Overlap other sheets on the first sheet so that the lines of top and bottom sheet coincide, expanding the graph area to a size bigger than plates to be measured; tape these sheets to the measuring base. Number each line from the top and left side of base plates: 1, 2, 3, etc.

#### How are paper products inspected?

- 1. Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following test procedure to determine lot compliance.
- 2. Select an initial tare sample according to Chapter 2, Section 2.3.
- 3. Open each package and select one item from each.

**Note:** Some packages of plates contain a combination of different-sized plates. In this instance, take a plate of each declared size from the package to represent all the plates of that size in the package. For example, if three sizes are declared, select three different plates from each package.

#### How are paper products measured?

**Note:** Occasionally, packages of plates declared to be one size contain plates that can be seen by inspection to be of different sizes in the same package. In this instance, select the smallest plate and use the methods below to determine the package error. If the smallest plate is not short measure by more than the MAV, measure each size of plate in the package and calculate the average dimensions.

**Example:** If 5 plates measure 21.41 cm (8.43 in) and 15 measure 21.74 cm (8.56 in), the average dimension for this package of 20 plates is 21.66 cm (8.53 in).

- 4. For paper plates: place each item on the measuring base plate (or use the linear measure) with the eating surface down so two sides of the plate touch the sides of the measuring base. For other products, use either the measuring base or a linear measure to determine actual labeled dimensions (e.g., packages of napkins, rolls of paper towels). If testing folded products, be sure that the folds are pressed flat so that the measurement is accurate.
- 5. If the measurements reveal that the dimensions of the individual items vary, select at least 10 items from each package. Measure and average these dimensions. Use the average dimensions to determine package error in step 5 below.
- 6. The package error equals the actual dimensions minus the labeled dimensions.

#### **Evaluation of Results**

Follow the procedures in Chapter 2, Section 2.3., Evaluating Results to determine lot conformance.

#### 4.6 Special Test Requirements for Packages Labeled by Linear or Square Measure (Area)

#### Are there special measurement requirements for packages labeled by dimensions?

Yes, products labeled by length (such as yarn) or area often requires the application of tension to the ends of the product in order to straighten the product before measuring. When testing yarn and thread apply tension and use the specialized equipment specified in ASTM D 1907-97, "Standard Test Method for Linear Density of Yarn (Yarn Number) by the Skein Method," in conjunction with the sampling plans and package requirements described in this handbook.

#### **Evaluation of Results**

Follow the procedures in Chapter 2, Section 2.3., Evaluating Results to determine lot conformance.

#### 4.7 Polyethylene Sheeting

#### Which procedures are used to verify the declarations on polyethylene sheeting and bags?

Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following test procedure to determine lot compliance.

**Note:** Most polyethylene products are sold by length, width, thickness, area, and net weight.

#### **Equipment**

- A scale that meets the requirements in Chapter 2, Section 2.2., Measurement Standards and Test Equipment.
- Steel measuring tapes and rules as specified in 4.5.
- Deadweight dial micrometer (or equal) equipped with a flat anvil, 6.35 mm or (1/4 in) diameter or larger, and a 4.75 mm (3/16 in) diameter flat surface on the head of the spindle. The anvil and spindle head surfaces should be ground and lapped, parallel to within 0.002 mm (0.0001 in), and should move on an axis perpendicular to their surfaces. The dial spindle should be vertical, and the dial should be at least 50.8 mm (2 in) in diameter. The dial indicator should be continuously graduated to read directly to 0.002 mm (0.00-01 in) and should be capable of making more than one revolution. It must be equipped with a separate indicator to indicate the number of complete revolutions. The dial indicator mechanism should be fully jeweled. The frame should be of sufficient rigidity that a load of 1.36 kg (3 lb) applied to the dial housing, exclusive of the weight or spindle presser foot, will not cause a change in indication on the dial of more than 0.02 mm (0.001 in). The indicator reading must be repeatable to 0.001 2 mm (0.000 05 in) at zero. The mass of the probe head (total of anvil, weight 102 g or [3.6 oz], spindle, etc.) must be 113.4 g (4 oz). The micrometer should be operated in an atmosphere free from drafts and fluctuating temperature and should be stabilized at ambient room temperature before use.
- Gage blocks covering the range of thicknesses to be tested should be used to check the accuracy of the micrometer
- T-square

#### **Test Procedure**

- 1. Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following test procedure to determine lot compliance.
- 2. Be sure the product is not mislabeled. Check the label declaration to confirm that all of the declared dimensions are consistent with the required standards. The declaration on sheeting, film, and bags shall be equal to or greater than the weight calculated by using the formulas below. Calculate the final value to four digits and declare to three digits dropping the final digit (e.g., if the calculated value is 2.078 lb, then the declared net weight is truncated to 2.07 lb).

# **Example Label:**

# **Polyethylene Sheeting**

1.82 m (6 ft) x 30.48 m (100 ft)

101.6 µm (4 mil)

5.03 kg (11.1 lb)

- 3. Use the following formulas to compute a target net weight. The labeled weight should equal or exceed the target net weight or the package is not in compliance.
  - For metric dimensions:

Target Mass in Kilograms =  $(T \times A \times D) \div 1,000$ 

Where: T = nominal thickness in centimeters

A = nominal length in centimeters x nominal width (the nominal width for bags is twice the labeled width) in centimeters

D = density in grams per cubic centimeter\*

For inch-pound dimensions:

Target Weight in Pounds =  $T \times A \times D \times 0.03613$ 

Where: T = nominal thickness in inches;

A = nominal area; that is the nominal length in inches x nominal width (the nominal width for bags is twice the labeled width) in inches;

D = density in grams per cubic centimeter; 0.036 13 is a factor for converting  $^g/_{cm^3}$  to  $^{lb}/_{in^3}$ .

\*Determined by ASTM Standard D 1505-98, "Standard Method of Test for Density of Plastics by the Density Gradient Technique." For the purpose of this handbook, the minimum density shall be 0.92 g/cm<sup>3</sup> when the actual density is not known.

#### **Evaluation**

1. Perform the calculations as shown in the following samples. If the product complies with the label declaration, go to step (2).

Sample Calculations

For metric units:

 $\begin{array}{l} (0.010\ 16\ cm\ x\ [(1.82\ m\ x\ 100\ ^{cm}/_{m})\ x\ (30.48\ m\ x\ 100\ ^{cm}/_{m})]\ x\ 0.92\ ^{g}/_{c\,m^{\,3}})\ \div\ 1,000\ ^{g}/_{k\,g} \\ =\ a\ target\ net\ mass\ of\ 5.18\ kg \end{array}$ 

at one end and along the length on one side of the In this example, the labeled net mass of 5.03 kg does not meet the target net mass, so the product is not in compliance.

For inch-pound units:

$$(0.004 \text{ in}) \times [(6 \text{ ft x } 12^{\text{in}}/_{\text{ft}}) \times (100 \text{ ft x } 12^{\text{in}}/_{\text{ft}})] \times 0.92^{\text{g}}/_{\text{cm}^3} \times 0.03613 = \text{a target net weight of } 11.48 \text{ lb}$$

In this example, the labeled net weight of 11.1 lb does not meet the target net weight, so the product is not in compliance.

- 2. Select packages for tare samples. Determine and record the gross weights of the initial tare sample.
- 3. Extend the product in the sample packages to their full dimensions and remove by hand all creases and folds.
- 4. Measure the length and width of the product to the closest 3 mm (1/8 in). Make all measurements at intervals uniformly distributed along the length and width of the sample and record the results. Compute the average length and width, and record.
  - With rolls of product, measure the length of the roll at three points along the width of each roll and measure the width at a minimum of 10 points along the length of each roll.
  - For folded products, such as drop cloths or tarpaulins, make three length measurements along the width of the sample and three width measurements along the length of the sample.
- 5. Determine and record the average tare weight according to Chapter 2, Section 2.3, Tare Procedures.

#### Evaluation of Results – Length, Width, and Net Weight

Follow the procedures in Chapter 2, Section 2.3., Evaluating Results to determine the lot conformance requirements for length, width, and weight.

- ➤ If the sample fails to meet the package requirements for any of these declarations, no further measurements are necessary. The lot fails to conform.
- > If the sample meets the package requirements for the declarations of length, widths, and weight, go to step 6 to verify the thickness declaration.

Measure the thickness of the plastic sheet with a micrometer using the following guide. Place the micrometer on a solid level surface. If the dial does not read zero with nothing between the anvil and the spindle head, set it at zero. Raise and lower the spindle head or probe several times; it should indicate zero each time. If it does not, find and correct the cause before proceeding.

Take measurements at five uniformly distributed locations across the width at each end and five locations along each side of each roll in the sample. If this is not possible, take measurements at five uniformly distributed locations across the width product for each package in the sample.

When measuring the thickness, place the sample between the micrometer surfaces and lower the spindle head or probe near, but outside, the area where the measurement will be made. Raise the spindle head or probe a distance of 0.008 mm to 0.01 mm (0.000 3 in to 0.000 4 in) and move the sheet to the measurement position. Drop the spindle head onto the test area of the sheet.

Read the dial thickness two seconds or more after the drop, or when the dial hand or digital readout becomes stationary. This procedure minimizes small errors that may occur when the spindle head or probe is lowered slowly onto the test area.

For succeeding measurements, raise the spindle head 0.008 mm to 0.01 mm (0.000 3 in to 0.000 4 in) above the rest position on the test surface, move to the next measurement location, and drop the spindle head onto the test area. Do not raise the spindle head more than 0.01 mm (0.000 4 in) above its rest position on the test area. Take measurements at least 6 mm (1/4 in) or more from the edge of the sheet.

Repeat Step 6 above on the remaining packages in the sample and record all thickness measurements. Compute and record the average thickness for the individual package and apply the following MAV requirements.

#### Evaluation of Results - Individual Thickness

- No measured thickness of polyethylene labeled 25 μm (1 mil) or greater should be less than 80 % of the labeled thickness.
- No measured thickness of polyethylene labeled less than 25 μm (1 mil) should be less than 65 % of the labeled thickness.

Count the number of values that are smaller than specified MAVs (0.8 x labeled thickness if 25  $\mu$ m [1 mil] or greater or 0.65 x labeled thickness, if less than 25  $\mu$ m [1 mil]). If the number of values that fail to meet the thickness requirement exceeds the number of MAVs permitted for the sample size, the lot fails to conform to requirements. No further testing of the lot is necessary. If the number of MAVs for thickness measurements is less than or equal to the number permitted for the sample size, go on to Evaluation of Results - Average Thickness.

#### **Evaluation of Results – Average Thickness**

The average thickness for any single package should be at least 96 % of the labeled thickness. This is an MAV of 4 %. Circle and count the number of package average thickness values that are smaller than 0.96 x labeled thickness. If the number of package average thicknesses circled exceeds the number of MAVs permitted for the sample size, the lot fails to conform to requirements. No further testing of the lot is necessary. If the number of MAVs for package average thickness is less than or equal to the number of MAVs permitted for the sample size, proceed to "Evaluating Results" in Section 2.3 of Chapter 2 to determine if the lot meets the package requirements for average thickness.

# 4.8 Packages Labeled by Linear or Square (Area) Measure

#### **Equipment**

- Use a scale that meets the requirements in Chapter 2, Section 2.2., Measurement Standards and Test Equipment. Calculate the length or area of packaged product corresponding to MAV/6. If there is no suitable weighing device, all of the packages in the sample must be opened and measured.
- Steel tapes and rules as specified in 4.5
- T-square

#### **Test Procedure**

- 1. Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following test procedure to determine lot compliance.
- 2. Select an initial tare sample according to Chapter 2, Section 2.3.
- 3. Gross weigh the first package in the tare sample and record this weight.
- 4. Determine and record the measurements (to the nearest division of the appropriate tape or rule) of the packaged goods (length, width, area; depending upon which dimensions are declared on the label) and weigh the goods from the first package opened for tare determination.

> Calculate and record the weight of the labeled measurements using the following formula:

Weight of the labeled measurement = (labeled measurement) x (contents weight)  $\div$  (contents measurement)

Look up and record the MAV in units of length or area measure (given in Table 2-8.)

Note: See Table 2-10., Exceptions to the MAVs for textiles, and polyethylene sheeting and film.

- 5. Determine and record the tare weight of the first package opened.
- 6. Determine and record the measurements (length, width, area; depending upon which dimensions are declared on the label) of the product in the second package chosen for tare determination (to the nearest division of the appropriate tape or rule). Determine and record the tare weight of this package.
- 7. Calculate and record the weight of the labeled measurement for the second package using the following formula:

Weight of the labeled measurement = (labeled measurement) x (contents weight ÷ contents measurement)

The weights of the labeled measurement for two packages must not differ by more than one division on the scale. If they do, open all packages in the sample, measure individually, and compare them against the labeled measure to determine the package errors. If the criterion is met, go to step 8.

- 8. Calculate the average weight of the labeled measurement and record.
- 9. Determine and record the average tare weight according to Chapter 2, Section 2.3., Tare Procedures.
- 10. Compute and record the nominal gross weight by adding the average weight of the labeled measurements to the average tare weight.
- 11. Compute package errors according to the following formula:

Package error (weight) = (actual package gross weight) (nominal gross weight)

12. Convert the MAV to units of weight using the following formula:

MAV (weight) = (avg. wt. of label measurements x MAV [length]) ÷ (labeled measurements)

Convert the MAV to dimensionless units by dividing the MAV (weight) by the unit of measure and record.

# **Evaluation of Results**

Follow the procedure in Chapter 2, Section 2.3., Evaluating Results to determine lot conformance.

Convert back to dimensions when completing the report form using following the formula:

Avg. Pkg. Error (dimension) = (Avg. Pkg. Error [dimensionless units]) x (Unit of Measure) x (Labeled unit of measure) ÷ (Avg. Weight of Labeled dimension.)

# 4.9 Baler Twine - Test Procedure for Length

# **Equipment**

- A scale that meets the requirements in Chapter 2, Section 2.2., Measurement Standards and Test Equipment, except a scale with 0.1 g (0.000 2 lb) increments must be used for weighing twine samples. The recommended minimum load for weighing samples is 20 divisions.
- Steel tapes and rules specified in Section 4.5.
- A hand-held straight-face spring scale of at least 4.53 kg (10 lb) capacity or a cordage-testing device that applies the specified tension to the twine being measured. When measuring twine samples or total roll length, apply 4.53 kg (10 lb) of tension to the twine.

#### **Test Procedure**

Follow the Basic Test Procedure in Section 2.3. Define the inspection lot. Use a Category A sampling plan in the inspection; select a random sample; then use the following test procedure to determine lot compliance.

- 1. Select packages for tare samples. Determine gross weights of the initial tare sample and record. Open the tare samples. Use the procedures for tare determination in Tare Procedures of Chapter 2, Section 2.3 to compute the average tare weight and record this value.
- 2. Procedure for obtaining twine samples: randomly select four balls of twine from the packages that were opened for tare

From each of the four balls of twine:

- Measure and discard the first 10.05 m (33 ft) of twine from each roll. Accurate measurement requires applying tension to the ends of the twine before measuring in order to straighten the product.
- Take two 30.48 m (100 ft) lengths of twine from inside each roll.
- Weigh and record the weight of each piece separately and record the values. Compare the weight values to determine the variability of the samples. If the individual weights of the eight twine samples vary by more than one division on the scale, use one of the following steps: If the lot is short, determine the actual length of the lightest-weight roll found in the lightest-weight package of the lot to confirm that the weight shortages reflect the shortages in the length of the rolls; or, determine the average weight-per-unit of measure by taking ten 30.48 m (100 ft) lengths from inside the lightest weight package. Use this value to recalculate its length and determine lot compliance.
- 3. Weigh all of the sample lengths together and record the total value. Determine the total length of the samples (243.8 m or 800 ft, unless more than eight sample-lengths were taken) and record the value. Compute the average weight-per-unit-of-length by dividing the total weight by the total length of the pieces.
- 4. Determine the MAV for a package of twine (refer to Table 2-8., Maximum Allowable Variations for Packages Labeled by Length, Width, or Area).
  - Record the total declared package length.
  - > Multiply the MAV from Table 2-8. times the total package length to obtain the MAV for length and record this value.
  - Multiply the weight per unit of length (from step 3) times the MAV for the total declared package length to obtain the MAV by weight and record this value.

- > Convert the MAV to dimensionless units and record.
- 4. Calculate the nominal gross weight and record.

Follow the Basic Test procedure in Section 2.3 to determine individual package errors. Determine errors using the following formula:

- Package error (weight) = (package gross weight) (nominal gross weight).
- > To convert the Package error in weight back to length, divide the weight by the average weight-per-unit-of-length.

#### **Evaluation of Results**

Follow the procedures in Chapter 2, Section 2.3., Evaluating Results to determine lot compliance.

# 4.10 Procedure for Checking the Area Measurement of Chamois

Chamois is natural leather made from skins of sheep and lambs that have been oil-tanned. Chamois are irregularly shaped, which makes area measurement difficult. Because of these characteristics, an accurate area determination can only be made using an internationally recognized method of conditioning (rehydrating) and measurement. Chamois is produced in a wet manufacturing process, so it has high moisture content at time of measurement. Chamois is hydroscopic; therefore, its dimensions and total area change as it loses or absorbs moisture. It is also subject to wrinkling. Because of the variation of the thickness and density, and therefore the weight per unit area of chamois, an estimated gross weight procedure cannot be used to verify the labeled area declaration.

Standard Test Conditions: As with all hydroscopic products, reasonable variations in measure must be allowed if caused by ordinary and customary exposure to atmospheric conditions that normally occur in good distribution practice. Both Federal and international standards specify procedures to restore the moisture content of chamois so that tests to verify dimensions and area can be conducted.

Federal Test Method Standard 311, "Leather, Methods of Sampling and Testing," (January 15, 1969) defines the standard atmospheric condition for chamois as  $50 \pm 4$  % relative humidity and  $23 \pm 2$  °C ( $73.4 \pm 3.6$  °F). The chamois is considered to be at equilibrium moisture when the difference in two successive weighings, made at 1 hr intervals, is no greater than 0.25 % (e.g., the maximum change in weight on a 100 g sample in two successive weighings is less than 0.25 g (250 mg).

#### **Test Procedures**

The area of chamois is verified using a two-stage test procedure. The first stage is a field audit using the template test procedure. This test is used for field audits because it is simpler to perform and does not require the chamois to be conditioned. The field audit is used to identify chamois that are potentially under measure. It is not as accurate as the gravimetric procedure because some error results from reading the area from the template. The gravimetric procedure should be used for compliance testing because it includes conditioning (rehydrating) the chamois.

#### **Template Test Method (for field audits)**

Select a random sample of chamois and use the Template Procedure (below) to determine the area of each sample. Chamois is labeled in uniform sizes in terms of square decimeters and square feet, and are sized in increments of ¼ ft<sup>2</sup> (e.g., 1 ft<sup>2</sup>, 1¼ ft<sup>2</sup>, and 1½ ft<sup>2</sup>). Separate the chamois into different sizes and define the inspection lot by specific sizes.

# **Equipment**

Use a transparent, flexible template that is graduated in square centimeters or square inches and that has been verified for accuracy. The template must be large enough to completely cover the chamois under test.

#### **Template Procedures**

#### 1. Template Procedure

Place the template over the chamois specimen on a smooth surface. Determine the area by counting the number of squares that cover the surface of the chamois. Estimate parts of the template that do not completely cover the chamois by adding the number of partially covered blocks. (See Figure 1.)

Compute the total area and go to Evaluation to determine if further action is necessary.

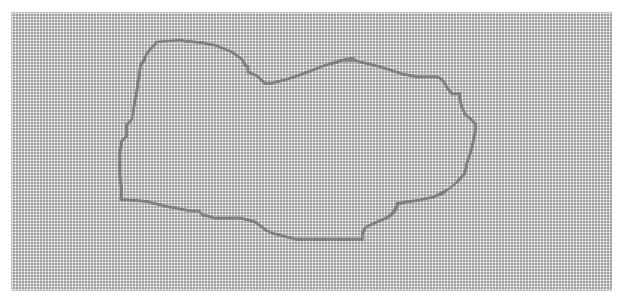


Figure 1.

First Stage - Decision Criteria

If the average minus error exceeds 3 % of the labeled area, the chamois may not be labeled accurately. To confirm the finding, the sample must be taken to a laboratory for conditioning and testing using the gravimetric test procedure.

#### 2. Gravimetric Procedure for Area Measurement

This test cannot be performed in the field because the samples must be conditioned with water before testing. This method is intended for use in checking full or cut skins, or pattern shapes. Open and condition all of the packages in the sample before determining their area on the recommended paper. Conditioning and verifying chamois can be accomplished without destroying the product. When successful tests are completed, the chamois may be repackaged for sale, so do not destroy the packaging material.

## **Equipment**

- Scale with a capacity of 1 kg that is accurate to at least ± 0.01 g and a load receiving element of adequate size
  to properly hold the chamois
- Atomizer or trigger type sprayer and sealable, airtight polyethylene bags
- Medium weight drawing paper (e.g., drawing paper, medium weight (100 lb), regular surface or comparable)
- Household iron with low temperature settings 30 °C to 40 °C (86 °F to 104 °F)
- Rule or tape that is graduated in centimeters or inches
- Instrument for cutting paper (razor blade, scissors, or cutting board)

#### **Sample Conditioning**

- 1. Remove each sample from its packages weigh and record each weight. Using an atomizer-type sprayer, spray water in the amount of 25 % of the weight of each skin uniformly over its area. Place wetted chamois in an airtight polyethylene bag; seal the bag, and leave it in this condition at room temperature for 24 hours.
- 2. Open the bag, remove the chamois, and reweigh the chamois to confirm that it retained maximum moisture. This is done by confirming that the difference in the two consecutive weighings conducted an hour apart does not exceed 0.25 %).
- 3. Place the chamois flat on a continuous piece of drawing paper. To remove wrinkles and make the chamois lie flat, use a normal domestic iron that is heated to a maximum of 30 °C to 40 °C (86 °F to 104 °F). Place the iron on the bottom of the skin, and iron the skin up the center to the top. Then, iron the skin from the center out to each side. Iron until the skin is fully extended and perfectly flat.

#### Measurement

- 1. Immediately after ironing, carefully draw around the outline of the skin on the paper. Remove the skin; carefully cut along the outline of the skin; weigh the cutout pattern, and record to the nearest 0.1 g as Sample Weight 1 (W1).
- 2. Lay out the pattern and cut an accurately measured rectangle of a size not less than one-half the area of the pattern. Weigh the cutout rectangle and record the weight to the nearest 0.1 g as Sample Weight 2 (W2). Calculate the area of the rectangle cut from the patterns by multiplying length by width and record as Area (A) in centimeters or square inches.
  - For metric units calculate the area of the original skin being checked as follows:

W1/W2 x A = Skin Area in 
$$cm^2/100$$
 = Area in  $dm^2$ 

For inch-pound units - calculate the area of the original skin being checked as follows:

$$W1/W2 \times A = Skin Area in in^2/144 = Area ft^2$$

## **Evaluation of Results**

Compute the average error for the sample and follow the procedures in Chapter 2, Section 2.3., Evaluating Results to determine lot conformance.

The MAV for area declarations on chamois is 3 % of the labeled area as specified in Table 2-8.

# NIST Handbook 133 Fourth Edition (2005) Index

aerosol containers13	Nominal Gross Weight15
Assistance in Testing Operations5	Other Volumetric Test Procedures28
Average Requirement	package errors for the tare sample packages
Baler Twine64	Package Requirements2
Basic Inspection Procedure and Record Keeping11	Packages Labeled by Count53
Basic Test Procedure7	Packages Labeled by Count of More than 50 Items 54
Borax10, 19	Packages Labeled by Linear or Square (Area) Measure
Boxed Firewood50	62
Bundles and Bags of Firewood51	Packages Labeled by Volume24
Calculations	Packages Labeled with 50 Items or Less54
Caulking Compounds37	Paint32, 33, 34, 35
Chamois	Paper Plates and Sanitary Paper Products57
coffee14	Peat Moss38
Count	Point of pack1
Crosshatched Firewood51	Point-of-pack1
Decreasing-Load Test9	point-of-sale1
Defoaming agent25	Polyethylene Sheeting59
Determining the Net Contents of Compressed Gas in	Pressed and Blown Glass Tumblers and Stemware31
Cylinders46	Random number tables
Drained Weight21	Random Sample Selection
Drained Weight for Glazed or Frozen Foods21	reasonable variation
Evaluating Results16, 21, 23, 28, 29, 30, 31, 37, 39,	reference temperature24
41, 45, 46, 49, 50, 51, 52, 56, 58, 59, 61, 62, 63, 65,	Regulatory Agencies Responsible for Package
	Regulations and Applicable Requirements4
firewood12, 49, 50, 51, 52	Retail
flour	Return to Zero9
Fresh Oysters45	Sampling Plans
Frozen Foods21	Scope
Glossary	Shift Test9
Good Measurement Practices	Special Test Requirements for Packages Labeled by
Goods Labeled by Capacity30	Linear or Square Measure (Area)58
Gravimetric Test Procedure for Checking the Net	Tare Procedures 13
Contents of Packaged Goods7	Test Procedure for Cylinders Labeled by Volume 49
Gravimetric Test Procedure for Liquids25	Test Procedure For Cylinders Labeled By Weight48
Health and Safety5	Testing Viscous Materials - Such As Caulking
Ice Cream Novelties41	Compounds
Increasing-Load Test9	The Determination of Drained Weight
Individual Package Requirement	Unit of measure
initial tare sample	Unused Dry Tare 13
•	Used Dry Tare
Inspection Lot2 Linear Measure, Area, Thickness, and Combinations	vacuum-packed
	Volumetric Headspace Test Procedure29
of Quantities	
Maximum Allowable Variation2, 3, 7, 10, 12, 16, 18	Volumetric Test Procedure for Liquids
Mayonnaise and Salad Dressing	Volumetric Test Procedure for Packaged Firewood
Measurement Standards and Test Equipment5	with a Labeled Volume
milk	Volumetric Test Procedure for Paint, Varnish, and
Moisture Allowances	Lacquers – Non-aerosol
Moisture Loss or Gain	Wet Tare
Mulch and Soils Labeled by Volume	Wholesale 1
nominal gross weight11, 14, 15, 20, 27, 28, 37, 44, 55,	

# Appendix A. Tables

Table 1-1. Agencies Responsible for Package Regulations and Applicable Requirements			
Commodity	Responsible Agency	NIST Handbook 133 Sampling Plans	Table of Maximum Allowable Variations
Meat and Poultry	U.S. Department of Agriculture/ Food Safety and Inspection Service and State and local weights and measures.	1. Use Table 2-1. Sampling Plans for Category A to test packages at other than point of pack.  2. Use Table 2-2. Sampling Plans for Category B to test packages in Federally inspected meat and poultry plants.	Table 2-9. U.S. Department of Agriculture, Meat and Poultry, Groups and Lower Limits for Individual Packages.
Foods, drugs, and cosmetics subject to the Food, Drug, and Cosmetic Act including those packaged at the retail store level that have been in interstate commerce (e.g., seafood) or those made with ingredients that have been in interstate commerce.	U.S. Food and Drug Administration and State and local weights and measures.  http://www.fda.gov		Table 2-5. MAVs for Packages Labeled by Weight
Food products <u>not</u> subject to the Federal Food, Drug, and Cosmetic Act, including meat and poultry products packaged at the retail store level.	State and local weights and measures.  http://www.nist.gov/owm	Use Table 2-1. Sampling Plans for Category A to test packages at all locations	Table 2-6. MAVs for Packages Labeled by Liquid or Dry Volume.  Table 2-7. MAVs for
Non-food Consumer Products	Federal Trade Commission <a href="http://www.ftc.gov">http://www.ftc.gov</a>		Packages Labeled by Count  Table 2-8. MAVs for Packages Labeled by
Non-food Consumer and Non-consumer Products	State and local weights and		Length (Width) or Area.
Alcohol and Tobacco Products	measures.  U.S. Bureau of Alcohol, Tobacco, and Firearms and State and local weights and measures. <a href="http://www.atf.treas.gov">http://www.atf.treas.gov</a>		Table 2-10. Exceptions to the MAVs for Textiles, Polyethylene Sheeting and Film, Mulch and Soil Labeled by Volume, Packaged Firewood, and Packages Labeled by Count with Less than 50
Pesticides	U.S. Environmental Protection Agency and State and local weights and measures. <a href="http://www.epa.gov">http://www.epa.gov</a>		Items.

Table 2-1. Sampling Plans for Category A					
1	2	3	4	5	6
T T	G 1		Number of Minus	Initial Tare Sample Size**	
Inspection Lot Size	Sample Size	Sample Correction Factor	Package Errors Allowed to Exceed the MAV*	Glass and Aerosol Packages	All Other Packages
1	1	Apply MAV			
2	2	8.984			
3	3	2.484			
4	4	1.591			
5	5	1.241			
6	6	1.050			
7	7	0.925	0.4	2	2
8	8	0.836	0*	2	2
9	9	0.769			
10	10	0.715			
11	11	0.672			
12 to 250	12	0.635			
251 to 3 200	24	0.422		3	
More than 3 200	48	0.291	1*	3	

<sup>\*</sup>For mulch and soils packaged by volume, see Table 2-10. Exceptions to the Maximum Allowable Variations – 1 package may exceed the MAV for every 12 packages in the sample.

<sup>\*\*</sup>If sample size is 11 or less, the initial tare sample size and the total tare sample size is 2 samples. (Amended 2001)

	Table 2-2. Sampling Plans for Category B			
Fo	r Use In USDA-Inspe	cted Meat and Poultry Plan	ts Only	
1	2	3	4	
Inspection Lot Size	Sample Size	Initial Tare Sample Size	Number of Packages Allowed to Exceed the MAVs in Table 2-9	
250 or Less	10	2	0	
251 or More	30	5	J	

Table 2-3. Category A – Total Number of Packages to be Opened for Tare Determination Numbers Include those Packages Opened for Initial Tare Sample

Ratio of R <sub>c</sub> /R <sub>t</sub>		Total Numbe	r of Packages ir	Tare Sample	
Sample Size	12	2	24	4	8
Initial Tare Sample Size	2	2	3	2	3
If range of tare equals "zero," use Initial Tare Sample Size.  If the ratio is "zero" based on a "zero" range of net weight open all of the packages in the sample.	2	2	3	2	3
If the ratio is greater than 0 but less than or equal to 0.2	12	24	24	48	48
0.21 to 0.60	12	24	24	48	48
0.61 to 0.70	12	24	24	47	47
0.71 to 0.80	12	23	23	47	47
0.81 to 1.00	12	23	23	46	46
1.01 to 1.10	11	23	23	46	46
1.11 to 1.20	11	23	23	45	45
1.21 to 1.30	11	22	22	45	45
1.31 to 1.50	11	22	22	44	44
1.51 to 1.60	11	22	22	43	43
1.61 to 1.70	11	21	21	42	42
1.71 to 1.80	10	21	21	42	42
1.81 to 1.90	10	21	21	41	41
1.91 to 2.00	10	20	20	41	41
2.01 to 2.10	10	20	20	40	40
2.11 to 2.20	10	20	20	39	39
2.21 to 2.30	10	19	19	39	39
2.31 to 2.40	9	19	19	38	38
2.41 to 2.50	9	19	19	37	37
2.51 to 2.60	9	18	18	37	37
2.61 to 2.70	9	18	18	36	36
2.71 to 2.80	9	18	18	35	35
2.81 to 2.90	9	17	17	34	34
2.91 to 3.00	8	17	17	34	34
3.01 to 3.10	8	17	17	33	33
3.11 to 3.30	8	16	16	32	32
3.31 to 3.40	8	16	16	31	31
3.41 to 3.50	8	15	15	30	30
3.51 to 3.60	7	15	15	30	30
3.61 to 3.70	7	15	15	29	29
3.71 to 3.90	7	14	14	28	28
3.91 to 4.00	7	14	14	27	27
4.01 to 4.10	7	13	13	27	27
4.11 to 4.20	7	13	13	26	26
4.21 to 4.30	6	13	13	25	25
4.31 to 4.40	6	12	12	25	25
4.41 to 4.60	6	12	12	24	24

Go to Next Page for Additional Values.

Table 2-3 (Continued) . Category A – Total Number of Packages to be Opened for Tare Determination Numbers Include those Packages Opened for Initial Tare Sample

Ratio of R <sub>c</sub> /R <sub>t</sub>		Total Number	er of Packages i	n Tare Sample	
Sample Size	12		24		18
Initial Tare Sample Size	2	2	3	2	3
4.61 to 4.70	6	12	12	23	23
4.71 to 4.80	6	11	11	23	23
4.81 to 4.90	6	11	11	22	22
4.91 to 5.00	5	11	11	22	22
5.01 to 5.10	5	11	11	21	21
5.01 to 5.10	5	11	11	21	21
5.11 to 5.20	5	10	10	21	21
5.21 to 5.40	5	10	10	20	20
5.41 to 5.60	5	10	10	19	19
5.61 to 5.70	5	9	9	19	19
5.71 to 5.80	5	9	9	18	18
5.81 to 5.90	4	9	9	18	18
5.91 to 6.10	4	9	9	17	17
6.11 to 6.20	4	8	8	17	17
6.21 to 6.50	4	8	8	16	16
6.51 to 6.70	4	8	8	15	15
6.71 to 6.80	4	7	7	15	15
6.81 to 7.00	4	7	7	14	14
7.01 to 7.20	3	7	7	14	14
7.21 to 7.40	3	7	7	13	13
7.41 to 7.60	3	6	6	13	13
7.61 to 8.00	3	6	6	12	12
8.01 to 8.20	3	6	6	11	11
8.21 to 8.50	3	5	5	11	11
8.51 to 8.80	3	5	5	10	10
8.81 to 9.00	2	5	5	10	10
9.01 to 9.30	2	5	5	9	9
9.31 to 9.70	2	4	4	9	9
9.71 to 10.40	2	4	4	8	8
10.41 to 10.90	2	4	4	7	7
10.91 to 11.30	2	3	3	7	7
11.31 to 12.50	2	3	3	6	6
12.51 to 13.20	2	3	3	5	5
13.21 to 13.90	2	2	3	5	5
13.91 to 16.00	2	2	3	4	4
16.01 to 19.10	2	2	3	3	3
19.11 to 19.20	2	2	3	2	3
Initial Tare Sample Size	2	2	3	2	3

Table 2-4. Category B – Total Number of Packages to be Opened for Tare Determination Numbers Include those Packages Opened for Initial Tare Sample

Ratio of R <sub>c</sub> /R <sub>t</sub>	Total Number of Packages in Tare Sample		
Sample Size	10	30	
Initial Tare Sample Size	2	5	
If the ratio is zero, based on a "zero" range of tare, use Initial Tare Sample Size. If the ratio is "zero" based on a "zero" range of net weight, open all the packages in the sample.	2	5	
If the ratio is greater than 0 but less than or equal to 0.2	10	30	
0.21 to 0.40	10	29	
0.41 to 0.60	10	28	
0.61 to 0.80	9	26	
0.81 to 1.00	8	24	
1.01 to 1.20	8	23	
1.21 to 1.40	7	21	
1.41 to 1.60	7	19	
1.61 to 1.80	6	17	
1.81 to 2.00	5	15	
2.01 to 2.20	5	14	
2.21 to 2.40	5	13	
2.41 to 2.60	4	12	
2.61 to 2.80	4	11	
2.81 to 3.00	4	10	
3.01 to 3.20	3	9	
3.21 to 3.60	3	8	
3.61 to 3.80	3	7	
3.81 to 4.40	2	6	
If the ratio is greater than 4.40, use the Initial Tare Sample Size	2	5	

**Table 2-5. Maximum Allowable Variations (MAVs) for Packages Labeled by Weight**Do Not Use This Table for Meat and Poultry Products subject to USDA Regulations – Use Table 2.9
For Polyethylene Sheeting and Film, see Table 2-10. Exceptions to the MAVs.

Labeled Quantity	Maximum Allowable Variations
Less than 36 g, 0.08 lb, or 1.28 oz	10 % of labeled quantity
36 g or more to 54 g	3.6 g
0.08 lb or more to 0.12 lb	0.008 lb
1.28 oz or more to 1.92 oz	1/8 oz
More than 54 g to 81 g	5.4 g
More than 0.12 lb to 0.18 lb	0.012 lb
More than 1.92 oz to 2.88 oz	3/16 oz
More than 81 g to 117 g	7.2 g
More than 0.18 lb to 0.26 lb	0.016 lb
More than 2.88 oz to 4.16 oz	¹⁄4 oz
More than 117 g to 154 g	9.0 g
More than 0.26 lb to 0.34 lb	0.020 lb
More than 4.16 oz to 5.44 oz	5/16 oz
More than 154 g to 208 g	10.8 g
More than 0.34 lb to 0.46 lb	0.024 lb
More than 5.44 oz to 7.36 oz	3/8 oz
More than 208 g to 263 g	12.7 g
More than 0.46 lb to 0.58 lb	0.028 lb
More than 7.36 oz to 9.28 oz	7/16 oz
More than 263 g to 317 g	14.5 g
More than 0.58 lb to 0.70 lb	0.032 lb
More than 9.28 oz to 11.20 oz	1/2 oz
More than 317 g to 381 g	16.3 g
More than 0.70 lb to 0.84 lb	0.036 lb
More than 11.20 oz to 13.44 oz	9/16 oz
More than 381 g to 426 g	18.1 g
More than 0.84 lb to 0.94 lb	0.040 lb
More than 13.44 oz to 15.04 oz	5/8 oz
More than 426 g to 489 g	19.9 g
More than 0.94 lb to 1.08 lb	0.044 lb
More than 15.04 oz to 17.28 oz	11/16 oz
More than 489 g to 571 g	21.7 g
More than 1.08 lb to 1.26 lb	0.048 lb
More than 571 g to 635 g	23.5 g
More than 1.26 lb to 1.40 lb	0.052 lb
More than 635 g to 698 g	25.4 g
More than 1.40 lb to 1.54 lb	0.056 lb
More than 698 g to 771 g	27.2 g
More than 1.54 lb to 1.70 lb	0.060 lb
More than 771 g to 852 g	29.0 g
More than 1.70 lb to 1.88 lb	0.064 lb
More than 852 g to 970 g	31.7 g
More than 1.88 lb to 2.14 lb	0.070 lb

Go to Next Page for Additional Values.

**Table 2-5 (continued). Maximum Allowable Variations (MAVs) for Packages Labeled by Weight**Do Not Use This Table for Meat and Poultry Products Subject to USDA-Regulations. Use Table 2.9 for USDA Regulated Products.

Labeled Quantity	Maximum Allowable Variations (MAVs)
More than 970 g to 1.12 kg	35.3 g
More than 2.14 lb to 2.48 lb	0.078 lb
More than 1.12 kg to 1.25 kg	39.0 g
More than 2.48 lb to 2.76 lb	0.086 lb
More than 1.25 kg to 1.45 kg	42.6 g
More than 2.76 lb to 3.20 lb	0.094 lb
More than 1.45 kg to 1.76 kg	49 g
More than 3.20 lb to 3.90 lb	0.11 lb
More than 1.76 kg to 2.13 kg	54 g
More than 3.90 lb to 4.70 lb	0.12 lb
More than 2.13 kg to 2.63 kg	63 g
More than 4.70 lb to 5.80 lb	0.14 lb
More than 2.63 kg to 3.08 kg	68 g
More than 5.80 lb to 6.80 lb	0.15 lb
More than 3.08 kg to 3.58 kg	77 g
More than 6.80 lb to 7.90 lb	0.17 lb
More than 3.58 kg to 4.26 kg	86 g
More than 7.90 lb to 9.40 lb	0.19 lb
More than 4.26 kg to 5.30 kg	99 g
More than 9.40 lb to 11.70 lb	0.22 lb
More than 5.30 kg to 6.48 kg	113 g
More than 11.70 lb to 14.30 lb	0.25 lb
More than 6.48 kg to 8.02 kg	127 g
More than 14.30 lb to 17.70 lb	0.28 lb
More than 8.02 kg to 10.52 kg	140 g
More than 17.70 lb to 23.20 lb	0.31 lb
More than 10.52 kg to 14.33 kg	167 g
More than 23.20 lb to 31.60 lb	0.37 lb
More than 14.33 kg to 19.23 kg	199 g
More than 31.60 lb to 42.40 lb	0.44 lb
More than 19.23 kg to 24.67 kg	226 g
More than 42.40 lb to 54.40 lb	0.50 lb
More than 24.67 kg	2 % of labeled quantity
More than 54.40 lb	2 /0 of fabolog quality

Table 2-6. Maximum Allowable Variations for Packages Labeled by Liquid and Dry Volume

Do Not Use This Table for Meat and Poultry Products Subject to USDA Regulations For Mulch, see Table 2-10. Exceptions to the Maximum Allowable Variations Use Table 2-9 for USDA –Regulated Products.

Labeled Quantity	Maximum Allowable Variations (MAVs)
3 mL or less	0.5 mL
0.50 fl oz or less	0.02 fl oz
$0.18 \text{ in}^3 \text{ or less}$	$0.03 \text{ in}^3$
More than 3 mL to 8 mL	1.0 mL
More than $0.18 \text{ in}^3$ to $0.49 \text{ in}^3$	$0.06 \text{ in}^3$
More than 8 mL to 14 mL	1.5 mL
More than $0.49 \text{ in}^3$ to $0.92 \text{ in}^3$	$0.09 \text{ in}^3$
More than 14 mL to 22 mL	1.7 mL
More than 0.50 fl oz to 0.75 fl oz	0.06 fl oz
More than $0.92 \text{ in}^3$ to $1.35 \text{ in}^3$	$0.10 \text{ in}^3$
More than 22 mL to 66 mL	3.8 mL
More than 0.75 fl oz to 2.25 fl oz	0.13 fl oz
More than $1.35 \text{ in}^3 \text{ to } 4.06 \text{ in}^3$	$0.23 \text{ in}^3$
More than 66 mL to 125 mL	5.6 mL
More than 2.25 fl oz to 4.25 fl oz	0.19 fl oz
More than 4.06 in <sup>3</sup> to 7.66 in <sup>3</sup>	$0.34 \text{ in}^3$
More than 125 mL to 170 mL	7.3 mL
More than 4.25 fl oz to 5.75 fl oz	0.25 fl oz
More than $7.66 \text{ in}^3 \text{ to } 10.37 \text{ in}^3$	$0.45 \text{ in}^3$
More than 170 mL to 221 mL	9.1 mL
More than 5.75 fl oz to 7.50 fl oz	0.31 fl oz
More than 10.37 in <sup>3</sup> to 13.53 in <sup>3</sup>	$0.55 \text{ in}^3$
More than 221 mL to 347 mL	11.2 mL
More than 7.50 fl oz to 11.75 fl oz	0.38 fl oz
More than 13.53 in <sup>3</sup> to 21.20 in <sup>3</sup>	$0.68 \text{ in}^3$
More than 347 mL to 502 mL	14.7 mL
More than 11.75 fl oz to 17.00 fl oz	0.5 fl oz
More than 21.20 in <sup>3</sup> to 30.67 in <sup>3</sup>	$0.90 \text{ in}^3$
More than 502 mL to 621 mL	18.6 mL
More than 17 fl oz to 21 fl oz	0.63 fl oz
More than 30.67 in <sup>3</sup> to 37.89 in <sup>3</sup>	$1.13 \text{ in}^3$
More than 621 mL to 798 mL	22.1 mL
More than 21 fl oz to 27 fl oz	0.75 fl oz
More than 37.89 in <sup>3</sup> to 48.72 in <sup>3</sup>	$1.35 \text{ in}^3$
More than 798 mL to 916 mL	26.0 mL
More than 27 fl oz to 31 fl oz	0.88 fl oz
More than 48.72 in <sup>3</sup> to 55.94 in <sup>3</sup>	1.58 in <sup>3</sup>
More than 916 mL to 1.15 L	29 mL
More than 31 fl oz to 39 fl oz	1 fl oz
More than 55.94 in <sup>3</sup> to 70.38 in <sup>3</sup>	1.80 in <sup>3</sup>
More than 1.15 L to 1.62 L	36 mL
More than 39 fl oz to 55 fl oz	1.25 fl. Oz.
More than 70.38 in <sup>3</sup> to 99.25 in <sup>3</sup>	2.25 in <sup>3</sup>

Go to Next Page for Additional Values.

**Table 2-6 (Continued). Maximum Allowable Variations (MAVs) for Packages Labeled by Volume**Do Not Use This Table for Meat and Poultry Products Subject to USDA Regulations – Use Table 2-9
For Mulch, see Table 2-10. Exceptions to the Maximum Allowable Variations.

Labeled Quantity	Maximum Allowable Variations (MAVs)
More than 1.62 L to 2.04 L	44 mL
More than 55 fl oz to 69 fl oz	1.5 fl oz
More than 99.25 in <sup>3</sup> to 124.5 in <sup>3</sup>	$2.70 \text{ in}^3$
More than 2.04 L to 2.51 L	51 mL
More than 69 fl oz to 85 fl oz	1.75 fl oz
More than 124.5 in <sup>3</sup> to 153.3 in <sup>3</sup>	$3.1 \text{ in}^3$
More than 2.51 L to 3.04 L	59 mL
More than 85 fl oz to 103 fl oz	2 fl oz
More than 153.3 in <sup>3</sup> to 185.8 in <sup>3</sup> .	$3.6 \text{ in}^3$
More than 3.04 L to 4.73 L	73 mL
More than 103 fl oz to 160 fl oz	2.5 fl oz
More than 185.8 in <sup>3</sup> to 288.7 in <sup>3</sup>	4.5 in <sup>3</sup>
More than 4.73 L to 5.48 L	88 mL
More than 160 fl oz to 185.6 fl oz	3 fl oz
More than $288.7 \text{ in}^3$ to $334.9 \text{ in}^3$ .	$5.4 \text{ in}^3$
More than 5.48 L to 7.09 L	103 mL
More than 185.6 fl oz to 240 fl oz	3.5 fl oz
More than 334.9 in <sup>3</sup> to 443.1 in <sup>3</sup>	$6.3 \text{ in}^3$
More than 7.09 L to 8.04 L	118 mL
More than 240 fl oz to 272 fl oz	4 fl oz
More than 443.1 in <sup>3</sup> to 490.8 in <sup>3</sup> .	$7.2 \text{ in}^3$
More than 8.04 L to 10.17 L	133 mL
More than 272 fl oz to 344 fl oz	4.5 fl oz
More than 490.8 in <sup>3</sup> to 620.8 in <sup>3</sup>	8.1 in <sup>3</sup>
More than 10.17 L to 11.59 L	147 mL
More than 344 fl oz to 392 fl oz	5 fl oz
More than 620.8 in <sup>3</sup> to 707.4 in <sup>3</sup>	9.0 in <sup>3</sup>
More than 11.59 L to 16.56 L	177 mL
More than 392 fl oz to 560 fl oz	6 fl oz
More than 707.4 in <sup>3</sup> to 1, 010 in <sup>3</sup>	10.8 in <sup>3</sup>
More than 16.56 L to 18.92 L	207 mL
More than 560 fl oz to 640 fl oz (5 gal)	7 fl oz
More than 1,010 in <sup>3</sup> into 1,155 in <sup>3</sup>	12.6 in <sup>3</sup>
More than 18.92 L to 23.65 L	236 mL
More than 640 fl oz to 800 fl oz	8 fl oz
More than 1,155 in <sup>3</sup> to 1,443 in <sup>3</sup>	14.4 in <sup>3</sup>
More than 23.65 L to 26.73 L	266 mL
More than 800 fl oz to 904 fl oz	9 fl oz
More than 1,443 in <sup>3</sup> to 1,631 in <sup>3</sup>	16.2 in <sup>3</sup>
More than 26.73 L	1.0/ .61.1. 1.1.
More than 904 fl oz	1 % of labeled quantity
More than 1,631 in <sup>3</sup>	

Table 2-7. Maximum Allowable Vari	iations (MAVs) for Packages Labeled by Count
Labeled Quantity	Maximum Allowable Variations (MAVs)
17 or less	0
18 to 50	1
51 to 83	2
84 to 116	3
117 to 150	4
151 to 200	5
201 to 240	6
241 to 290	7
291 to 345	8
346 to 400	9
401 to 465	10
466 to 540	11
541 to 625	12
626 to 725	13
726 to 815	14
816 to 900	15
901 to 990	16
991 to 1 075	17
1 076 to 1 165	18
1 166 to 1 250	19
1 251 to1 333	20
1 334 or more	1.5 % of labeled count rounded off to the nearest whole number

Table 2-8. Maximum Allowable Variations for Packages Labeled by Length, (Width), or Area
For Textiles, Polyethylene Sheeting and Film – Use Table 2-10.

Labeled Quantity	Maximum Allowable Variations (MAVs)
1 m or less 1 yd or less	3 % of labeled quantity
More than 1 m to 43 m More than 1 yd to 48 yd	1.5 % of labeled quantity
More than 43 m to 87 m More than 48 yd to 96 yd	2 % of labeled quantity
More than 87 m to 140 m More than 96 yd to 154 yd	2.5 % of labeled quantity
More than 140 m to 301 m More than 154 yd to 330 yd	3 % of labeled quantity
More than 301 m to 1,005 m More than 330 yd to 1,100 yd	4 % of labeled quantity
More than 1,005 m or 1,100 yd	5 % of labeled quantity

## Maximum Allowable Variations for Packages Labeled by Area.

The MAV for packages labeled by area is 3 % of labeled quantity

For Textiles, Polyethylene Sheeting and Film, see Table 2-10. Exceptions to the MAVs

Table 2-9. U.S. Department of Agriculture, Meat and Poultry
Groups and Lower Limits for Individual Packages (Maximum Allowable Variations)

Definition of Grou	up and Labeled Quantity			
Homogenous Fluid when Filled (e.g., baby food or containers of lard)	All Other Products	Lower Limit for Individual Weights (MAVs)		
Less th	an 85 g or 3 oz	10 % of labeled quantity		
85 g or more to 453 g 3 oz or more to 16 oz		7.1 g 0.016 lb (0.25 oz)		
More than 453 g More than 16 oz	85 g or more to 198 g 3 oz to 7 oz	14.2 g 0.031 lb (0.5 oz)		
	More than 198 g to 1.36 kg 7 oz to 48 oz	28.3 g 0.062 lb (1 oz)		
	More than 1.36 kg to 4.53 kg More than 48 oz to 160 oz	42.5 g 0.094 lb (1.5 oz)		
	More than 4.53 kg More than 160 oz	1 % of labeled quantity		

Table 2-10. Exceptions to the Maximum Allowable Variations for Textiles, Polyethylene Sheeting and Film, Mulch and Soil Labeled by Volume, Packaged Firewood, and Packages Labeled by Count with Less than 50 Items.

	Maximum Allowable Variations (MAVs)
	Thickness
	When the labeled thickness is 25: m (1 mil or 0.001 in) or less, any individual thickness measurement of polyethylene film may be up to 35 % below the labeled thickness.
Polyethylene Sheeting and Film	When the labeled thickness is greater than 25: m (1 mil or 0.001 in), individual thickness measurements of polyethylene sheeting may be up to 20 % less than the labeled thickness.
	The average thickness of a single package of polyethylene sheeting may be up to 4 % less than the labeled thickness.
	Weight
	The MAV for individual packages of polyethylene sheeting and film shall be 4 % of the labeled quantity.
	The MAVs are:
	For packages labeled with dimensions of 60 cm (24 in) or more:
Textiles	Three percent of the labeled quantity for negative errors and 6 % of the labeled quantity for plus errors.
	For packages labeled with dimensions less than 60 cm (24 in):
	6 % of the labeled quantity for negative errors and 12 % for plus errors.
	The MAVs are:
Mulch and Soil Labeled	For individual packages: 5 % of the labeled volume.
by Volume	For example: one package may exceed the MAV for every 12 packages in the sample (e.g., when the sample size is 12 or less, 1 package may exceed the MAV and when the sample size is 48 packages, 4 packages may exceed the MAV).
Packaged Firewood and Packages Labeled By Count with Less Than 50 Items	MAVs are not applied to these packages.

Table 2-11. Accuracy Requirements for Packages Labeled by Low Count (50 or Less) and **Packages Given Tolerances (Glass and Stemware)** For Packages **For Packages Given Tolerances** (Glasses and Stemware) Labeled by Low Sample **Inspection Lot** Count Size Size (50 or Less) **Number of Package Errors that May Exceed the Number of Packages Allowed to Contain** Allowable Difference Less than the **Labeled Count** 1 - 11 1-11 0 12 - 250 0 12 1 251 – 3 200 24 2 1 More than 3 200 48 3 2

## **Appendix B. Random Number Tables**

Reproduced from <u>Million Random Digits</u>, used with permission of the Rand Corporation, Copyright, 1955, The Free Press. The publication is available for free on the Internet at <a href="http://www.rand.org/publications/classics/randomdigits">http://www.rand.org/publications/classics/randomdigits</a>.

All of the sampling plans presented in this handbook are based on the assumption that the packages constituting the sample are chosen at random from the inspection lot. Randomness in this instance means that every package in the lot has an equal chance of being selected as part of the sample. It does not matter what other packages have already been chosen, what the package net contents are, or where the package is located in the lot.

To obtain a random sample, two steps are necessary. First it is necessary to identify each package in the lot of packages with a specific number whether on the shelf, in the warehouse, or coming off the packaging line. Then it is necessary to obtain a series of random numbers. These random numbers indicate exactly which packages in the lot shall be taken for the sample.

#### The Random Number Table

The random number tables in Appendix B are composed of the digits from 0 through 9, with approximately equal frequency of occurrence. This appendix consists of 8 pages. On each page digits are printed in blocks of five columns and blocks of five rows. The printing of the table in blocks is intended only to make it easier to locate specific columns and rows.

#### **Random Starting Place**

Starting Page. The Random Digit pages numbered B-2 through B-8. You can use the day of the week to determine the starting page or use the first page for the first lot you test in a location, the second page for the second lot and so on moving to the following page for each new lot.

Starting Column and Row. You may choose a starting page in the random number table and with eyes closed, drop a pencil anywhere on the page to indicate a starting place in the table.

For example, assume that testing takes place on the 3rd day of the week. Start with Table 3 of Appendix B. Assume you dropped your pencil on the page and it has indicated a starting place at column 22, row 45. That number is 1.

If 1-digit random numbers are needed, record them, going down the column to the bottom of the page and then to the top of the next column, and so on. Ignore duplicates and record zero (0) as ten (10). Following on from the last example, these numbers are 3, 2, 9, 8, etc. If two-digit random numbers are needed, rule off the pages, and further pages if necessary, in columns of two digits each. If there is a single column left on the page, ignore this column, and rule the next page in columns of two. Again, ignore duplicate numbers and record 00 as 100. For example, using the same starting place as in the last example (Table 3, column 22, row 45), the recorded two-digit recorded numbers would be 11, 34, 26, 95, etc.. When three-digit numbers are needed, rule the page in columns of three. Record 000 as 1000. Starting on Table 3, column 22, row 45, the recorded numbers would be 119, 346, 269, 959, etc..

**TABLE 1 - RANDOM DIGITS** 

11164	36318	75061	37674	26320	75100	10431	20418	19228	91792
21215	91791	76831	58678	87054	31687	93205	43685	19732	08468
10438	44482	66558	37649	08882	90870	12462	41810	01806	02977
36792	26236	33266	66583	60881	97395	20461	36742	02852	50564
73944	04773	12032	51414	82384	38370	00249	80709	72605	67497
49563	12872	14063	93104	78483	72717	68714	18048	25005	04151
64208	48237	41701	73117	33242	42314	83049	21933	92813	04763
51486	72875	38605	29341	80749	80151	33835	52602	79147	08868
99756	26360	64516	17971	48478	09610	04638	17141	09227	10606
71325	55217	13015	72907	00431	45117	33827	92873	02953	85474
11323	33217	13013	12901	00431	43117	33621	92013	02933	03474
65285	97198	12138	53010	94601	15838	16805	61004	43516	17020
17264	57327	38224	29301	31381	38109	34976	65692	98566	29550
95639	99754	31199	92558	68368	04985	51092	37780	40261	14479
61555	76404	86210	11808	12841	45147	97438	60022	12645	62000
78137	98768	04689	87130	79225	08153	84967	64539	79493	74917
10131	70700	04007	07130	17223	00133	04707	04337	17473	77717
<b>60</b> 400	00015	0.4005	20550	10155	1 4500	24550	2006	50004	20.400
62490	99215	84987	28759	19177	14733	24550	28067	68894	38490
24216	63444	21283	07044	92729	37284	13211	37485	10415	36457
16975	95428	33226	55903	31605	43817	22250	03918	46999	98501
59138	39542	71168	57609	91510	77904	74244	50940	31553	62562
29478	59652	50414	31966	87912	87154	12944	49862	96566	48825
96155	95009	27429	72918	08457	78134	48407	26061	58754	05326
						04014			03024
29621	66583	62966	12468	20245	14015		35713	03980	
12639	75291	71020	17265	41598	64074	64629	63293	53307	48766
14544	37134	54714	02401	63228	26831	19386	15457	17999	18306
83403	88827	09834	11333	68431	31706	26652	04711	34593	22561
67642	05204	30697	44806	96989	68403	85621	45556	35434	09532
64041	99011	14610	40273	09482	62864	01573	82274	81446	32477
17048	94523	97444	59904	16936	39384	97551	09620	63932	03091
93039	89416	52795	10631	09728	68202	20963	02477	55494	39563
82244	34392	96607	17220	51984	10753	76272	50985	97593	34320
02211	31372	70007	17220	31701	10755	70272	20702	71373	31320
0.5000	~~~	<b>5</b> 0.602	25255	40020	22200	10010	05150	60150	01.60
96990	55244	70693	25255	40029	23289	48819	07159	60172	81697
09119	74803	97303	88701	51380	73143	98251	78635	27556	20712
57666	41204	47589	78364	38266	94393	70713	53388	79865	92069
46492	61594	26729	58272	81754	14648	77210	12923	53712	87771
08433	19172	08320	20839	13715	10597	17234	39355	74816	03363
10011	75004	86054	41190	10061	19660	03500	68412	57812	57929
				10683			84750		
92420	65431	16530	05547		88102	30176		10115	69220
35542	55865	07304	47010	43233	57022	52161	82976	47981	46588
86595	26247	18552	29491	33712	32285	64844	69395	41387	87195
			99137		06204				
72115	34985	58036	99137	47482	06204	24138	24272	16196	04393
07428	58863	96023	88936	51343	70958	96768	74317	27176	29600
35379	27922	28906	55013	26937	48174	04197	36074	65315	12537
		10920	26299						
10982	22807			23593	64629	57801	10437	43965	15344
90127	33341	77806	12446	15444	49244	47277	11346	15884	28131
63002	12990	23510	68774	48983	20481	59815	67248	17076	78910
40779	86382	48454	65269	91239	45989	45389	54847	77919	41105
43216	12608	18167	84631	94058	82458	15139	76856	86019	47928
96167	64375	74108	93643	09204	98855	59051	56492	11933	64958
70975	62693	35684	72607	23026	37004	32989	24843	01128	74658
85812	61875	23570	75754	29090	40264	80399	47254	40135	69916

**TABLE 2 – RANDOM DIGITS** 

40603	16152	83235	37361	98783	24838	39793	80954	76865	32713
40941	53585	69958	60916	71018	90561	84505	53980	64735	85140
73505	83472	55953	17957	11446	22618	34771	25777	27064	13526
39412	16013	11442	89320	11307	49396	39805	12249	57656	88686
57994	76748	54627	48511	78646	33287	35524	54522	08795	56273
31774	70740	34027	40311	70040	33267	33324	34322	00193	30273
(1024	50100	15469	02205	04164	01222	00054	07106	21500	25042
61834	59199		82285	84164	91333	90954	87186	31598	25942
91402	77227	79516	21007	58602	81418	87838	18443	76162	51146
58299	83880	20125	10794	37780	61705	18276	99041	78135	99661
40684	99948	33880	76413	63839	71371	32392	51812	48248	96419
75978	64298	08074	62055	73864	01926	78374	15741	74452	49954
34556	39861	88267	76068	62445	64361	78685	24246	27027	48239
65990	57048	25067	77571	77974	37634	81564	98608	37224	49848
16381	15069	25416	87875	90374	86203	29677	82543	37554	89179
52458	88880	78352	67913	09245	47773	51272		99571	
							06976		33365
33007	85607	92008	44897	24964	50559	79549	85658	96865	24186
38712	31512	08588	61490	72294	42862	87334	05866	66269	43158
58722	03678	19186	69602	34625	75958	56869	17907	81867	11535
26188	69497	51351	47799	20477	71786	52560	66827	79419	70886
12893	54048	07255	86149	99090	70958	50775	31768	52903	27645
33186	81346	85095	37282	85536	72661	32180	40229	19209	74939
79893	29448	88392	54211	61708	83452	61227	81690	42265	20310
48449	15102	44126	19438	23382	14985	37538	30120	82443	11152
94205	04259	68983	50561	06902	10269	22216	70210	60736	58772
38648	09278	81313	77400	41126	52614	93613	27263	99381	49500
04292	46028	75666	26954	34979	68381	45154	09314	81009	05114
04292	40028	/3000	20934	34979	00301	43134	09314	81009	03114
17026	49737	85875	12139	59391	81830	30185	83095	78752	40899
48070	76848	02531	97737	10151	18169	31709	74842	85522	74092
30159	95450	83778	46115	99178	97718	98440	15076	21199	20492
12148	92231	31361	60650	54695	30035	22765	91386	70399	79270
73838	77067	24863	97576	01139	54219	02959	45696	98103	78867
73547	43759	95632	39555	74391	07579	69491	02647	17050	49869
07277	93217	79421	21769	83572	48019	17327	99638	87035	89300
65128	48334	07493	28098	52087	55519	83718	60904	48721	17522
38716	61380	60212	05099	21210	22052	01780	36813	19528	07727
31921	76458	73720	08657	74922	61335	41690	41967	50691	30508
01/21	, 0.00	70720	0000,	, .,	01000	.10,0	.1,0,	20071	20200
57238	27464	61487	52329	26150	79991	64398	91273	26824	94827
24219	41090	08531	61578	08236	41140	76335	91189	66312	44000
31309	49387	02330	02476	96074	33256	48554	95401	02642	29119
20750	97024	72619	66628	66509	31206	55293	24249	02266	39010
28537	84395	26654	37851	80590	53446	34385	86893	87713	26842
97929	41220	86431	94485	28778	44997	38802	56594	61363	04206
40568	33222	40486	91122	43294	94541	40988	02929	83190	74247
41483	92935	17061	78252	40498	43164	68646	33023	64333	64083
93040					37641	97613	87282	63693	55200
	66476	24990	41099	65135					55299
76869		24990 84978	41099 07504	36835	72748	47644	48542	25076	68626
76869	66476 39300	84978	07504	36835	72748	47644	48542	25076	68626
76869 02982	66476 39300 57991	84978 50765	07504 91930	36835 21375	72748 35604	47644 29963	48542 13738	25076 03155	68626 59914
76869 02982 94479	66476 39300 57991 76500	84978 50765 39170	07504 91930 06629	36835 21375 10031	72748 35604 48724	47644 29963 49822	48542 13738 44021	25076 03155 44335	68626 59914 26474
76869 02982 94479 52291	66476 39300 57991 76500 75822	50765 39170 95966	91930 06629 90947	36835 21375 10031 65031	72748 35604 48724 75913	47644 29963 49822 52654	48542 13738 44021 63377	25076 03155 44335 70664	59914 26474 60082
76869 02982 94479	66476 39300 57991 76500	84978 50765 39170	07504 91930 06629	36835 21375 10031	72748 35604 48724	47644 29963 49822	48542 13738 44021	25076 03155 44335	68626 59914 26474
76869 02982 94479 52291	66476 39300 57991 76500 75822	50765 39170 95966	91930 06629 90947	36835 21375 10031 65031	72748 35604 48724 75913	47644 29963 49822 52654	48542 13738 44021 63377	25076 03155 44335 70664	59914 26474 60082

**TABLE 3 – RANDOM DIGITS** 

37100	62492	63642	47638	13925	80113	88067	42575	44078	62703
53406	13855	38519	29500	62479	01036	87964	44498	07793	21599
55172	81556	18856	59043	64315	38270	25677	01965	21310	28115
40353	84807	47767	46890	16053	32415	60259	99788	55924	22077
18899	09612	77541	57675	70153	41179	97535	82889	27214	03482
68141	25340	92551	11326	60939	79355	41544	88926	09111	86431
51559	91159	81310	63251	91799	41215	87412	35317	74271	11603
92214	33386	73459	79359	65867	39269	57527	69551	17495	91456
15089	50557	33166	87094	52425	21211	41876	42525	36625	63964
96461	00604	11120	22254	16763	19206	67790	88362	01880	37911
28177	44111	15705	73835	69399	33602	13660	84342	97667	80847
66953	44737	81127	07493	07861	12666	85077	95972	96556	80108
19712	27263	84575	49820	19837	69985	34931	67935	71903	82560
68756	64757	19987	92222	11691	42502	00952	47981	97579	93408
75022	65332	98606	29451	57349	39219	08585	31502	96936	96356
75022	03332	70000	27 131	37317	3,21,	00505	31302	70750	70550
11323	70069	90269	89266	46413	61615	66447	49751	15836	97343
55208	63470	18158	25283	19335	53893	87746	72531	16826	52605
11474	08786	05594	67045	13231	51186	71500	50498	59487	48677
81422	86842	60997	79669	43804	78690	58358	87639	24427	66799
21771	75963	23151	90274	08275	50677	99384	94022	84888	80139
12279	12160	32576	14278	34231	20724	27908	02657	19023	07190
42278 17697	60114	63247	32096	32503	04923	17570	73243	76181	99343
05686	30243	34124	02936	32303 71749	03031	72259	26351	77511	00850
52992	46650	89910	57395	39502	49738	87854	71066	84596	33115
94518	93984	81478	57393 67750	89354	01080	25988	84359	31088	13655
94318	93964	014/0	07730	89334	01080	23900	64339	31000	13033
00184	72186	78906	75480	71140	15199	69002	08374	22126	23555
87462	63165	79816	61630	50140	95319	79205	79202	67414	60805
88692	58716	12273	48176	86038	78474	76730	82931	51595	20747
20094	42962	41382	16768	13261	13510	04822	96354	72001	68642
60935	81504	50520	82153	27892	18029	79663	44146	72876	67843
51202	05026	12000	50506	01101	00100	60106	5.4051	12050	62520
51392	85936	43898	50596	81121	98122	69196	54271	12059	62539
54239	41918	79526	46274	24853	67165	12011	04923	20273	89405
57892 02330	73394 74736	07160 53274	90262 44468	48731 53616	46648 35794	70977 54838	58262 39114	78359 68302	50436 26855
76115	29247	55342	51299	79908	36613	54656 68361	18864	13419	34950
70113	29247	33342	31299	19906	30013	00301	10004	13419	34930
63312	81886	29085	20101	38037	34742	78364	39356	40006	49800
27632	21570	34274	56426	00330	07117	86673	46455	66866	76374
06335	62111	44014	52567	79480	45886	92585	87828	17376	35254
64142	87676	21358	88773	10604	62834	63971	03989	21421	76086
28436	25468	75235	75370	63543	76266	27745	31714	04219	00699
00.500	02055	0.5050	1.5000	20554	15005	25.442	11161	12000	22.52.4
09522	83855	85973	15888	29554	17995	37443	11461	42909	32634
93714	15414	93712	02742	34395	21929	38928	31205	01838	60000
15681 77712	53599 23914	58185 08907	73840 43768	88758 10304	10618 61405	98725 53986	23146 61116	13521 76164	47905 54958
						02534			
78453	54844	61509	01245	91199	07482	02334	08189	62978	55516
24860	68284	19367	29073	93464	06714	45268	60678	58506	23700
37284	06844	78887	57276	42695	03682	83240	09744	63025	60997
35488	52473	37634	32569	39590	27379	23520	29714	03743	08444
51595	59909	35223	44991	29830	56614	59661	83397	38421	17503
90660	35171	30021	91120	78793	16827	89320	08260	09181	53616

**TABLE 4 – RANDOM DIGITS** 

54723 84828	56527 81248	53076 25548	38235 34075	42780 43459	22716 44628	36400 21866	48028 90350	78196 82264	92985 20478
65799	01914	81363	05173	23674	41774	25154	73003	87031	94368
87917	38549	48213	71708	92035	92527	55484	32274	87918	22455
26907	88173	71189	28377	13785	87469	35647	19695	33401	51998
68052	65422	88460	06352	42379	55499	60469	76931	83430	24560
42587	68149	88147	99700	56124	53239	38726	63652	36644	50876
97176	55416	67642	05051	89931	19482	80720	48977	70004	03664
53295	87133	38264	94708	00703	35991	76404	82249	22942	49659
23011	94108	29196	65187	69974	01970	31667	54307	40032	30031
7.7.40	40.5.40	24542	<220 F	22002	10201	00051	00201	02200	00001
75768	49549	24543	63285	32803	18301	80851	89301	02398	99891
86668	70341	66460	75648	78678	27770	30245	44775	56120	44235
56727	72036	50347	33521	05068	47248	67832	30960	95465	32217
27936	78010	09617	04408	18954	61862	64547	52453	83213	47833
31994	69072	37354	93025	38934	90219	91148	62757	51703	84040
02985	95303	15182	50166	11755	56256	89546	31170	87221	63267
89965	10206	95830	95406	33845	87588	70237	84360	19629	72568
45587	29611	98579	42481	05359	36578	56047	68114	58583	16313
01071	08530	74305	77509	16270	20889	99753	88035	55643	18291
90209	68521	14293	39194	68803	32052	39413	26883	83119	69623
04982	68470	27875	15480	13206	44784	83601	03172	07817	01520
19740	24637	97377	32112	74283	69384	49768	64141	02024	85380
50197	79869	86497	68709	42073	28498	82750	43571	77075	07123
46954	67536	28968	81936	95999	04319	09932	66223	45491	69503
82549	62676	31123	49899	70512	95288	15517	85352	21987	08669
61798	81600	80018	84742	06103	60786	01408	75967	29948	21454
57666	29055	46518	01487	30136	14349	56159	47408	78311	25896
29805	64994	66872	62230	41385	58066	96600	99301	85976	84194
06711	34939	19599	76247	87879	97114	74314	39599	43544	36255
13934	46885	58315	88366	06138	37923	11192	90757	10831	01580
28549	98327	99943	25377	17628	65468	07875	16728	22602	33892
40871	61803	99943 25767	55484	90997	86941	64027	01020	39518	34693
40871	38355	71708	80117	11361	88875	22315	38048	42891	34093 87885
62611	19698	09304	29265	07636	08508	23773	56545	08015	28891
03047	83981	11916	09267	67316	87952	27045	62536	32180	60936
03047	03701	11710	0)201	07510	01752	27043	02330	32100	00730
26460	50501	31731	18938	11025	18515	31747	96828	58258	97107
01764	25959	69293	89875	72710	49659	66632	25314	95260	22146
11762	54806	02651	52912	32770	64507	59090	01275	47624	16124
31736	31695	11523	64213	91190	10145	34231	36405	65860	48771
97155	48706	52239	21831	49043	18650	72246	43729	63368	53822
31181	49672	17237	04024	65324	32460	01566	67342	94986	36106
32115	82683	67182	89030	41370	50266	19505	57724	93358	49445
07068	75947	71743	69285	30395	81818	36125	52055	20289	16911
26622	74184	75166	96748	34729	61289	36908	73686	84641	45130
02805	52676	22519	47848	68210	23954	63085	87729	14176	45410
32301	58701	04193	30142	99779	21697	05059	26684	63516	75925
26339	56909	39331	42101	01031	01947	02257	47236	19913	90371
95274	09508	81012	42413	11278	19354	68661	04192	36878	84366
24275	39632	09777	98800	48027	96908	08177	15364	02317	89548
36116	42128	65401	94199	51058	10759	47244	99830	64255	40516
	0			2 2 0 0 0	- 3. 37				. 55 10

**TABLE 5 – RANDOM DIGITS** 

47505	02008	20300	87188	42505	40294	04404	59286	95914	07191
13350	08414	64049	94377	91059	74531	56228	12307	87871	97064
33006	92690	69248	97443	38841	05051	33756	24736	43508	53566
55216	63886	06804	11861	30968	74515	40112	40432	18682	02845
21991	26228	14801	19192	45110	39937	81966	23258	99348	61219
71025	28212	10474	27522	16356	78456	46814	28975	01014	91458
65522	15242	84554	74560	26206	49520	65702	54193	25583	54745
27975	54923	90650	06170	99006	75651	77622	20491	53329	12452
07300	09704	36099	61577	34632	55176	87366	19968	33986	46445
54357	13689	19569	03814	47873	34086	28474	05131	46619	41499
00977	04481	42044	08649	83107	02423	46919	59586	58337	32280
13920	78761	12311	92808	71581	85251	11417	85252	61312	10266
08395	37043	37880	34172	80411	05181	58091	41269	22626	64799
46166	67206	01619	43769	91727	06149	17924	42628	57647	76936
87767	77607	03742	01613	83528	66251	75822	83058	97584	45401
29880	95288	21644	46587	11576	30568	56687	83239	76388	17857
36248	36666	14894	59273	04518	11307	67655	08566	51759	41795
12386	29656	30474	25964	10006	86382	46680	93060	52337	56034
52068	73801	52188	19491	76221	45685	95189	78577	36250	36082
41727	52171	56719	06054	34898	93990	89263	79180	39917	16122
49319	74580	57470	14600	22224	49028	93024	21414	90150	15686
88786	76963	12127	25014	91593	98208	27991	12539	14357	69512
84866	95202	43983	72655	89684	79005	85932	41627	87381	38832
11849	26482	20461	99450	21636	13337	55407	01897	75422	05205
54966	17594	57393	73267	87106	26849	68667	45791	87226	74412
10959	33349	80719	96751	25752	17133	32786	34368	77600	41809
22784	07783	35903	00091	73954	48706	83423	96286	90373	23372
86037	61791	33815	63968	70437	33124	50025	44367	98637	40870
80037	65089	85919	74391	36170	82988	52311	59180	37846	98028
72751	84359	15769	13615	70866	37007	74565	92781	37770	76451
18532	03874	66220	79050	66814	76341	42452	65365	07167	90134
22936	22058	49171	11027	07066	14606	11759	19942	21909	15031
66397	76510	81150	00704	94990	68204	07242	82922	65745	51503
89730	23272	65420	35091	16227	87024	56662	59110	11158	67508
81821	75323	96068	91724	94679	88062	13729	94152	59343	07352
94377	82554	53586	11432	08788	74053	98312	61732	91248	23673
68485	49991	53165	19865	30288	00467	98105	91483	89389	61991
07330	07184	86788	64577	47692	45031	36325	47029	27914	24905
10993	14930	35072	36429	26176	66205	07758	07982	33721	81319
20801	15178	64453	83357	21589	23153	60375	63305	37995	66275
79241	35347	66851	79247	57462	23893	16542	55775	06813	63512
43593	39555	97345	58494	52892	55080	19056	96192	61508	23165
29522	62713	33701	17186	15721	95018	76571	58615	35836	66260
88836	47290	67274	78362	84457	39181	17295	39626	82373	10883
65905	66253	91482	30689	81313	01343	37188	37756	04182	19376
44798	69371	07865	91756	42318	63601	53872	93610	44142	89830
35510	99139	32031	27925	03560	33806	85092	70436	94777	57963
50125	93223	64209	49714	73379	89975	38567	44316	60262	10777
25173	90038	63871	40418	23818	63250	05118	52700	92327	55449
68459	90094	44995	93718	83654	79311	18107	12557	09179	28416

TABLE 6 – RANDOM DIGITS

96195 22408	07059 94958	13266 19095	31389 58035	87612 43831	88004 32354	31843 83946	83469 57964	22793 70404	14312 32017
53896	23508	16227	56929	74329	12264	26047	66844	47383	42202
22565	02475	00258	79018	70090	37914	27755	00872	71553	56684
49438	20772	60846	69732	07612	70474	46483	21053	95475	53448
65620	34684	00210	04863	01373	19978	61682	69315	46766	83768
20246	26941	41298	04763	19769	25865	95937	03545	93561	73871
09433	09167	35166	32731	73299	41137	37328	28301	61629	05040
95552	73456	16578	88140	80059	50296	07656	01396	83099	09718
76053	05150	69125	69442	16509	03495	26427	58780	27576	31342
34822	35843	78468	82380	52313	71070	71273	10768	86101	51474
07753	04073	58520	80022	28185	16432	86909	82347	10548	83929
04204	94434	62798	81902	29977	57258	87826	35003	46449	76636
96770	19440	29700	42093	64369	69176	29732	37389	34054	28680
65989	62843	10917	34458	81936	84775	39415	10622	36102	16753
06644	94784	66995	61812	54215	01336	75887	57685	66114	76984
88950	46077	34651	12038	87914	20785	39705	73898	12318	78334
21482	95422	02002	33671	46764	50527	46276	77570	68457	62199
55137	61039	02006	69913	11291	87215	89991	26003	55271	08153
98441	81529	59607	65225	49051	28328	85535	37003	87211	10204
57168	30458	23892	07825	53447	53511	09315	42552	43135	57892
71886	65334	38013	09379	83976	42441	14086	33197	82671	05037
40418	59504	52383	07232	14179	59693	37668	26689	93865	78925
28833	76661	47277	92935	63193	94862	60560	72484	29755	40894
37883	62124	62199	49542	55083	20575	44636	92282	52105	77664
44882	33592	66234	13821	86342	00135	87938	57995	34157	99858
19082	13873	07184	21566	95320	28968	31911	06288	77271	76171
45316	29283	89318	55806	89338	79231	91545	55477	19552	03471
22788	55433	31188	74882	44858	69655	08096	70982	61300	23792
08293	86193	05026	21255	63082	92946	28748	25423	45282	57821
29223	70541	67115	84584	10100	33854	26466	77796	70698	99393
22681	80110	31595	09246	39147	11158	43298	36220	88841	11271
74580	90354	43744	22178	38084	60027	24201	71686	59767	33274
69093	71364	08107	96952	50005	30297	97417	89575	04676	35616
40456	91234	58090	65342	95002	28447	21'700	43137	13746	85959
72927	67349	83962	58912	59734	76323	02913	46306	53956	38936
61869	33093	81129	06481	89281	83629	81960	63704	56329	10357
40048	16520	07638	10797	22270	57350	72214	36410	95526	87614
68773	97669	28656	89938	12917	25630	08068 76804	19445	76250	24727 70493
09774	30751	49740	11385	91468	28900	70804	52460	52320	70493
46139	36689	82587	13586	35061	76128	38568	62300	43439	53434
26566	95323	32993	89988	12152	01862	93113	33875	31730	62941
06765	57141	48617	18282	13086	76064	83334	70192	15972	80429
35384	90380	12317	89702	33091	68835	62960	38010	52710	87604
49333	78482	36199	11355	86044	88760	03724	22927	91716	92332
4.5.5.	1.40.4.1	# coc :	0017	0.5.50	0====	<b>5</b> 0115	2277	4027=	<b>5</b> 015
45595	14044	56806	99126	85584	87750	78149	22723	48245	78126
79819	15054	76174	12206	06886	06814	43285	20008	75345	19779
11971	62234	74857 53084	46401	20817	57591 74101	41189	49604 76536	29604 58303	30660
11452 38746	89318 81271	53084 96260	21993 98137	62471 60275	74101 22647	61217 33103	50090	58393 29395	63718 10016
30740	012/1	20200	70137	00273	22047	22103	20030	ムランプン	10010

**TABLE 7 – RANDOM DIGITS** 

19360         55049         94951         76341         38159         31008         41476         05278         03909         026823         32007         03513         61149         66270         73087         16795         76845         44645         44645         43511         50721         84850         34159         38985         75384         22965         55366         81632         788           54031         59329         58963         52220         76806         98715         67452         78741         58186         37350         93614         31706         66722         85515         4773         2411         03834         12109         81855         37350         93614         3218         23944         48478         86066         31135         33243         01190         47277         55146         56130         70117         832         22982         25936         96417         34845         28942         65569         38253         77182         12996         195484         24824         65569         38253         77182         12996         195484         24941         27532         25588         94802         75332         95585         69542         799         38349         1606										
19360         55049         94951         76341         38159         31008         41476         05278         03909         026923         32007         03513         61149         66270         73087         16795         76845         44645         44645         43511         50721         84850         34159         38985         75384         22965         55366         81632         788           54031         59329         58963         52220         76806         98715         67452         78741         58185         37350         93614         3170         76786         76782         85155         73350         93614         3199         44991         45777         702070         38159         239         45478         86066         31135         33243         01190         47277         55146         56130         70117         832         22982         25936         96417         34845         28942         65569         38253         77182         12996         195         48243         62993         47132         88248         79160         9981         71696         79609         33809         608         93674         7979         78814         14915         67960         82203	02260	12044	(0(0(	70160	20122	51544	17005	5.7720	22692	02152
47798         89890         06893         65483         97658         74884         38611         27264         26956         835           69223         32007         03513         61149         66270         73087         16795         76845         44645         445           34511         50721         84880         34159         38985         75384         22965         55366         81632         788           54031         59329         58963         52220         76806         98715         67452         78741         58128         000           66722         85515         04723         92411         03834         12109         85185         37350         93614         138           71059         07466         38404         18126         37894         44991         45777         02070         38159         239           45478         80666         31135         33243         01190         47277         55146         56118         3239           48243         69934         7132         85248         79160         9081         71696         79609         33309         1616         01542         51771         16833         20922         <	93369				29132	51544	1/925	56/38		83153
47798         89890         06893         65483         97658         74884         38611         27264         26956         835           69223         32007         03513         61149         66270         73087         16795         76845         44645         445           34511         50721         84880         34159         38985         75384         22965         55366         81632         788           54031         59329         58963         52220         76806         98715         67452         78741         58128         000           66722         85515         04723         92411         03834         12109         85185         37350         93614         138           71059         07466         38404         18126         37894         44991         45777         02070         38159         239           45478         80666         31135         33243         01190         47277         55146         56118         3239           48243         69934         7132         85248         79160         9081         71696         79609         33309         1616         01542         51771         16833         20922         <	19360	55049	94951	76341	38159	31008	41476	05278	03909	02299
69223         32007         03513         61149         66270         73087         16795         76845         44645         445           34511         50721         84850         34159         38985         75384         22965         55366         81632         788           54031         59329         85963         522220         7680         8715         67452         78741         58185         37350         93614         153           71059         07496         38404         18126         37894         44991         45777         02070         38159         239           97246         91121         89437         20393         76598         99458         76665         83733         37448         326           48243         62993         47132         85248         79160         9981         71690         79699         33809         668           93514         14915         67960         82203         22598         94802         75332         95585         69542         799           9375         30502         44868         81279         23585         49678         70014         105           81458         83315         8326	17708				07658	7/188/	38611	27264		83504
34511         50721         84850         34159         38985         75384         22965         55366         81632         788           54031         59329         58963         52220         76806         98715         67452         78741         58128         000           66722         85515         04723         92411         03834         12109         85185         37350         93614         133           71059         70496         38404         18126         37894         44991         45777         702070         38159         239           45478         86066         31135         33243         01190         47277         55146         56130         70117         832           22982         25936         96417         34845         28942         65569         38253         77182         12996         195           48243         62993         47132         85248         79160         90981         71696         79609         33809         608           93514         14915         67960         82203         22598         94802         75332         95585         69542         7999           87467         91794 <td< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></td<>										
54031         59329         58963         52220         76806         98715         67452         78741         58128         000           66722         85515         04723         92411         03834         12109         85185         37350         93614         153           71059         07496         38404         18126         37894         44991         45777         02070         38159         239           45478         86066         31135         33243         01190         47277         55146         56130         70117         823           97246         91121         89437         20393         76598         99458         76665         83793         37448         326           48243         62993         44115         67960         82203         22598         94802         75332         95585         69542         799           93514         14915         67960         82203         22598         94802         75332         95855         69542         799           87467         91794         70814         12743         17543         04057         71231         11309         32780         832           81068         8										44552
54031         59329         58963         52220         76806         98715         67452         78741         58128         0066722         85515         04723         92411         03834         12109         85185         37350         93614         133           71059         07496         38404         18126         37894         44991         45777         02070         38159         239           45478         86066         31135         33243         01190         47277         55146         56130         70117         832           97246         91121         89437         20393         76598         99458         76665         83793         37448         326           22982         25936         96417         34845         28942         65569         38253         77182         12996         195           48243         62993         47132         85248         79160         90981         71696         79609         33809         668942         799           93514         14915         67960         82203         22598         94802         75332         95855         69542         799           87167         91784         70814	34511	50721	84850	34159	38985	75384	22965	55366	81632	78872
66722         85151         04723         92411         03834         412109         85185         37350         93614         135           71059         07496         38404         18126         37894         44991         45777         02070         38159         239           45478         86066         31135         33243         01190         47277         55146         56130         70117         832           97246         91121         89437         20393         76598         99458         76665         83793         37448         326           22982         25936         96417         34845         28942         65569         38253         77182         12996         195           48243         62993         47132         825248         79160         9081         71696         79609         33809         608           93514         14915         67960         82203         22598         94802         75332         95855         69542         799           69707         98303         93069         16216         01542         51771         16833         20922         94415         276           87467         91794										
66722         85151         04723         92411         03834         412109         85185         37350         93614         135           71059         07496         38404         18126         37894         44991         45777         02070         38159         239           45478         86066         31135         33243         01190         47277         55146         56130         70117         832           97246         91121         89437         20393         76598         99458         76665         83793         37448         326           22982         25936         96417         34845         28942         65569         38253         77182         12996         195           48243         62993         47132         825248         79160         9081         71696         79609         33809         608           93514         14915         67960         82203         22598         94802         75332         95855         69542         799           69707         98303         93069         16216         01542         51771         16833         20922         94415         276           87467         91794	54021	50220	£90 <i>6</i> 2	52220	76906	00715	(745)	70741	50120	00077
71059         07496         38404         18126         37894         44991         45777         02070         38159         239           45478         86066         31135         33243         01190         47277         55146         56130         70117         832           97246         91121         89437         20393         76598         99458         76665         83793         37448         326           48243         62993         47132         85248         79160         90981         71696         79609         33809         608           93514         14915         67960         82203         22598         94802         75332         95585         69542         799           87467         91794         70814         12743         17543         04057         71231         11309         32780         832           81006         81498         59375         30502         44868         81279         23585         49678         70014         105           15458         83481         50187         43375         56644         72076         59403         65469         74760         6953           67198         07176										
45478         86066         31135         33243         01190         47277         55146         56130         70117         832           97246         91121         89437         20393         76598         99458         76665         83793         37448         326           22982         25936         96417         34845         28942         65569         38253         77182         12996         195           48243         62993         47132         85248         79160         90981         71696         79609         33809         608           69707         98303         39069         16216         01542         51771         16833         20922         94415         276           87467         91794         70814         12743         17543         04057         71231         11309         32780         832           81006         81498         59375         30502         44868         81279         23585         49678         70014         105           15458         83481         50187         43375         56644         72076         59403         65469         74760         695           33469         12510         3	66722	85515	04723	92411	03834	12109	85185	37350	93614	15351
45478         86066         31135         33243         01190         47277         55146         56130         70117         832           97246         91121         89437         20393         76598         99458         76665         83793         37448         326           22982         25936         96417         34845         28942         65569         38253         77182         12996         195           48243         62993         47132         85248         79160         90981         71696         79609         33809         608           69707         98303         39069         16216         01542         51771         16833         20922         94415         276           87467         91794         70814         12743         17543         04057         71231         11309         32780         832           81006         81498         59375         30502         44868         81279         23585         49678         70014         105           15458         83481         50187         43375         56644         72076         59403         65469         74760         695           33469         12510         3	71059	07496	38404	18126	37894	44991	45777	02070	38159	23930
97246         91121         89437         20393         76598         99458         76665         83793         37448         326           22982         25936         96417         34845         28942         65569         38253         77182         12996         195           48243         62993         47132         85248         79160         90981         71696         79609         33809         608           93514         14915         67960         8203         22598         94802         75332         95585         69542         799           67077         98303         39069         16216         01542         51771         16833         2092         24415         278           81006         81498         59375         30502         44868         81279         23585         49678         70014         105           15458         83481         50187         43375         56644         72076         59403         65469         74760         695           33469         12510         23095         48016         22064         39774         07373         10555         33345         217           67198         7176         6599										
22982         25936         96417         34845         28942         65569         38253         77182         12996         1954           48243         62993         47132         85248         79160         90981         71696         79609         33809         608           93514         14915         67960         82203         22598         94802         75332         95585         69542         799           69707         98303         93069         16216         01542         51771         16833         20922         94415         276           87467         91794         70814         12743         17543         04057         71231         11309         32780         822           81006         81498         59375         30502         44868         81279         23585         49678         70014         1053           15458         83481         50187         43375         56644         72076         59403         65469         74760         695           33469         12510         23095         48016         22044         39774         07373         10555         33345         217           67176         65936 <td< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></td<>										
48243         62993         47132         85248         79160         90981         71696         79609         33809         608           93514         14915         67960         82203         22598         94802         75332         95585         69542         799           67070         98303         93069         16216         01542         51771         16833         2092         94415         276           87467         91794         70814         12743         17543         04057         71231         11309         32780         832           81006         81498         59375         30502         44868         81279         23585         49678         70014         105           15458         83481         50187         43375         56644         72076         59403         65469         74760         695           33469         12510         23095         48016         22064         39774         07373         10555         33345         217           67198         67176         65996         18317         83083         11921         06254         68437         59481         547           58037         92261         85	97246	91121	89437	20393	76598	99458	76665	83793	37448	32664
48243         62993         47132         85248         79160         90981         71696         79609         33809         608           93514         14915         67960         82203         22598         94802         75332         95585         69542         799           67070         98303         93069         16216         01542         51771         16833         2092         94415         276           87467         91794         70814         12743         17543         04057         71231         11309         32780         832           81006         81498         59375         30502         44868         81279         23585         49678         70014         105           15458         83481         50187         43375         56644         72076         59403         65469         74760         695           33469         12510         23095         48016         22064         39774         07373         10555         33345         217           67198         67176         65996         18317         83083         11921         06254         68437         59481         547           58037         92261         85										
48243         62993         47132         85248         79160         90981         71696         79609         33809         608           93514         14915         67960         82203         22598         94802         75332         95585         69542         799           67070         98303         93069         16216         01542         51771         16833         2092         94415         276           87467         91794         70814         12743         17543         04057         71231         11309         32780         832           81006         81498         59375         30502         44868         81279         23585         49678         70014         105           15458         83481         50187         43375         56644         72076         59403         65469         74760         695           33469         12510         23095         48016         22064         39774         07373         10555         33345         217           67198         67176         65996         18317         83083         11921         06254         68437         59481         547           58037         92261         85	22982	25936	96417	34845	28942	65569	38253	77182	12996	19505
93514         14915         67960         82203         22598         94802         75332         95585         69542         799           69707         98303         93069         16216         01542         51771         16833         20922         94415         276           87467         91794         70814         12743         17543         04057         71231         11309         32780         832           81006         81498         59375         30502         44868         81279         23585         49678         70014         105           15458         83481         50187         43375         56644         72076         59403         65469         74760         695           33469         12510         23095         48016         22064         39774         07373         10555         33345         217           67198         07176         65996         18317         33083         11921         06254         68437         59481         547           58037         92261         85504         55690         63488         26451         43223         3809         50567         091           44983         68312         25										
69707         98303         93069         16216         01542         51771         16833         20922         94415         276           87467         91794         70814         12743         17543         04057         71231         11309         32780         832           81006         81498         59375         30502         44868         81279         23585         49678         70014         105           15458         83481         50187         43375         56644         72076         59403         65469         74760         696           67198         07176         65996         18317         83083         11921         06254         68437         59481         547           58037         92261         85504         55690         63488         26451         43223         38009         50567         091           84983         68312         25519         56158         22390         12823         92390         28947         36708         253           35554         02935         72889         68772         79774         14336         50716         63003         86391         940           43823         89887         5										60839
87467         91794         70814         12743         17543         04057         71231         11309         32780         832           81006         81498         59375         30502         44868         81279         23585         49678         70014         105           15458         83481         50187         43375         56644         72076         59403         65469         74760         695           33469         12510         23095         48016         22064         39774         07373         10555         33345         217           67198         07176         65996         18317         83083         11921         06254         68437         59481         547           58037         92261         85504         55690         63488         26451         43223         38009         50567         091           84983         68312         25519         56158         22390         12823         92390         28947         36708         253           35554         02935         72889         68772         79774         14336         50716         63003         86391         940           04368         17632         5	93514	14915	67960	82203	22598	94802	75332	95585	69542	79924
87467         91794         70814         12743         17543         04057         71231         11309         32780         832           81006         81498         59375         30502         44868         81279         23585         49678         70014         105           15458         83481         50187         43375         56644         72076         59403         65469         74760         695           33469         12510         23095         48016         22064         39774         07373         10555         33345         217           67198         07176         65996         18317         83083         11921         06254         68437         59481         547           58037         92261         85504         55690         63488         26451         43223         38009         50567         091           84983         68312         25519         56158         22390         12823         92390         28947         36708         253           35554         02935         72889         68772         79774         14336         50716         63003         86391         940           04368         17632         5	69707	98303	93069	16216	01542	51771	16833	20922	94415	27617
81006         81498         59375         30502         44868         81279         23585         49678         70014         105           15458         83481         50187         43375         56644         72076         59403         65469         74760         695           33469         12510         23095         48016         22064         39774         07373         10555         33345         217           67198         07176         65996         18317         83083         11921         06254         68437         59481         547           58037         92261         85504         55690         63488         26451         43223         38009         50567         091           84983         68312         25519         56158         22390         12823         92390         28947         36708         233           35554         02935         72889         68772         79774         14336         50716         63003         86391         940           438111         60479         69985         30952         93067         70056         55229         83226         22555         664           93233         89887										
15458         83481         50187         43375         56644         72076         59403         65469         74760         695           33469         12510         23095         48016         22064         39774         07373         10555         33345         217           67198         07176         65996         18317         83083         11921         06254         68437         59481         547           58037         92261         85504         55690         63488         26451         43223         38009         50567         091           84983         68312         25519         56158         22390         12823         92390         28947         36708         233           35554         02935         72889         68772         79774         14365         5016         63003         86391         940           438811         60479         69985         30952         93067         70056         55229         83226         22555         664           03823         89887         55828         74452         21692         55847         15960         47521         27784         257           80422         65437         3	8/46/	91/94	/0814	12/43	1/543	04057	/1231	11309	32/80	83270
15458         83481         50187         43375         56644         72076         59403         65469         74760         695           33469         12510         23095         48016         22064         39774         07373         10555         33345         217           67198         07176         65996         18317         83083         11921         06254         68437         59481         547           58037         92261         85504         55690         63488         26451         43223         38009         50567         091           84983         68312         25519         56158         22390         12823         92390         28947         36708         233           35554         02935         72889         68772         79774         14365         5016         63003         86391         940           438811         60479         69985         30952         93067         70056         55229         83226         22555         664           03823         89887         55828         74452         21692         55847         15960         47521         27784         257           80422         65437         3										
33469         12510         23095         48016         22064         39774         07373         10555         33345         217           67198         07176         65996         18317         83083         11921         06254         68437         59481         547           58037         92261         85504         55690         63488         26451         43223         38009         50567         091           84983         68312         25519         56158         22390         12823         92390         28947         36708         253           35554         02935         72889         68772         79774         14336         50716         63003         86391         940           04368         17632         50962         71908         13105         76285         31819         16884         11665         165           81311         60479         69985         30952         93067         70056         55229         83226         222555         664           03823         89887         55828         74452         21692         55847         15960         47521         27784         257           80422         65437	81006	81498	59375	30502	44868	81279	23585	49678	70014	10523
33469         12510         23095         48016         22064         39774         07373         10555         33345         217           67198         07176         65996         18317         83083         11921         06254         68437         59481         547           58037         92261         85504         55690         63488         26451         43223         38009         50567         091           84983         68312         25519         56158         22390         12823         92390         28947         36708         253           35554         02935         72889         68772         79774         14336         50716         63003         86391         940           04368         17632         50962         71908         13105         76285         31819         16884         11665         165           81311         60479         69985         30952         93067         70056         55229         83226         222555         664           03823         89887         55828         74452         21692         55847         15960         47521         27784         257           80422         65437	15458	83481	50187	43375	56644	72076	59403	65469	74760	69509
67198         07176         65996         18317         83083         11921         06254         68437         59481         547           58037         92261         85504         55690         63488         26451         43223         38009         50567         091           84983         68312         25519         56158         22390         12823         92390         28947         36708         253           35554         02935         72889         68772         79774         14336         50716         63003         86391         940           04368         17632         50962         71908         13105         76285         31819         16884         11665         165           81311         60479         69985         30952         93067         70056         55229         83226         22555         664           03823         89887         55828         74452         21692         55847         15960         47521         27784         237           80422         65437         38797         56261         88300         35980         56656         45662         29219         492           61307         49468         4										
58037         92261         85504         55690         63488         26451         43223         38009         50567         091           84983         68312         25519         56158         22390         12823         92390         28947         36708         253           35554         02935         72889         68772         79774         14336         50716         63003         86391         940           04368         17632         50962         71908         13105         76285         31819         16884         11665         165           81311         60479         69985         30952         93067         70056         55229         83226         22555         664           03823         89887         55828         74452         21692         55847         15960         47521         27784         257           80422         65437         38797         56261         88300         35980         56656         45662         29219         492           61307         49468         43344         43700         14074         19739         03275         99444         62545         237           83873         82557         1										
84983         68312         25519         56158         22390         12823         92390         28947         36708         253           35554         02935         72889         68772         79774         14336         50716         63003         86391         940           04368         17632         50962         71908         13105         76285         31819         16884         116655         165           81311         60479         69985         30952         93067         70056         55229         83226         22555         664           03823         89887         55828         74452         21692         55847         15960         47521         27784         257           80422         65437         38797         56261         88300         35980         56656         45662         29219         492           61307         49468         43344         43700         14074         19739         03275         99444         62545         237           83873         82557         10002         80093         74645         33109         15281         38759         09342         694           3810         16855         2	67198	07176	65996	18317	83083	11921	06254	68437	59481	54778
84983         68312         25519         56158         22390         12823         92390         28947         36708         253           35554         02935         72889         68772         79774         14336         50716         63003         86391         940           04368         17632         50962         71908         13105         76285         31819         16884         116655         165           81311         60479         69985         30952         93067         70056         55229         83226         22555         664           03823         89887         55828         74452         21692         55847         15960         47521         27784         257           80422         65437         38797         56261         88300         35980         56656         45662         29219         492           61307         49468         43344         43700         14074         19739         03275         99444         62545         237           83873         82557         10002         80093         74645         33109         15281         38759         09342         694           3810         16855         2	58037	92261	85504	55690	63488	26451	43223	38009	50567	09191
35554         02935         72889         68772         79774         14336         50716         63003         86391         940           04368         17632         50962         71908         13105         76285         31819         16884         11665         165           81311         60479         69985         30952         93067         70056         55229         83226         22555         664           03823         89887         55828         74452         21692         55847         15960         47521         27784         257           80422         65437         38797         56261         88300         35980         56656         45662         29219         492           61307         49468         43344         43700         14074         19739         03275         99444         62545         237           83873         82557         10002         80093         74645         33109         15281         38759         09342         694           93189         87226         56935         99836         85489         89693         49475         31941         780           93683         09664         53927         4		,								
35554         02935         72889         68772         79774         14336         50716         63003         86391         940           04368         17632         50962         71908         13105         76285         31819         16884         11665         165           81311         60479         69985         30952         93067         70056         55229         83226         22555         664           03823         89887         55828         74452         21692         55847         15960         47521         27784         257           80422         65437         38797         56261         88300         35980         56656         45662         29219         492           61307         49468         43344         43700         14074         19739         03275         99444         62545         237           83873         82557         10002         80093         74645         33109         15281         38759         09342         694           93189         87226         56935         99836         85489         89693         49475         31941         780           93683         09664         53927         4	0.4002	(9212	25510	56150	22200	12022	02200	20047	26709	25202
04368         17632         50962         71908         13105         76285         31819         16884         11665         165           81311         60479         69985         30952         93067         70056         55229         83226         22555         664           03823         89887         55828         74452         21692         55847         15960         47521         27784         257           80422         65437         38797         56261         88300         35980         56656         45662         29219         492           61307         49468         43344         43700         14074         19739         03275         99444         62545         237           83873         82557         10002         80093         74645         33109         15281         38759         09342         694           43892         91189         87226         56935         99836         85489         89693         49475         31941         780           93683         09664         53927         49885         94979         88848         42642         93218         80305         494           32748         02121         1										
81311       60479       69985       30952       93067       70056       55229       83226       22555       664         03823       89887       55828       74452       21692       55847       15960       47521       27784       257         80422       65437       38797       56261       88300       35980       56656       45662       29219       492         61307       49468       43344       43700       14074       19739       03275       99444       62545       237         83873       82557       10002       80093       74645       33109       15281       38759       09342       694         38110       16855       28922       93758       22885       36706       92542       60270       99599       179         43892       91189       87226       56935       99836       85489       89693       49475       31941       780         93683       09664       53927       49885       94979       88848       42642       93218       80305       494         32748       02121       11972       96914       83264       89016       45140       20362       63242       862	35554	02935	72889	68772	79774	14336	50716	63003	86391	94074
81311       60479       69985       30952       93067       70056       55229       83226       22555       664         03823       89887       55828       74452       21692       55847       15960       47521       27784       257         80422       65437       38797       56261       88300       35980       56656       45662       29219       492         61307       49468       43344       43700       14074       19739       03275       99444       62545       237         83873       82557       10002       80093       74645       33109       15281       38759       09342       694         38110       16855       28922       93758       22885       36706       92542       60270       99599       179         43892       91189       87226       56935       99836       85489       89693       49475       31941       780         93683       09664       53927       49885       94979       88848       42642       93218       80305       494         32748       02121       11972       96914       83264       89016       45140       20362       63242       862	04368	17632	50962	71908	13105	76285	31819	16884	11665	16594
03823         89887         55828         74452         21692         55847         15960         47521         27784         257           80422         65437         38797         56261         88300         35980         56656         45662         29219         492           61307         49468         43344         43700         14074         19739         03275         99444         62545         237           3873         82557         10002         80093         74645         33109         15281         38759         09342         694           38110         16855         28922         93758         22885         36706         92542         60270         99599         179           43892         91189         87226         56935         99836         85489         89693         49475         31941         780           93683         09664         53927         49885         94979         88848         42642         93218         80305         494           43892         111972         96914         83264         89016         45140         20362         63242         862           49211         92963         38625         6										
80422         65437         38797         56261         88300         35980         56656         45662         29219         492           61307         49468         43344         43700         14074         19739         03275         99444         62545         237           83873         82557         10002         80093         74645         33109         15281         38759         09342         694           38110         16855         28922         93758         22885         36706         92542         60270         99599         179           43892         91189         87226         56935         99836         85489         89693         49475         31941         780           93683         09664         53927         49885         94979         88848         42642         93218         80305         494           32748         02121         11972         96914         83264         89016         45140         20362         63242         862           49211         92963         38625         65312         52156         36400         67050         64058         45489         241           63365         64224         6										
61307         49468         43344         43700         14074         19739         03275         99444         62545         237           83873         82557         10002         80093         74645         33109         15281         38759         09342         694           38110         16855         28922         93758         22885         36706         92542         60270         99599         179           43892         91189         87226         56935         99836         85489         89693         49475         31941         780           93683         09664         53927         49885         94979         88848         42642         93218         80305         494           32748         02121         11972         96914         83264         89016         45140         20362         63242         862           49211         92963         38625         65312         52156         36400         67050         64058         45489         241           63365         64224         69475         57512         85097         05054         88673         96593         00902         533           63576         26373         4	03823	89887	55828	74452	21692	55847	15960	47521	27784	25728
61307         49468         43344         43700         14074         19739         03275         99444         62545         237           83873         82557         10002         80093         74645         33109         15281         38759         09342         694           38110         16855         28922         93758         22885         36706         92542         60270         99599         179           43892         91189         87226         56935         99836         85489         89693         49475         31941         780           93683         09664         53927         49885         94979         88848         42642         93218         80305         494           32748         02121         11972         96914         83264         89016         45140         20362         63242         862           49211         92963         38625         65312         52156         36400         67050         64058         45489         241           63365         64224         69475         57512         85097         05054         88673         96593         00902         533           63576         26373         4										
83873         82557         10002         80093         74645         33109         15281         38759         09342         694           38110         16855         28922         93758         22885         36706         92542         60270         99599         179           43892         91189         87226         56935         99836         85489         89693         49475         31941         780           93683         09664         53927         49885         94979         88848         42642         93218         80305         494           32748         02121         11972         96914         83264         89016         45140         20362         63242         862           49211         92963         38625         65312         52156         36400         67050         64058         45489         241           63365         64224         69475         57512         85097         05054         88673         96593         00902         533           63576         26373         44610         43748         90399         06770         71609         90916         69002         571           41078         47036         6	80422	65437	38797	56261	88300	35980	56656	45662	29219	49257
83873         82557         10002         80093         74645         33109         15281         38759         09342         694           38110         16855         28922         93758         22885         36706         92542         60270         99599         179           43892         91189         87226         56935         99836         85489         89693         49475         31941         780           93683         09664         53927         49885         94979         88848         42642         93218         80305         494           32748         02121         11972         96914         83264         89016         45140         20362         63242         862           49211         92963         38625         65312         52156         36400         67050         64058         45489         241           63365         64224         69475         57512         85097         05054         88673         96593         00902         533           63576         26373         44610         43748         90399         06770         71609         90916         69002         571           41078         47036         6	61307	10168	13311	43700	14074	10730	03275	00///	62545	23720
38110       16855       28922       93758       22885       36706       92542       60270       99599       179         43892       91189       87226       56935       99836       85489       89693       49475       31941       780         93683       09664       53927       49885       94979       88848       42642       93218       80305       494         32748       02121       11972       96914       83264       89016       45140       20362       63242       862         49211       92963       38625       65312       52156       36400       67050       64058       45489       241         63365       64224       69475       57512       85097       05054       88673       96593       00902       533         63576       26373       44610       43748       90399       06770       71609       90916       69002       571         41078       47036       65524       68466       77613       20076       71969       47706       22506       810         70846       89558       64173       15381       67322       70097       82363       90767       17879       326										
43892         91189         87226         56935         99836         85489         89693         49475         31941         780           93683         09664         53927         49885         94979         88848         42642         93218         80305         494           32748         02121         11972         96914         83264         89016         45140         20362         63242         862           49211         92963         38625         65312         52156         36400         67050         64058         45489         241           63365         64224         69475         57512         85097         05054         88673         96593         00902         533           63576         26373         44610         43748         90399         06770         71609         90916         69002         571           41078         47036         65524         68466         77613         20076         71969         47706         22506         810           70846         89558         64173         15381         67322         70097         82363         90767         17879         326           68800         64492         2										69408
43892         91189         87226         56935         99836         85489         89693         49475         31941         780           93683         09664         53927         49885         94979         88848         42642         93218         80305         494           32748         02121         11972         96914         83264         89016         45140         20362         63242         862           49211         92963         38625         65312         52156         36400         67050         64058         45489         241           63365         64224         69475         57512         85097         05054         88673         96593         00902         533           63576         26373         44610         43748         90399         06770         71609         90916         69002         571           41078         47036         65524         68466         77613         20076         71969         47706         22506         810           70846         89558         64173         15381         67322         70097         82363         90767         17879         326           68800         64492         2	38110	16855	28922	93758	22885	36706	92542	60270	99599	17983
93683 09664 53927 49885 94979 88848 42642 93218 80305 494 32748 02121 11972 96914 83264 89016 45140 20362 63242 862 49211 92963 38625 65312 52156 36400 67050 64058 45489 241 63365 64224 69475 57512 85097 05054 88673 96593 00902 533 63576 26373 44610 43748 90399 06770 71609 90916 69002 571  41078 47036 65524 68466 77613 20076 71969 47706 22506 810 70846 89558 64173 15381 67322 70097 82363 90767 17879 326 68800 64492 20162 32707 69510 82465 26821 79917 34615 358 44977 89525 51269 63747 30997 97213 53016 65909 05723 501 79354 63847 24395 53679 07667 67993 24634 78867 78516 004  14954 22299 40156 52685 19093 06090 23800 06739 76836 190 01711 98439 09446 33937 98956 85676 89493 05132 45886 493 62328 55328 45738 93940 15772 81975 91017 21387 57949 139 73004 62109 81907 71077 50322 66093 79921 61412 18347 211 34218 89445 03609 52336 19005 15179 94958 99448 11612 769  99159 01968 45886 86875 05196 64297 59339 39878 61548 564 92858 29949 15817 93372 34732 61584 72007 58597 43802 510 27396 97477 65554 71601 01540 26509 19487 39684 18676 412 37103 45309 30129 43380 66638 10841 77292 40288 25826 614		91189	87226	56935	99836	85489	89693	49475	31941	78065
32748         02121         11972         96914         83264         89016         45140         20362         63242         862           49211         92963         38625         65312         52156         36400         67050         64058         45489         241           63365         64224         69475         57512         85097         05054         88673         96593         00902         533           63576         26373         44610         43748         90399         06770         71609         90916         69002         571           41078         47036         65524         68466         77613         20076         71969         47706         22506         810           70846         89558         64173         15381         67322         70097         82363         90767         17879         326           68800         64492         20162         32707         69510         82465         26821         79917         34615         358           44977         89525         51269         63747         30997         97213         53016         65909         05723         501           79354         63847         2	73072	71107	07220	30733	<i>)</i>	05407	07075	47475	31771	70005
32748         02121         11972         96914         83264         89016         45140         20362         63242         862           49211         92963         38625         65312         52156         36400         67050         64058         45489         241           63365         64224         69475         57512         85097         05054         88673         96593         00902         533           63576         26373         44610         43748         90399         06770         71609         90916         69002         571           41078         47036         65524         68466         77613         20076         71969         47706         22506         810           70846         89558         64173         15381         67322         70097         82363         90767         17879         326           68800         64492         20162         32707         69510         82465         26821         79917         34615         358           44977         89525         51269         63747         30997         97213         53016         65909         05723         501           79354         63847         2				4000=	0.40=0	00040	10-10			40.400
49211       92963       38625       65312       52156       36400       67050       64058       45489       241         63365       64224       69475       57512       85097       05054       88673       96593       00902       533         63576       26373       44610       43748       90399       06770       71609       90916       69002       571         41078       47036       65524       68466       77613       20076       71969       47706       22506       810         70846       89558       64173       15381       67322       70097       82363       90767       17879       326         68800       64492       20162       32707       69510       82465       26821       79917       34615       358         44977       89525       51269       63747       30997       97213       53016       65909       05723       501         79354       63847       24395       53679       07667       67993       24634       78867       78516       004         14954       22299       40156       52685       19093       06090       23800       06739       76836       190	93683	09664	53927	49885	94979	88848	42642			49428
63365         64224         69475         57512         85097         05054         88673         96593         00902         533           63576         26373         44610         43748         90399         06770         71609         90916         69002         571           41078         47036         65524         68466         77613         20076         71969         47706         22506         810           70846         89558         64173         15381         67322         70097         82363         90767         17879         326           68800         64492         20162         32707         69510         82465         26821         79917         34615         358           44977         89525         51269         63747         30997         97213         53016         65909         05723         501           79354         63847         24395         53679         07667         67993         24634         78867         78516         004           14954         22299         40156         52685         19093         06090         23800         06739         76836         190           01711         98439         0	32748	02121	11972	96914	83264	89016	45140	20362	63242	86255
63365         64224         69475         57512         85097         05054         88673         96593         00902         533           63576         26373         44610         43748         90399         06770         71609         90916         69002         571           41078         47036         65524         68466         77613         20076         71969         47706         22506         810           70846         89558         64173         15381         67322         70097         82363         90767         17879         326           68800         64492         20162         32707         69510         82465         26821         79917         34615         358           44977         89525         51269         63747         30997         97213         53016         65909         05723         501           79354         63847         24395         53679         07667         67993         24634         78867         78516         004           14954         22299         40156         52685         19093         06090         23800         06739         76836         190           01711         98439         0	49211	92963	38625	65312	52156	36400	67050	64058	45489	24165
63576         26373         44610         43748         90399         06770         71609         90916         69002         571           41078         47036         65524         68466         77613         20076         71969         47706         22506         810           70846         89558         64173         15381         67322         70097         82363         90767         17879         326           68800         64492         20162         32707         69510         82465         26821         79917         34615         358           44977         89525         51269         63747         30997         97213         53016         65909         05723         501           79354         63847         24395         53679         07667         67993         24634         78867         78516         004           14954         22299         40156         52685         19093         06090         23800         06739         76836         190           01711         98439         09446         33937         98956         85676         89493         05132         45886         493           62328         55328         4										
41078       47036       65524       68466       77613       20076       71969       47706       22506       810         70846       89558       64173       15381       67322       70097       82363       90767       17879       326         68800       64492       20162       32707       69510       82465       26821       79917       34615       358         44977       89525       51269       63747       30997       97213       53016       65909       05723       501         79354       63847       24395       53679       07667       67993       24634       78867       78516       004         14954       22299       40156       52685       19093       06090       23800       06739       76836       190         01711       98439       09446       33937       98956       85676       89493       05132       45886       493         62328       55328       45738       93940       15772       81975       91017       21387       57949       139         73004       62109       81907       71077       50322       66093       79921       61412       18347       211	63365	64224								53320
70846         89558         64173         15381         67322         70097         82363         90767         17879         326           68800         64492         20162         32707         69510         82465         26821         79917         34615         358           44977         89525         51269         63747         30997         97213         53016         65909         05723         501           79354         63847         24395         53679         07667         67993         24634         78867         78516         004           14954         22299         40156         52685         19093         06090         23800         06739         76836         190           01711         98439         09446         33937         98956         85676         89493         05132         45886         493           62328         55328         45738         93940         15772         81975         91017         21387         57949         139           73004         62109         81907         71077         50322         66093         79921         61412         18347         211           34218         89445         0	63576	26373	44610	43748	90399	06770	71609	90916	69002	57180
70846         89558         64173         15381         67322         70097         82363         90767         17879         326           68800         64492         20162         32707         69510         82465         26821         79917         34615         358           44977         89525         51269         63747         30997         97213         53016         65909         05723         501           79354         63847         24395         53679         07667         67993         24634         78867         78516         004           14954         22299         40156         52685         19093         06090         23800         06739         76836         190           01711         98439         09446         33937         98956         85676         89493         05132         45886         493           62328         55328         45738         93940         15772         81975         91017         21387         57949         139           73004         62109         81907         71077         50322         66093         79921         61412         18347         211           34218         89445         0										
70846         89558         64173         15381         67322         70097         82363         90767         17879         326           68800         64492         20162         32707         69510         82465         26821         79917         34615         358           44977         89525         51269         63747         30997         97213         53016         65909         05723         501           79354         63847         24395         53679         07667         67993         24634         78867         78516         004           14954         22299         40156         52685         19093         06090         23800         06739         76836         190           01711         98439         09446         33937         98956         85676         89493         05132         45886         493           62328         55328         45738         93940         15772         81975         91017         21387         57949         139           73004         62109         81907         71077         50322         66093         79921         61412         18347         211           34218         89445         0	41078	47036	65524	68466	77613	20076	71969	47706	22506	81053
68800         64492         20162         32707         69510         82465         26821         79917         34615         358           44977         89525         51269         63747         30997         97213         53016         65909         05723         501           79354         63847         24395         53679         07667         67993         24634         78867         78516         004           14954         22299         40156         52685         19093         06090         23800         06739         76836         190           01711         98439         09446         33937         98956         85676         89493         05132         45886         493           62328         55328         45738         93940         15772         81975         91017         21387         57949         139           73004         62109         81907         71077         50322         66093         79921         61412         18347         211           34218         89445         03609         52336         19005         15179         94958         99448         11612         769           99159         01968         4										
44977       89525       51269       63747       30997       97213       53016       65909       05723       501         79354       63847       24395       53679       07667       67993       24634       78867       78516       004         14954       22299       40156       52685       19093       06090       23800       06739       76836       190         01711       98439       09446       33937       98956       85676       89493       05132       45886       493         62328       55328       45738       93940       15772       81975       91017       21387       57949       139         73004       62109       81907       71077       50322       66093       79921       61412       18347       211         34218       89445       03609       52336       19005       15179       94958       99448       11612       769         99159       01968       45886       86875       05196       64297       59339       39878       61548       564         92858       29949       15817       93372       34732       61584       72007       58597       43802       510										32697
79354         63847         24395         53679         07667         67993         24634         78867         78516         004           14954         22299         40156         52685         19093         06090         23800         06739         76836         190           01711         98439         09446         33937         98956         85676         89493         05132         45886         493           62328         55328         45738         93940         15772         81975         91017         21387         57949         139           73004         62109         81907         71077         50322         66093         79921         61412         18347         211           34218         89445         03609         52336         19005         15179         94958         99448         11612         769           99159         01968         45886         86875         05196         64297         59339         39878         61548         564           92858         29949         15817         93372         34732         61584         72007         58597         43802         510           27396         97477         6	68800	64492	20162	32707	69510	82465	26821	79917	34615	35820
79354         63847         24395         53679         07667         67993         24634         78867         78516         004           14954         22299         40156         52685         19093         06090         23800         06739         76836         190           01711         98439         09446         33937         98956         85676         89493         05132         45886         493           62328         55328         45738         93940         15772         81975         91017         21387         57949         139           73004         62109         81907         71077         50322         66093         79921         61412         18347         211           34218         89445         03609         52336         19005         15179         94958         99448         11612         769           99159         01968         45886         86875         05196         64297         59339         39878         61548         564           92858         29949         15817         93372         34732         61584         72007         58597         43802         510           27396         97477         6	44977	89525	51269	63747	30997	97213	53016	65909	05723	50168
14954       22299       40156       52685       19093       06090       23800       06739       76836       190         01711       98439       09446       33937       98956       85676       89493       05132       45886       493         62328       55328       45738       93940       15772       81975       91017       21387       57949       139         73004       62109       81907       71077       50322       66093       79921       61412       18347       211         34218       89445       03609       52336       19005       15179       94958       99448       11612       769         99159       01968       45886       86875       05196       64297       59339       39878       61548       564         92858       29949       15817       93372       34732       61584       72007       58597       43802       510         27396       97477       65554       71601       01540       26509       19487       39684       18676       412         37103       45309       30129       43380       66638       10841       77292       40288       25826       614										
01711       98439       09446       33937       98956       85676       89493       05132       45886       493         62328       55328       45738       93940       15772       81975       91017       21387       57949       139         73004       62109       81907       71077       50322       66093       79921       61412       18347       211         34218       89445       03609       52336       19005       15179       94958       99448       11612       769         99159       01968       45886       86875       05196       64297       59339       39878       61548       564         92858       29949       15817       93372       34732       61584       72007       58597       43802       510         27396       97477       65554       71601       01540       26509       19487       39684       18676       412         37103       45309       30129       43380       66638       10841       77292       40288       25826       614	19334	03647	24393	33079	07007	0/993	24034	/000/	/8310	00448
01711       98439       09446       33937       98956       85676       89493       05132       45886       493         62328       55328       45738       93940       15772       81975       91017       21387       57949       139         73004       62109       81907       71077       50322       66093       79921       61412       18347       211         34218       89445       03609       52336       19005       15179       94958       99448       11612       769         99159       01968       45886       86875       05196       64297       59339       39878       61548       564         92858       29949       15817       93372       34732       61584       72007       58597       43802       510         27396       97477       65554       71601       01540       26509       19487       39684       18676       412         37103       45309       30129       43380       66638       10841       77292       40288       25826       614										
62328       55328       45738       93940       15772       81975       91017       21387       57949       139         73004       62109       81907       71077       50322       66093       79921       61412       18347       211         34218       89445       03609       52336       19005       15179       94958       99448       11612       769         99159       01968       45886       86875       05196       64297       59339       39878       61548       564         92858       29949       15817       93372       34732       61584       72007       58597       43802       510         27396       97477       65554       71601       01540       26509       19487       39684       18676       412         37103       45309       30129       43380       66638       10841       77292       40288       25826       614	14954	22299	40156	52685	19093	06090	23800	06739	76836	19050
62328       55328       45738       93940       15772       81975       91017       21387       57949       139         73004       62109       81907       71077       50322       66093       79921       61412       18347       211         34218       89445       03609       52336       19005       15179       94958       99448       11612       769         99159       01968       45886       86875       05196       64297       59339       39878       61548       564         92858       29949       15817       93372       34732       61584       72007       58597       43802       510         27396       97477       65554       71601       01540       26509       19487       39684       18676       412         37103       45309       30129       43380       66638       10841       77292       40288       25826       614	01711	98439	09446	33937	98956	85676	89493	05132	45886	49379
73004     62109     81907     71077     50322     66093     79921     61412     18347     211       34218     89445     03609     52336     19005     15179     94958     99448     11612     769       99159     01968     45886     86875     05196     64297     59339     39878     61548     564       92858     29949     15817     93372     34732     61584     72007     58597     43802     510       27396     97477     65554     71601     01540     26509     19487     39684     18676     412       37103     45309     30129     43380     66638     10841     77292     40288     25826     614										13992
34218     89445     03609     52336     19005     15179     94958     99448     11612     769       99159     01968     45886     86875     05196     64297     59339     39878     61548     564       92858     29949     15817     93372     34732     61584     72007     58597     43802     510       27396     97477     65554     71601     01540     26509     19487     39684     18676     412       37103     45309     30129     43380     66638     10841     77292     40288     25826     614										
99159     01968     45886     86875     05196     64297     59339     39878     61548     564       92858     29949     15817     93372     34732     61584     72007     58597     43802     510       27396     97477     65554     71601     01540     26509     19487     39684     18676     412       37103     45309     30129     43380     66638     10841     77292     40288     25826     614		62109	81907	71077	50322	66093		61412	18347	21115
99159     01968     45886     86875     05196     64297     59339     39878     61548     564       92858     29949     15817     93372     34732     61584     72007     58597     43802     510       27396     97477     65554     71601     01540     26509     19487     39684     18676     412       37103     45309     30129     43380     66638     10841     77292     40288     25826     614	34218	89445	03609	52336	19005		94958	99448	11612	76981
92858     29949     15817     93372     34732     61584     72007     58597     43802     510       27396     97477     65554     71601     01540     26509     19487     39684     18676     412       37103     45309     30129     43380     66638     10841     77292     40288     25826     614	-	-						-	-	'
92858     29949     15817     93372     34732     61584     72007     58597     43802     510       27396     97477     65554     71601     01540     26509     19487     39684     18676     412       37103     45309     30129     43380     66638     10841     77292     40288     25826     614	00150	01068	15886	86875	05106	64207	50330	30272	61549	56442
27396     97477     65554     71601     01540     26509     19487     39684     18676     412       37103     45309     30129     43380     66638     10841     77292     40288     25826     614										
37103 45309 30129 43380 66638 10841 77292 40288 25826 614	92858	29949	15817	93372	34732		72007	58597	43802	51066
37103 45309 30129 43380 66638 10841 77292 40288 25826 614	27396	97477	65554	71601	01540	26509	19487	39684	18676	41219
										61431
57347 97012 48428 20606 54138 75716 23741 50462 13221 472										
	57347	97012	48428	20606	54138	75716	23741	50462	13221	47216

## Appendix C. Glossary

A

**allowable difference.** The amount by which the actual quantity in the package may differ from the declared quantity. Pressed and blown tumblers and stemware labeled by count and capacity are assigned an allowable difference in capacity. This is also called a tolerance.

audit testing. Preliminary tests designed to quickly identify potential noncompliance units.

**average.** The sum of a number of individual measurement values divided by the number of values. For example, the sum of the individual weights of 12 packages divided by 12 would be the average weight of those packages.

**average error.** The sum of the individual "package errors" (defined) (considering their arithmetic sign) divided by the number of packages comprising the sample.

**average requirement.** A requirement that the average net quantity of contents of packages in a "lot" equals the net quantity of contents printed on the label.

**average tare.** The sum of the weights of individual package containers (or wrappers, etc.) divided by the number of containers or wrappers weighed.

В

berry baskets and boxes. Disposable containers in capacities of 1 dry quart or less for berries and small fruits. See Section 4.46. in NIST Handbook 44.

 $\mathbf{C}$ 

**Category A (Category B).** A set of sampling plans provided in this handbook to use in checking packages that must (except when exempted) meet the "average requirement" (defined).

**chamois.** A natural leather made from skins of sheep and lambs that have been oil-tanned.

**combination quantity declarations.** A package label that contains the count of items in the package as well as one or more of the following: weight, measure, or size.

compliance testing. Determining package conformance using specified legal requirements.

D

**decision criteria.** The rules for deciding whether or not a lot conforms to package requirements based on the results of checking the packages in the sample.

**delivery.** A quantity of identically labeled product received at one time by a buyer.

**dimensionless units.** The integers in terms of which the official records package errors. The dimensionless units must be multiplied by the "unit of measure" to obtain package errors in terms of weight, length, etc.

**division, value of (d).** The value of the scale division, expressed in units of mass, is the smallest subdivision of the scale for analog indication or the difference between two consecutively indicated or printed values for digital indication or printing. See NIST Handbook 44.

**drained weight.** The weight of solid or semisolid product representing the contents of a package obtained after a prescribed method for removal of the liquid has been employed.

**dry measure.** Rigid containers designed for general and repeated use in the volume measurement of particulate solids. See Section 4.45. Dry Measures in NIST Handbook 44.

**dry pet food.** All extruded dog and cat foods and baked treat packaged in kraft paper bags and cardboard boxes that has a moisture content of 13 % or less at the time of packaging.

dry tare. See UNUSED DRY TARE.

 $\mathbf{E}$ 

error. See PACKAGE ERROR.

 $\mathbf{G}$ 

gravimetric test procedure. An analytical procedure that involves measurement by mass or weight.

gross weight. The weight of the package including contents, packing material, labels.

Н

**headspace.** The container volume not occupied by product.

Ι

**inch-pound units.** Units based upon the yard, gallon, and the pound commonly used in the United States of America. Some of these units have the same name as similar units in the United Kingdom (British, English, or Imperial units), but they are not necessarily equal to them.

**initial tare sample.** The first packages (either two or five) selected from the sample to be opened for tare determination in the tare procedure. Depending upon the variability of these individual tare weights as compared with the variability of the net contents, this initial tare sample may be sufficient or more packages may be needed to determine the tare.

**inspection lot.** The collection of identically labeled (random packages, in some cases, are exempt from identity and labeled quantity when determining the inspection lot) packages available for inspection at one time. This collection will pass or fail as a whole based on the results of tests on a sample drawn from this collection.

L

**label.** "Any written, printed, or graphic matter affixed to, applied to, attached to, blown into, formed, molded into, embossed on, or appearing upon or adjacent to a consumer commodity or a package containing any consumer commodity, for purposes of branding, identifying, or giving any information with respect to the commodity or to the contents of the package, except that an inspector's tag or other non-promotional matter affixed to or appearing upon a consumer commodity is not a label." See Section 2.5 in the Uniform Packaging and Labeling Regulation in NIST Handbook 130.

linear measures. Rulers and tape measures.

**location of test.** The place where the package will be examined. This is broadly defined as one of three general locations: (1) where the commodity was packaged, (2) a warehouse or storage location, or (3) a retail outlet.

lot. See INSPECTION LOT.

**lot code.** A series of identifying numbers and/or letters on the outside of a package designed to provide information such as the date and location of packaging or the expiration date.

lot size. The number of packages in the "inspection lot".

M

#### MAV. See MAXIMUM ALLOWABLE VARIATION

maximum allowable variation (MAV). A deficiency in the weight, measure, or count of an individual package beyond which the deficiency is considered to be an "unreasonable error". The number of packages with deficiencies that are greater than the MAV is controlled by the sampling procedure.

measure containers. Containers whose capacities are used to determine quantity. They are of two basic types: (a) retail and (b) prepackaged. Retail containers are packaged at the time of retail sale, and prepackaged containers are packaged in advance of sale. An example of a prepackaged measure container is an ice cream package.

metric or SI units. Units of the International System of Units as established in 1960 by the General Conference on Weights and Measures and interpreted or modified for the United States by the Secretary of Commerce. (See NIST Special Publication 814 – "Metric System of Measurement; Interpretation of the SI for the United States and Federal Government Metric Conversion Policy")

**minus or plus errors.** Negative or positive deviations from the labeled quantity of the actual package quantities as measured. See PACKAGE ERROR.

**mulch.** Any product or material other than peat or peat moss for sale, or sold for primary use as a horticultural, aboveground dressing for decoration, moisture control, weed control, erosion control, temperature control, or other similar purposes.

**moisture allowance.** That variation in weight of a packaged product permitted in order to account for loss of weight due to loss of moisture during good package distribution practices. For packaged goods subject to moisture loss, when the average net weight of a sample is found between the labeled weight and the boundary of the moisture allowance, the lot is said to be in a no-decision area. Further information is required to determine lot compliance or noncompliance.

N

**net quantity or net contents.** That quantity of packaged product remaining after all necessary deductions for tare (defined) have been made.

**nominal.** A designated or theoretical size that may vary from the actual.

**nominal gross weight.** The sum of the nominal tare weight (defined) plus the declared or labeled weight (or other labeled quantity converted to a weight basis).

P

packaged goods. Product or commodity put up in any manner in advance of sale suitable for either wholesale or retail sale.

**package error.** The difference between the actual net contents of an individual package as measured and the declared net contents on the package label; minus (-) for less than the label and plus (+) for more than the label.

**petroleum products.** Gasoline, diesel fuel, kerosene, or any product (whether or not such a product is actually derived from naturally occurring hydro-carbon mixtures known as "petroleum") commonly used in powering, lubricating, or idling engines or other devices, or labeled as fuel to power camping stoves or lights. Sewing machine lubricant, camping fuels, and synthetic motor oil are "petroleum products" for the purposes of this regulation. The following products are not "petroleum products:" brake fluid, copier machine dispersant, antifreeze, cleaning solvents, and alcohol.

#### plus errors. See MINUS OR PLUS ERRORS

**principal display panel or panels.** Part (s) of a label that are designed to be displayed, presented, shown, or examined under normal and customary conditions of display and purchase. Wherever a principal display panel appears more than once on a package, all requirements pertaining to the "principal display panel" shall pertain to all such "principal display panels." See Section 2.7 in the Uniform Packaging and Labeling Regulation in NIST Handbook 130.

**production lot.** The total collection of packages defined by the packager, usually consisting of those packages produced within a given unit of time and coded identically.

**pycnometer.** A container of known volume used to contain material for weighing so that the weight of a known volume may be determined for the material. If it is constructed, it is called a density cup.

R

**random pack.** "The term 'random package' shall be construed to mean a package that is one of a lot, shipment, or delivery of packages of the same consumer commodity with varying weights which means, packages of the same consumer commodity with no fixed pattern of weight."

**random sampling.** The process of selecting sample packages such that all packages under consideration have the same probability of being selected. An acceptable method of random selection is to use a table of random numbers.

**range.** The difference between the largest and the smallest of a set of measured values.

**reasonable variation.** An amount by which individual package net contents are allowed to vary from the labeled net contents. This term is found in most Federal and State laws and regulations governing packaged goods. Reasonable variations from the labeled declaration are recognized for (1) unavoidable deviations in good manufacturing practice, and (2) loss or gain of moisture in good distribution practice.

**rounding.** The process of omitting some of the end digits of a numerical value and adjusting the last retained digit so that the resulting number is as near as possible to the original number.

S

**sample.** A group of packages taken from a larger collection of packages and providing information that can be used to make a decision concerning the larger collection of packages or of the package production process. A sample provides a valid basis for decision only when it is a random sample (defined).

sample correction factor. Students' "t" value for a one sided test at the 3 % confidence level and n is the sample size.

**sample error limit (SEL).** Means a statistical value computed by multiplying the sample standard deviation times the sample correction factor from Column 3 of Table 2-1. Category A - Sampling Plans for the appropriate sample size. The SEL value allows for the uncertainty between the average error of the sample and the average error of the inspection lot with an approximately 97 % level of confidence.

sample size (n). The number of packages in a sample.

sampling plan. A specific plan that states the number of packages to be checked and the associated decision criteria.

**scale tolerance.** The official value fixing the limit of allowable error for weighing equipment as defined in NIST Handbook 44.

**seat.** (as in "seat diameter" or "seated capacity"). The projection or shoulder near the upper rim of a cup or container that is designed to serve as the support for a lid or cover.

**seated capacity.** The capacity of a cup, container, or bottle, as defined by the volume contained by them when the lid or a flat disc is inserted into the lid groove that is located inside and near the upper rim of the cup, container, or bottle.

**SEL.** See SAMPLE ERROR LIMIT.

**shipment.** A quantity of identically labeled product (except for lot code) sent at one time to a single location.

**slicker plate.** A flat plate, usually of glass or clear plastic composition, used to determine the "level full" condition of a capacity (volumetric) measure.

standard deviation. A measure to describe the scatter of the individual package contents around the mean contents.

**standard pack.** That type of package in which a commodity is put up with identical labels and only in certain specific quantity sizes. Examples of goods so packed are canned, boxed, bottled and bagged foods, and over-the-counter drugs.

**supplementary quantity declarations.** The required quantity declaration may be supplemented by one or more declarations of weight, measure, or count, such declaration appearing other than on a principal display panel. Such supplemental statement of quantity of contents shall not include any terms qualifying a unit of weight, measure, or count that tends to exaggerate the amount of commodity contained in the package (e.g., "giant" quart, "full" gallon, "when packed," "minimum", or words of similar import)." See Section 6.12 in the Uniform Packaging and Labeling Regulation in NIST Handbook 130.

Ί

tare weight. The weight of a container, wrapper, or other material that is deducted from the gross weight to obtain the net weight.

tare sample. The packages or packaging material used to determine the average tare weight.

tare sample size. The number of packages or packaging material units used to determine the average tare weight.

**tolerance.** A value fixing the limit of allowed departure from the labeled contents; usually presented as a plus (+) and minus (-) value.

 $\mathbf{U}$ 

**unit of measure.** An increment of weight, length, or volume so that an inspector may record package errors in terms of small integers. (The package errors are actually the integers multiplied by the unit of measure.)

**unreasonable errors.** Minus package errors that exceed the MAV (defined). The number of unreasonable errors permitted in a sample is specified by the sampling plan.

**unused dry tare.** All unused packaging materials (including glue, labels, ties, etc.) that contain or enclose a product. It includes prizes, gifts, coupons, or decorations that are not part of the product.

**used dry tare.** Used tare material that has been air dried, or dried in some manner to simulate the unused tare weight. It includes all packaging materials that can be separated from the packaged product, either readily (e.g., by shaking) or by washing, scraping, ambient air drying, or other techniques involving more than "normal" household recovery procedures, but not including laboratory procedures like oven drying. Labels, wire closures, staples, prizes, decorations, and such are considered tare. It is not the same as "wet tare. See also "wet tare."

v

volumetric measures. Standard measuring flasks, graduates, cylinders, for use in the measuring volumes of liquids.

 $\mathbf{W}$ 

wet tare. Used packaging materials absorbent portion (if any) of the tare.	when no effort is made	to reconstruct unused tar	e weight by drying out the

## Appendix D. Acknowledgments and References

We would like to thank the State and local weights and measures officials who evaluated the test procedures and commented on the drafts of this edition. We also thank the many packagers, industries, and trade associations for their comments and suggestions. We also received support and encouragement from the U.S. Department of Agriculture, Food Safety and Inspection Service; the Office of Food Labeling at Food and Drug Administration; and from the Federal Trade Commission. This project could not have been accomplished without the support and encouragement we received from other members of the NIST Office of Weights and Measures, especially Tina G. Butcher, Georgia Harris, Michele Krebs, and Richard Suiter. We could not have completed this handbook without the technical support, guidance, and encouragement provided by this team of dedicated professionals and friends.

We want to also honor the dedication and hard work of NIST staff who where the creators and editors of the previous editions of this handbook, especially that of Dr. Carroll Brickenkamp, Steve Hasko, and the late Mary Natrella. We learned a great deal from their work, and we share their knowledge with others every day.

#### REFERENCES

- C. Brickenkamp, S. Hasko, and M.G. Natrella, <u>NIST Handbook 133 Third Edition Checking the Net Contents of Packaged Goods</u>, 1988.
- K. Butcher and T. Coleman, <u>4<sup>th</sup> Supplement to the Third Edition of NIST Handbook 133 Checking the Net Contents</u> of Packaged Goods, 1994.
- T. Butcher, J. Williams, R. Suiter, and L. Crown, <u>Specifications</u>, <u>Tolerances</u>, and <u>Other Technical Requirements for Weighing and Measuring Devices</u>, National Institute of Standards and Technology Handbook 44, 2004. Available at <a href="http://www.nist.gov/owm">http://www.nist.gov/owm</a>
- T. Coleman, K. Dresser, and L. Crown, <u>Uniform Laws and Regulations in the Areas of Legal Metrology and Engine Fuel Quality</u>, National Institute of Standards and Technology Handbook 130, 2004. Available at <a href="http://www.nist.gov/owm">http://www.nist.gov/owm</a>

Compressed Gas Association, <u>Fourth Edition - Handbook of Compressed Gases, 1999.</u> Compressed Gas Association, 4221 Walney Road, 5<sup>th</sup> Floor, Chantilly, Virginia 20151-2923. URL: http://www.cganet.com

P. Cunniff, ed., Official Methods of Analysis of the Association of Official Analytical Chemists International, Seventeenth Edition, Association of Official Analytical Chemists, 481 North Frederick Avenue, Suite 500, Gaithersburg, Maryland 20877, 2003. URL: http://www.aoac.org

<u>Federal Test Method Standard 311 "Leather, Methods of Sampling and Testing."</u> (January 15, 1969). U.S. General Services Administration.

- G. L. Harris, <u>Specifications and Tolerances for Reference Standards and Field Standard Weights and Measures, 1.</u> <u>Specifications and Tolerances for Field Standard Weights (National Institute of Standards and Technology Class F)</u>, National Institute of Standards and Technology Handbook 105-1, 1990. Available at http://www.nist.gov/owm
- G. L. Harris, <u>Specifications and Tolerances for Reference Standards and Field Standard Weights and Measures; 2. Specifications and Tolerances for Field Standard Measuring Flasks</u>, National Institute of Standards and Technology Handbook 105-2, U.S. Government Printing Office, Washington, D.C., 1996. Available at http://www.nist.gov/owm
- G. L. Harris, <u>Specifications and Tolerances for Reference Standards and Field Standard Weights and Measures</u>, <u>5. Specifications and Tolerances for Field Standard Stopwatches</u>, National Institute of Standards and Technology Handbook 105-5, 1997. Available at http://www.nist.gov/owm

- G. L. Harris, <u>Specifications and Tolerances for Reference Standards and Field Standard Weights and Measures, 6. Specifications and Tolerances for Thermometers</u>, National Institute of Standards and Technology Handbook 105-6, 1997. Available at http://www.nist.gov/owm
- M. W. Jensen and R. W. Smith, <u>The Examination of Weighing Equipment</u>, National Institute of Standards and Technology Handbook 94, U.S. Government Printing Office, Washington, D.C., 1965.
- G. D. Lee, <u>Examination Procedure Outlines for Commercial Weighing and Measuring Devices</u>, National Institute of Standards and Technology Handbook 112, 2002.

Rand Corporation. <u>A Million Random Digits with 100,000 Normal Deviates</u>, Glencoe, IL: The Free Press, 1955. The Rand Corporation, 1700 Main Street, P.O. Box 2138, Santa Monica, California 90407-2138. URL: http://www.rand.org

Standard Method of Test for Density of Plastics by the Density Gradient Technique, ASTM D 1505-03, 2003. URL: http://www.astm.org

<u>Standard Method of Test for Volume of Processed Peat Materials,</u> ASTM D 2978-71, 1998. URL: http://www.astm.org

<u>Standard Method of Test for Yarn Number by the Skein Method,</u> ASTM D 1907-01, 2001. URL: http://www.astm.org

<u>Standard Practice for Calibration of Laboratory Volumetric Apparatus,</u> ASTM E 542-01, 2001. URL: http://www.astm.org

Standard Specification for Glass Volumetric (Transfer) Pipets, ASTM E 969-02, 2002. URL: http://www.astm.org

Standard Specification for Laboratory Glass Graduated Burets, ASTM E 287-02, 2002. URL: http://www.astm.org.

Standard Specification for Polyethylene Film and Sheeting, ASTM D 2103-03, 2003. URL: http://www.astm.org

Standard Specification for Polyethylene Sheeting for Construction, Industrial, and Agricultural Applications, ASTM D 4397-02, 2002. URL: http://www.astm.org

<u>Standard Test Methods for Thickness of Solid Electrical Insulation,</u> ASTM D 374-99, 1999. URL: http://www.astm.org

- U.S. Department of Defense Military Standard, <u>Sampling Procedures and Tables for Inspection by Attributes</u> (MIL-STD-105 D), U.S. Government Printing Office, Washington, D.C., 1963.
- B. Younglove and N. Olien. <u>NBS Technical Note 1079 Tables of Industrial Gas Container Contents and Density for Oxygen</u>, Argon, Nitrogen, Helium, and Hydrogen, 1985.

# **Appendix E. Model Inspection Report Forms**

Report Form	<b>Page</b>
Random Inspection Report	E-2
Random Package Inspection Report - Example	E-3
Standard Package Inspection Report	E-4
Standard Inspection Report - Example	E-5

Date	Random I	Random Package Report					Sampling	Plan	□ A	□В	Report Nu	ımber	
Location (name, address)		Product	Brand Identity	y			Manufact	urer			Container	Description	
		Lot Cod	les										
Labeled Quantity-	2. Unit of M	easure	3. MAV –					n a		ection Lot	6. Samp	e Size (n)	
enter weight for each package in column 1						mensionless	units		Size				
below.			and enter this value in Column 4 below.  1 9. Range of Package 10. Range of Tare Weights 11. Rc/Rt (9) 10 = ) 12										
7. Initial Tare Sample	9. Range o Errors (Rc)				f Tare Wei	ghts	11. Rc/		12. Total No. of Tare				
, and the second					(	(Kt)					Samples	Samples	
13. Avg. Tare Wt □ U	☐ Unused I	Dry Ta	are 1	13a. ☐ Tare						14. Nominal Gross Wt			
							sture Allow	(Labeled	(Labeled Wt + 13 – 13a)				
G W	Pkg 1	Pkg 2	Pkg 3	Pk	g 4	Pkg 5	Pkg	6	Pkg 7	Pkg 8	Pkg 9	Pkg 10	
a. Gross Wt b. Tare Wt													
c. Net Wt												_	
d. Package Error													
d. Tackage Effor													
Product Description, Lot C	ode. Unit Price				Money E	Errors	1. Label	ed Net V	Veight	Package	Errors	4. MAV	
1,	,				-	+				-	+		
1.													
2.													
3.													
4.													
5.													
6.													
7.													
8.													
9.													
10.													
11.													
12. 13.													
14.													
15.													
16.													
17.													
18.													
19.													
20.													
21.													
22.													
23.													
24.													
	1								otals	1			
15. Total Error		nreasonable mi h package erro			Is 16 grea es, Lot Fail	ter than 8?			vg. error in sionless uni		19. Avg. erro inits (18 x 2 =		
	MAV in Col		i with the		o, go to 18			$(15) \epsilon$		is	iiits (10 X 2 -	-)	
20. Is 18 Zero or Plus?		21. Compute	e Sample			e Correction	Factor	` '	/	nple Error Li	nit (21 x 22 =	:)	
☐ Yes, lot passes, go to 25	i	Standard Dev			•				•	•			
□ No, go to 21						T							
24. Disregarding the signs	s, is 18 larger th	an 23?				25. Dispo	osition of I	nspection	n Lot				
☐ Yes, Lot Fails,	go to 25	□ No, Lo	ot Passes, go to	25		Off: -: -12		proved		□ Reje	ected		
Comments						Official's	Signature						
						Acknowle	dgement o	f Report					

Date September 16, 1999	Random P	Package Rep	ort - Exa	ımp	le Form		Sampling	; Plan	A	□В	Report No	umb <i>17</i>		
Location (name, address)		Product/	Product/Brand Identity Manufacturer Conta								Container	Container Description		
L&O Market MacCorkle Ave			Ground C	huck	ζ		Meat Department – L&O Market				2S Tray with soaker and plastic wrap			
Charleston, WV 25177		Lot Code		1, 19, 99										
Labeled Quantity- enter weight for each	2. Unit of M	easure	3. MAV	– loo		AV for each dimensionles		h a	5. Inspec	ction Lot	6. Sample Size (n)			
package in the column 1 below.	0.001 lł		and enter t	this v	value in Col	lumn 4 below	7.		2	12				
7. Initial Tare Sample Size 2	8. No. of MA	AVs Allowed	Errors (Rc	of Package 10. Range (Rt)			e of Tare We	ights	11. Rc/Rt (9) 10 = )  10		12. Total No. of Tard Samples			
13. Avg. Tare Wt	sed Dry Tare 0.0205	☐ Wet Tare	Unused Dry Tare				re Correction oisture Allo					14. Nominal Gross Wt (Labeled Wt + 13 – 13a) Label Wt + 0.020 lb		
	Pkg 1	Pkg 2	Pkg 3		Pkg 4	Pkg 5	Pkg	6	Pkg 7	Pkg 8	Pkg 9		Pkg 10	
a. Gross Wt b. Tare Wt	1.852 lb	1.223 lb		_			<del>                                     </del>					4		
c. Net Wt	0 .020 lb 1.832 lb	0 .021 lb 1.202 lb	<del>                                     </del>	╆			+				+	$\dashv$		
d. Package Error (a – 14 = )	-18	-8					1					7		
Product Description, Lot C	ode, Unit Price				Money -	Errors +	1. Labe	eled Net V	Veight	Package	Errors +	4.	MAV	
1. Ground Chuck - 1, 19,	99 - \$1.79 per	r lb						1.85 lb		18				
2.								1.21 lb		7				
3.				—			<u> </u>	1.56 lb		8		<u> </u>		
<u>4.</u> 5.				-	\$ 0.04		+	1.98 lb 1.07 lb	14 23	+	<del>                                     </del>	44		
6.					7 - 111 - 1			1.55 lb 16						
7.								1.02 lb 2 1.44 lb 25						
8. 9.				₩	\$ 0.04						+	$\vdash$	56	
10.				<del>                                     </del>			1.33 lb 16 2.03 lb 20				+ +		70	
11.								1.73 lb		14				
12.				<u> </u>				1.16 lb		11		<u> </u>		
13. 14.				₩						<del>                                     </del>		$\vdash$		
15.				<del> </del>			+					<del>                                     </del>		
16.							1				1			
17.								,						
18.							<del>                                     </del>					$\vdash$		
19. 20.				┼			+				+	$\vdash$		
21.				1			+							
22.														
23.							<del> </del>					$\vdash$		
24.								To	otals	174	+			
15. Total Error - 174		nreasonable min h package error 0			7. Is 16 gr Yes, Lot F No, go to	******		18. Av	vg. error in ionless units	1	19. Avg. er units (18 x 2 - 0.		)	
20. Is 18 = Zero or Plus?  ☐ Yes, lot passes, go to 25		21. Compute Standard Devi			22. Sam	ple Correctio	n Factor	23. Co	mpute Samp	ple Error Lim	it (21 x 22 =	=)		
No, go to 21		6.72	21			0.635				4.267				
24. Disregarding the signs	s, is 18 larger th						position of l	Inspection	Lot					
Yes, Lot Fails,	go to 25	□ No, Lo	ot Passes, go	to 2.	5		□ A	approved		Rejec	cted			
Comments:						Official'	s Signature							
Product found to contain le	ess than the state	ed net contents				Acknow	ledgement o	of Report						

Date		Standard	Package Re	eport		1	Sampling Plan							
Location (name, ad		Product.		Manufactur	er			Container I	Description					
Labeled Quanti	Labeled Quantity 2. Unit of Measure 3. MAV 4. MAV (d						mensionless units) (3 ) 2 =)  5. Inspection Lot Size					6. Sample Size (n)		
7. Initial Tare San Size	nple	8. No. of M	AVs Allowed	9. Range of Errors (Rc)	Package	10. Range of (Rt)	Tare Weigh	hts	11. Rc	/Rt (9) 10 =)	12. Total No. of Tare Samples			
13. Avg. Tare Wt	□ U	sed Dry Tare	□Wet Tare	□ Unused D	ry Tare	☐ Mois	Ba.   Tare Correction  Moisture Allowance  Vacuum Pack					14. Nominal Gross Wt (1 + 13 – 13 a =)		
		Pkg 1	Pkg 2	Pkg 3	Pkg 4	Pkg 5	Pkg 6		Pkg 7	Pkg 8	Pkg 9	Pkg 10		
a. Gross Wt								_						
b. Tare Wt														
c. Net Wt	1													
-		+	-		+	-			+	-		+		
1.			13.			25.				37.				
2.			14.			26.	38.							
3.			15.			27.				39.				
4.			16.			28.				40.				
5.			17.		29.				41.					
6.			18.		30.					42.				
7.			19.			31.				43.				
8.			20.			32.				44.				
9.			21.			33.				45.				
10.			22.			34.			46.					
11.			23.			35.				47.				
12. Total	TD 4 1		24.	Tr . 1		36. Total	T. (		tal Total		T 1			
15. Total Error							Is 16 greater than 8? 18. Av			error in 19. A units (		Total  O. Avg. error in labeled nits (18 x 2 =)		
20. Is 18 = Zero or Plus?  ☐ Yes, lot passes, go to 25  ☐ No, go to 21  21. Compute Sample Standard Deviation					pple Correction F	le Correction Factor 23. Compute Sample Error Limit (21 x				Limit (21 x 2	2 =)			
24. Disregarding t	the signs	, is 18 larger th	nan 23?			25. Dispos	sition of Ins	pecti	on Lot					
☐ Yes, lot	fails, go	o to 25	□ No, lot p	basses, go to 25			□ App	rove	d	□ Rejec	cted			
Comments:						Official's S	ignature							
							Acknowledgement of Report							

Date January 20, 1999	Standard Package Report - Sample Form					Sampling Plan	: <b>A</b>	□В		Report Number 16					
Location (name, add	ress)	Product/Br	and Identity				Manufacturer				Container I	Container Description			
18765 Alcoa Highway					ABC Cookies I 1069 Capitol A Nashville, Teni	7204	Cardboard Box / Plastic Liner								
Labeled Quantity	· ·					mensionless uni	nensionless units) 5. Inspection Lot				6. Sample Size (n)				
453 g (1 lb)	(3) 2 =)			4.4	Size				12						
7. Initial Tare	8	No. of MAV	0 .044 lb  7s Allowed 9. Range of Package			age	44 10. Range of	f Tare	11. Ro	72 -/Rt	12. Total	No. of Tare	Samples		
Sample Size	0.	0	3 I III O W C C	9. Range of Package Errors (Rc)			Weights (Rt)	ruic	(9) 10 =		12. 1000	vo. or rure	Sumpres		
2		15 m	- W - M		24		2			2	14 27 '	2			
13. Avg. Tare Wt	Us	sed Dry Tare	□ Wet Ta	re 🗆 Unus	sed Dr	y Tare	13a. □ Tare	Correcti sture All			14. Nomii (1 + 13 – 1		t		
		0 .014 lb						um Pacl		N/A	(	1.014	lb		
		Pkg 1	Pkg 2	Pkg 3	I	Pkg 4	Pkg 5	Pkg	6	Pkg 7	Pkg 8	Pkg 9	Pkg 10		
a. Gross Wt		1.052 lb	1.026 lb												
b. Tare Wt		0.015 lb	.013 lb												
c. Net Wt		1.037 lb	1.013 lb	<u> </u>											
- 1		+ 38	13.		-	+	25.			+	37.		+		
1. 2.		12	14.				26.				38.				
3.		8	15.				27.				39.				
4.		4	16.				28.		+		40.				
5. 3			17.				29.				41.				
6. 2			18.				30.				42.				
7.		12	19.				31.				43.				
8. 3			20.				32.				44.				
9.		4	21.				33.				45.				
10. 1			22.				34.				46.				
11. 0			23.				35.			47.					
12.		6	24.				36.				48.				
	Total	84	Total		otal		Total		Total		Total	Total			
15. Total Error		16. No. of u each package	error with 4	)	(comp	are	No, go to 18 (15) 6=			dimension (15) 6=)	albeled units (18 x 2 =)				
+ 75	Dlue?		21 Comp			22 50	mple Correction	Factor			6.25 + 0.006 lb				
20. Is 18 = Zero or Plus?  Yes, lot passes, go to 25  No, go to 21  21. Compute Sample Standard Deviation				22. Sa	ample Correction Factor 23. Compute Sample Error Limit (21 x 22 =					21 x 22 =)					
24. Disregarding the	e signs	, is 18 larger th	nan 23?			1	25. Disp	osition o	of Inspect	ion Lot					
☐ Yes, lot f	ails, go	to 25	□ No, lo	t passes					Approv	ed	□ Rej	ected			
Comments:		-	-	•			Official's	Signatu	re						
Lot Passes															
							Acknowl	Acknowledgement of Report							