Sample report. Made-up property and findings to show the layout; not a real inspection and not AI output from a real job.

EXAMPLE HOME INSPECTIONS LLC

Home inspection report

Draft — not yet issued

123 Example Street, Anytown, ON A1A 1A1



CLIENT	DATE OF INSPECTION	INSPECTOR
A. Sample Buyer	**2026-10-13**	**Jordan Sample**
		Ontario sample registration 000000 (sample)

Inspection details

This report records a visual inspection of 123 Example Street, Anytown, ON, carried out on 2026-10-13 at the request of the client. The house was occupied and partly furnished. Every name, address and finding in this sample is invented to show the report layout.

Property address	123 Example Street, Anytown, ON A1A 1A1
Client	A. Sample Buyer
Date of inspection	2026-10-13
Property type	Single-family ranch, brick veneer on a vented crawlspace
Year built (approx.)	1964
Size	172 m^2 (1,850 ft^2)
Weather	Dry, 11 °C
Occupancy	Occupied
Furnishing	Partly furnished
Present	A. Sample Buyer, Buyer’s agent
Agreement reference	Pre-inspection agreement signed 2026-10-12 (sample)
Inspector	Jordan Sample
License / qualifications	Ontario sample registration 000000 (sample)
Company	Example Home Inspections LLC

Property description

A single-story ranch house built about 1964, with brick veneer walls, an asphalt shingle roof and a vented crawlspace. Heating is a gas forced-air furnace and the water heater is gas. There is a 100 amp electrical service and an attached two-car garage.

How to read this report

System status

Inspected: The inspector looked at the accessible parts of this system on the day of the inspection.

Not inspected: The inspector did not inspect this system. The reason is given.

Not present: The home does not have this system.

Deficiency: A system shows a deficiency count when the inspector recorded at least one safety hazard, major defect or repair-or-replace item for it. The count is calculated from the inspector's observations. It is not a separate judgment.

Categories

Safety hazard: The inspector flagged this item as a possible risk of harm to people. Have it looked at promptly.

Major defect: A significant problem with a part of the home. It usually needs attention from a qualified professional.

Repair or replace: A part that is damaged or not working as intended and should be repaired or replaced.

Maintenance: Routine upkeep or minor wear that an owner can plan for. Maintenance items are listed separately from the deficiencies.

Further evaluation recommended: The inspector suggests that a qualified professional look more closely before you rely on the finding or decide how to repair it.

Summary of deficiencies

1	2	6	7
Safety hazard	Major defect	Repair or replace	Maintenance

Overview

The most urgent items are one safety hazard and two major defects. The guard rail on the rear deck is loose. Standing water and wet insulation were found in the crawlspace, and one breaker in the main panel showed heat marks. A qualified deck contractor, a drainage or waterproofing contractor and a licensed electrician should look at these. Six more items need repair or replacement, among them the roof shingles, the grading at the northeast corner and the furnace burner compartment. Seven items are routine maintenance. The air conditioner was not operated because of the cold weather.

Deficiencies

One safety hazard, two major defects and six repair items were recorded. The safety hazard is the loose guard rail on the rear deck. The major defects are the standing water in the crawlspace and the heat marks at a breaker in the main panel.

Every safety hazard, major defect and repair-or-replace item the inspector recorded, in that order and then by system. Details and photos are in the numbered sections.

#	Category	System	Location	Item	Recommendation
2.3	Safety hazard	Exterior	Rear deck	Guard rail on the rear deck moves under light pressure	Do not lean on the rail or let children use the deck until a qualified deck contractor has repaired it.
3.1	Major defect Further evaluation recommended	Basement, Foundation, Crawlspace & Structure	Crawlspace	Standing water and wet insulation in the crawlspace	Have a licensed drainage or waterproofing contractor find the source of the water and correct it before the crawlspace is cleaned up and the insulation is replaced.
7.1	Major defect Further evaluation recommended	Electrical	Electrical	Signs of overheating at a breaker in the main panel	Have a licensed electrician evaluate the panel and repair or replace the affected parts before further use of that circuit.
1.1	Repair or replace	Roof	Roof	Cracked and missing shingles on the south slope	Have a licensed roofing contractor replace the damaged shingles and check the underlayment and decking beneath them.
2.2	Repair or replace	Exterior	Exterior	Ground slopes toward the foundation at the northeast corner	Re-grade the soil so that it slopes away from the foundation, and extend the downspout discharge away from the wall.
4.1	Repair or replace Further evaluation recommended	Heating	Heating	Rust and soot staining in the furnace burner compartment	Have a licensed HVAC contractor service the furnace and evaluate the cause of the staining.
6.1	Repair or replace	Plumbing	Plumbing	Slow drip at the kitchen sink drain trap	Have a licensed plumber tighten or replace the trap connection, and replace the damaged cabinet base if it does not dry out.
6.2	Repair or replace	Plumbing	Water heater	Relief valve discharge pipe is too short	Have a licensed plumber extend the discharge pipe so that it ends within a few inches of the floor.
7.2	Repair or replace	Electrical	Electrical	Kitchen and bathroom receptacles lack GFCI protection	Have a licensed electrician add GFCI protection to the kitchen and bathroom circuits.

Maintenance items

Seven maintenance items were recorded, such as cleaning the gutters, repainting the trim, replacing the furnace filter and adding attic insulation.

1.2 Gutters partly clogged with debris — Roof

2.1 Peeling paint on wood trim and fascia — Exterior

3.2 Hairline cracks in the foundation wall — Basement, Foundation, Crawlspace & Structure, Crawlspace

4.2 Furnace air filter is dirty — Heating

9.1 Attic insulation is thin and uneven — Attic, Insulation & Ventilation, Attic

10.1 Loose cabinet door hinge and sticking drawer — Doors, Windows & Interior, Kitchen

10.2 Worn caulk around the bathtub — Doors, Windows & Interior, Bathroom

Systems at a glance

#	System	Status	Note
1	Roof	Inspected · 1 deficiency	Limitations noted
2	Exterior	Inspected · 2 deficiencies	
3	Basement, Foundation, Crawlspace & Structure	Inspected · 1 deficiency	Limitations noted
4	Heating	Inspected · 1 deficiency	
5	Cooling	Not inspected	The outdoor temperature was below 15 °C at the time of the inspection, so the air conditioner was not operated.
6	Plumbing	Inspected · 2 deficiencies	
7	Electrical	Inspected · 2 deficiencies	
8	Fireplace	Not present	
9	Attic, Insulation & Ventilation	Inspected · Maintenance noted	Limitations noted
10	Doors, Windows & Interior	Inspected · Maintenance noted	

The deficiency count is calculated from the inspector's observations in each system.

1. Roof

Status: **Inspected · 1 deficiency**

DESCRIPTION

Roof covering type:	Asphalt shingles (architectural)	Inspection method:	Ladder at eave

Limitations: The north slope was viewed from the ground with binoculars; the south slope was viewed from a ladder at the eave.





Roof covering	Repair or replace	Flashings	Inspected
Penetrations & skylights	Inspected	Gutters & downspouts	Maintenance

Inspector's notes: Architectural asphalt shingles, about 15 years old according to the seller.

1.1 Cracked and missing shingles on the south slope

Repair or replace

ROOF COVERING

Several shingles are cracked or missing along the south slope near the ridge. The underlayment below them is exposed and weathered.

Recommendation: Have a licensed roofing contractor replace the damaged shingles and check the underlayment and decking beneath them.



1.2 Gutters partly clogged with debris

Maintenance

GUTTERS

Leaves and shingle granules have built up in the gutters on the north and west sides, and one downspout does not drain freely.

Recommendation: Clean the gutters and downspouts as part of routine maintenance.


2. Exterior

Status: **Inspected · 2 deficiencies**

DESCRIPTION

Wall covering type:	Brick veneer with painted wood trim

Exterior

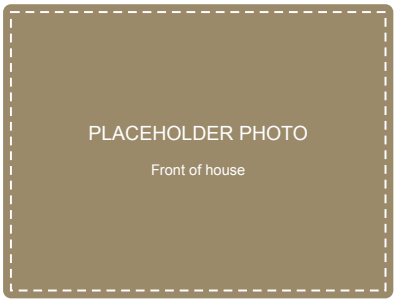

Wall covering	**Inspected**	Trim, eaves, soffit & fascia	**Maintenance**
Exterior doors	**Inspected**	Windows (exterior)	**Inspected**
Walkways & driveway	**Inspected**	Grading & drainage	**Repair or replace**

Inspector's notes: Brick veneer walls with painted wood trim.

2.1 Peeling paint on wood trim and fascia — Maintenance

TRIM

Paint is peeling on the fascia boards and on the trim around the garage door. The wood underneath is dry and firm where it was probed.

Recommendation: Scrape, prime and repaint the trim to keep moisture out of the wood.


2.2 Ground slopes toward the foundation at the northeast corner

Repair or replace

GRADING

The soil at the northeast corner slopes toward the house. Staining on the lower bricks suggests water collects there after rain.

Recommendation: Re-grade the soil so that it slopes away from the foundation, and extend the downspout discharge away from the wall.

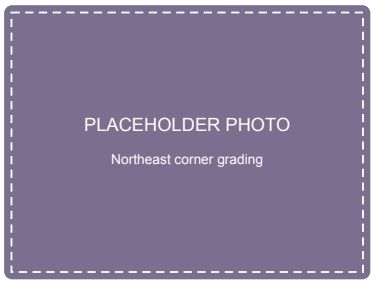

Rear deck

Steps, stairs & railings	Repair or replace	Decks, balconies & porches	Repair or replace

Inspector's notes: Pressure-treated wood deck, about 12 by 14 feet, with a stair to the yard.

2.3 Guard rail on the rear deck moves under light pressure

Safety hazard Repair or replace

RAILINGS

Two guard rail posts are loose at their connection to the deck frame, and the rail moves when pushed by hand. The deck surface is about 4 feet above grade.

Recommendation: Do not lean on the rail or let children use the deck until a qualified deck contractor has repaired it.



3. Basement, Foundation, Crawlspace & Structure

Status: **Inspected · 1 deficiency**

DESCRIPTION

Foundation type: Concrete block walls, vented crawlspace

Floor structure type: Wood joists

Crawlspace access: Entered

Limitations: The part of the crawlspace under the kitchen has less than 18 inches of clearance and was viewed from a distance.

Crawlspace



Foundation	**Maintenance**	Crawlspace	**Major defect**
Floor structure	**Inspected**	Moisture intrusion	**Major defect**

Inspector's notes: Vented crawlspace with concrete block walls and a dirt floor covered in part by plastic sheeting.

3.1 Standing water and wet insulation in the crawlspace

Major defect | Further evaluation recommended

MOISTURE

Standing water about 1 inch deep was seen near the north wall. The fiberglass insulation between the floor joists is wet and sagging in that area.

Recommendation: Have a licensed drainage or waterproofing contractor find the source of the water and correct it before the crawlspace is cleaned up and the insulation is replaced.





3.2 Hairline cracks in the foundation wall

Maintenance

FOUNDATION

Hairline vertical cracks were seen in the east block wall. No displacement was noted.

Recommendation: Monitor the cracks and have them looked at again if they widen.

4. Heating

Status: **Inspected · 1 deficiency**

DESCRIPTION

Heating type: Forced-air furnace

Energy source: Natural gas

Location: Hall closet

Heating equipment	**Repair or replace**	Distribution	**Inspected**
Venting / flue	**Inspected**	Thermostat	**Inspected**

4.1 Rust and soot staining in the furnace burner compartment

Repair or replace · **Further evaluation recommended**

HEATING EQUIPMENT

There is rust on the burner compartment floor and soot staining around two of the burners. The furnace ran and produced heat during the inspection.

Recommendation: Have a licensed HVAC contractor service the furnace and evaluate the cause of the staining.



4.2 Furnace air filter is dirty

Maintenance

HEATING EQUIPMENT

The air filter is heavily loaded with dust.

Recommendation: Replace the filter now and then every one to three months.

5. Cooling

Status: **Not inspected**

Reason: The outdoor temperature was below 15 °C at the time of the inspection, so the air conditioner was not operated.

6. Plumbing

Status: **Inspected · 2 deficiencies**

DESCRIPTION

Main shutoff location: Utility room wall
Supply piping material: Copper
Drain piping material: Plastic (PVC and ABS)
Water heater type: Tank, 40 gallons
Water heater energy source: Natural gas
Fuel shutoff location: Garage, at the water heater

Plumbing

Main water shutoff	Inspected	Supply piping	Inspected
Drain, waste & vent	Inspected	Fixtures	Repair or replace

Inspector's notes: Copper supply piping, plastic drain piping.

6.1 Slow drip at the kitchen sink drain trap

Repair or replace

FIXTURES

The slip nut on the kitchen sink trap drips when the sink drains. The cabinet floor below it is stained and slightly swollen.

Recommendation: Have a licensed plumber tighten or replace the trap connection, and replace the damaged cabinet base if it does not dry out.



Water heater

Water heater	Inspected	Temperature & pressure relief valve	Repair or replace
Fuel shutoff	Inspected		

Inspector's notes: 40-gallon natural gas water heater in the garage.

6.2 Relief valve discharge pipe is too short

Repair or replace

WATER HEATER

The temperature and pressure relief valve discharge pipe ends about 2 feet above the floor and is not turned down toward it.

Recommendation: Have a licensed plumber extend the discharge pipe so that it ends within a few inches of the floor.



7. Electrical

Status: **Inspected · 2 deficiencies**

DESCRIPTION

Service type: Overhead
Service rating: 100 A
Panel location: Garage
Wiring type: Copper, non-metallic sheathed cable



Service entrance	Inspected	Main panel	Major defect
Branch wiring	Inspected	GFCI / AFCI protection	Repair or replace
Outlets & switches	Maintenance	Smoke & CO alarms	Inspected

Inspector's notes: Main panel in the garage, 100 amp main breaker.

7.1 Signs of overheating at a breaker in the main panel

Major defect | Further evaluation recommended

PANEL

Discolouration and heat marks were seen on one breaker and its wire in the main panel. The panel cover was removed for the inspection.

Recommendation: Have a licensed electrician evaluate the panel and repair or replace the affected parts before further use of that circuit.



7.2 Kitchen and bathroom receptacles lack GFCI protection

Repair or replace

PROTECTION

The receptacles at the kitchen counter and in the bathroom did not trip when tested with a GFCI tester and no GFCI breaker was found in the panel.

Recommendation: Have a licensed electrician add GFCI protection to the kitchen and bathroom circuits.

8. Fireplace

Status: **Not present**

9. Attic, Insulation & Ventilation

Status: **Inspected · Maintenance noted**

DESCRIPTION

Access method:	Hallway hatch	Insulation type:	Blown fiberglass
Insulation depth:	About 6 in. where measured	Ventilation type:	Gable vents

Limitations: Viewed from the hatch, because there are no walking boards.

Attic

Attic access	**Inspected**	Insulation	**Maintenance**
Ventilation	**Inspected**		

9.1 Attic insulation is thin and uneven — Maintenance

INSULATION

The attic floor insulation is thin over the hallway and has been pushed aside near the hatch.

Recommendation: Add insulation and level it as part of routine upgrades.

10. Doors, Windows & Interior

Status: **Inspected · Maintenance noted**

Kitchen

Walls	Inspected	Floors	Inspected
Windows	Inspected	Cabinets & counters	Maintenance

10.1 Loose cabinet door hinge and sticking drawer — Maintenance

CABINETS

One upper cabinet door has a loose hinge and the top drawer next to the stove sticks.

Recommendation: Tighten the hinge screws and adjust or lubricate the drawer slides.

Bathroom

Walls	Inspected	Floors	Inspected
Fixtures	Maintenance		

10.2 Worn caulk around the bathtub — Maintenance

FIXTURES

The caulk at the tub and wall junction is cracked and discoloured.

Recommendation: Remove the old caulk and apply new tub-and-tile sealant.

Primary bedroom

Walls	Inspected	Ceilings	Inspected
Floors	Inspected	Doors	Inspected
Windows	Inspected		

No observations were recorded.

Garage

Walls	**Inspected**	Floors	**Inspected**
Doors	**Inspected**	Garage door opener	**Inspected**

Inspector's notes: Attached two-car garage.

No observations were recorded.

Limitations and items not inspected

Systems not inspected

- **Cooling:** The outdoor temperature was below 15 °C at the time of the inspection, so the air conditioner was not operated.

Limitations recorded by the inspector

The house was occupied and partly furnished. Furniture, floor coverings and stored items limited the view of some walls and floors.
Hidden plumbing and electrical components inside walls were not inspected.

Limitations by system

- **Roof:** The north slope was viewed from the ground with binoculars; the south slope was viewed from a ladder at the eave.
- **Basement, Foundation, Crawlspace & Structure:** The part of the crawlspace under the kitchen has less than 18 inches of clearance and was viewed from a distance.
- **Attic, Insulation & Ventilation:** Viewed from the hatch, because there are no walking boards.

General exclusions

This was a visual inspection of the parts of the home that could be reached safely on the day of the inspection. The inspector does not open walls, move furniture or stored items, or take equipment apart.

It describes what was seen at that time. It does not predict how long any part will last, what repairs will cost or whether a part will fail later, and no inspection can promise that a home is free of defects.

Areas that were hidden, covered or out of reach were not inspected. Problems that cannot be seen from the surface can exist.

Equipment was assessed by sight and, where the inspector noted it, by operating its normal controls. It was not taken apart or tested to its limits.

This is not a building code inspection. It does not say whether the home conforms to building codes, permits or local rules, either now or when it was built.

Unless the inspector mentions them in this report, it does not cover mould, asbestos, lead, radon, pests, water or air quality, or other environmental hazards. If you are concerned about any of these, ask a qualified specialist to test.

Homes built before 1978 may contain lead-based paint. No paint was tested for lead.

This report is not an appraisal and does not give advice on whether to buy. It was prepared for the client named on it and should not be relied on by anyone else. It does not replace any form or statement that your state or province requires from an inspector.

Use of AI in this report

> Observations and ratings by Jordan Sample, Example Home Inspections LLC. Text drafted with AI assistance (2026-10-14). Not yet reviewed or issued.
>
> System statuses, reasons for not inspecting, descriptions, tags and the inspector's limitations are the inspector's own entries and are reproduced as entered. The deficiency summary table and the systems overview are calculated from the inspector's observations, not written by AI.

Terms and state or provincial statements

These are sample terms. A real company replaces this text with its own terms and conditions of engagement, including any statements its state or province requires.

This inspection and report are subject to the terms and conditions of Example Home Inspections LLC: https://example.com/terms