
Release Notes

FortiOS 7.6.6

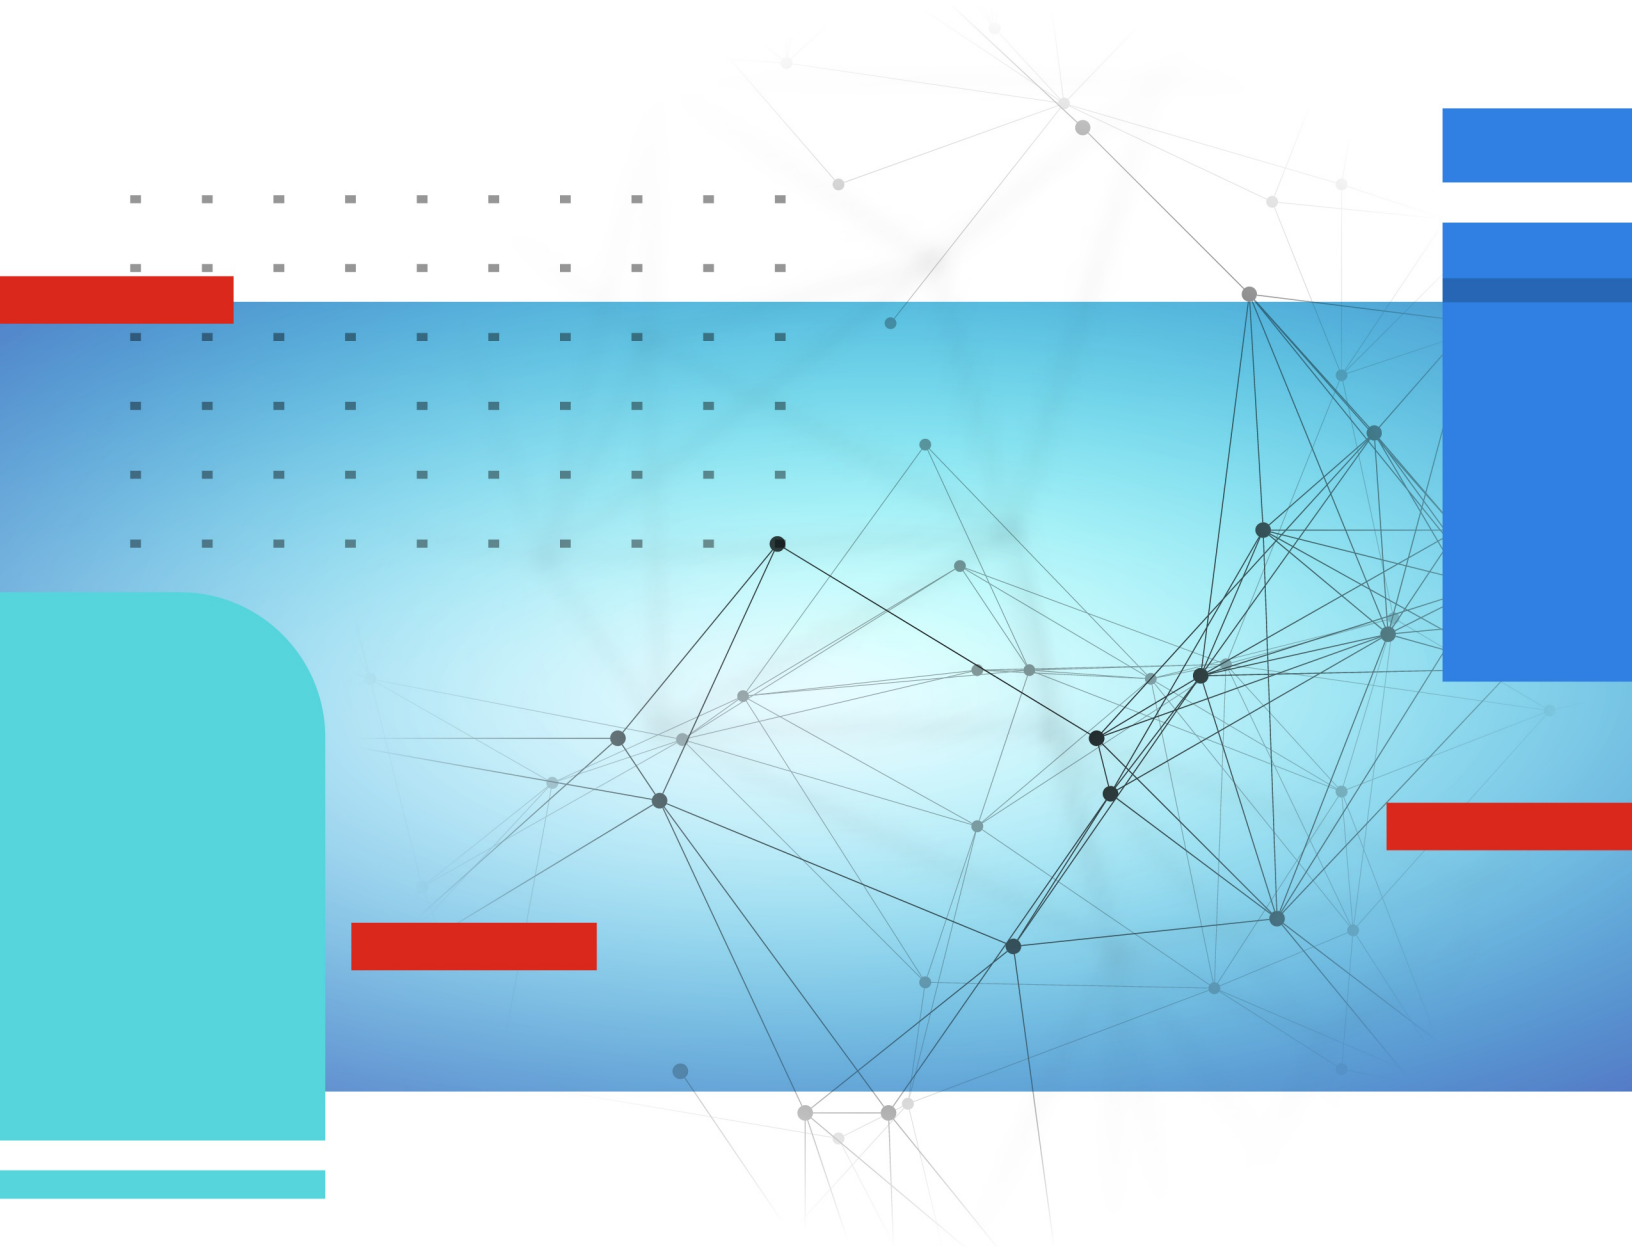

FORTINET DOCUMENT LIBRARY
https://docs.fortinet.com

FORTINET VIDEO LIBRARY
https://video.fortinet.com

FORTINET BLOG
https://blog.fortinet.com

CUSTOMER SERVICE & SUPPORT
https://support.fortinet.com

FORTINET TRAINING & CERTIFICATION PROGRAM
https://www.fortinet.com/training-certification

FORTINET TRAINING INSTITUTE
https://training.fortinet.com

FORTIGUARD LABS
https://www.fortiguard.com

END USER LICENSE AGREEMENT
https://www.fortinet.com/doc/legal/EULA.pdf

FEEDBACK
Email: techdoc@fortinet.com



October 26, 2026
FortiOS 7.6.6 Release Notes

TABLE OF CONTENTS

Change Log **5**
Introduction and supported models **7**
Supported models 7
Special branch supported models 8
FortiGate 6000 and 7000 support 8
Special notices **9**
FortiGate cannot restore configuration file after private-data-encryption is re-enabled 9
FortiManager support for updated FortiOS private data encryption key 10
Hyperscale incompatibilities and limitations 11
Hyperscale NP7 hardware limitation 11
FortiGate 6000 and 7000 incompatibilities and limitations 12
FortiGate VM memory and upgrade 12
Changes to NP7 traffic shaping 12
SSL VPN tunnel mode replaced with IPsec VPN 13
Agentless VPN (formerly SSL VPN web mode) not supported on some FortiGate series models 13
2 GB RAM FortiGate models no longer support most FortiOS proxy-related features 14
2 GB RAM FortiGate models no longer support Security Rating and Security Fabric topology 14
GUI access conflict with IPSec TCP tunnel on the same interface 14
SAML certificate verification 15
Policy check required for hairpin traffic 15
Changing vlan-lookup-cache requires system restart 16
Upgrade information **17**
Fortinet Security Fabric upgrade 17
Downgrading to previous firmware versions 19
Firmware image checksums 19
FortiGate 6000 and 7000 upgrade information 19
Default setting of cp-accel-mode is changed to none on 2GB memory models 21
Policies that use an interface show missing or empty values after an upgrade 21
Managed FortiSwitch do not permit empty passwords for administrator accounts 22
Removed speed setting affects SFP+ interfaces after upgrade 22
Hyperscale with FGCP HA clusters and interface monitoring 22
Password policy enforcement 23
Traffic loss during graceful upgrade on SLBC HA with override enable due to premature failover 23
Product integration and support **24**
Virtualization environments 25
Language support 25
Agentless VPN support 26
FortiExtender modem firmware compatibility 26

Resolved issues 29
Common Vulnerabilities and Exposures 29
Known issues 30
New known issues 30
DNS Filter 30
Explicit Proxy 30
Firewall 30
FortiGate 6000 and 7000 platforms 31
GUI 31
HA 31
Hyperscale 31
IPsec VPN 31
Proxy 32
System 32
Upgrade 32
User & Authentication 32
Web Filter 33
Existing known issues 33
Endpoint Control 33
Firewall 33
FortiGate 6000 and 7000 platforms 33
FortiView 34
GUI 35
HA 35
Hyperscale 35
Intrusion Prevention 35
IPsec VPN 36
Proxy 36
REST API 36
Security Fabric 36
Switch Controller 37
System 37
Upgrade 38
User & Authentication 38
VM 38
Web Filter 38
WiFi Controller 39
Built-in AV Engine 40
Built-in IPS Engine 41
Limitations 42
Citrix XenServer limitations 42
Open source XenServer limitations 42

Change Log

Date	Change Description
2026-01-28	Initial release.
2026-02-03	Updated Special notices on page 9.
2026-02-12	Updated Known issues on page 30.
2026-02-18	Added Special branch supported models on page 8 and Known issues on page 30.
2026-03-09	Updated Known issues on page 30.
2026-03-16	Updated Known issues on page 30.
2026-03-24	Updated Known issues on page 30.
2026-03-25	Updated Introduction and supported models on page 7.
2026-03-30	Updated Known issues on page 30.
2026-04-01	Updated Introduction and supported models on page 7 and Known issues on page 30.
2026-04-02	Updated Known issues on page 30.
2026-04-13	Updated Virtualization environments on page 25 and Known issues on page 30.
2026-04-14	Updated Known issues on page 30.
2026-04-22	Updated Known issues on page 30.
2026-05-05	Updated Upgrade information on page 17 and Known issues on page 30.
2026-05-25	Updated Known issues on page 30.
2026-06-01	Updated Known issues on page 30.
2026-06-03	Updated Known issues on page 30.
2026-06-08	Updated Known issues on page 30.
2026-06-22	Updated and Known issues on page 30.
2026-07-08	Updated Known issues on page 30.
2026-07-20	Updated Upgrade information on page 17.
2026-07-27	Updated Known issues on page 30.
2026-07-30	Updated Supported models on page 7 and Known issues on page 30.
2026-08-04	Updated Introduction and supported models on page 7 and Known issues on page 30.
2026-08-06	Updated Introduction and supported models on page 7, Special notices on page 9, and Known issues on page 30.
2026-08-18	Updated Known issues on page 30.

Date	Change Description
2026-09-08	Updated Known issues on page 30.
2026-09-14	Updated Upgrade information on page 17 and Known issues on page 30.
2026-09-28	Updated Known issues on page 30.
2026-10-06	Updated Known issues on page 30.
2026-10-07	Updated Known issues on page 30.
2026-10-26	Update Known issues on page 30.

Introduction and supported models

This guide provides release information for FortiOS 7.6.6 build 3652.

For FortiOS documentation, see the Fortinet Document Library.

Supported models

FortiOS 7.6.6 supports the following models.

FortiGate	FG-40F, FG-40F-3G4G, FG-50G, FG-50G-5G, FG-50G-SFP, FG-50G-DSL, FG-50G-SFP-POE, FG-51G, FG-51G-5G, FG-51G-SFP-POE, FG-60F, FG-61F, FG-70F, FG-70G, FG-70G-POE, FG-71F, FG-71G, FG-71G-POE, FG-80F, FG-80F-BP, FG-80F-DSL, FG-80F-POE, FG-81F, FG-81F-POE, FG-90G, FG-91G, FG-100F, FG-101F, FG-120G, FG-121G, FG-200E, FG-200F, FG-200G, FG-201E, FG-201F, FG-201G, FG-300E, FG-301E, FG-400E, FG-400E-BP, FG-401E, FG-400F, FG-401F, FG-500E, FG-501E, FG-600E, FG-601E, FG-600F, FG-601F, FG-700G, FG-701G, FG-900G, FG-901G, FG-1000F, FG-1001F, FG-1100E, FG-1101E, FG-1800F, FG-1801F, FG-2000E, FG-2200E, FG-2201E, FG-2500E, FG-2600F, FG-2601F, FG-3000F, FG-3001F, FG-3200F, FG-3201F, FG-3300E, FG-3301E, FG-3400E, FG-3401E, FG-3500F, FG-3501F, FG-3600E, FG-3601E, FG-3700F, FG-3701F, FG-3960E, FG-3980E, FG-4200F, FG-4201F, FG-4400F, FG-4401F, FG-4800F, FG-4801F, FG-5001E, FG-5001E1, FG-6000F, FG-7000E, FG-7000F
FortiWiFi	FWF-40F, FWF-40F-3G4G, FWF-50G, FWF-50G-5G, FWF-50G-SFP, FWF-50G-DSL, FWF-51G, FWF-60F, FWF-61F, FWF-70G, FWF-70G-POE, FWF-71G, FWF-80F-2R, FWF-80F-2R-3G4G-DSL, FWF-81F-2R, FWF-81F-2R-3G4G-DSL, FWF-81F-2R-POE, FWF-81F-2R-3G4G-POE
FortiGate Rugged	FGR-50G-5G, FGR-60F, FGR-60F-3G4G, FGR-70F, FGR-70G, FGR-70G-5G-Dual, FGR-70F-3G4G
FortiFirewall	FFW-1801F, FFW-2600F, FFW-3001F, FFW-3501F, FFW-3980E, FFW-4200F, FFW-4400F, FFW-4401F, FFW-4801F, FFW-VM64, FFW-VM64-KVM
FortiGate VM	FG-ARM64-AWS, FG-ARM64-AZURE, FG-ARM64-GCP, FG-ARM64-KVM, FG-ARM64-OCI, FG-VM64, FG-VM64-ALI, FG-VM64-AWS, FG-VM64-AZURE, FG-VM64-GCP, FG-VM64-HV, FG-VM64-IBM, FG-VM64-KVM, FG-VM64-OPC, FG-VM64-RAXONDEMAND, FG-VM64-XEN



Starting with FortiOS 7.6.1, New deployments on Azure Marketplace use Generation 2 (Gen2) VM images and no longer support Azure F-series, Fs-series, Standard Dv2, and Standard Dsv2 instance types, or similar instance families, which require Gen1 images. Existing FortiGate VMs deployed on F-series or Fs-series instance types can continue to operate and be upgraded to FortiOS 7.6.1 or later. Upgrade to newer instance families for better and more stable performance. See Instance type support for details.

Special branch supported models

The following models are released on a special branch of FortiOS 7.6.6. To confirm that you are running the correct build, run the CLI command `get system status` and check that the `Branch point` field shows 3652.

FG-400G	is released on build 6689.
FG-401G	is released on build 6689.
FG-800D	is released on build 6605.
FG-900D	is released on build 6605.
FG-1000D	is released on build 6605.
FG-3000D	is released on build 6605.
FG-3000G	is released on build 6570.
FG-3001G	is released on build 6570.
FG-3100D	is released on build 6605.
FG-3200D	is released on build 6605.
FG-3500G	is released on build 6632.
FG-3501G	is released on build 6632.
FG-3700D	is released on build 6605.

FortiGate 6000 and 7000 support

FortiOS 7.6.6 supports the following FG-6000F, FG-7000E, and FG-7000F models:

FG-6000F	FG-6001F, FG-6300F, FG-6301F, FG-6500F, FG-6501F
FG-7000E	FG-7030E, FG-7040E, FG-7060E
FG-7000F	FG-7081F, FG-7121F

Special notices

- FortiGate cannot restore configuration file after private-data-encryption is re-enabled on page 9
- FortiManager support for updated FortiOS private data encryption key on page 10
- Hyperscale incompatibilities and limitations on page 11
- Hyperscale NP7 hardware limitation on page 11
- FortiGate 6000 and 7000 incompatibilities and limitations on page 12
- FortiGate VM memory and upgrade on page 12
- Changes to NP7 traffic shaping on page 12
- SSL VPN tunnel mode replaced with IPsec VPN on page 13
- Agentless VPN (formerly SSL VPN web mode) not supported on some FortiGate series models on page 13
- 2 GB RAM FortiGate models no longer support most FortiOS proxy-related features on page 14
- 2 GB RAM FortiGate models no longer support Security Rating and Security Fabric topology on page 14
- GUI access conflict with IPSec TCP tunnel on the same interface on page 14
- SAML certificate verification on page 15
- Policy check required for hairpin traffic on page 15
- Changing vlan-lookup-cache requires system restart on page 16

FortiGate cannot restore configuration file after private-data-encryption is re-enabled

In a new enhancement, enabling `private-data-encryption` will utilize a randomly generated private key. Therefore, FortiGate cannot restore the configuration file in the following sequence:

1. `private-data-encryption` enabled with random key, and configuration is backed up.
2. `private-data-encryption` disabled.
3. `private-data-encryption` enabled again, with new random key.
4. Restore configuration file in step 1.

When disabling `private-data-encryption`, a warning in the CLI will be displayed:

```
This operation will restore system default data encryption key!
```

```
Previous config files encrypted with the private key cannot be restored after this operation!
```

```
Do you want to continue? (y/n)y
```

FortiManager support for updated FortiOS private data encryption key

With the introduction of FortiOS 7.6.1, Fortinet has updated the private-data-encryption key feature. Administrators are no longer required to manually input a 32-digit hexadecimal `private-data-encryption` key. Instead administrators simply enable the command, and a random `private-data-encryption` key is generated.

How FortiManager 7.6.3 and later works with FortiOS private data encryption keys has changed. This topic covers the changes. See FortiManager behavior on page 10.

Previous FortiOS CLI behavior

```
config system global
    set private-data-encryption enable
end
Please type your private data encryption key (32 hexadecimal numbers):
1234567890123456789012345678 9abc
Please re-enter your private data encryption key (32 hexadecimal numbers) again:
1234567890123456789012345678 9abc
Your private data encryption key is accepted.
```

New FortiOS CLI behavior

```
config system global
    set private-data-encryption enable
end
This operation will generate a random private data encryption key!
Previous config files encrypted with the system default key cannot be restored after this
operation!
Do you want to continue? (y/n)y
Private data encryption key generation succeeded!
```

FortiManager behavior

FortiManager 7.6.3 can centrally manage FortiGates with the private-data-encryption setting enabled, with the following limitations:

- FortiManager cannot import objects that include the password type attribute.
- FortiManager cannot be used to create NAT and transparent VDOMs.

This applies to FortiGates with private keys that are manually configured in FortiOS 7.6.0 and earlier and private keys that are randomly generated in FortiOS 7.6.1 and later.

FortiManager does not require you to verify the private key of the FortiGate when adding it to FortiManager.

FortiGates that require the protection of private data encryption and need to be managed by FortiManager should follow these procedures on a fresh install.

1. On the FortiGate, enable private-data-encryption.
2. On the FortiManager, add the FortiGate to the Device Manager. FortiManager will not be required to provide the key for PDE, as it will not be importing any password-related settings.
3. Make all configuration changes directly on the FortiManager.
4. Push and install the changes to the FortiGate.

If you require the use of NAT or Transparent VDOMs, you should perform this additional step before the steps above.

1. Enable multi-vdom mode on the FortiGate.
2. Add the VDOMs that you will use on the FortiGate.
3. Follow the above steps to enable private-data-encryption and manage the FortiGate from the FortiManager.

For more information, see the FortiManager Administration Guide.

FortiOS upgrade behavior with FortiManager 7.6.2 and earlier

If in FortiOS 7.4.5 or 7.6.0 the 32-digit hexadecimal private key is enabled, and then the FortiGate device is upgraded to 7.6.1, the 32-digit hexadecimal `private-data-encryption` key is preserved. As a result, FortiManager 7.6.2 and earlier is aware of the 32-digit hexadecimal `private-data-encryption` key and can continue to manage the FortiGate device. However, if the `private-data-encryption` key is enabled after an upgrade of FortiOS to 7.6.1, FortiManager 7.6.2 and earlier no longer can manage FortiGate devices running FortiOS 7.6.1.

Hyperscale incompatibilities and limitations

See Hyperscale firewall incompatibilities and limitations in the Hyperscale Firewall Guide for a list of limitations and incompatibilities with FortiOS 7.6.6 features.

Hyperscale NP7 hardware limitation

Because of an NP7 hardware limitation, for CGN traffic accepted by a hyperscale firewall policy that includes an overload with port block allocation (overload PBA) IP Pool, only one block is allocated per client. The setting of the hyperscale firewall policy `cgn-resource-quota` option is ignored.

Because of this limitation, under certain rare conditions (for example, only a single server side IP address and port are being used for a large number of sessions), port allocation may fail even if the block usage of the client is less than its quota. In cases such as this, if the client has traffic towards some other servers or ports, additional port allocation can become successful. You can also work around this problem by increasing the IP Pool block size (`cgn-block-size`).

FortiGate 6000 and 7000 incompatibilities and limitations

See the following links for information about FortiGate 6000 and 7000 limitations and incompatibilities with FortiOS 7.6.6 features.

- FortiGate 6000 incompatibilities and limitations
- FortiGate 7000E incompatibilities and limitations
- FortiGate 7000F incompatibilities and limitations

FortiGate VM memory and upgrade

FortiGate virtual machines (VMs) are not constrained by memory size and will continue to support all available features after upgrading to FortiOS 7.6.0. However, it is recommended to set up VMs with at least 4 GB of RAM for optimal performance.

Changes to NP7 traffic shaping

The following known issues for the Queuing based Traffic Management (QTM) module on NP7 are fixed:

- Incorrect checksum for fragments after QTM.
- Packets longer than 6000 bytes cause QTM to hang.
- Refreshing causes QTM to hang.
- MTU is not honored after QTM, so the packet is not fragmented.

As a result of these changes, you can no longer use the following command to change QoS type used for traffic shaping for sessions offloaded to NP7 processors:

```
config system npu
    set default-qos-type {policing | shaping}
end
```

Instead, `default-qos-type` can only be set to `policing`.

For NP7 sessions, policy traffic shaping, per-IP shaping, and regular port shaping (outbandwidth enabled on an interface without a shaping profile) always use the NP7 accounting and traffic shaping module (called the TPE module). This is the same as changing the `default-qos-type` to `policing`.

For NP7 sessions, shaping profiles on interfaces now only use QTM for traffic shaping (equivalent to setting `default-qos-type` to `shaping`). Shaping profiles on interfaces are also called Multiclass shaping (MCS). The interface can be a physical interface, LAG interface, and VLAN interface (over physical or LAG). The FortiGate supports shaping profiles on a maximum of 100 interfaces.

SSL VPN tunnel mode replaced with IPsec VPN

Starting in FortiOS 7.6.3, the SSL VPN tunnel mode feature is replaced with IPsec VPN, which can be configured to use TCP port 443. SSL VPN tunnel mode is no longer available in the GUI and CLI. Settings will not be upgraded from previous versions. This applies to all FortiGate models.

To ensure uninterrupted remote access, customers must migrate their SSL VPN tunnel mode configuration to IPsec VPN before upgrading to FortiOS 7.6.3 and later.

See Migration from SSL VPN tunnel mode to IPsec VPN in the *FortiOS 7.6 New Feature* guide for detailed steps on migrating to IPsec VPN before upgrade.

A complete migration guide can be found in the following links:

- For FortiOS 7.6, see SSL VPN to IPsec VPN Migration.
- For FortiOS 7.4, see SSL VPN to IPsec VPN Migration.

Agentless VPN (formerly SSL VPN web mode) not supported on some FortiGate series models

On the following FortiGate models, the Agentless VPN (formerly SSL VPN web mode) feature is no longer available from the GUI or CLI. Settings will not be upgraded from previous versions.

The affected models include:

- FGT-40F/FWF-40F and variants
- FGT-50G/FWF-50G and variants
- FGT-60F/FWF-60F
- FGT-61F/FWF-61F
- FGR-60F and variants (2GB versions only)
- FGT-70G/FWF-70G and variants
- FGT-90G and FGT-91G

To confirm if your FortiGate model has 2 GB RAM, enter `diagnose hardware sysinfo conserve` in the CLI, and check that the total RAM value is below 2000 MB (1000 MB = 1 GB).

On these FortiGate models, consider migrating to using IPsec Dialup VPN for remote access.

See SSL VPN to IPsec VPN Migration for more information.



FortiGate models not listed above will continue to support Agentless VPN (formerly SSL VPN web mode). However, SSL VPN tunnel mode is not longer supported on any models.

2 GB RAM FortiGate models no longer support most FortiOS proxy-related features

As part of improvements to enhance performance and optimize memory usage on FortiGate models with 2 GB RAM or less, FortiOS no longer supports most proxy-related features.

However FortiOS 7.6.5 brings back proxy-based inspection for email protocols on FortiGate models with 2 GB RAM. This covers the following services:

- SMTP(s)
- POP3(s)
- IMAP(s)
- NNTP

Firewall policies can once again support proxy-based inspection mode when users select one or more of the above services in the firewall policy.

This change impacts the FortiGate 40F, 60F, and 50G series devices, along with their variants.

See Proxy-related features no longer supported on FortiGate 2 GB RAM models for more information.

2 GB RAM FortiGate models no longer support Security Rating and Security Fabric topology

To enhance the stability of physical FortiGate devices devices with 2 GB RAM, the Security Rating feature and Security Fabric topology visibility have been removed. These changes prioritizes device stability and mitigate potential performance issues. For more information, see Optimizations for physical FortiGate devices with 2 GB RAM.

GUI access conflict with IPSec TCP tunnel on the same interface

In FortiOS version 7.6.1, the default IKE TCP port has been changed to port 443 on new deployments. In the FortiOS 7.6.1 Release Notes, see Bug ID 1051144 in Changes in default values.

This may affect GUI access for interfaces bound to an IPsec tunnel in the scenario that the GUI admin port is also using port 443.

In case GUI connectivity is lost, connect to the FortiGate by:

1. Connecting from an interface that is not bound to an IPsec tunnel.
2. Connecting to the interface using SSH, if SSH is enabled.

3. Connecting to the FortiGate from console.

To ensure continued functionality, users are recommended to either:

- Choose an alternative interface for GUI access by configuring:

```
config system global
    set admin-sport <port>
end
```

- Customize the `ike-tcp-port` to a value other than 443:

```
config system settings
    set ike-tcp-port <port>
end
```

SAML certificate verification

For security purposes, in previous versions, FortiGate required a signature verification for both the SAML response message and the SAML assertion carried inside the SAML response. This means that the SAML response must have a valid signature, and the SAML assertion must also have a valid signature. If the Identity Provider (IdP) provides an invalid signature, or fails to sign one of these, the FortiGate will reject the SAML response.

This has now been loosened with the following configuration:

```
config user saml
    edit <name>
        set require-signed-resp-and-asrt <enable | disable>
    next
end
```

Option	Description
`enable`	Both response and assertion must be signed and valid.
`disable`	At least one of response or assertion must be signed and valid (default).

By default, the setting is disabled, which only requires one of the response or assertion to be signed and valid.

For more information, see Identity Providers.

Policy check required for hairpin traffic

In FortiOS 7.6.5, the default setting for `allow-traffic-redirect` and `ipv6-allow-traffic-redirect` changed from `enable` to `disable`:

```
config system global
  set allow-traffic-redirect disable
  set ipv6-allow-traffic-redirect disable
end
```

Upon upgrade, both of these settings will be changed to `disable`, even if they were enabled before.

Disabling this setting ensures that hairpin traffic arriving at an interface and redirected out on the same interface requires a firewall policy to explicitly allow the traffic. If you want to redirect traffic without the need for a policy based only on routing decision, then manually enable these settings.

Changing vlan-lookup-cache requires system restart

Enabling or disabling `vlan-lookup-cache` or any configuration change that causes a system restart can disrupt the operation of an FGCP cluster. If possible, you should make this configuration change to the individual FortiGates before setting up the cluster. If the cluster is already operating, you should temporarily remove the secondary FortiGate(s) from the cluster, change the configuration of the individual FortiGates and then re-form the cluster. You can remove FortiGate(s) from a cluster using the *Remove Device from HA cluster* button on the *System > HA GUI* page. For more information, see Disconnecting a FortiGate.

Upgrade information

Supported upgrade path information is available through the Upgrade Path Tool on the Fortinet Document Library.

FortiGate	Upgrade option	Details
Individual FortiGate devices	Manual update	Use the procedure in this topic. See also Upgrading individual devices in the FortiOS Administration Guide.
	Automatic update based on FortiGuard upgrade path	See Enabling automatic firmware updates in the FortiOS Administration Guide for details
Multiple FortiGate devices in a Fortinet Security Fabric	Manual, immediate or scheduled update based on FortiGuard upgrade path	See Fortinet Security Fabric upgrade on page 17 and Upgrading all devices in the FortiOS Administration Guide.

To view supported upgrade path information:

1. Go to the Fortinet Document Library at https://docs.fortinet.com/product/fortigate.
2. From the right side-bar, go to *Tools & Resources* and select *Upgrade Path Tool*.
3. Check that *Choose a product* is *FortiGate / FortiOS*.
4. In the *Product Model* list, select your model.
5. In the *Current Version* list, select the FortiOS version you are currently running.
6. In the *Target Upgrade Version* list, select the target FortiOS version for the upgrade.
7. Click *Go* to view the upgrade path.

Fortinet Security Fabric upgrade

FortiOS 7.6.6 is verified to work with these Fortinet products. This includes:

FortiAnalyzer	• 7.6.6
FortiManager	• 7.6.6
FortiExtender	• 7.4.0 and later
FortiSwitch OS (FortiLink support)	• 6.4.6 build 0470 and later
FortiAP	• 7.2.2 and later

FortiAP-U	• 6.2.5 and later
FortiAP-W2	• 7.2.2 and later
FortiClient EMS	• 7.0.3 build 0229 and later
FortiClient Microsoft Windows	• 7.0.3 build 0193 and later
FortiClient Mac OS X	• 7.0.3 build 0131 and later
FortiClient Linux	• 7.0.3 build 0137 and later
FortiClient iOS	• 7.0.2 build 0036 and later
FortiClient Android	• 7.0.2 build 0031 and later
FortiSandbox	• 2.3.3 and later for post-transfer scanning • 4.2.0 and later for post-transfer and inline scanning

* If you are using FortiClient only for IPsec VPN, FortiClient version 6.0 and later are supported.

When upgrading your Security Fabric, devices that manage other devices should be upgraded first.



When using FortiClient with FortiAnalyzer, you should upgrade both to their latest versions. The versions between the two products should match. For example, if using FortiAnalyzer 7.6.0, use FortiClient 7.6.0.

Upgrade the firmware of each device in the following order. This maintains network connectivity without the need to use manual steps.

1. FortiAnalyzer
2. FortiManager
3. FortiGate devices
4. Managed FortiExtender devices
5. Managed FortiSwitch devices
6. Managed FortiAP devices
7. FortiClient EMS
8. FortiClient
9. FortiSandbox
10. FortiMail
11. FortiWeb
12. FortiNAC
13. FortiVoice
14. FortiDeceptor
15. FortiNDR
16. FortiTester
17. FortiMonitor



If Security Fabric is enabled, then all FortiGate devices must be upgraded to 7.6.6. When Security Fabric is enabled in FortiOS 7.6.6, all FortiGate devices must be running FortiOS 7.6.6.

Downgrading to previous firmware versions

Downgrading to previous firmware versions results in configuration loss on all models. Only the following settings are retained:

- operation mode
- interface IP/management IP
- static route table
- DNS settings
- admin user account
- session helpers
- system access profiles

Firmware image checksums

The MD5 checksums for all Fortinet software and firmware releases are available at the Customer Service & Support portal, https://support.fortinet.com. After logging in, go to *Support* > *Firmware Image Checksums* (in the *Downloads* section), enter the image file name including the extension, and click *Get Checksum Code*.

FortiGate 6000 and 7000 upgrade information

To make sure a FortiGate 6000 or 7000 firmware upgrade is successful, before starting the upgrade, Fortinet recommends you use health checking to make sure the FIMs and FPMs are all synchronized and operating as expected.

If you are following a multi-step upgrade path, you should re-do health checking after each upgrade step to make sure all components are synchronized before the next step.

You should also perform a final round of health checking after the firmware upgrade process is complete.

For recommended health checking commands, see the Fortinet community article: Technical Tip: FortiGate-6000/7000 Chassis health check commands.

Both management boards and all of the FPCs in a FortiGate 6000 FGCP HA cluster run the same firmware image. You upgrade the firmware from the primary FortiGate 6000 management board. The firmware image is copied to the FPCs and all components upgrade at the same time.

All of the FIMs and FPMs in a FortiGate 7000 FGCP HA cluster also run the same firmware image. You upgrade the firmware from the primary FIM in the primary FortiGate 7000. The firmware image is copied to the secondary FIM and the FPMs and all components upgrade at the same time.

A graceful firmware upgrade of a FortiGate 6000 or 7000 FGCP cluster only causes minimal traffic interruption. Use the following command to enable graceful upgrade.

```
config system ha
   set upgrade-mode uninterruptible
end
```

To improve session synchronization during a graceful upgrade, you can also enable `session-pickup`:

```
config system ha
   set session-pickup enable
end
```



For the FortiGate 7000F platform, enabling session pickup requires using the `session-sync-dev` option to select one or more interfaces to use for session synchronization. The recommended session synchronization configuration is to add two 100Gbps FIM management interfaces to a LAG and configure the HA `session-sync-dev` option to use this LAG for session synchronization. The recommended interfaces to use for this LAG are the M1 interface of the FIM in slot 1 and the M1 interface of the FIM in slot 2. You should use a switch to connect the LAGs in the two chassis. To support graceful upgrade with session synchronization:

```
config system ha
   set upgrade-mode uninterruptible
   set session-syn-dev <lag>
   set session-pickup enable
end
```

During a graceful firmware upgrade the secondary FortiGate 6000 or 7000 upgrades its firmware first, traffic then fails over to the secondary FortiGate 6000 or 7000 and then the primary FortiGate 6000 or 7000 firmware is upgraded. A FortiGate 6000 or 7000 firmware upgrade can take a few minutes, the amount of time depending on the hardware and software configuration and whether DP or NP7 processor software is also upgraded.

On a standalone FortiGate 6000 or 7000, or an HA cluster with `upgrade-mode` to `simultaneous`, the firmware upgrade interrupts traffic because all components upgrade in one step. These firmware upgrades should be done during a quiet time because traffic can be interrupted for a few minutes during the upgrade process.

Normally, you would want to set `upgrade-mode` to `uninterruptible` to minimize traffic interruptions. If a traffic interruption is not going to cause any problems, you can set `upgrade-mode` to `simultaneous` so that the firmware upgrade process takes less time.

As well, some firmware upgrades may not support setting `upgrade-mode` to `uninterruptible`. Make sure to review the release notes before running a firmware upgrade to verify whether or not setting `upgrade-mode` to `uninterruptible` is supported to upgrade to that version.

Default setting of cp-accel-mode is changed to none on 2GB memory models

This change disables CP acceleration to lower system memory usage thus can prevent some unexpected behavior due to lack of memory.

Previous FortiOS CLI behavior:

```
config ips global
    set cp-accel-mode advanced
end
```

New FortiOS CLI behavior after upgrade:

```
config ips global
    set cp-accel-mode none
end
```

This change will cause performance impact as CPU will do the pre-match (pattern match) inside IPS (CPU) instead of hardware engine (cp module in SOC4). Some customers could expect an increase in CPU utilization as a result.

FortiGate and FortiWiFi 4xF/6xF families are affected by this change.

Policies that use an interface show missing or empty values after an upgrade

If local-in policy, DoS policy, interface policy, multicast policy, TTL policy, or central SNAT map used an interface in version 7.4.5, 7.6.0 GA or any previous GA version that was part of the SD-WAN zone, these policies will be deleted or show empty values after upgrading to version 7.4.6 or 7.6.1 or later.

This issue is resolved in FortiOS 7.6.3 with mantis 1104649.

After following the upgrade path to FortiOS 7.6.3, you must manually recreate these policies and assign them to the appropriate SD-WAN zone.



Although not recommended, you can skip the upgrade path and upgrade directly to FortiOS 7.6.3, and the policies remain untouched. Skipping upgrade steps might cause devices to miss other important FortiOS checks and changes and is not recommended.

Managed FortiSwitch do not permit empty passwords for administrator accounts

Starting from FortiOS version 7.6.1, a managed FortiSwitch no longer permits empty passwords for the admin account. If a FortiSwitch unit was previously authorized without an admin password, the FortiGate will automatically generate a random admin password for the FortiSwitch upon upgrading to 7.6.1 or later. This change will cause the admin to lose access.

To regain access, configure a password override on the FortiGate device using the following commands:

```
config switch-controller switch-profile
    edit default
        set login-passwd-override enable
        set login-passwd <passwd>
    next
end
```



FortiSwitch units with an existing admin password will not be affected by this change.

Removed speed setting affects SFP+ interfaces after upgrade

Due to `1000auto` speed setting removal on FortiGate 1000F/1001F in FortiOS 7.6.1, upgrade from previous version may result in interface down because speed setting changed to `10000full` on SFP+ interface, which previously used speed `1000auto`. Administrators may need to manually change speed setting to `1000full` to restore the connection.

Hyperscale with FGCP HA clusters and interface monitoring

For previous versions of hyperscale FortiOS, FGCP HA clustering with hardware session synchronization with `config vcluster-status disabled` allowed you to monitor `hw-session-sync-dev` interfaces. FortiOS 7.6.3 changed this behavior, and you can no longer monitor `hw-session-sync-dev` interfaces.

If your HA configuration includes monitoring `hw-session-sync-dev` interfaces, the upgrade to FortiOS 7.6.4 removes the monitor interface configuration.

You can work around this problem by removing monitoring from `hw-session-sync-dev` interfaces or by selecting different interfaces to be `hw-session-sync-dev` interfaces before performing the upgrade.

Password policy enforcement

After upgrade to FortiOS 7.6.5 or later, the password policy is enforced, and your password must meet the requirements before you can log in to FortiOS. Passwords must contain:

- 1 uppercase letter
- 1 lowercase letter
- 1 special character
- 1 number (0-9)
- A minimum length of 12 characters

If your password meets the requirements, you can log in to FortiOS after upgrade.

If your password does not meet the requirements, you must change your password before you can log in to the GUI or CLI.

Traffic loss during graceful upgrade on SLBC HA with override enable due to premature failover

During a graceful firmware upgrade on a FortiGate 6000/7000 Active-Passive HA cluster with HA override enable, traffic loss and session failures may occur when the original primary unit upgrades and reclaims the primary role before its internal modules (FPCs/FPMs) fully come online and synchronize.

Product integration and support

The following table lists FortiOS 7.6.6 product integration and support information:

FortiManager and FortiAnalyzer	See the FortiOS Compatibility Tool for information about FortiOS compatibility with FortiManager and FortiAnalyzer.
Web browsers	• Microsoft Edge 135 • Mozilla Firefox version 138 • Google Chrome version 136 Other browser versions have not been tested, but may fully function. Other web browsers may function correctly, but are not supported by Fortinet.
Explicit web proxy browser	• Microsoft Edge 135 • Mozilla Firefox version 138 • Google Chrome version 136 Other browser versions have not been tested, but may fully function. Other web browsers may function correctly, but are not supported by Fortinet.
FortiController	• 5.2.5 and later Supported models: FCTL-5103B, FCTL-5903C, FCTL-5913C
Fortinet Single Sign-On (FSSO)	• 5.0 build 0328 and later (needed for FSSO agent support OU in group filters) • Windows Server 2025 Standard • Windows Server 2025 Datacenter • Windows Server 2025 Core • Windows Server 2022 Standard • Windows Server 2022 Datacenter • Windows Server 2019 Standard • Windows Server 2019 Datacenter • Windows Server 2019 Core • Windows Server 2016 Datacenter • Windows Server 2016 Standard • Windows Server 2016 Core • Windows Server 2012 Standard • Windows Server 2012 R2 Standard • Windows Server 2012 Core • Novell eDirectory 8.8
AV Engine	• 7.00048
IPS Engine	• 7.01168

See also:

- Virtualization environments on page 25
- Language support on page 25
- Agentless VPN support on page 26
- FortiExtender modem firmware compatibility on page 26

Virtualization environments

The following table lists hypervisors and recommended versions.

Hypervisor	Recommended versions
Citrix Hypervisor	• 8.2 Express Edition, CU1
Linux KVM	• Ubuntu 22.04.3 LTS • Red Hat Enterprise Linux release 9.4 • SUSE Linux Enterprise Server 12 SP3 release 12.3
Microsoft Windows Server	• Windows Server 2022
Windows Hyper-V Server	• Microsoft Hyper-V Server 2022
Open source XenServer	• Version 3.4.3 • Version 4.1 and later
VMware ESXi	• Versions 6.5, 6.7, 7.0, 8.0, and 9.0.

Language support

The following table lists language support information.

Language support

Language	GUI
English	✓
Chinese (Simplified)	✓
Chinese (Traditional)	✓
French	✓
Japanese	✓
Korean	✓

Language	GUI
Portuguese (Brazil)	✓
Spanish	✓

Agentless VPN support

The following table lists the operating systems and web browsers supported by Agentless VPN (formerly SSL VPN web mode). See also SSL VPN tunnel mode replaced with IPsec VPN on page 13.

Operating System	Web Browser
Microsoft Windows 7 SP1 (32-bit & 64-bit)	Mozilla Firefox version 138 Google Chrome version 136
Microsoft Windows 10 (64-bit)	Microsoft Edge 135 Mozilla Firefox version 138 Google Chrome version 136
Ubuntu 20.04 (64-bit)	Mozilla Firefox version 138 Google Chrome version 136
macOS Ventura 13.1	Apple Safari version 18 Mozilla Firefox version 137 Google Chrome version 136
iOS	Apple Safari Mozilla Firefox Google Chrome
Android	Mozilla Firefox Google Chrome

Other operating systems and web browsers may function correctly, but are not supported by Fortinet.

FortiExtender modem firmware compatibility

The following table lists the modem firmware file name and version for each FortiExtender model and its compatible geographical region.

FortiExtender model	Modem firmware image name	Modem firmware file on Support site	Geographical region
FEX-101F-AM	FEM_EM06A-22-1-1	FEM_EM06A-22.1.1-build0001.out	America
FEX-101F-EA	FEM_EM06E-22-01-01	FEM_EM06E-22.1.1-build0001.out	EU
	FEM_EM06E-22.2.2	FEM_EM06E-22.2.2-build0002.out	EU
FEX-201E	FEM_06-19-0-0-AMEU	FEM_06-19.0.0-build0000-AMEU.out	America and EU
	FEM_06-19-1-0-AMEU	FEM_06-19.1.0-build0001-AMEU.out	America and EU
	FEM_06-22-1-1-AMEU	FEM_06-22.1.1-build0001-AMEU.out	America and EU
	FEM_06-22-1-2-AMEU	FEM_06-22.1.2-build0001-AMEU.out	America and EU
FEX-201F-AM	FEM_07A-22-1-0-AMERICA	FEM_07A-22.1.0-build0001-AMERICA.out	America
	FEM_07A-22-2-0-AMERICA	FEM_07A-22.2.0-build0002-AMERICA.out	America
FEX-201F-EA	FEM_07E-22-0-0-WRLD	FEM_07E-22.0.0-build0001-WRLD.out	World
	FEM_07E-22-1-1-WRLD	FEM_07E-22.1.1-build0001-WRLD.out	World
FEX-202F-AM	FEM_07A-22-1-0-AMERICA	FEM_07A-22.1.0-build0001-AMERICA.out	America
	FEM_07A-22-2-0-AMERICA	FEM_07A-22.2.0-build0002-AMERICA.out	America
FEX-202F-EA	FEM_07E-22-1-1-WRLD	FEM_07E-22.1.1-build0001-WRLD.out	World
FEX-211E	FEM_12-19-1-0-WRLD	FEM_12-19.1.0-build0001-WRLD.out	World
	FEM_12-19-2-0-WRLD	FEM_12-19.2.0-build0002-WRLD.out	World
	FEM_12-22-1-0-AMEU	FEM_12-22.0.0-build0001-AMEU.out	America and EU
	FEM_12-22-1-1-WRLD	FEM_12-22.1.1-build0001-WRLD.out	World
FEV-211F_AM	FEM_12_EM7511-22-1-2-AMERICA	FEM_12_EM7511-22.1.2-build0001-AMERICA.out	America

FortiExtender model	Modem firmware image name	Modem firmware file on Support site	Geographical region
FEV-211F	FEM_12-22-1-0-AMEU	FEM_12-22.1.0-build0001-AMEU.out	World
FEX-211F-AM	FEM_12_EM7511-22-1-2-AMERICA	FEM_12_EM7511-22.1.2-build0001-AMERICA.out	America
FEX-212F	FEM_12-19-2-0-WRLD	FEM_12-19.2.0-build0002-WRLD.out	World
	FEM_12-22-1-1-WRLD	FEM_12-22.1.1-build0001-WRLD.out	World
FEX-311F	FEM_EM160-22-02-03	FEM_EM160-22.2.3-build0001.out	World
	FEM_EM160-22-1-2	FEM_EM160-22.1.2-build0001.out	World
FEX-511F	FEM_RM502Q-21-2-2	FEM_RM502Q-21.2.2-build0003.out	World
	FEM_RM502Q-22-03-03	FEM_RM502Q-22.3.3-build0004.out	World
	FEM_RM502Q-22-04-04-AU	FEM_RM502Q-22.4.4-build0005_AU.out	Australia
	FEM_RM502Q-22-1-1	FEM_RM502Q-22.1.1-build0001.out	World
	FEM_RM502Q-22-2-2	FEM_RM502Q-22.2.2-build0002.out	World

The modem firmware can also be uploaded manually by downloading the file from the Fortinet Customer Service & Support site. The firmware file names are listed in the third column of the table.

To download the modem firmware:

1. Go to https://support.fortinet.com/Download/FirmwareImages.aspx.
2. From the *Select Product* dropdown, select *FortiExtender*.
3. Select the *Download* tab.
4. Click *MODEM-Firmware*.
5. Select the FortiExtender model and image name, then download the firmware file.

Resolved issues

The following issues have been fixed in version 7.6.6. To inquire about a particular bug, please contact Customer Service & Support.

Common Vulnerabilities and Exposures

Visit https://fortiguard.com/psirt for more information.

Bug ID	CVE references
1246654	FortiOS 7.6.6 is no longer vulnerable to the following CVE Reference: • CVE-2026-24858

Known issues

Known issues are organized into the following categories:

- New known issues on page 30
- Existing known issues on page 33

To inquire about a particular bug or report a bug, please contact Customer Service & Support.

New known issues

The following issues have been identified in version 7.6.6.

DNS Filter

Bug ID	Description
1254463	Traffic drop occurs when using wildcard FQDN objects when a certain pattern of FQDN cannot be resolved by passive learning. **Workaround**: Include the apex domain in the firewall address and avoid using the wildcard FQDN entry with the exact domain name.

Explicit Proxy

Bug ID	Description
1240208	Intermittent 504 Gateway Timeout errors occur when using explicit proxy after upgrade due to wildcard FQDN not resolving a certain pattern of FQDN **Workaround**: Increase the fqdn-max-refresh value

Firewall

Bug ID	Description
1259241	FortiGate forwards packets with incorrect destination MAC addresses when using EMAC interface with VLAN ID

FortiGate 6000 and 7000 platforms

Bug ID	Description
1244720	Memory usage issues caused by running v4/v6 routing protocols after upgrade **Workaround**: Block or reduce LLC packets from all front port interfaces.

GUI

Bug ID	Description
1256988	Brute-force attacks triggered a lot of leaving http_authd processes running and causing memory usage to steadily increase.

HA

Bug ID	Description
1250511	Unexpected Layer 2 bouncing occurs when peer's dev_base is missing in FGSP HA **Workaround**: Set layer2-connection to unavailable under config system standalone-cluster"

Hyperscale

Bug ID	Description
1262881	Hw session sync dev goes out of sync due to the discrepancy in lag driver between primary and secondary

IPsec VPN

Bug ID	Description
1215724	IPsec tunnel establishment fails when FIPS-CC mode is enabled and DH group 31 or 32 is used.

Proxy

Bug ID	Description
1213247	504 Gateway Timeout shown when a virtual-server configured in full mode connects to a HTTPS server that only supports TLS <= 1.2 and which also only supports using SHA1 for signatures.
1224915	Intermittent page could not be reached issue occurs when authentication is required by QUIC **Workaround**: Disable QUIC

System

Bug ID	Description
1183678	QSFP-28-CWDM4 transceivers in ports 33 and 34 of FortiGate 2600F show as down after upgrading to 7.6.3. **Workaround**: Set mediatype to SR4 and enable FEC.
1188905	Unresponsiveness occurs when MTU calculation is incorrect in function np_fragment.

Upgrade

Bug ID	Description
1243233	Configuration load failure occurs when upgrading to 7.6.5 through FortiManager. **Workaround**: 1. Back up the config. 2. Find all instances of '`Builtin-`' and replace them with '`BuiltIn-`'. 3. Restore the modified config. 4. Upgrade.

User & Authentication

Bug ID	Description
1263865	Connection failure occurs when maximum session limit is reached with EAP enabled in IKE config and TFA for users.

Web Filter

Bug ID	Description
1261505	Video Filter fails to effectively block videos after YouTube updated its API.

Existing known issues

The following issues have been identified in a previous version of FortiOS and remain in FortiOS 7.6.6.

Endpoint Control

Bug ID	Description
1019658	On FortiGate, not all registered endpoint EMS tags are displayed in the GUI.
1038004	FortiGate may not display the correct user information for some FortiClient instances.

Firewall

Bug ID	Description
959065	On the *Policy & Objects > Traffic Shaping* page, when deleting or creating a shaper, the counters for the other shapers are cleared.
990528	When searching for an IP address on the *Firewall Policy* page, the search/filter functionality does not return the expected results.
1252751	Virtual servers with custom SSL ciphers are deleted during upgrade **Workaround**: Set the versions explicitly as soon as the cipher is configured and the end/next command is used.

FortiGate 6000 and 7000 platforms

Bug ID	Description
653335	SSL VPN user status does not display on the FortiManager GUI.
835847	Password policy was not correctly updated when using automation stitch.

Bug ID	Description
936320	When there is a heavy traffic load, there are no results displayed on any *FortiView* pages in the GUI.
947982	On NP7 platforms, DSW packets are missing resulting in VOIP experiencing performance issues during peak times.
950983	*Feature Visibility* options are visible in the GUI on a `mgmt-vdom`.
994241	On FortiGate 7000F using FGSP and FGCP, when TCP traffic takes an asymmetric path, the TCP ACK and data packets might be dropped in NP7.
1006759	After an HA failover, there is no IPsec route in the kernel. **Workaround**: Bring down and bring up the tunnel.
1102072	On the FortiGate 7000 platform, cmdbsvr CPU usage can be higher than normal for extended periods on one or more FPM.
1112582	Under some conditions, such as during conserve mode, you may be unable to log in to the FortiGate 6000 management board GUI or CLI, or when you log in to the management board console, a message similar to fork failed() continuously repeats.
1130491	Traffic disruption occurs when WCCP is enabled on FortiGate **Workaround**: Direct all related traffic to master FPC.
1131269	UESP packet drop occurs when VPN peer uses different source ports for IKE-NATT and UESP **Workaround**: Add a flow rule to work around the issue
1170210	FGT Wireless controller Wifi client cannot ping GW/FGT interface. Pass-through traffic works fine.
1185009	Traffic on VLAN interfaces is dropped when changing LAG members in emac over VLAN setups due to MAC address changes not being updated.
1185528	Subscription license on the secondary chassis is missing after the graceful upgrade from 7.2.10/11 to 7.2.12. **Workaround**: Run `execute update-now` again.
1225359	During a graceful firmware upgrade on a FortiGate 6000/7000 Active-Passive HA cluster with HA override enable, traffic loss and session failures may occur when the original primary unit upgrades and reclaims the primary role before its internal modules (FPCs/FPMs) fully come online and synchronize.
1242828	Erroneous memory allocation may occur under specific conditions on FIMs and the primary FPM during IPv4 and IPv6 routing operations.

FortiView

Bug ID	Description
1034148	The *Application Bandwidth* widget on the *Dashboard > Status* page does not display some external applications bandwidth data.

GUI

Bug ID	Description
793029	Unexpected behavior occurs on some FortiGate models when a FortiClient lacks a required MAC address attribute.
1237136	Dynamic VLANs are not visible on the GUI when a port-security-policy is applied

HA

Bug ID	Description
1135376	When HA members are not registered under the same FortiCare account, the HA cluster cannot obtain contract info of all members from FortiGuard servers.
1226122	System > HA: There is no upgrade button on secondary GUI page when HA in local-only or secondary-only MVC upgrade mode. **Workaround**: upgrade the secondary via the command line.
1234340	Asymmetric session handling fails when two FGSP links are configured and only the second link recovers after both go down.
1260236	Unexpected power off events occur in FortiGate 70G when configured in HA Active/Passive mode with wireless traffic.

Hyperscale

Bug ID	Description
1030907	With a FGSP and FGCP setup, sessions do not show on the HA secondary when the FGSP peer is in HA.
1042011	Observed `NPD-0 :DEL PRP FAIL! 0xffffffff; NPD-0 :PRP ADD FAIL! 0xffffffff nat_type=00000044 block_sz=128 port_base=11000`.
1130107	Session-helper DNS session is created by hw and can be seen in log2host table.

Intrusion Prevention

Bug ID	Description
1076213	FortiGate's with 4GB memory might enter conserve mode during the FortiGuard update when IPS or APP control is enabled. **Workaround**: Disable the `proxy-inline-ips` option under `config ips settings`.

Bug ID	Description
1093769	Unexpected IPS UTM logs may be generated in NGFW policy mode for unknown applications.

IPsec VPN

Bug ID	Description
735398	On FortiGate, the IKE anti-replay does not log duplicate ESP packets when SA is offloaded in the event log.
1164175	DH group mismatches with INVALID_KE when peer proposes a DH group in its IKE_SA_INIT which is not in the expected order

Proxy

Bug ID	Description
1035490	The firewall policy works with proxy-based inspection mode on FortiGate models with 2GB RAM after an upgrade. **Workaround**: After an upgrade, reboot the FortiGate.
1252579	High CPU usage occurs when proxy-based inspection mode is enabled and udp-not-quic traffic is allowed **Workaround**: Set `udp-not-quic` to `block` in `firewall ssl-ssh-profile`.

REST API

Bug ID	Description
993345	The router API does not include all ECMP routes for SD-WAN included in the `get router info routing-table` command.

Security Fabric

Bug ID	Description
1040058	The Security Rating topology and results does not display non-FortiGate devices.

Switch Controller

Bug ID	Description
1113304	FortiSwitch units are offline after FortiGate is upgraded from 7.4.6 or 7.6.0 to 7.6.1 or later when LLDP configuration is set to vdom/disable under the FortiLink interface. **Workaround**: In LLDP configuration, enable `lldp-reception` and `lldp-transmission` under the FortiLink interface, or rebuild the FortiLink interface.
1172745	Timeout error occurs when running `execute switch-controller diagnose-connection` command.

System

Bug ID	Description
1041726	Traffic flow speed is reduced or interrupted when the traffic shaper is enabled.
1142465	ARP entries age out quickly after a system reboot, despite a long reachable-time setting.
1179259	TCP traffic is impacted over VXLAN when auto-asic-offload and UTM both enabled under the policy. **Workaround**: Disable auto-asic-offload on the impacted policy
1193085	Proxy-arp configuration failure occurs when the proxy-arp address group exceeds 256 entries. **Workaround**: Divide the subnet into multiple proxy-arp entries less than 256.
1193085	Proxy-arp configuration failure occurs when the proxy-arp address group exceeds 256 entries **Workaround**: Divide the subnet into multiple proxy-arp entries less than 256
1209793	Interface configuration is lost when FMG managed FortiGate reboots after a power cycle or unexpected shutdown

1227167	Memory usage issues caused by the node process
	Workaround: Enable web-svc-auto-restart by running the command:
	`config system global`
	`  set web-svc-auto-restart enable`
	`end`

1248631	Intermittent reboot issues occur in FortiWiFi-50G when WiFi clients connect via RADIUS or ax bands
1259458	Intermittent reboot of FortiGate-71G caused by an error condition in the IPS engine.
1283972	Reboot occurs when FortiSentry triggers a reboot for suspicious cases. **Workaround**: Switch the security level to low to prevent the reboot.
1299330	Third-party CAPWAP fragments are dropped when they pass through NP7 or NP7Lite FortiGate.

Upgrade

Bug ID	Description
1135049	After a FortiOS upgrade, an error condition occurs when update daemon tries to update the databases while CMDB is still loading the JSON file at the same time.
1252663	On FortiGate D-series devices running older BIOS versions, the serial number changes to FGT0000000000001 after upgrading to FortiOS 7.4.10, 7.4.11, 7.6.5, and 7.6.6.

User & Authentication

Bug ID	Description
1021719	On the *System* > *Certificates* page, the *Create Certificate* pane does not function as expected after creating a new certificate.
1082800	When performing LDAP user searches from the GUI against LDAP servers with a large number of users (more than 100000), FortiGate may experience a performance issue and not operate as expected due to the HTTPSD process consuming too much memory. User may need to stop the HTTPSD process or perform a reboot to recover. **Workaround**: Perform an LDAP user search using the CLI.
1157003	Agentless FSSO connector issues occur when using Windows 2025 due to Microsoft introducing additional restrictions to remote Event log reading.

VM

Bug ID	Description
1125805	Unable to access the FortiGate VM web interface deployed on AWS when ACME is enabled.
1188422	FFW_VM License validation fails when FortiManager is configured as a license server

Web Filter

Bug ID	Description
1040147	The device encounters an issue where options in the `ftgd-wf` section cannot be unset when configuring a web filter via an Ansible playbook

WiFi Controller

Bug ID	Description
1227978	Wi-Fi clients cannot maintain previous IP addresses after roaming from one FAP to another in the inter-controller layer-3 roaming topology.

Built-in AV Engine

AV Engine 7.00048 is released as the built-in AV Engine.

Built-in IPS Engine

IPS Engine 7.01168 is released as the built-in IPS Engine.

Limitations

Citrix XenServer limitations

The following limitations apply to Citrix XenServer installations:

- XenTools installation is not supported.
- FortiGate-VM can be imported or deployed in only the following three formats:
  - XVA (recommended)
  - VHD
  - OVF
- The XVA format comes pre-configured with default configurations for VM name, virtual CPU, memory, and virtual NIC. Other formats will require manual configuration before the first power on process.

Open source XenServer limitations

When using Linux Ubuntu version 11.10, XenServer version 4.1.0, and libvir version 0.9.2, importing issues may arise when using the QCOW2 format and existing HDA issues.



www.fortinet.com

Copyright© 2026 Fortinet, Inc. All rights reserved. Fortinet®, FortiGate®, FortiCare® and FortiGuard®, and certain other marks are registered trademarks of Fortinet, Inc., and other Fortinet names herein may also be registered and/or common law trademarks of Fortinet. All other product or company names may be trademarks of their respective owners. Performance and other metrics contained herein were attained in internal lab tests under ideal conditions, and actual performance and other results may vary. Network variables, different network environments and other conditions may affect performance results. Nothing herein represents any binding commitment by Fortinet, and Fortinet disclaims all warranties, whether express or implied, except to the extent Fortinet enters a binding written contract, signed by Fortinet's Chief Legal Officer, with a purchaser that expressly warrants that the identified product will perform according to certain expressly-identified performance metrics and, in such event, only the specific performance metrics expressly identified in such binding written contract shall be binding on Fortinet. For absolute clarity, any such warranty will be limited to performance in the same ideal conditions as in Fortinet's internal lab tests. Fortinet disclaims in full any covenants, representations, and guarantees pursuant hereto, whether express or implied. Fortinet reserves the right to change, modify, transfer, or otherwise revise this publication without notice, and the most current version of the publication shall be applicable.