



DESIGNER EXTRUDER HEAD.


***"In order to ensure the best possible tile conformation by roller and the slipper, it's necessary coating the stirrers with tungsten guides.**

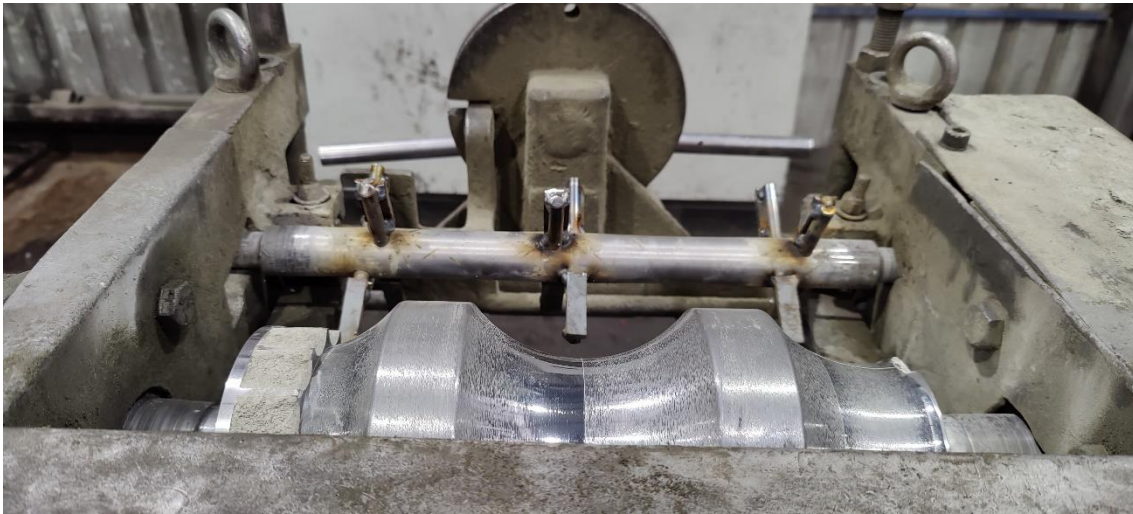

***Adjust the upper side guide in underlap wáter course overlap, to be 0.5 mm, to avoid leverage.**

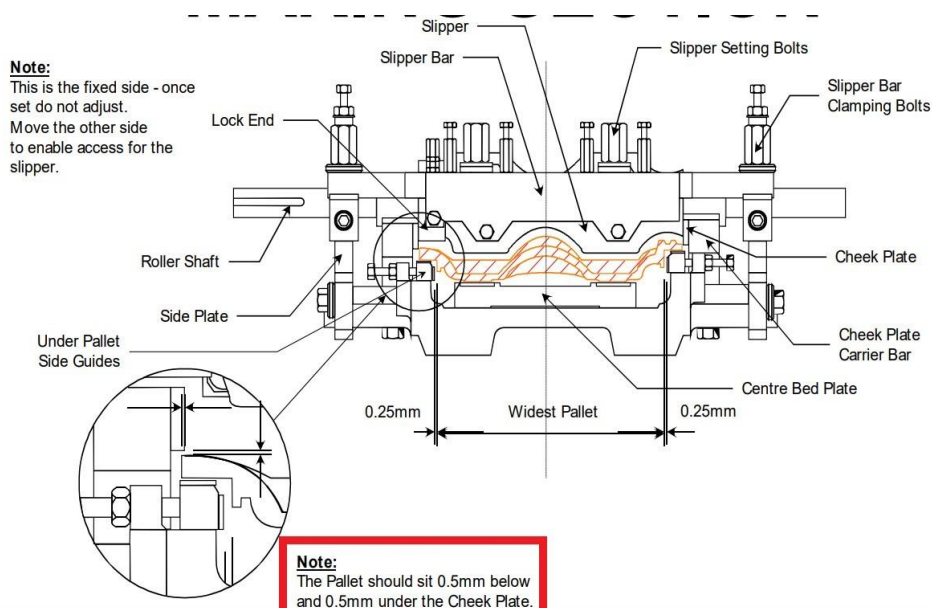

Adjustment of (A) roller heights, end slipper(C) and inclination (B-C). Setting 020223

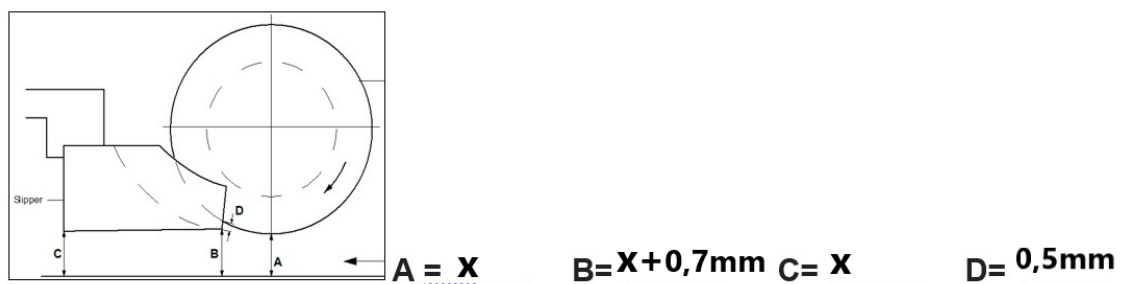

ARTISAN, CLASSIC Y LODGE EXTRUDER HEAD.


***Use the same approach as the DESIGN HEAD, if necessary.**

POSSIBLE CAUSES OF BREAKAGE ROLLER AND SLIPPER BIG.

***One of the possible causes of these breakages on the overlap side of the slipper and roller big is the excess slack in the side locking guide, which allows the guide to be pressed laterally at the bottom, putting excess pressure on the critical areas of the roller and slipper.**




***I believe that this excess clearance and pressure should be identified and, if necessary, the guide should be pressed on a higher line, outside the critical areas of breakage of roller and slipper big.**

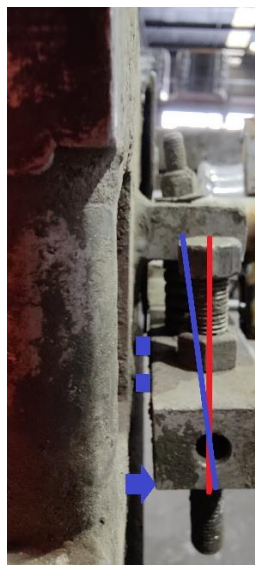


REALISE AGENT APPLICATOR

***The current system pollutes a “lot”, by the pneumatic pump and nozzles in its application.**

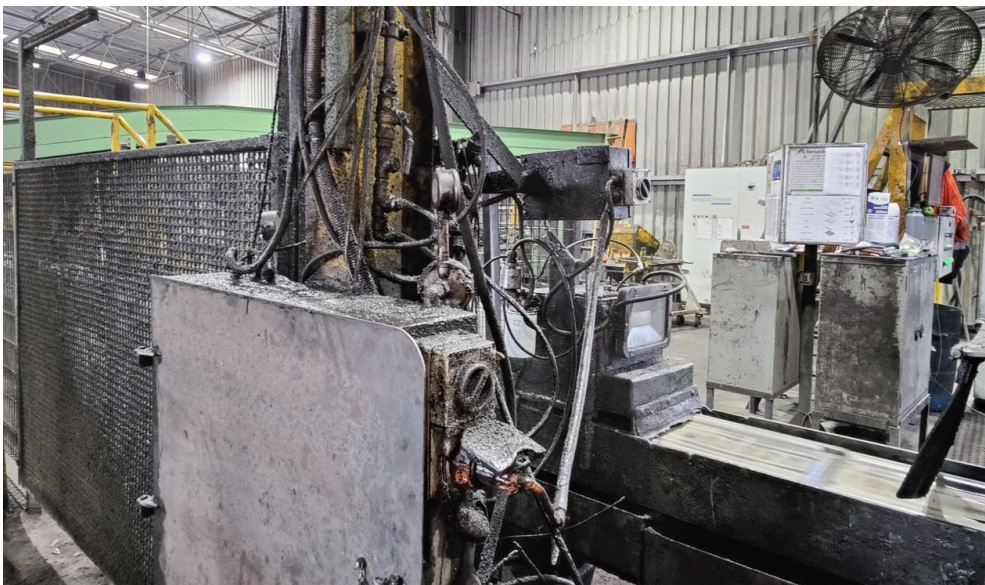

***Better “to change the oil application system” to the New oil curtain application system.**

***Fit anti-fall oil reservoirs ,release agent in application system.**

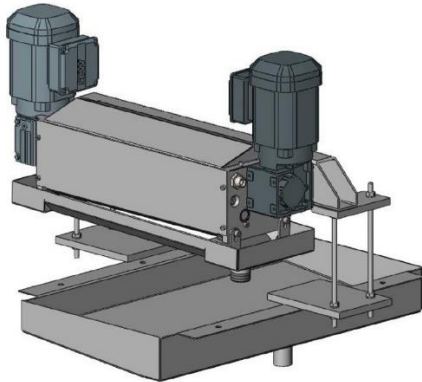

MOISTURE CONTROL.

***A Moisture Analyser should be available ,in the extruder area for the extruder operator to test the moisture content of the mixture.**





IDENTIFY THE PALLET RISE POINT AT THE EXTRUDER OUTLET.


***Point where the pallet is raised and lowered at the extruder outlet.**



***The pallet retention system at the bottom lateral does not work, the pallet has excessive wear and deformation on the pallet sides, which makes it impossible to clamp the pallet.**

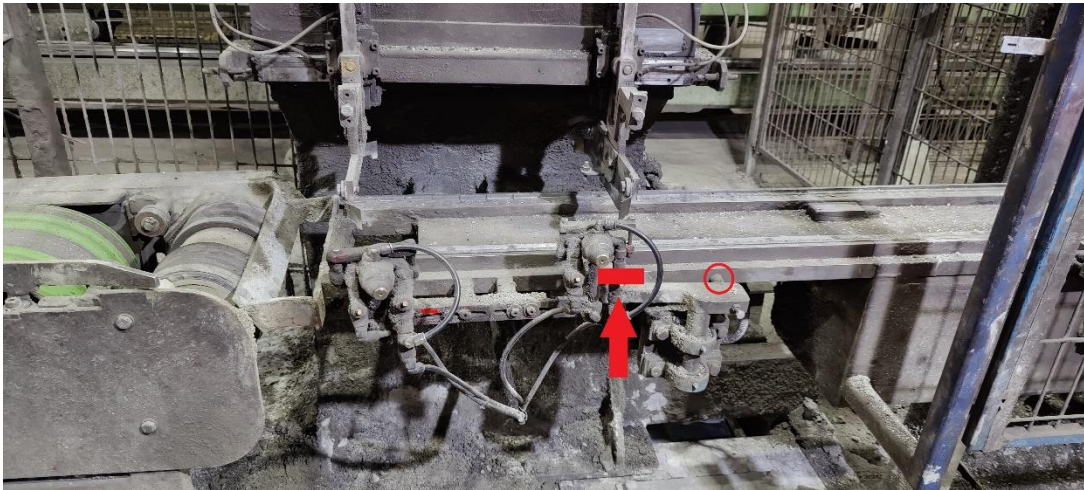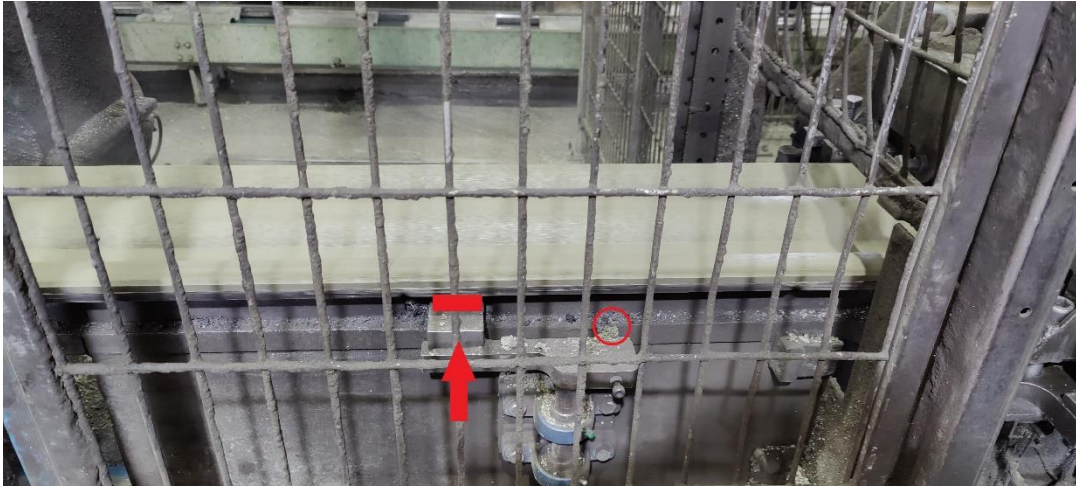

***Lack of pressure or excess wear on the side of the pallet (-2 / 3 mm) or wear on the base (0,5 / 0,7 mm), the free pallet and the pressure exerted by the big slipper between two pallets causes the pallet to rise. (The pallets are a lot wear)**

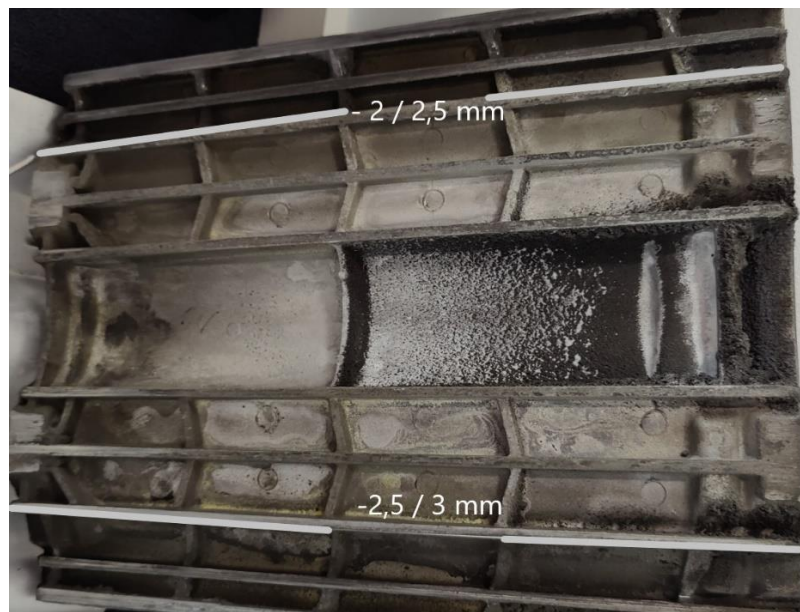

PUSH CHAIN SYSTEM PALLETS


***I don't know this system of “top” thrust pallets, in Spain we changed it many years ago, the bottom pallet pusher system is better**

TILE CUTTING SYSTEM.

***Current contamination of the cutter must be avoided in order to keep the cutter in good working order and to reduce maintenance costs.**



***Cover the back of the cutter (metraquilato or other material) to prevent dirt from entering.**

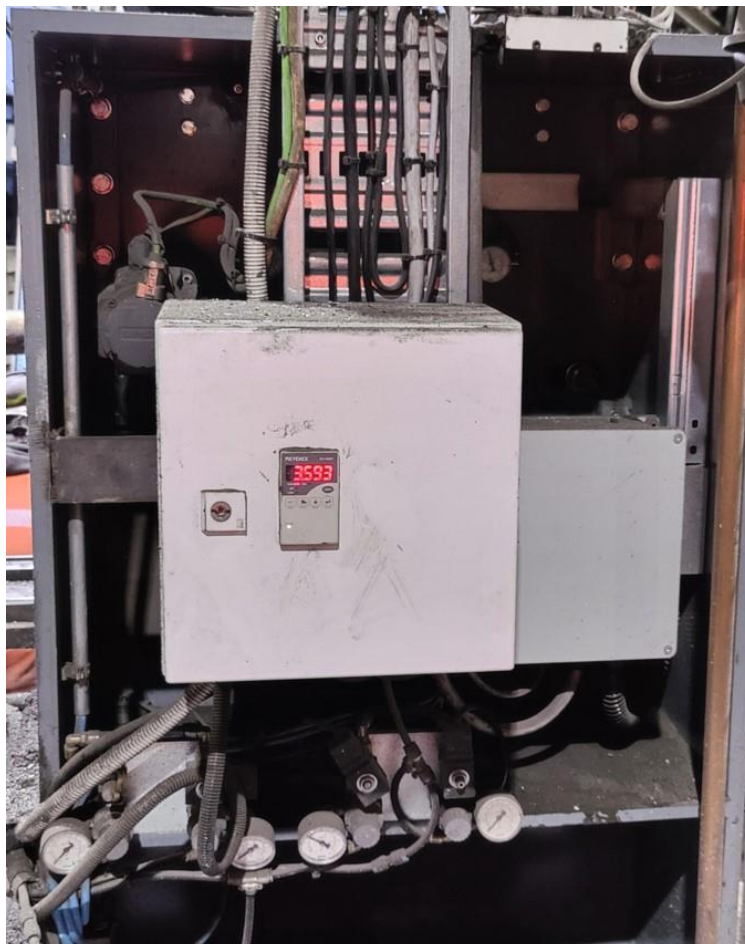

***Place a separation wall between the aplicación de slurry and the cutting system tiles,it's necessary in order not to damage the new cutting system.**



***Concrete debris generated by the tile cutting system and water from the cleaning of the blades, must be collected in a lower box, channelling the water. to prevent it from falling to the floor.**



DIRT ON THE SIDES OF THE PALLETS


***There is dirt on the sides of the pallets, currently in the scraper area, there is a “non-contact área”.**



***Consider placing pallet side scrapers at conveyor feeding pallets to the pusher chain or the exit of the cutting system.(A check and evaluatio of the pallets is necessary)**



***The pallets with the most lateral dirt are the DESIGNER and the ARTISAN.**

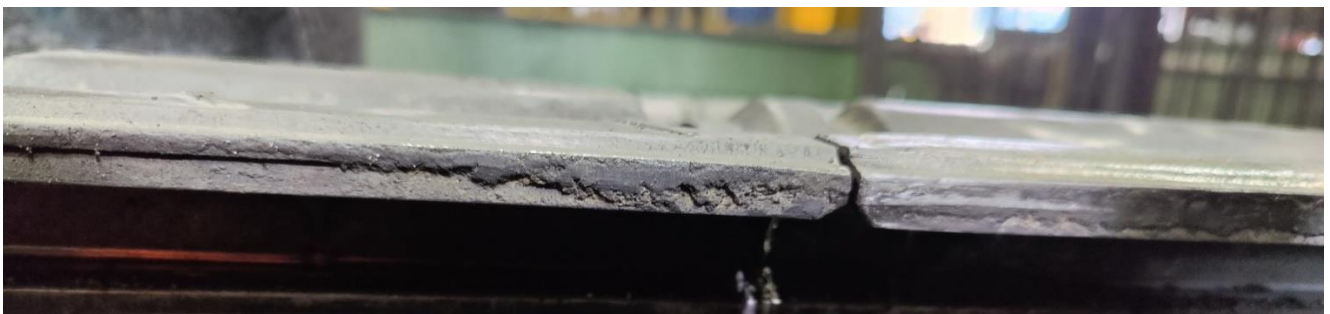

STOCK PALLETS 020223 :

DESIGNER 26.000 Pallets

ARTISAN 14.000 Pallets.

CLASSIC 24.000 Pallets

LODGE 8.000 Pallets.

DESIGNER MOULD WEAR

***In addition to the lower wear of the DESIGNER pallet, on the side of the underlap water course, there is a wear of 2.5 / 3 mm on the support guide, which has led to a deformation of the pallet on that side.**



***In addition to the lower wear of the DESIGNER mould, on the side of the underlap water course. .(A check the dimensions of the pallets on a monthly basis, in order to identify possible wear, as early as possible.)**

***The useful life of a pallette, is considered to be more or less 2,000 passes of the pallet through the extruder head.**