



1. MODIFICATION OF THE FRONT ENCLOSURE IN THE LOADING/UNLOADING ZONE (RACKER AND DERACKER)

Current Situation:


- The Racker and Deracker areas are located within the ROTARY's internal enclosure, sharing the same ambient air as the curing chamber.

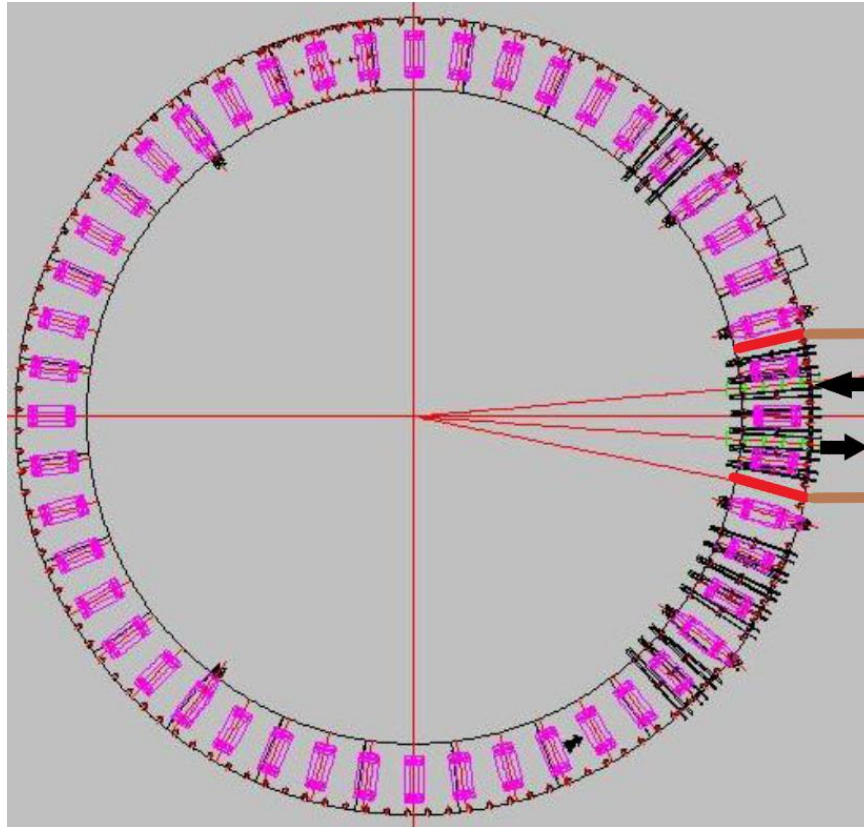

- As a result, temperature and humidity spikes during tile loading directly and negatively impact the Racker and Deracker zones.

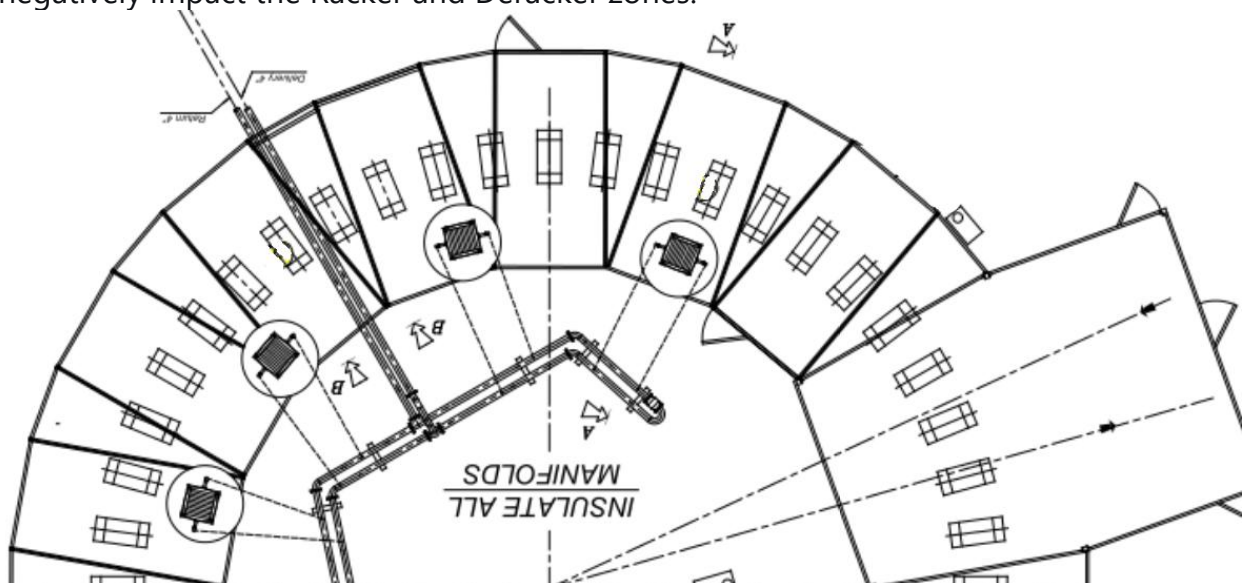


- The current setup allows visibility into the ROTARY's interior from the lateral access points of the Racker and Deracker.

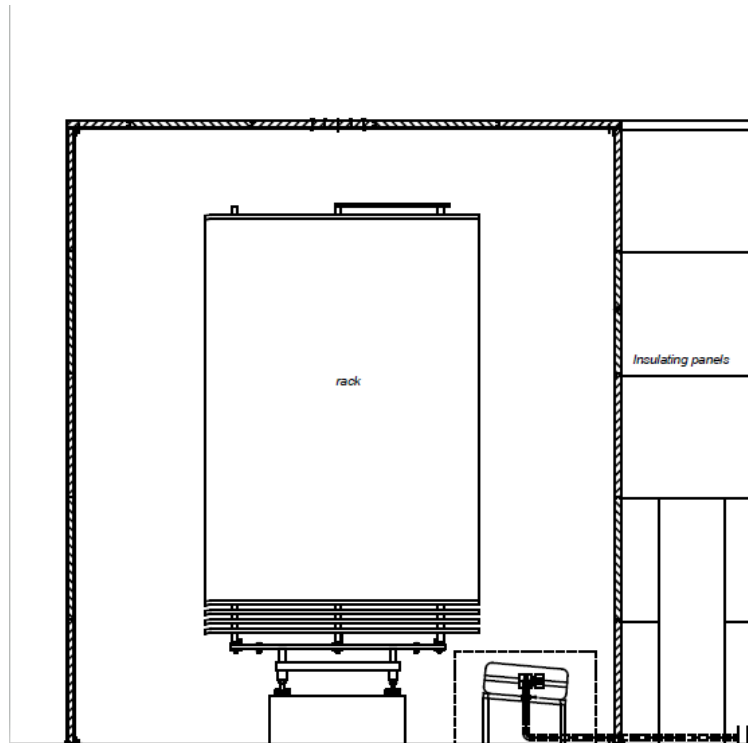


Proposed Modification:

To eliminate the existing external enclosure, the following steps are proposed:

1. Install insulating panels in the interior areas defining the enclosure.

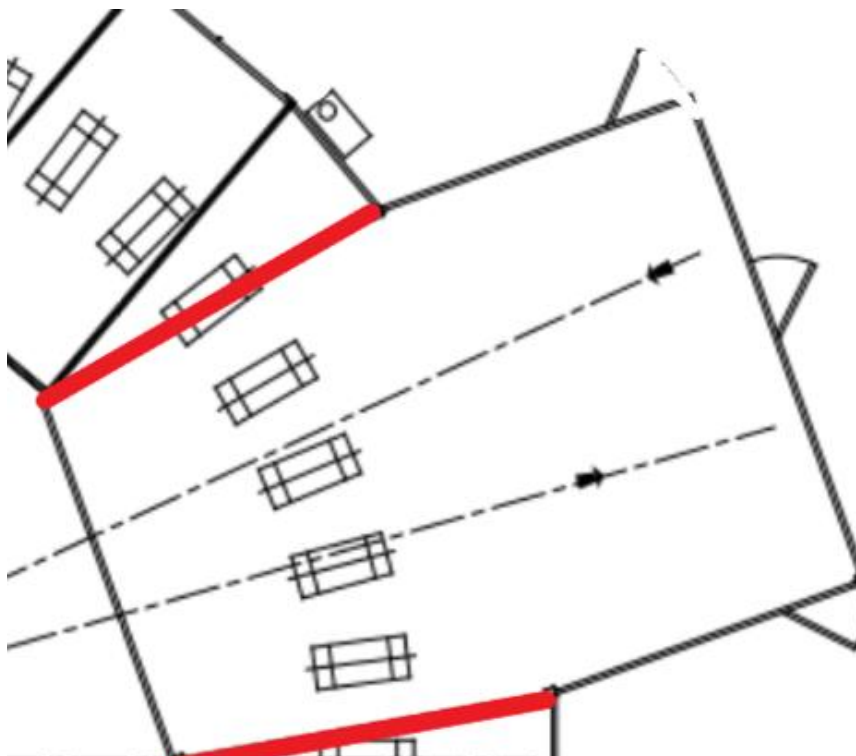

2. Incorporate rubber seals on the top and sides of the insulating panels to improve sealing.

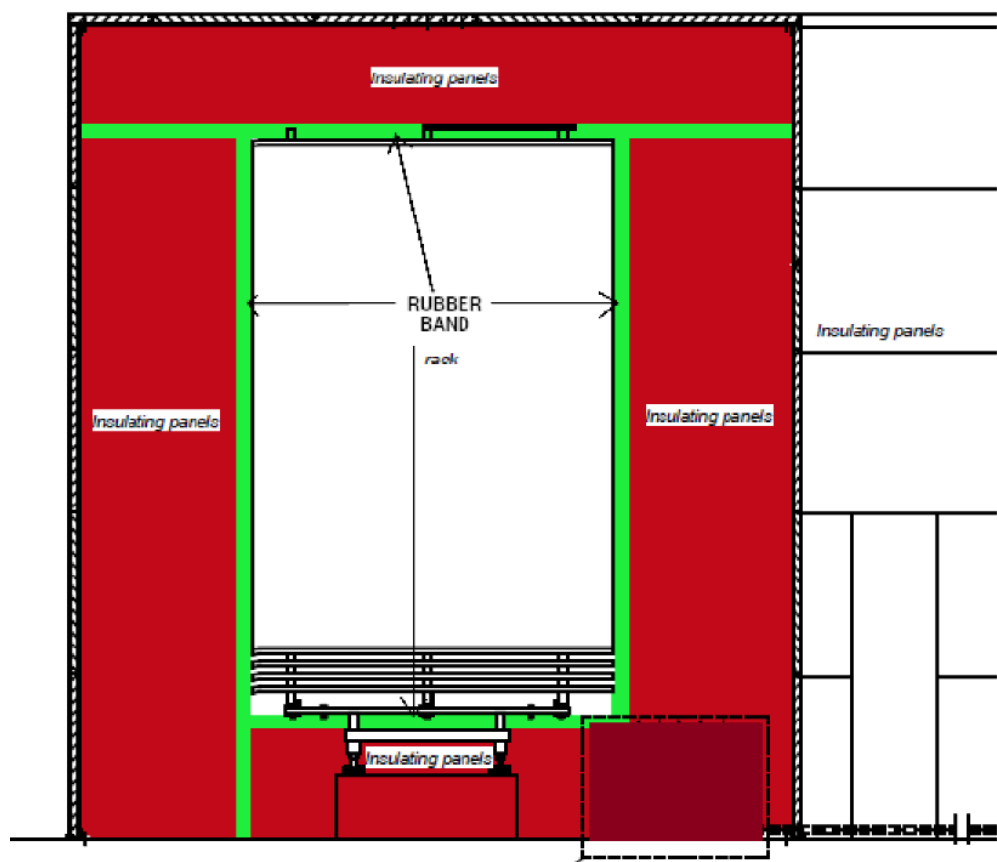

3. Optionally, include access doors in the panels for maintenance purposes.



4. Once the interior enclosure is completed, proceed with the removal of the external front and side panels.

2. AMBIENT HUMIDITY CONTROL SYSTEM FOR CURING

Current Issues:

- 100% relative humidity inside the ROTARY.
- Condensation leading to water dripping from the ceiling onto the tiles.
- Tile surface damage and excessive moisture in the connection boxes.

Proposed Solution:

Installation of a control system with the following features:

- Centralized controller with humidity sensors.
- Activation threshold: 98% relative humidity.
- Two alternative systems for extracting humidity to the exterior.
- Objective: Prevent humidity from reaching 100%.

3. HUMIDITY EXTRACTION SYSTEMS IN THE ROTARY

Two systems are available for humidity control in the ROTARY:

1. Installation of extraction fans on the ceiling:

A conventional system involving the placement of specialized fans at the top of the chamber.



2. Installation of ventilation louver windows on the perimeter:

An alternative system comprising adjustable louver windows on the external enclosure, allowing controlled release of humid air.

3. REDUCTION OF CURING TEMPERATURE DIFFERENCE BETWEEN TILES

Current Issues:

A temperature difference of approximately 15°C has been identified between the upper and lower zones of the ROTARY curing system. This variation causes significant discrepancies in tile finish, with higher gloss on the upper tiles and darker shades on the lower ones.


Proposed Solution:

To homogenize the temperature inside the chamber, a forced air recirculation system is proposed. The strategy involves redirecting hot air from the upper zone to the lower levels of the ROTARY.

Technical Implementation:

The proposed solution includes the installation of two recirculation fans strategically placed in front of the existing heat exchangers. This design will:

- Force the descent of accumulated hot air from the upper section.
- Ensure constant and uniform air circulation throughout the chamber.
- Maintain even thermal distribution during the curing process.

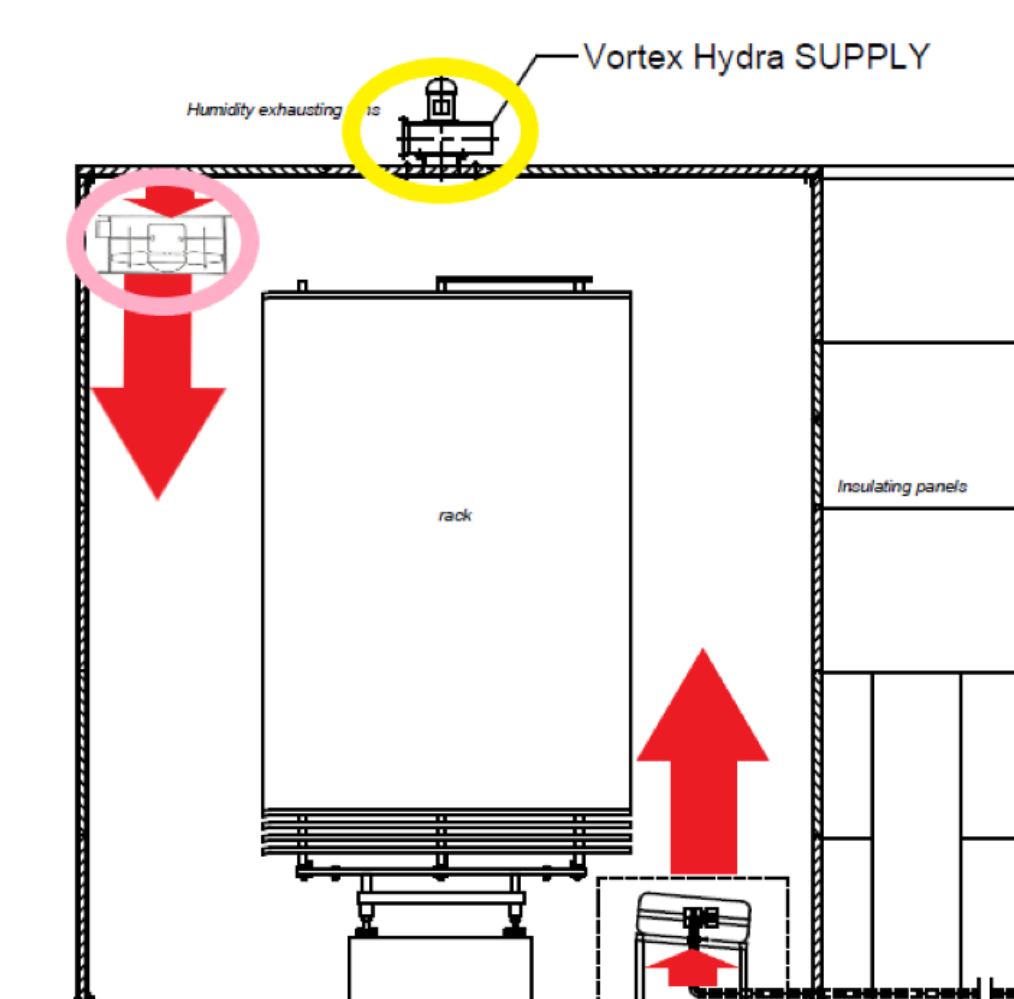

Graphical Reference:

The attached schematic illustrates the layout and configuration of all elements described in this proposal.

