# INITIAL FIRE SAFETY INSPECTION REPORT

## FUTURE CLOTHING LTD.

## RSC ID: 24447

**DURGAPUR, MONDOLBARI, ZIRABO, ASHULIA, SAVAR, DHAKA**

Geographical Coordinates of factory building: 23.903444,90.303604

**Other Factories: No**




RSC | RMG SUSTAINABILITY COUNCIL

**Inspected By: Dilip Kumar Mondal and Md. Sadid Rahman**

**Date: 18 July-2022**

# Fire Safety Inspection Report

## FUTURE CLOTHING LTD.

## Introduction:

FUTURE CLOTHING LTD. complex was surveyed for fire safety on **18 July-2022** by The RSC Inspection Team. The purpose of the survey was to identify significant fire safety issues and to provide recommendations for remediation based on applicable standards specified by the RSC. The scope of this initial fire safety inspection was limited to the review and identification of major fire safety issues. The inspection did not include identification of minor deficiencies, which will be further addressed as part of follow-up inspections.

## Limitations

The information in this fire safety inspection report was obtained during a visit to the facility and during interviews with local factory management. It has not been possible to provide independent verification for all the information and data collected, and, therefore, The RSC cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.
The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

## General Factory Information

**Factory Building name(s) in this ID:24447:**

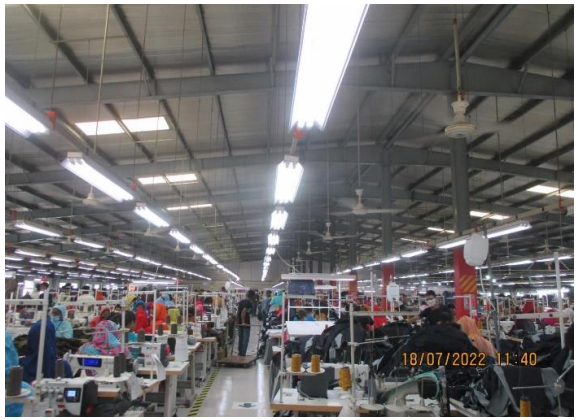
1. Building-1 [Office]: Two Story RCC Building-(Construction starting Feb 2018, and Under construction)
2. Shed-1 [Sewing]: Single Story Steel Structure-(Construction starting Feb 2018, Completed- Aug 2019)
3. Shed-2 [HR-Reception]: Single Story Steel Structure -(Construction starting Feb 2018, Completed- Aug 2019)
4. Shed-3 [Finishing]: Single Story Steel Structure -(Construction starting Feb 2018, Completed- Aug 2019)
5. Shed-4 [Wash Sent and Receive]: Single Story Steel Structure -(Construction starting Feb 2018, Completed- Aug 2019)
6. Shed-5 [Medical and Daycare]: Single Story Steel Structure -(Construction starting Feb 2018, Completed- Aug 2019)
7. Shed-6 [Utility]: Single Story Steel Structure -(Construction starting Feb 2018, Completed- Aug 2019)
8. Building-2 [Guard Room]: Single Story RCC Building -(Construction starting Feb 2018, Completed- Aug 2019)
9. Building-3 [Compressor]: Single Story RCC Building -(Construction starting Feb 2018, Completed- Aug 2019)
10. Shed-7 [Boiler]: Single Story Steel Structure ( Nov 2021 to March 2022)
11. Shed-8 [Inspection Room]: Single Story Steel Structure -(Construction starting Feb 2018, Completed- Aug 2019)
12. Shed-9 [Prayer]: Single Story Steel Structure -(Construction starting Feb 2018, Completed- Aug 2019)
13. Shed-10 [Toilet 1]: Single Story Steel Structure -(Construction starting Feb 2018, Completed- Aug 2019)
14. Shed-11 [Toilet 2]: Single Story Steel Structure-(Construction starting Feb 2018, Completed- Aug 2019)
15. Shed-12 [Toilet 3]: Single Story Steel Structure -(Construction starting Feb 2018, Completed- Aug 2019)

**Factory Address: DURGAPUR, MONDOLBARI, ZIRABO, ASHULIA, SAVAR, DHAKA**

**Findings & Recommendations :**

Table 1 summarizes the major fire safety issues identified during the inspection of main building. Recommendations have been provided to address each issue. An implementation schedule shall be developed by the factory to remediate each of the findings. The specific timing of improvements, including any requested extensions due to design / installation constraints, shall be submitted to the RSC for approval.

| **Table-1:** | | | | |
|---|---|---|---|---|
| **Sl No.** | **Category** | **Findings** | **Required Action** | **Remediation Time Frame** |
| F-01 | Fire Rated Construction | Transformer and generator room are not properly separated from each others by fire rated construction.<br>**Location**: **Utility Shed-6.** | Separate the transformer and generator room by a minimum 2-hr fire rated constructions. Seal and/or protect all opening to maintain the required fire separation. Provide proper ventilation system with consult a qualified engineer. Follow the RSC Technical Guidelines (Standard)-3.4.2.1 | Within 3 months |
|  | | |  | |

| | | | | |
|---|---|---|---|---|
| F-02 | Fire Rated Construction | The Sheds have been found steel-composite type and the steel columns and girders has been found in exposed condition without any fire protection.<br>Location : Shed-1 and Shed-3 | Construction of interim non-high-rise factories containing G and/or H2 occupancies(factories) shall be Type 1 or Type 2 construction as required in BNBC 2006 Part 3 Table 3.2.4.The fire resistance of structural members for interim and existing building shall be in compliance with BNBC 2006 Part 3 Chapter 3 and Table 3.3.1. Chemical store shed shall be type-1 construction. Provide required fire rating on the structural elements by following Table-3.2.4, 3.1.9 & Table 4.4.1 of the RSC Technical Guidelines (Standard) or Table 3.3.1 of BNBC-2006. Consult a qualified fire protection engineer to design the rated construction barriers in between two floors and in structural members. | Within 6 months |
|  | | |  | |

| | | | | |
|---|---|---|---|---|
| F-03 | Fire Rated Construction | Storage rooms are not properly separated by fire rated construction.<br>Location: Shed-1 and Shed-3 ( non-rated door) | Provide dedicated storage rooms separated by minimum 1-hr fire-rated construction.<br>Where separate storage rooms are not feasible, provide defined storage areas and limit the storage arrangement as follows: - Maximum height of 2.4m and maximum area of 23 m² - If sprinkler protected: maximum height of 3.66m and maximum area of 93 m²<br>Separate areas of unenclosed combustible storage by a minimum clear distance of 3m. | Within 3 months |
|  | | |  | |

| | | | | |
|---|---|---|---|---|
| F-04 | Fire Rated Construction | Areas used for **in-process storage** of combustible materials are open to the surrounding occupancy. Location: **Shed-3** | Provide defined storage areas and limit the storage arrangement as follows:-<br>1. **General Condition:** Maximum height of 2.4m and maximum area of 23m2. Separate areas of unenclosed combustible storage by a minimum clear distance of 3m.<br><br>2. **If sprinkler protected:** maximum height of 3.66m and maximum area of 93m2. Separate areas of unenclosed combustible storage by a minimum clear distance of 3m.<br>or<br>3. Enclose the storage area from the surrounding occupancy with a minimum 1 hour construction. | Within 1month |
|  | | |  | |

| | | | | |
|---|---|---|---|---|
| F-05 | Fire Rated Construction | The exit discharge path is less than 10 ft. wide and is not separated from the building interior from **Shed-1 at exit-5 and Shed-3 at exit-3.** | Seal all penetrations and openings to the interior of the building along the discharge path, up to a height of 10 ft., to provide a minimum 1-hr fire separation.<br><br>Alternatively, provide a second remote discharge path to the public way (only include this if feasible). | Within 6 months |
|   | | | | |

| | | | | |
|---|---|---|---|---|
| F-06 | Egress | Occupant load sign was not present in the exits. | Provide present occupant load sign in every floors. | Within 1 month |
|   | | | | |

| | | | | |
|---|---|---|---|---|
| F-07 | Fire Alarm & Detection system | The fire detection system is antiquated, not a listed system, and does not provide alarm and notification features consistent with acceptable standards. | Replace the fire detection system with a new, listed addressable fire detection system in accordance with NFPA 72. | Design within 3 months and installation with 6 months |
| |    | | | |
| F-08 | ITM of Fire Alarm & Detection system | Inspection, testing and maintenance for the fire alarm system is not in accordance with NFPA 72. | Inspect, test and maintain the fire alarm system and keep written records on-site, in accordance with The RSC Technical Guidelines (Standard). | Within 1 month (after installation) |
| F-09 | ITM of Fire Extinguishers | Inspection, testing and maintenance of portable fire extinguishers is not in accordance with NFPA 10. | Inspect, test and maintain the portable fire extinguishers and keep written records onsite, in accordance with NFPA 10 ,and in accordance with The RSC Technical Guidelines (Standard). | Within 3 months |

| | | | | |
|---|---|---|---|---|
| F-10 | Egress Lighting | Directional signs are not provided where direction of the path of travel to an exit has changed. | Illuminated directional signs shall be provided where there is a change in the direction for the path of travel and the direction to an exit is not obvious. | Within 3 months |
| |   | |   | |
| F-11 | Egress Lighting | Exit signage not illuminated/missing (burned out, broken, etc.).<br>**Locations: Shed-4 and Shed-8** | Regularly inspect all exit signage and replace/install lights as needed to illuminate signs | Within 1 month |


EXIT

| | | | | |
|---|---|---|---|---|
| F-12 | Emergency light and Exit Sign | Based on the number and location of emergency lights observed, adequate illumination levels are not anticipated along egress routes. **Location-Shed-1 and Shed-3** | Test the emergency lighting system on each floor and provide additional emergency fixtures to provide adequate illumination along the means of egress. Provide a minimum illumination of 10 lux at the floor level within exit stairs and exit discharge paths and minimum 2.5 lux along exit access aisles. | Within 3 months |
| |  | |  | |
| F-13 | ITM of Emergency light and Exit Sign | Inspection, testing, and maintenance for the exit sign and emergency lighting system was not in accordance with The RSC Technical Guidelines (Standard). | Inspect, test and maintain the exit sign and emergency lighting system in the accordance with The RSC Technical Guidelines (Standard). Keep written records on-site. | Within 3 months |