FUTURE CLOTHING LTD.

DURGAPUR, MONDOLBARI, ZIRABO, ASHULIA, SAVAR, DHAKA
(23.903727, 90.303310)
18 July 2022






RSC RMG SUSTAINABILITY COUNCIL

Building information

Building 01 (Office Building): is a partially 3-storied RC structure.

Shed 01 (Sewing): is a single storied prefabricated steel structure.

Shed 02 (HR Reception): is a single storied prefabricated steel structure.

Shed 03 (Finishing): is a single storied steel structure.

Shed 04 (Wash Sent & Receive): is a single storied steel structure.

Shed 05 (Medical & Daycare): is a single storied prefabricated steel structure.

Shed 06 (Utility): is a single storied prefabricated steel structure.

Building 02 (Guard Room): is a single storied masonry structure.

Building 03 (Boiler Room): is a single storied RC structure.

Shed 07 (Compressor Room): is a single storied steel structure.

Shed 08 (Inspection Room): is a single storied steel structure.

Shed 09 (Prayer Room): is a single storied steel structure.

Shed 10 (Toilet -1): is a single storied steel structure.

Shed 11 Toilet -2: The structure is a single storied steel structure.

Shed 12 Toilet -3: The structure is a single storied steel structure.


Observations

Absence of design documents and as-built drawing

Observations: Building-01 (Office Building)



Building-1 (Office Building)

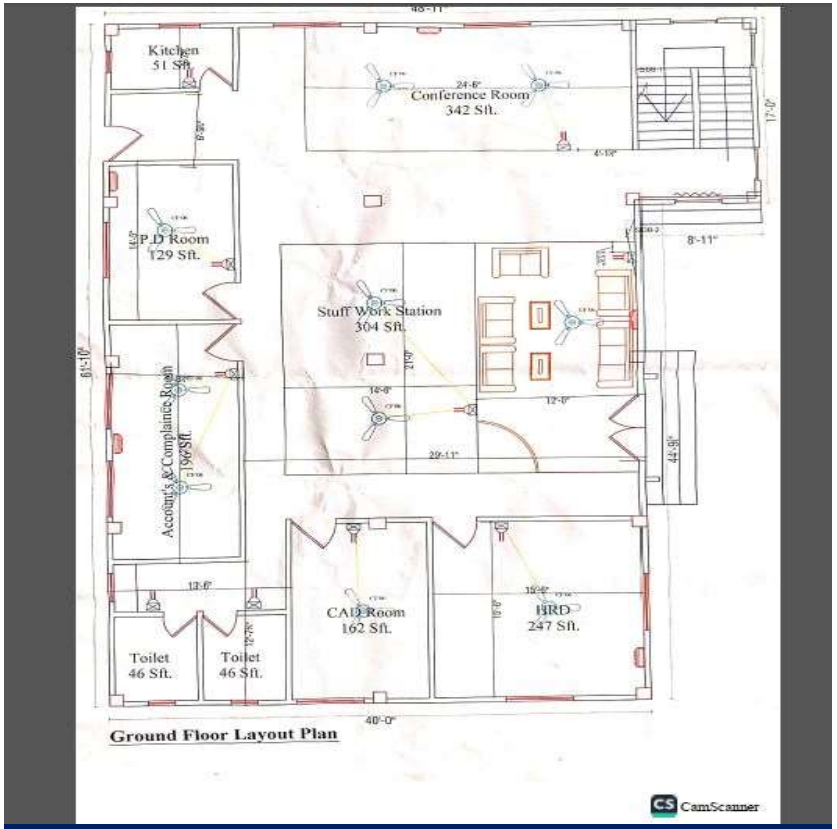

Available floor layout plan

As per BNBC, every building or structure designed shall have its design documents prepared in accordance with the provision of Section 1.9.1. The design document shall include a design report, and a set of structural drawings, which shall be prepared in compliance with section 1.9.1.1 and section 1.9.1.2 as per BNBC. At the time of inspection design report was not available and only a floor layout was available which are required to be prepared in compliance with section 1.9.1.1 and section 1.9.1.2 (part-6, BNBC).

Observations: Building-01 (Office Building)

RSC RMG SUSTAINABILITY COUNCIL

Falling Hazard at roof level and stair area

Observation: Building-01 (Office Building)





Parapet/railing was missing at several location on roof and staircase

Factory is required to provide parapet/railing at all locations of roof and staircase to avoid possible falling hazard.

Observation: Building-01 (Office Building)

Exposed reinforcement left at roof level

Observation: Building-01 (Office Building)



Exposed reinforcement left at roof

Exposed reinforcement is left at roof level which is prone to corrosion. Factory is required to provide rust proof paint on exposed reinforcement to protect from corrosion.

Observation: Building-01 (Office Building)

Crack on brick wall

Observations: Building-02 (Guard Room)



Crack on brick wall

Horizontal crack was observed on masonry wall of Guard room. Factory engineer is required to investigate the reason of crack and repair with a suitable method.

Observations: Building-02 (Guard Room)

Absence of design documents




Shed-1 (Sewing)

As per BNBC, every building or structure designed shall have its design documents prepared in accordance with the provision of Section 1.9.1. The design document shall include a design report, and a set of structural drawings, which shall be prepared in compliance with section 1.9.1.1 and section 1.9.1.2 as per BNBC. At the time of inspection design report was not available. Factory engineer is required to prepare the design report in compliance with section 1.9.1.1 (part-6, BNBC).


Observations: Shed-01 (Sewing)

Discrepancy and missing information as-built drawing

Observations: Shed-01 (Sewing)

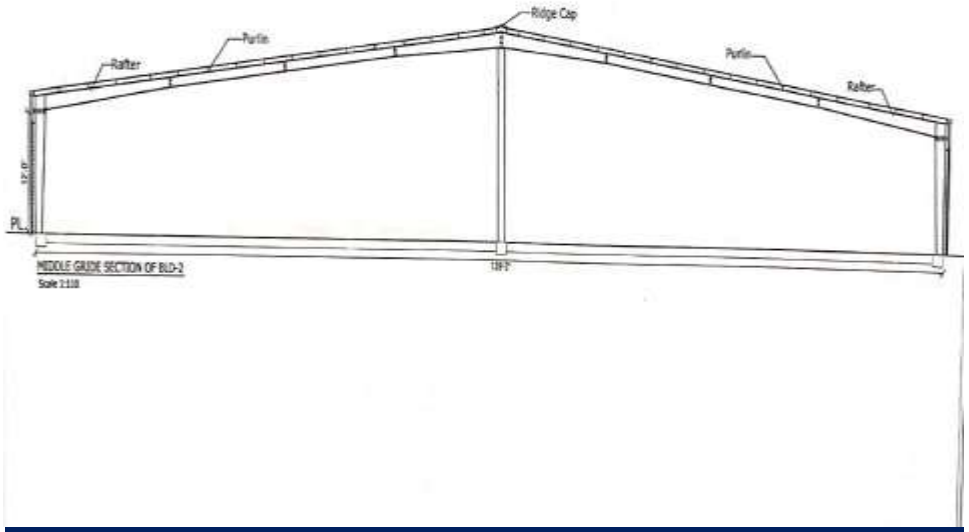


Section provided with no dimension of members

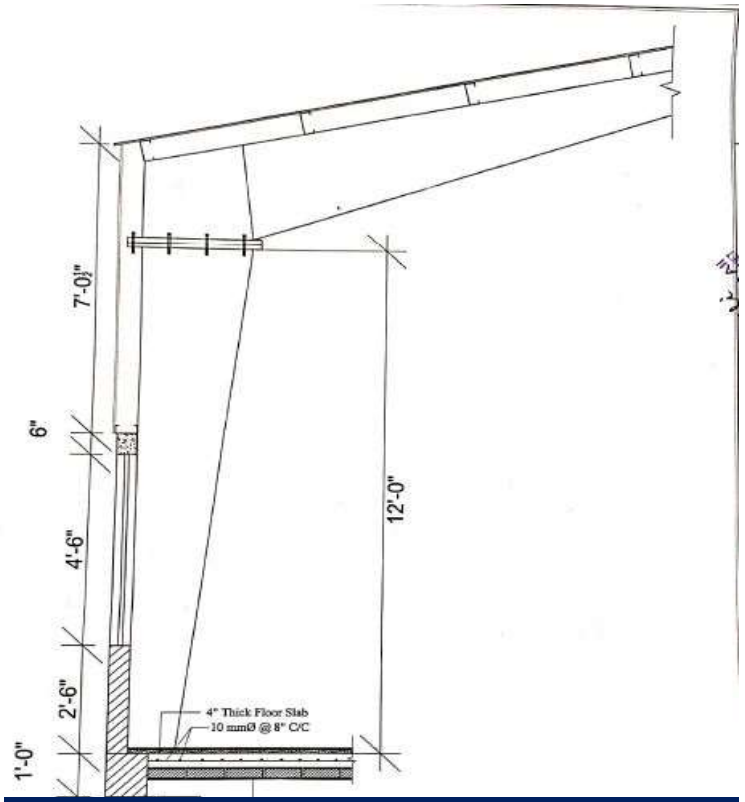

Section provided with no dimension of members

Steel section was shown in as-built drawing, but no dimension of steel members was mentioned. Also, no bracing layout included in as-built drawing. Factory engineer is required to prepare the full set of as-built drawing in compliance with section 1.9.1.2 (part-6, BNBC).

Observations: Shed-01 (Sewing)

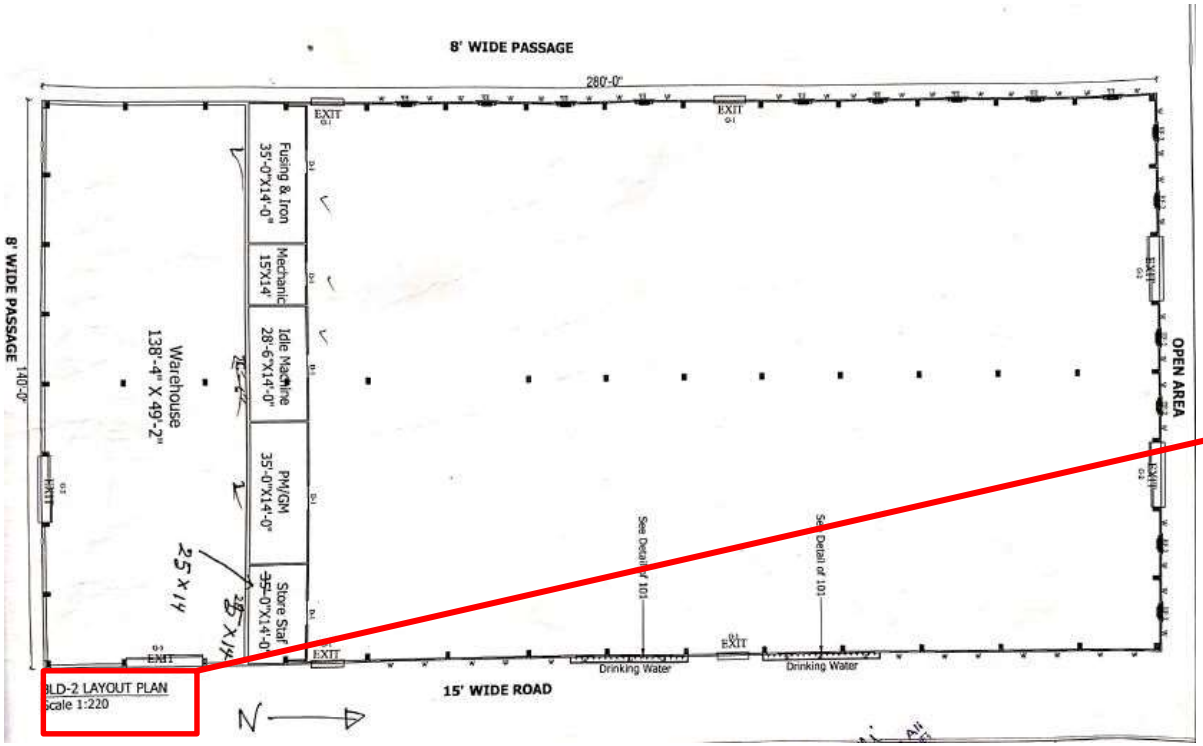

No canopy shown in as-built drawing



A structurally connected canopy observed

A structurally connected canopy observed at marked location which was not shown in as-built drawing. Factory engineer is required to survey the whole structure and prepare accurate as-built drawing.

Observations: Shed-01 (Sewing)

Non-structural elements found unbraced/not anchored

Observations: Shed-01 (Sewing)



Storage rack found within the building without braced/anchored

Factory is required to brace/anchor all non structural elements.

Observations: Shed-01 (Sewing)

Absence of design documents

Observations: Shed-03 (Finishing)



Shed 03 (Finishing)



Interior of the shed

As per BNBC, every building or structure designed shall have its design documents prepared in accordance with the provision of Section 1.9.1. The design document shall include a design report, and a set of structural drawings, which shall be prepared in compliance with section 1.9.1.1 and section 1.9.1.2 as per BNBC. At the time of inspection design report was not available and only a floor layout was available which are required to be prepared in compliance with section 1.9.1.1 and section 1.9.1.2 (part-6, BNBC).


Observations: Shed-03 (Finishing)

Absence of design documents

Observations: Shed-04 (Wash Sent & Receive)



Shed 04 (Wash Sent)

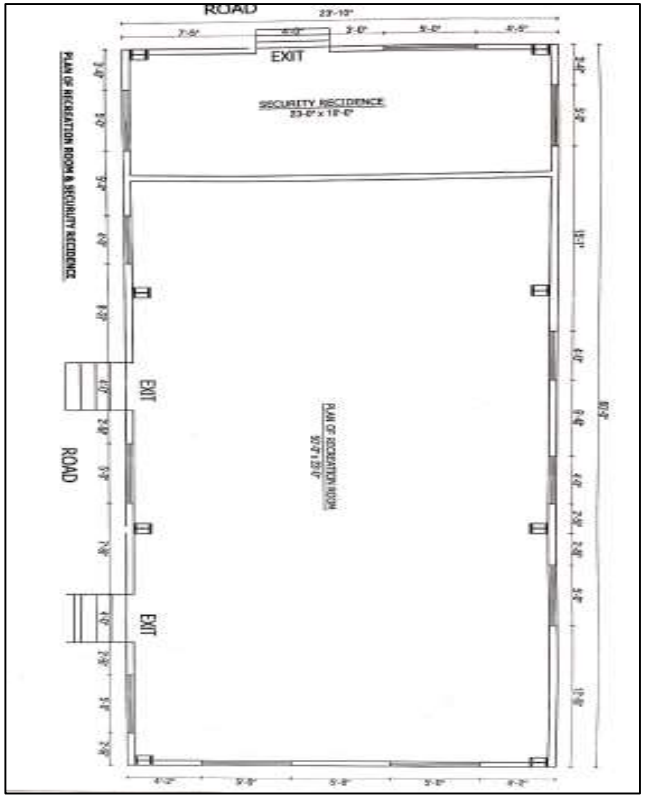

Available floor layout plan

As per BNBC, every building or structure designed shall have its design documents prepared in accordance with the provision of Section 1.9.1. The design document shall include a design report, and a set of structural drawings, which shall be prepared in compliance with section 1.9.1.1 and section 1.9.1.2 as per BNBC. At the time of inspection design report was not available and only a floor layout was available which are required to be prepared in compliance with section 1.9.1.1 and section 1.9.1.2 (part-6, BNBC).

Observations: Shed-04 (Wash Sent & Receive)

Apparently lack of lateral stability

Observation: Shed-05 (Medical & Daycare)



Framing system

No wall bracing or load transfer media is provided in the long direction. Therefore, later stability system of this shed is apparently incomplete. Factory engineer is required to check the lateral stability of the shed.

Observation: Shed-05 (Medical & Daycare)

Corrosion on steel members

Observation: Shed-05 (Medical & Daycare)



Corrosion on steel members

Corrosion was observed on steel members at several locations. Factory is required to identify the locations and apply rust proof paint on steel members to prevent corrosion.

Observations: Shed-05 (Medical & Daycare)

Apparently lack of lateral stability

Observation: Shed-06 (Utility)



Vertical bracing missing

Vertical bracing missing in the south-end bay and load transfer media is not provided in the long direction. Therefore, later stability system of this shed is apparently incomplete. Factory engineer is required to check the lateral stability of the shed.

Observation: Shed-06 (Utility)

Absence of design documents

Observation: Shed-06 (Utility)




Shed-6 (Utility)

As per BNBC, every building or structure designed shall have its design documents prepared in accordance with the provision of Section 1.9.1. The design document shall include a design report, and a set of structural drawings, which shall be prepared in compliance with section 1.9.1.1 and section 1.9.1.2 as per BNBC. At the time of inspection design report was not available which is required to be prepared in compliance with section 1.9.1.1 (part-6, BNBC).

Observation: Shed-06 (Utility)

Crack on brick wall

Observation: Shed-06 (Utility)

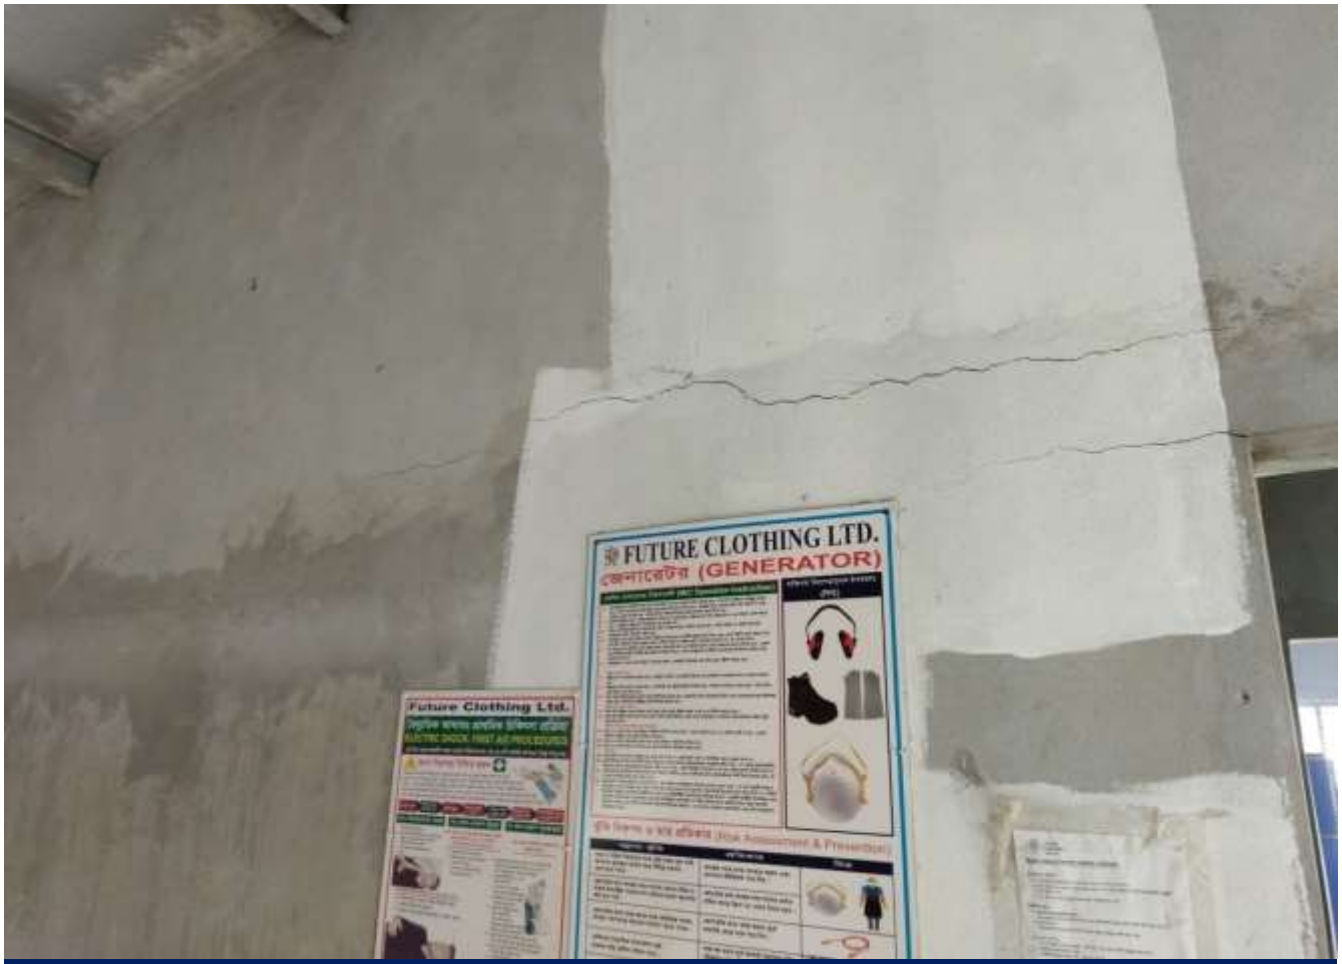

Crack on brick wall

Horizontal crack was observed on several locations of brick wall. Factory engineer is required to investigate the reason of crack and repair with a suitable method.

Observations: Shed-06 (Utility)

Loose bracing

Observation: Shed-06 (Utility)





Loose bracing

Loose bracing was observed at several locations. Factory is required to identify the locations and tighten all the bracings accordingly.

Observations: Shed-06 (Utility)

Absence of as-built drawings and Apparently inadequate connection

Observations: Shed-07 (Compressor Room)



Shed 07 (Compressor Room)

As-built drawing of this structure was not available at the time of inspection. Factory engineer is required to prepare full set of as-built drawing as per 1.9.1.2 (BNBC)



Steel members (both purlin and truss) are welded with rebars of columns without any joint plate which is appeared to be inadequate. Factory engineer is required to check the connection adequacy for uplift forces as a part of EA and implement remediation work where required.


Observations: Shed-07 (Compressor Room)

Absence of as-built drawings and Apparently inadequate connection

Observations: Shed-08 (Inspection Room)



Shed 08 (Inspection Room)

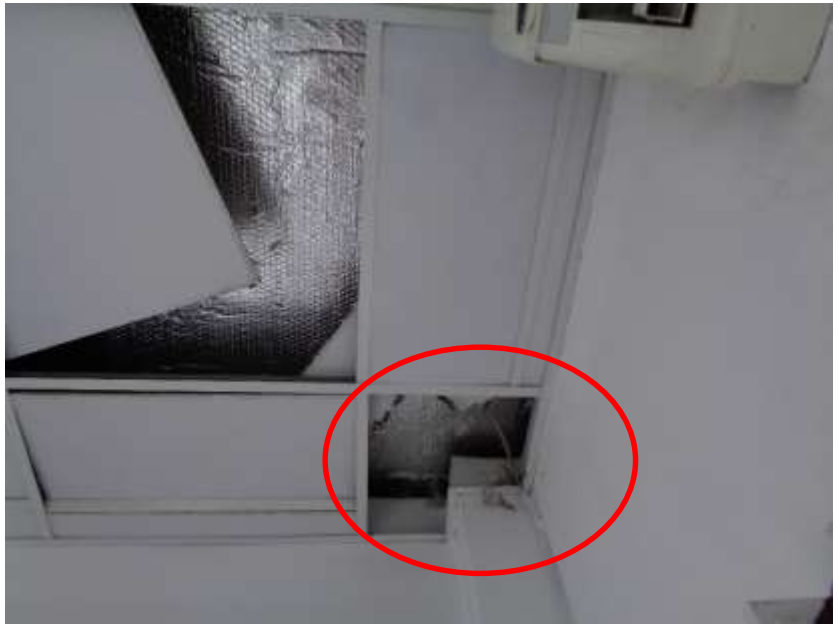

Steel members angel are inserted to brick wall which is appeared to be inadequate. Factory engineer is required to check the connection adequacy for uplift forces as a part of EA and implement remediation work where required.

As-built drawing of this structure was not available at the time of inspection. Factory engineer is required to prepare full set of as-built drawing as per 1.9.1.2 (BNBC)

Observations: Shed-08 (Inspection Room)

Lack of as-built drawing

Observation: Shed-09 (Prayer Room)



Shed-9 (Prayer)

As-built drawing of this structure was not available at the time of inspection. Factory engineer is required to prepare full set of as-built drawing as per 1.9.1.2 (BNBC)

Observation: Shed-09 (Prayer Room)

Crack on brick wall

Observation: Shed- 11 (Toilet -2) & Shed- 12 (Toilet -3)





Crack on brick wall

Horizontal crack was observed on several locations of brick wall. Factory engineer is required to investigate the reason of crack and repair with a suitable method.

Observations: Shed- 11 (Toilet -2) & Shed- 12 (Toilet -3)

Tests carried out

RSC RMG SUSTAINABILITY COUNCIL



Building-1: Brick chips in column



Ferro-scanning

Tests carried out: Building- 1 (Office Building)

Problems Observed

Building-01 (Office Building):

Item-1: Absence of design documents and as-built drawing

Item-2: Falling Hazard at roof level and stair area

Item-3: Exposed reinforcement left at roof level

Building-02 (Guard Room)

Item-4: Crack on brick wall

Shed-01 (Sewing)

Item-5: Absence of design documents

Item-6: Discrepancy and missing information as-built drawing

Item-7: Non-structural elements found unbraced/not anchored

Shed-03 (Finishing)

Item-8: Absence of design documents

Shed-04 (Wash Sent & Receive)

Item-9: Absence of design documents

Shed-05 (Medical & Daycare)

Item-10: Apparently lack of lateral stability

Item-11: Corrosion on steel members

Shed-06 (Utility)

Item-12: Apparently lack of lateral stability

Item-13: Absence of design documents

Item-14: Crack on brick wall

Item-15: Loose bracing

Shed-07 (Compressor Room)

Item-16: Absence of as-built drawings and Apparently inadequate connection

Problems Observed

Shed 08 (Inspection Room)

Item-17: Absence of as-built drawings and Apparently inadequate connection

Shed-09 (Prayer Room)

Item-18: Lack of as-built drawing

Shed-11 (Toilet -2) & Shed-12 (Toilet -3)

Item-19: Crack on brick wall

Item No.	Observation	Recommended Action Plan	Recommended Timeline
01	Absence of design documents and as-built drawing (Building-01: Office Building)	Factory engineer is required to be prepare a design report in compliance with section 1.9.1.1 (part-6, BNBC).	6-weeks
02	Absence of design documents and as-built drawing (Building-01: Office Building)	Factory engineer is required to be prepare a set of as-built drawing in compliance with section 1.9.1.2 (part-6, BNBC).	6-weeks
03	Absence of design documents and as-built drawing (Building-01: Office Building)	Implement remediation work if required.	6-months
04	Falling Hazard at roof level and stair area (Building-01: Office Building)	Factory is required to provide parapet/railing at all locations of roof and staircase to avoid possible falling hazard.	6-weeks

Item No.	Observation	Recommended Action Plan	Recommended Timeline
05	Exposed reinforcement left at roof level (Building-01: Office Building)	Factory is required to provide rust proof paint on exposed reinforcement to protect from corrosion.	6-weeks
06	Crack on brick wall (Building-02: Guard Room)	Factory engineer is required to investigate the reason of crack and repair with a suitable method.	6-weeks
07	Absence of design documents (Shed-01: Sewing)	Factory engineer is required to be prepare a design report in compliance with section 1.9.1.1 (part-6, BNBC).	6-weeks
08	Absence of design documents (Shed-01: Sewing)	Implement remediation work if required	6-months

Item No.	Observation	Recommended Action Plan	Recommended Timeline
09	Discrepancy and missing information as-built drawing (Shed-01: Sewing)	Factory engineer is required to be prepare a set of as-built drawing in compliance with section 1.9.1.2 (part-6, BNBC).	6-weeks
10	Non-structural elements found unbraced/not anchored (Shed-01: Sewing)	Factory is required to brace/anchor all non-structural elements.	6-months
11	Absence of design documents (Shed-03: Finishing)	Factory engineer is required to be prepare a design report in compliance with section 1.9.1.1 (part-6, BNBC).	6-weeks
12	Absence of design documents (Shed-03: Finishing)	Implement remediation work if required	6-months

Item No.	Observation	Recommended Action Plan	Recommended Timeline
13	Absence of design documents (Shed-04: Wash Sent & Receive)	Factory engineer is required to be prepare a design report in compliance with section 1.9.1.1 (part-6, BNBC).	6-weeks
14	Absence of design documents (Shed-04: Wash Sent & Receive)	Implement remediation work if required	6-months
15	Apparently lack of lateral stability (Shed-05: Medical-Daycare)	Factory engineer is required to check the lateral stability of the shed.	6-weeks
16	Apparently lack of lateral stability (Shed-05: Medical-Daycare)	Implement remediation work if required	6-months

Item No.	Observation	Recommended Action Plan	Recommended Timeline
17	Corrosion on steel members (Shed-05: Medical-Daycare)	Factory is required to identify the locations and apply rust proof paint on steel members to prevent corrosion.	6-weeks
18	Apparently lack of lateral stability (Shed-06: Utility)	Factory engineer is required to check the lateral stability of the shed.	6-weeks
19	Apparently lack of lateral stability (Shed-06: Utility)	Implement remediation work if required.	6-months
20	Absence of design documents (Shed-06: Utility)	Factory engineer is required to be prepare a design report in compliance with section 1.9.1.1 (part-6, BNBC).	6-months

Item No.	Observation	Recommended Action Plan	Recommended Timeline
21	Absence of design documents (Shed-06: Utility)	Implement remediation work if required.	6-months
22	Crack on brick wall (Shed-06: Utility)	Factory engineer is required to investigate the reason of crack and repair with a suitable method.	6-weeks
23	Loose bracing (Shed-06: Utility)	Factory is required to identify the locations and tighten all the bracings accordingly.	6-weeks
24	Absence of as-built drawings and apparently inadequate connection (Shed-07: Compressor Room)	Factory engineer is required to prepare full set of as-built drawing as per 1.9.1.2 (BNBC) Factory engineer is required to check the connection adequacy for uplift forces as a part of EA and implement remediation work where required.	6-weeks

Item No.	Observation	Recommended Action Plan	Recommended Timeline
25	Absence of as-built drawings and apparently inadequate connection (Shed-07: Compressor Room)	Factory engineer is required to check the connection adequacy for uplift forces as a part of EA and implement remediation work where required.	6-weeks
26	Absence of as-built drawings and apparently inadequate connection (Shed-07: Compressor Room)	Implement remediation work if required.	6-months
27	Absence of as-built drawings and apparently inadequate connection (Shed-08: Inspection Room)	Factory engineer is required to prepare full set of as-built drawing as per 1.9.1.2 (BNBC)	6-weeks
28	Absence of as-built drawings and apparently inadequate connection (Shed-08: Inspection Room)	Factory engineer is required to check the connection adequacy for uplift forces as a part of EA and implement remediation work where required.	6-weeks

Item No.	Observation	Recommended Action Plan	Recommended Timeline
29	Absence of as-built drawings and apparently inadequate connection (Shed-08: Inspection Room)	Implement remediation work if required.	6-months
30	Lack of as-built drawing (Shed-09: Prayer Room)	Factory engineer is required to prepare full set of as-built drawing as per 1.9.1.2 (BNBC)	6-weeks
31	Crack on brick wall (Shed-11: Toilet -2 & Shed-12: Toilet -2)	Engage a Consultant immediately to provide adequate restraint to the cracked external masonry.	Immediate - Now
32	Crack on brick wall (Shed-11: Toilet -2 & Shed-12: Toilet -2)	Provide adequate support for the roof shed. The factory must immediately engage a consultant to investigate the wall cracks, develop a remediation plan and submit to RSC for review.	Immediate - Now

Item No.	Observation	Recommended Action Plan	Recommended Timeline
33	Crack on brick wall (Shed-11: Toilet -2 & Shed-12: Toilet -2)	The factory must immediately engage a consultant to investigate the wall cracks, develop a remediation plan and submit to RSC for review.	Immediate - Now
34	Crack on brick wall (Shed-11: Toilet -2 & Shed-12: Toilet -2)	Complete remediation work as per investigation report.	6-weeks