FIRE SAFETY INSPECTION REPORT

Factory Name: Gardenia Wears Ltd

ACCORD ID: 23474

ADDRESS:
310/668, SITPARA, BORMI, SREEPUR
24.231249,90.505445

Other Factories: None



ACCORD
on Fire and Building Safety in Bangladesh

Inspected By: Nasif Javed Tofa
Date: 10 September, 2018.

Fire Safety Inspection Report

Factory Name: Gardenia Wears Ltd

Introduction:

ACCORD ID: 23474
Gardenia Wears Ltd complex was surveyed for fire safety on 10/09/2018 by The Accord Inspection Team. The purpose of the survey was to identify significant fire safety issues and to provide recommendations for remediation based on applicable standards specified by the Accord. The scope of this initial fire safety inspection was limited to the review and identification of major fire safety issues. The inspection did not include identification of minor deficiencies, which will be further addressed as part of follow-up inspections.

Limitations

The information in this fire safety inspection report was obtained during a visit to the facility and during interviews with local factory management. It has not been possible to provide independent verification for all the information and data collected, and, therefore, The Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.
The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

General Factory Information

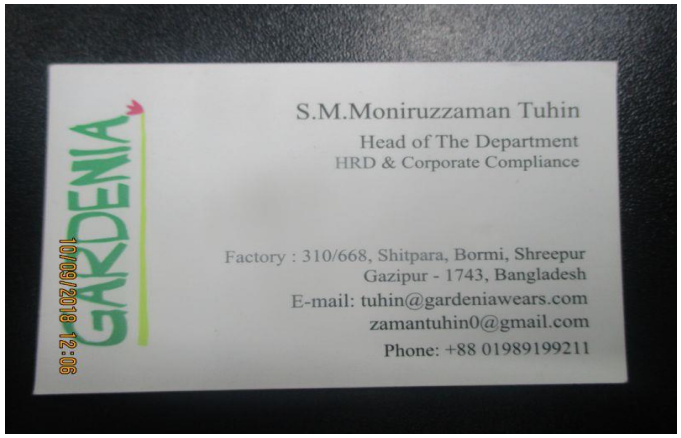
Factory Building name(s): Gardenia Wears Ltd

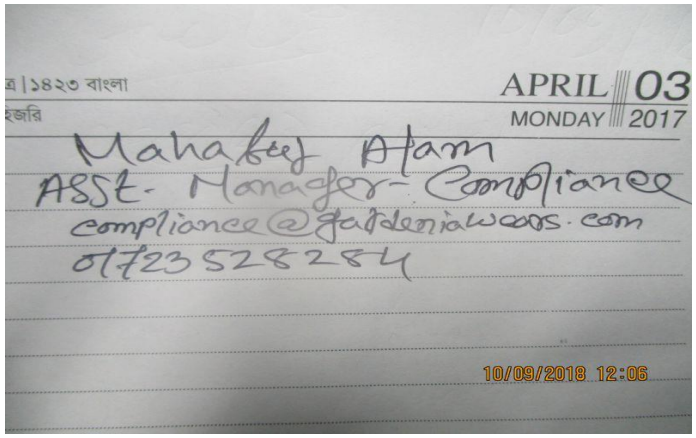
Factory Address: 310/668, SITPARA, BORMI, SREEPUR

Points of contact:

1. S.M Moniruzzaman Tuhin
Designation: Head of HRD & Corporate Compliance
Contact: 01989 19 92 11
Email: tuhin@gardeniawears.com

2. Mahafuj Alam
Designation: Asst. Manager-Compliance
Contact: 01723 52 82 84
Email: Mahafuj@gardeniawears.com


GARDENIA
S.M.Moniruzzaman Tuhin
Head of The Department
HRD & Corporate Compliance
Factory : 310/668, Shitpara, Bormi, Shreepur
Gazipur - 1743, Bangladesh
E-mail: tuhin@gardeniawears.com
zamantuhin0@gmail.com
Phone: +88 01989199211
10/09/2018 12:06


APRIL 03
MONDAY 2017
Mahabuj Alam
ASSt. Manager- Compliance
compliance@gardeniawears.com
01723528284
10/09/2018 12:06

Findings & Recommendations :

Factory Name: Gardenia Wears Ltd

This table summarizes the major fire safety issues identified during the inspection of new shed. Recommendations have been provided to address each issue.

An implementation schedule shall be developed by the factory to remediate each of the findings. The specific timing of improvements, including any requested extensions due to design / installation constraints, shall be submitted to the Accord for approval.

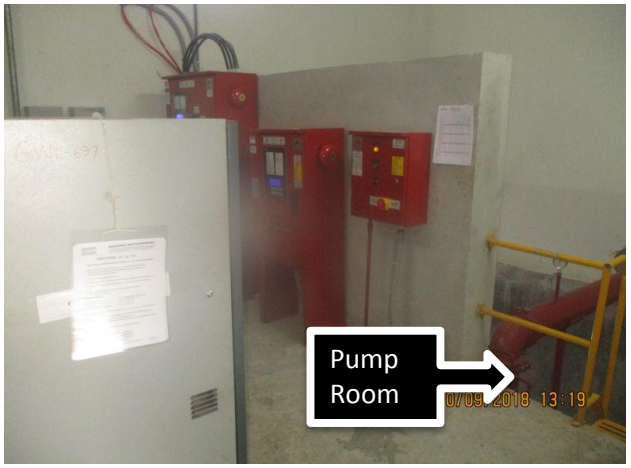
Table-1:

Sl No.	Category	Findings	Required Action	Remediation Time Frame
F-1	Fire Rated Construction	Since the structure (2 storied) is steel-composite type and all the RCC panels are resting on the steel columns and girders. Hench, each floor of the building is not separated by a fire resistive rated construction barriers.	Provide fire-resistive rated construction barriers between floors following Section 4.4 and Table 4.4.1 of the Accord Standard or Table 3.3.1 and Table 4.1.1 from BNBC Part 4. Consult a qualified fire protection engineer to design the rated construction barriers.	Within 6 months

  				
F-2	Fire Rated Construction	The fire pump room is not provided with adequate fire separation from compressor room. **Location: Utility Shed.**	Provide fire pump room with 2 hr. rated fire separation when not sprinkle red and 1 hr. rated fire separation when provided with automatic sprinklers in accordance with NFPA 20 Or, Physically separate the pump room from the protected building by a minimum of 50 ft. (15.3 m) in accordance with NFPA 20	Within 3 months







F-3	Fire Rated Construction	Rooms used for storage of combustible materials are not separated from the surrounding occupancy/areas. **Location: Packing store at SE side of ground floor.**	Rooms used for storage of combustible materials shall be separated from the surrounding occupancy with a minimum 1 hour construction.	Within 3 months

  				
F-4	Fire Rated Construction	The exit stairs are not separated from [work areas, other spaces] on each floor by fire rated construction. SW exit stair discharge the occupant inside the building. Corrugated metal roofing observed.	Provide minimum 1.5-hr fire rated doors and seal all unprotected openings to separate the exit stairs from work areas and other building spaces on all floor levels. Ensure that the fire rated doors are self-closing and positive latching and that they are provided with fire exit (panic) hardware where serving production floors. If fire rated doors are required to be held open for functional reasons, provide automatic closing devices tied to the fire alarm system. Modify stair to discharge directly outside. Or Provide 2-hr fire-rated exit passageway leading directly outside (vestibules to separate any storage areas).	Within 3 months







F-5	Fire Rated Construction	Unsealed penetrations and openings are located in the fire rated floor/ceiling assemblies.**(1. Electrical Bus bar riser penetration at north west side of the building 2. Toilet plumbing line penetration at north and south side of the building)**	Provide a minimum 2-hr fire rated shaft to separate the utility risers from each floor level. Seal all penetrations and openings in floors/ceiling assemblies to maintain the fire separation.	Within 3 months







F-6	Sliding Door & Gates	Shutter gates are provided at [building exits, exit stairs, along egress routes, exit discharge]. **Location: Bonded warehouse shed.**	Replace all collapsible gates/ sliding doors/ rolling shutter doors along the means of egress with side-hinged, swinging egress doors. If locks are required for security reasons, utilize specialized door locking features complying with NFPA101.	Within 1 month

	 			
F-7	Egress	Egress doors/gates with locking features not complying with NFPA101 are provided at [building exits, exit stairs, along egress routes, exit discharge]	Remove locking features from all egress doors/gates. If locks are required for security reasons, utilize specialized door locking features complying with NFPA101.	Immediate

  				
F-8	Egress	Storage was located under the exit stair and egress path.	Remove storage from the exit stairs and egress path	Immediately

  				
F-9	Detection System	An addressable fire alarm (Only alarm) system was found installed, and does not provide alarm and notification features consistent with acceptable standards. **(Building-1, Dining shed, Utility shed and Bonded warehouse, wastage godown.)**	Modifiy the system with a new listed addressable fire alarm and detection system in accordance with NFPA 72. Submit the proposed design to ACCORD for review.	Design within 4 months, Install within 9 months







F-10	Fire Detection ITM	Inspection, testing, and maintenance for the fire detection system is not in accordance with NFPA 72.	Inspect, test and maintain the fire detection system, and keep written records on-site, in accordance with NFPA 72.	Within 3 months
F-11	Egress Lighting	Based on the number and location of emergency lights observed, adequate illumination levels are not anticipated along egress routes.	Test the emergency lighting system on each floor and provide additional emergency fixtures to provide adequate illumination along the means of egress. Provide a minimum illumination of 10 lux at the floor level within exit stairs and exit discharge paths and minimum 2.5 lux along exit access aisles.	Within 3 months

				
F-12	Emergency Lighting ITM	Inspection, testing, and maintenance for the emergency lighting system was not in accordance with The ACCORD standard.	Inspect, test and maintain the emergency lighting system in accordance with The ACCORD standard. Keep written records on-site.	Within 3 months
F-13	On/Off Switch	Manual on-off switch is provided for [emergency lighting / exit signage] units.	Remove manual on/off switches from [emergency lighting /exit signage] units to prevent them from being switched off.	Within 1 month

	 			
F-14	Aisle Width	The width of egress aisles is less than 36-inch.	Provide minimum aisle widths of 36-inch. All the aisles shall be free from any kind of obstruction.	Within 3 months

		  		
F-15	No Parapets or Guards	Parapets or guards are provided in occupied roof which is less than 1067mm (42 inch	Provide parapets or guards with a minimum height of 1067mm (42 inch.).	Within 3 months

		 		
F-16	Exit sign	Exit sign not provided at exit. **Location: Bonded warehouse**	Provide exit signs above all exits to the exterior and all doors to the exit stair.	Within 1 month

				
F-17	Fire Extinguishers ITM	Inspection, testing and maintenance of portable fire extinguishers is not in accordance with NFPA 10.	Inspect, test and maintain the portable fire extinguishers and keep written records on-site, in accordance with NFPA 10.	Within 1 month