Gardenia Wears Ltd.

310/668, Shitpara, Bormi, Sreepur, Gazipur - 1743
(24.230718N, 90.505587E)
10th September 2018




ACCORD
on Fire and Building Safety in Bangladesh


Observations

Bolt missing and existence of gap in joints


Observations: Factory Building

ACCORD
on Fire and Building Safety in Bangladesh

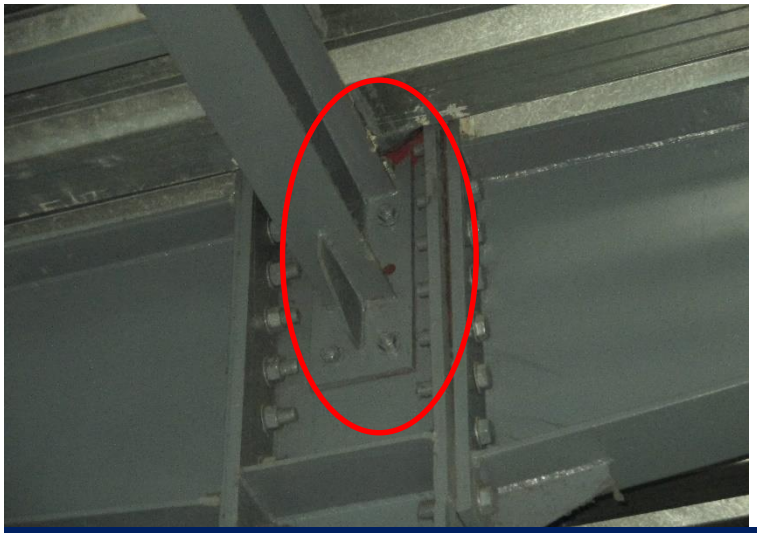

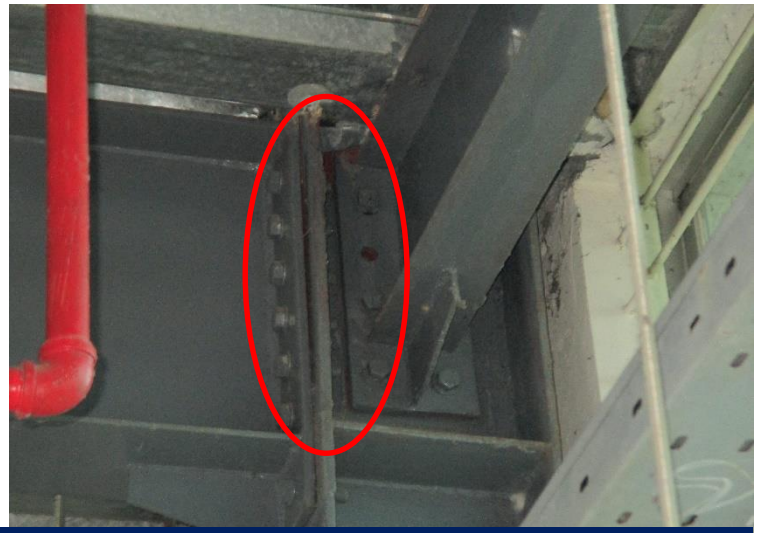

Missing bolts & gap between beam-column connection

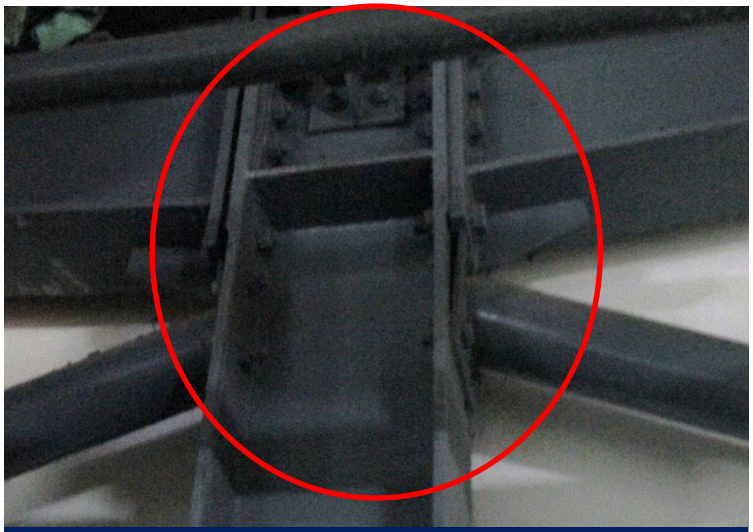

Gap on bracing connection

Bolts were found missing in several locations. Factory engineer to check the connections and install missing bolts. Existence of gap was observed in beam-column and column-bracing connections at several locations. Factory engineer to identify the gaps and implement the appropriate remediation.

Observations: Factory Building

Corrosion in Steel member

Corrosion was found on column base plate and sub-beam under toilet zone. Factory is required to find out all the deteriorated areas and apply suitable method to protect the steel members from corrosion.



Corrosion at column base plate



Corrosion at sub-beam under toilet zone


Observations: Factory Building

Mismatch in rafter size


Observation : Facility Building

ACCORD
on Fire and Building Safety in Bangladesh


Size of rafter at end bay was found 125 mm x 250 mm instead of 150 mm x 250 mm. Factory engineer is required to update the drawing reflecting actual site condition.

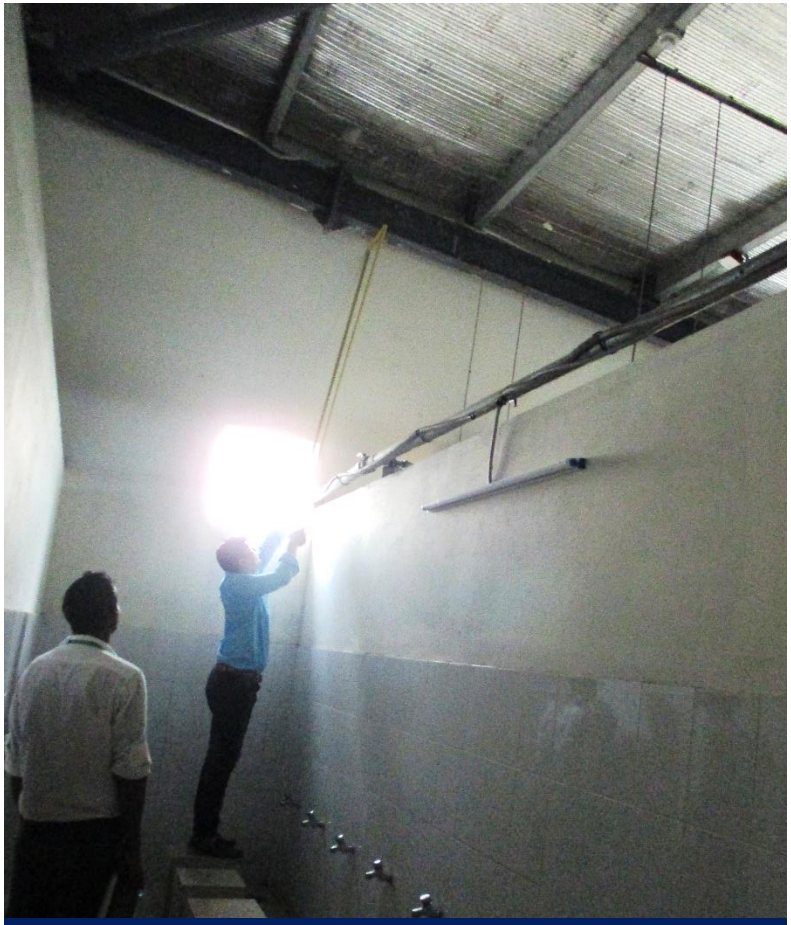

Rafter measuring

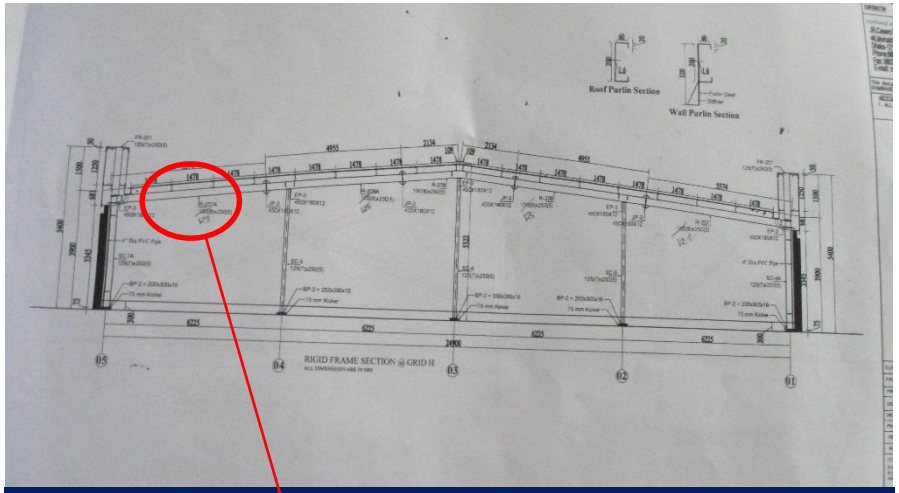

Section of end grid

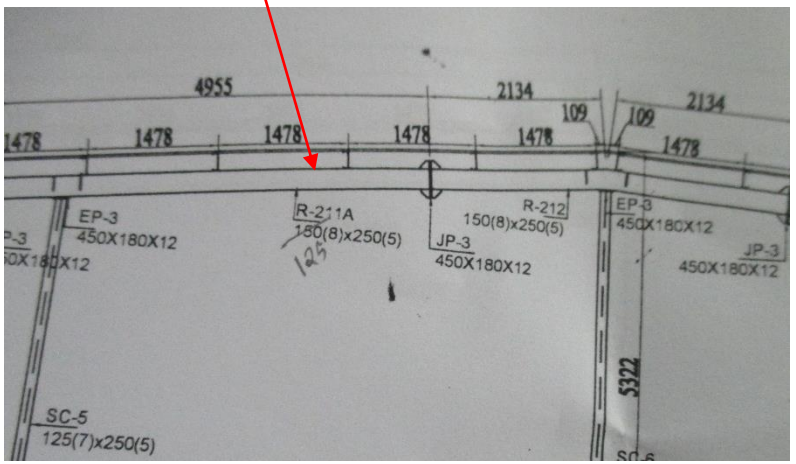

Observation : Facility Building

ACCORD on Fire and Building Safety in Bangladesh


Missing bolt, gap between rafter-column joint, improper bracing connection and lack of connection details on drawings

Observation : Bonded Ware House & Facility building


Bolts were found missing in several locations of both structures. Factory engineer to check the connections and install missing bolts. Significant gap was observed in beam-column and column-bracing connections. Factory engineer to identify the gap and implement the proper remediation. Moreover, improper bracing connections were found and connection details of bracings were not available on provided drawings.




Missing bolt

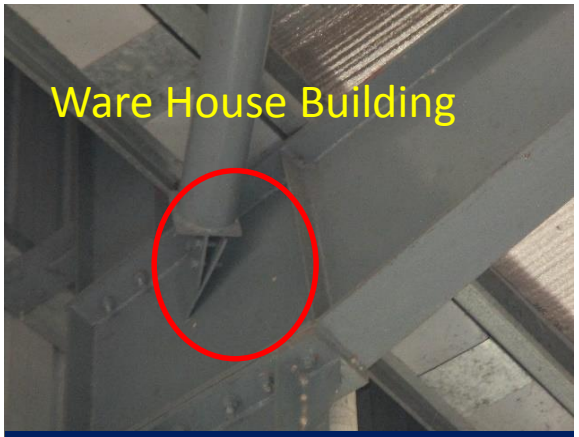

Improper connection

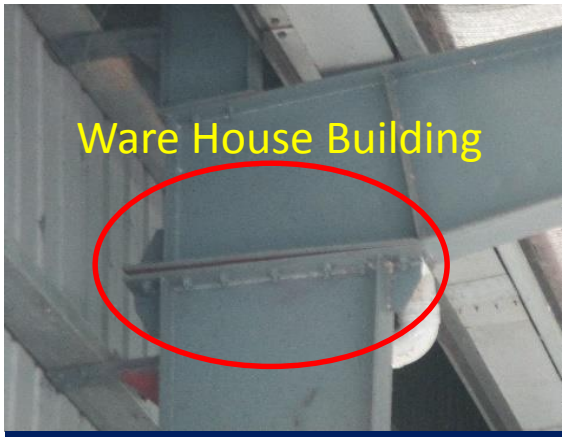

Gap at rafter-column joint

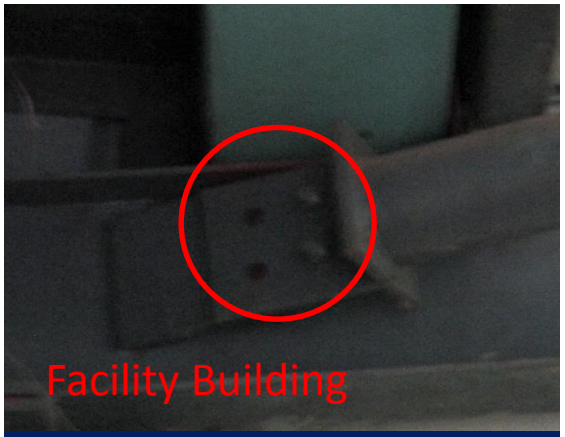

Missing bolt



Improper connection



Gap at rafter-column joint

Observations: Bonded Ware House & Facility building

Problems Observed

Factory Building:

01: Bolts missing and existence of gap in joints

02: Corrosion on steel member.

Facility Building :

03: Mismatch in rafter size.

Facility Building & Ware House Building:

04: Missing bolts, gap between rafter-column joints, improper bracing connections and lack of bracings details.

ACCORD
on Fire and Building Safety in Bangladesh

Item No.	Observation	Recommended Action Plan	Recommended Timeline
1	(Factory Building) Bolt missing and existence of gap in joints	Factory Engineer to survey the whole structure to identify locations of all missing bolts and install them.	**6-weeks**
2	(Factory Building) Bolt missing and existence of gap in joints	Factory Engineer to survey the whole structure to locate the gap in joints and take suitable measures.	**6-weeks**
3	(Factory Building) Corrosion in Steel member	Apply suitable method to protect the steel members from corrosion.	**6-weeks**
4	(Facility Building) Mismatch in rafter size	Engage an Engineer to produce an “as constructed” drawings which reflect the actual site dimensions with complete structural information.	**6-weeks**

Item No.	Observation	Recommended Action Plan	Recommended Timeline
5	(Facility Building & Ware House Building) Missing bolts, gap between rafter-column joints, improper bracing connections and lack of bracing details	Factory Engineer to survey the whole structure to identify locations of all missing bolts and install them	**6-weeks**
6	(Facility Building & Ware House Building) Missing bolts, gap between rafter-column joints, improper bracing connections and lack of bracing details	Factory Engineer to survey the whole structure to locate the gap in joints and take suitable measures.	**6-weeks**
7	(Facility Building & Ware House Building) Missing bolts, gap between rafter-column joints, improper bracing connections and lack of bracing details	Factory engineer to check the adequacy of bracing connections and update as-built drawings including bracing details.	**6-weeks**
8	(Facility Building & Ware House Building) Missing bolts, gap between rafter-column joints, improper bracing connections and lack of bracing details	Factory Engineer to take remedial actions where required.	**6-months**