INITIAL FIRE SAFETY INSPECTION REPORT

HANDZ CLOTHING BD LTD.

RSC ID: 26542

Geographical Coordinates: 24°03'59.3"N 90°23'03.8"E

Address: 433/1,Nanduain,Masterbari,Gazipur.

Other Factories: None



RSC RMG SUSTAINABILITY COUNCIL

Inspected By: Md. Anisuzzaman

Date: 10-December-2025

Fire Safety Inspection Report

HANDZ CLOTHING BD LTD.

RSC ID: 26542

HANDZ CLOTHING BD LTD.; complex was surveyed for fire safety on **10-Dec-2025** by The RSC Inspection Team. The purpose of the survey was to identify significant fire safety issues and to provide recommendations for remediation based on applicable standards specified by the RSC. The scope of this initial fire safety inspection was limited to the review and identification of major fire safety issues. The inspection did not include identification of minor deficiencies, which will be further addressed as part of follow-up inspections.

Limitations

The information in this fire safety inspection report was obtained during a visit to the facility and during interviews with local factory management. It has not been possible to provide independent verification for all the information and data collected, and, therefore, The RSC cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

General Factory Information

There are six structures covered under this RSC ID-26542

SL No	Building Name	Building Construction Period	Approval Date & Authority	Occupied	Structure type	Construction Category
1	Main Production Shed. Total Floor Area: 36 175 Sq. ft	Aug-2015 to Jan-2017	Approved from LGED Upazilla, Gazipur on date 8-01-2015 except Security room & Cartoon Godown Shed	Mar-17	Single-storied Shed with a mezzanine, Steel Structure	Interim Construction
2	Security Room Total Area: 205 Sq. Ft	Dec-2016 to Jan-2017		Mar-17	Single storied masonry structure	Interim Construction
3	Medical & Childcare Shed Total Area: 807 Sq. Ft	Aug-2015 to Feb-2016		Mar-17	Single Storied , Steel	Interim Construction
4	Generator & Substation Building Total Area: 1802 Sq. Ft	Aug-2015 to Dec-2016		Mar-17	Two Storied, RCC	Interim Construction
5	Boiler & Compressor Room Total Area: 302 Sq. Ft	Dec-2016 to Jan-2017		Mar-17	Single Storied , RCC	Interim Construction
6	Cartoon Godown Shed Total Floor Area: 807 Sq. ft	Dec-2016 to Jan-2017		Mar-2017	Single Storied, Steel	Interim Construction

Factory Address: 433/1, Nanduain, Masterbari, Gazipur.

Points of contact:

MD. Aktarul Islam
Head of HR, Admin and Compliance
01735113972
Email: hrm@handzclothing-bd.com



MD. A. K. AZAD
Deputy Managing Director and Chief Operating Officer
018199443322
Email: azad@handzclothing-bd.com



Findings & Recommendations :


Table-1 summarizes the major fire safety issues identified during the inspection. Recommendations have been provided to address each issue. An implementation schedule shall be developed by the factory to remediate each of the findings. The specific timing of improvements, including any requested extensions due to design / installation constraints, shall be submitted to the RSC for review.

Table-1: Finding & recommendation all structures in this IDs.

Sl No.	Category	Findings	Required Action	Remediation Time Frame
F-1	Means of Egress	The egress path along means of egress has interrupted by obstruction/storage/process **Location(s): Main Production Shed.**	Keep egress paths clear of storage/obstruction in accordance with section 6.3.9 of RSC Technical Guidelines (Standard)[1] V1.0. Means of egress shall be maintained continuously free and clear of all obstructions or impediments to full instant use in the case of fire or other emergency. No furnishings, decorations, or other objects shall obstruct exits and access to exits. Nothing shall obstruct or impede visibility to exits.	Immediately
 				


F-2	Means of Egress	Doors along means of egress are provided with non-compliant locking devices. **Location: South side of the production Shed & all other structures.**	Remove locking devices from all egress devices in accordance with section 6.8.2 of RSC Technical Guidelines (Standard)[1] V1.0.	Immediately
		 		
F-3	Means of Egress	Posted Fire evacuation maps are not updated as per site conditions. **Location(s): Production Shed & other all structures.**	Update the fire evacuation map and shall be posted at the entrance to each exit stair in accordance with RSC Technical Guidelines (Standard)[1] V1.0 Section 13.3.	Within 1 Month
F-4	Means of Egress	Stair clear width was found less than 60 in. **Location(s): Generator & Substation Building Available Width: 44inch**	Stairs shall have a minimum clear width of 60 in. in for all industrial occupancies as per RSC Technical Guideline (Standard) section of 6.5.6	Within 3 Months

		 		
F-5	Means of Egress	Illuminated Directional signs are not provided where direction of the path of travel to an exit has changed. **Location(s): Main Production Shed.**	Illuminated directional signs shall be provided where there is a change in the direction for the path of travel and the direction to an exit is not obvious in accordance with RSC Technical Guidelines (Standard)[1] V1.0 Section 6.11.3.	Within 1 Month
F-6	Means of Egress	Based on the number and location of emergency lights observed, adequate illumination levels are not anticipated along egress routes. **Location(s): All structures**	Test the emergency lighting system on each floor and provide additional emergency fixtures to provide adequate illumination along the means of egress. Provide a minimum illumination of 10 lux at the floor level within exit stairs and exit discharge paths and minimum 2.5 lux along exit access aisles. Illumination on means of egress shall meet in accordance with RSC Technical Guidelines (Standard)[1] V1.0 Section 10.12.2.	Within 3 Months
F-7	Means of Egress	The maximum travel distance exceeds 45 m which does not meet the requirements of Section 6.13 of RSC Technical Guidelines (Standard). **Location: GF, Main production Shed.** **Occupancy/Process: Sewing section**	Reconfigure the egress arrangement to meet 6.13 of RSC Technical Guidelines (Standard). Or, Provide additional exits so that the travel distance shall not exceed the maximum allowable limit.	Within 3 Months

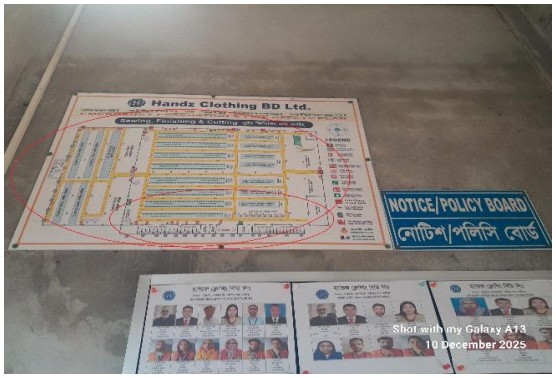

F-8	Means of Egress	Doors are swing out over stairs. **Location: Generator & Substation Building**	A landing shall be provided on both sides of doors used in the means of egress to facilitate uninterrupted egress of occupants. Door shall not swing out over stairs. Landings with same width as the stair clear width shall be provided at each level and at intermediate landings.	Within 3 Months

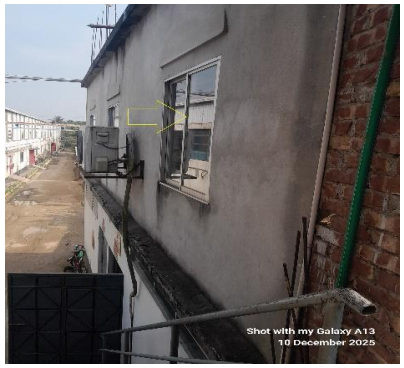

F-9	Means of Egress	The exterior exit stair is not separated from the building interior. **Location: Location: Generator & Substation Building**	Nonrated walls or unprotected openings enclose the exterior of the stairway and the walls or openings are exposed by other parts of the building at an angle of less than 180 degrees (3.14 rad), the building exterior walls within 3050 mm (10 ft) horizontally of a nonrated wall or unprotected opening shall have a fire-resistance rating of not less than 1 hr. in accordance with section 6.3.1.3 of RSC Technical Guidelines (Standard)[1] V1.0.	Within 3 Months
				
F-10	Means of Egress	Exit signage not illuminated during testing (burned out, broken, etc.). **Location(s)**: **All structures**	Regularly inspect all exit signage/directional signage as per RSC Technical Guidelines (Standard)[1] V1.0. and replace/install lights as needed to illuminate signs.	Within 1 Month

				
F-11	Means of Egress	Handrails are not provided on both sides of Final exit discharge stairs. **Location(s): South side of Main Production Shed.** **Non-Compliance: Handrail are not provided both side.**	Provide handrails on both sides of the exit stair. New handrails shall have a minimum height of 865 mm (34 in.) and a maximum height of 965 mm (38 in.) as measured from the leading edge of the tread. Intermediate handrails shall be provided when the stair width exceeds 2.2 m (87 in.). Open guards shall have intermediate rails or pattern such that a sphere 200 mm (8 in.) in diameter cannot pass through any opening up to a height of 865 mm (34 in.). Handrail shall construct in accordance with RSC Technical Guidelines (Standard)[1] V1.0 Section 6.12.	Within 3 Months
				

F-12	Means of Egress	Building does not have occupant load signs at required locations on floor. **Location(s)**: **All Structures**	Post the occupant load for every assembly and production floor in a facility in a conspicuous space near the main exit or exit access doorway for the space in accordance with RSC Technical Guidelines (Standard)[1] V1.0 Section 6.4.4 .	Within 1 Month
F-13	Means of Egress	Exit sign not provided at exit. **Location(s): Main Production Shed & Cartoon Godown Shed.**	Lighted exit signs shall be placed at entrance to an exit. Additional directional exit signs shall be placed throughout the facility anywhere the continuation of the egress is not obvious. Lighted exit signs shall be provided with either battery backup or uninterruptable power supply systems and shall be continuously illuminated at all times. Exit Sign shall provide in accordance with RSC Technical Guidelines (Standard)[1] V1.0 Section 6.11.	Within 1 Month
 				

F-14	Means of Egress	Manual on-off switch is provided for exit signage units. **Location(s): Main Production Shed.**	Remove manual on/off switches from emergency lighting / exit signage units to prevent them from being switched off.	Within 1 Month
				
F-15	Fire Rated Construction	Rooms used for storage of combustible materials are not separated from the surrounding occupancy(Production) **Location: GF, Main Production Shed.** **Non-compliance reason: Due to unprotected opening**	Rooms used for storage of combustible materials shall be separated from the surrounding occupancy with a minimum 1 hour construction in accordance with section 3.4.2.1.5 of RSC Technical Guideline (Standard). Keep proper datasheet & certifications for installed fire doors & accessories on-site for verification.	Within 3 Months

		 		
F-16	Fire Rated Construction	Storages were found underneath the cutting tables. **Location(s): Main Production Shed**.	Storage underneath the cutting tables shall be kept clear of combustibles at all time, except as provided for miscellaneous storage in accordance with 3.4.2.1.6 or , Where an automatic sprinkler system is installed sprinklers are required to be installed beneath cutting tables greater than 4 ft in width that are used for storage of combustibles.	Within 3 Months
		 		

F-17	Fire Rated Construction	The day-care room does not separated from other occupancy (Dining area) **Location: Medical & Childcare Shed.**	Separate the day-care from other occupancy ac per Table 3.2.1 (BNBC 2006)	Within 3 Months
				

F-18	Fire Rated Construction	Areas used for in-process storage of combustible materials are open to the surrounding occupancy. **Location: GF, Main Production Shed.**	Provide defined storage areas and limit the storage arrangement as follows: Maximum height of 2.45 m and maximum area of 23 m² and is separated by a minimum 3.0 m (10ft) from other storage areas and they do not exceed 10 percent of the building area of the story in which they occur. or, If sprinkler protected, Maximum height 12 ft (3.66 m) and maximum area of 1000 ft² (93 m²) and separated by a at least 25 ft (7.62 m) and does not constitute more than 10 percent of the building area or 4000 ft² (372 m²) of the sprinklered area, whichever is greater. or, Enclose the storage area from the surrounding occupancy with a minimum 1 hour construction.	Within 3 Months
  				

F-19	Fire Rated Construction	Transformer is not properly separated from exit stairs by fire rated construction due to unprotected opening **Location: GF, Generator & Substation Building.** **Non-compliance reason: Unprotected opening.**	Oil filled transformer shall be separated from other occupancies by a minimum 2-hr fire rated construction (wall, floor, slab etc.). Switch gears and transformer bays shall be separately housed with a 2-hr rated wall in between. Seal all penetrations and openings (door, window etc.) should be protected by 1.5-hr fire rated materials to maintain the fire separation if required. All exhaust systems shall discharge to the exterior of the building in a safe location. Oil filled transformers shall not be housed above ground level Or, Relocate it to exterior of the building and maintain a minimum 3m (10 ft.) spatial separation distance from the building. Transformer room separation shall meet section 3.4.2.1.4 of RSC Technical Guideline (Standard)	Within 3 Months
		 	 	

F-20	Fire Rated Construction	Single exit is provided at the dining/canteen area on two storied Generator & Substation Building. **Location: First floor of the Generator & Substation building.**	Assemblies of Occupancy E3, E4 and E5 shall have at least two means of exits leading directly to the street or leading to a corridor or open space having access to exits in two independent and different directions. (part-4, section-3.21.3, BNBC-2006). The required number of exits for the entire assembly arrangement shall lead directly to safe discharge path without passing through any other occupancies.	Within 3 Months
	  			
F-21	Fire Rated Construction	The required fire separation distance for the (Main Production Shed) does not comply with the requirements of BNBC 2020 **Location: North ,South side & east side of the Main Production Shed.**	The exterior walls shall have a fire resistance and opening protection as specified in BNBC 2020 Part 3 Table 3.2.2 & 3.2.3 and BNBC 2020 Part 3 Section 2.4.1.3	Within 6 Months

		 		
F-22	Fire Rated Construction	The required fire separation distance for the (Cartoon Godown Shed) does not comply with the requirements of BNBC 2020 **Location: North ,South side & West side of the Cartoon Godown Shed**	The exterior walls shall have a fire resistance and opening protection as specified in BNBC 2020 Part 3 Table 3.2.2 & 3.2.3 and BNBC 2020 Part 3 Section 2.4.1.3	Within 6 Months
		  		

F-23	Fire Alarm & Detection System (FADS)	The fire alarm system is antiquated, not a listed system and does not provide alarm and notification features consistent with acceptable standards. **Location(s): All Structures**	Replace the fire alarm system with a new, listed addressable fire alarm system in accordance with NFPA 72 to meet section 5.7.3 of RSC Technical Guideline (Standard) Submit the proposed fire alarm system design to RSC for review. Once the design is reviewed, install and modify the fire detection and alarm system throughout the building in accordance with review comment, RSC/ RSC Technical Guidelines (Standard) and NFPA 72. After installation the owner shall conduct internal testing and commissioning and then contact the RSC for witness of final acceptance testing.	Design within 2 Month and modification/ installation with 4 Months
		 		
F-24	Inspection, Testing & Maintenance (Fire)	Inspection, testing and maintenance for the fire alarm system is not in accordance with NFPA 72.	Inspect, test and maintain the fire alarm system and keep written records on-site, in accordance with NFPA 72 and RSC Technical Guidelines (Standard)[1] V1.0.s.	Within 1 Month after installation.

F-25	Fire Suppression System (SUPS)	The travel distance between portable fire extinguishers were found to be more than 30 m (100 ft). **Location(s):** Main Production Shed.	Portable fire extinguishers shall be installed throughout all new, interim, and existing facilities in accordance with BNBC 2006 and NFPA 10. Extinguishers shall be placed so that maximum travel distance to the nearest unit shall not exceed 30 m (100 ft).	Within 1 Month
				
F-26	Inspection, Testing & Maintenance (Fire)	The required no smoking signs are not present in the factory.	Smoking is prohibited in any garment factory building or separate storage building. Signs shall be posted in Bengali and English at all building entrances. If the factory creates a designated smoking area outside the building, information of these areas will be posted on the signs. Smoking sign shall post in accordance with section 13.5 of RSC Technical Guideline (Standard)	Within 1 Month.
F-27	Inspection, Testing & Maintenance (Fire)	Inspection, testing and maintenance of portable fire extinguishers is not in accordance with NFPA 10.	Inspect, test and maintain the portable fire extinguishers and keep written records on- site, in accordance with NFPA 10 and RSC Technical Guidelines (Standard)[1] V1.0.s.	Within 1 Month

F-28	Inspection, Testing & Maintenance (Fire)	Fire drills are not conducted according to section 13.2 of RSC Technical Guidelines (Standard)[1] V1.0.	Fire drills shall be conducted according to section 13.2 of RSC Technical Guidelines (Standard)[1] V1.0. Fire drills shall be conducted on a monthly basis as outlined in BNBC 2020 Part 4 Appendix A.	Within 1 Month
F-29	Inspection, Testing & Maintenance (Fire)	Inspection, testing, and maintenance for the exit sign and emergency lighting system was not in accordance with the RSC Technical Guidelines (Standard)[1] V1.0..	Inspect, test and maintain the exit sign and emergency lighting system in the accordance with the RSC Technical Guidelines (Standard)[1] V1.0.. Keep written records on-site.	Within 1 Month
F-30	Inspection, Testing & Maintenance (Fire)	Written housekeeping policy was not found, which is required as per RSC Technical Guideline (Standard) section 13.6.	Establish written corporate and plant policies on housekeeping to ensure scheduled cleaning for floor, wall, ceiling, supply and return air ventilation systems. Promptly reschedule skipped cleanings. Provide a documented line of authority for authorizing a cleaning delay and rescheduling. As a general rule the maximum tolerable deposit thickness for loose fluffy lint is 13 mm (½ in.) over a maximum of 46.5 m2 (500 ft2). Limit dense deposits to 6 mm (¼ in.) and oil saturated deposits to 3.2 mm (⅛ in.).	Within 1 Month
F-31	Inspection, Testing & Maintenance (Fire)	The Building approval from appropriate authority are not available at site Location: Security Room & Cartoon Godown Shed	Get all the required licenses and permits from the proper issuing authority and keep it at site.	Within 3 Months
F-32	Inspection, Testing & Maintenance (Fire)	Hot-work permit program is not established yet, although it is required. However, hot-work is not going on in the factory right now	Develop a hot-work permit program. The program must comply with the requirements of NFPA 51B. In general, this program should address the process of request and approval of authorities, necessary checks prior approval, standby fire watch and fire fighting equipment, sounding of alarm procedure, duration and expiry of permit and re-approval procedures, etc.	Within 1 Month