HANDZ CLOTHING BD LTD.

433/1, Nanduain, Masterbari, Gazipur.

(24.066519, 90.384311)

10 December 2025






RSC RMG SUSTAINABILITY COUNCIL

Level 5, Shanta Forum, 187, 188/B,
Bir Uttam Mir Shawkat Sarak, Tejgaon,
Dhaka- 1208, Bangladesh
PABX : +880 2 41081863-6
www.rsc-bd.org

1. Executive Summary


1. **Main Production Shed:** Single-storied prefabricated steel shed with a mezzanine floor.
2. **Security Room:** Single-storied masonry structure.
3. **Medical & Childcare Shed:** Single-storied steel Shed.
4. **Generator & Substation Building:** Two-storied (G+1) RC structure with a partial steel roof.
5. **Boiler & Compressor Room:** Single-storied masonry structure.
6. **Carton Godown Shed:** Single-storied steel Shed.

2. Observation

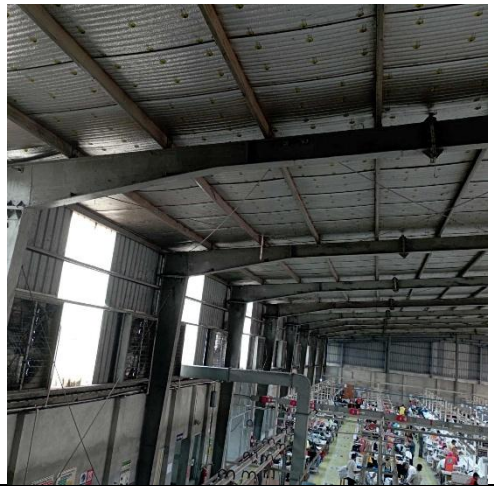Observation 1: Lack of lateral stability (Main Production Shed).
 
Description: Lateral load transfer media is not provided to transfer the lateral load. The building engineer is required to check the lateral stability of the structure as part of the DEA and propose a remediation plan if required. Verify in situ steel strength.
Observation 2: Lack of a geotechnical investigation report (Main Production Shed).

Description: No geotechnical investigation report was available for the structure. A geotechnical engineer must be engaged to prepare a geotechnical investigation report to determine the soil bearing capacity. Based on geotechnical data, check the foundation adequacy as part of DEA.

Observation 3: Faulty connection in vertical bracing (Main Production Shed).

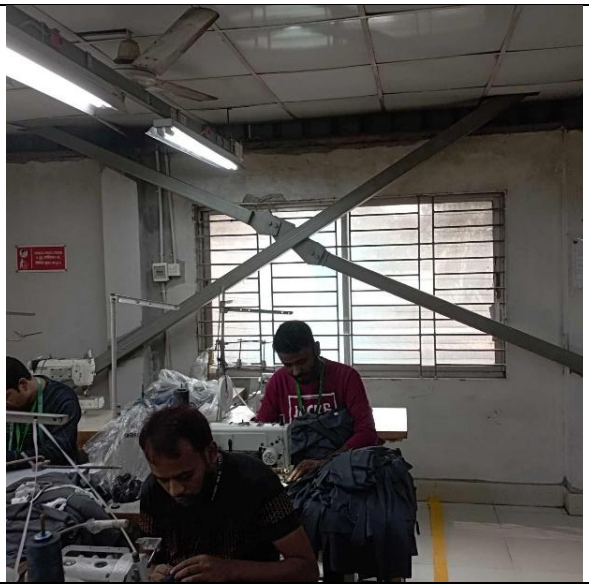

Description: Faulty connection in vertical bracing. As the bracing is not straight, the lateral load is not transferred properly. The building engineer is required to check the load path and connection adequacy and propose a remediation plan.


Observation 4: Possibility of construction of a new mezzanine floor (Main Production Shed).






Description: The factory has a plan to construct a new mezzanine floor inside the shed at the marked portion, which is not shown in the permit drawing. If the mezzanine floor is constructed, the total mezzanine area will exceed one-third of the ground floor area and eventually will be counted as a separate floor. Any addition to the new existing structure not shown in the permit drawing, the building engineer is required to take a fresh permit from the local authority and carry out a Detailed Engineering Assessment (DEA) in compliance with BNBC 2020.

Observation 5: Discrepancy and missing information in the provided drawing (Main Production Shed).

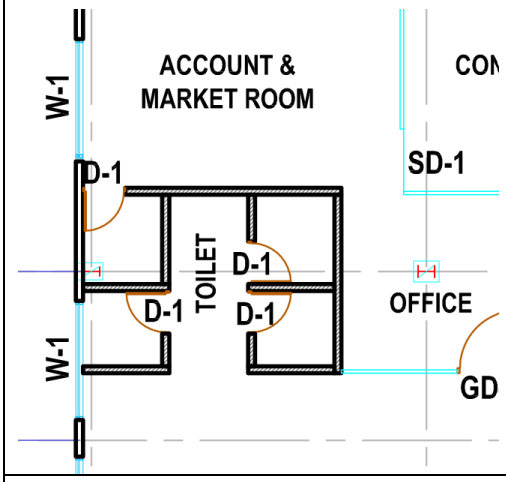




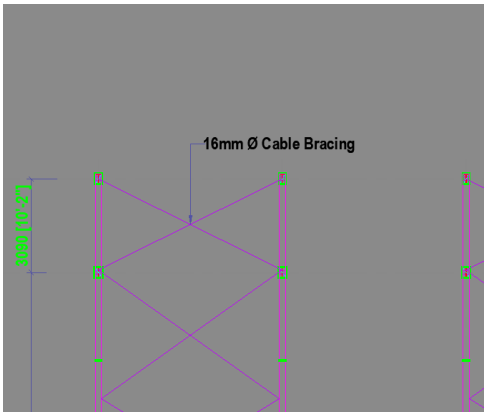



Description: The floor build-up, false ceiling were not shown in the drawing. Also, the diameter of the cable roof bracing was found 12mm but shown as 16mm. The building engineer is required to update the as-built drawing.


Observation 6: Corrosion on steel members (Main Production Shed).

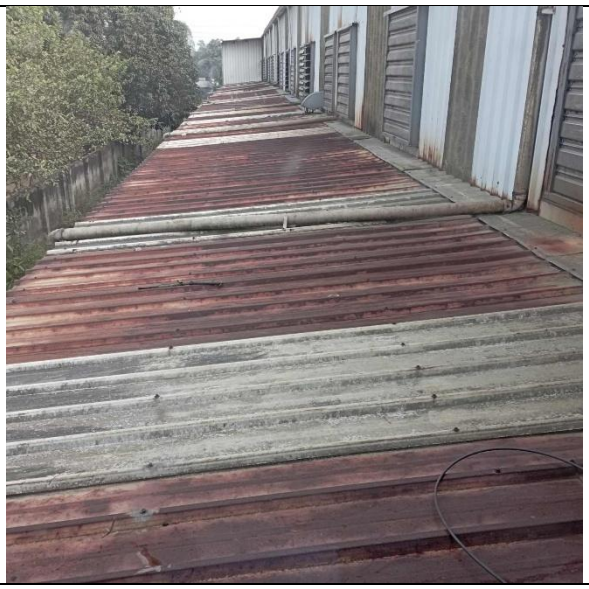




Description: Corrosion was observed on steel members at several locations. The building engineer is required to remove the corrosion and provide rust-proof paint on steel members.

Observation 7: Loose cable bracing (Main Production Shed).

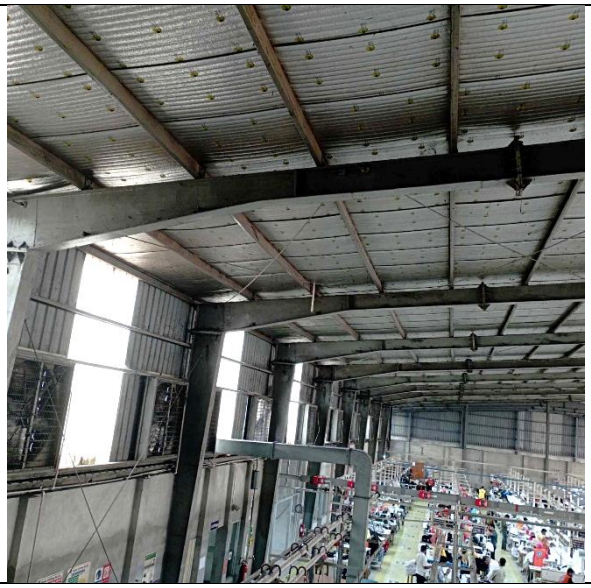

Description: Loose cable bracing was found. Tighten all loose bracings.


Observation-8: Non-structural elements found unanchored/braced (Main Production Shed).

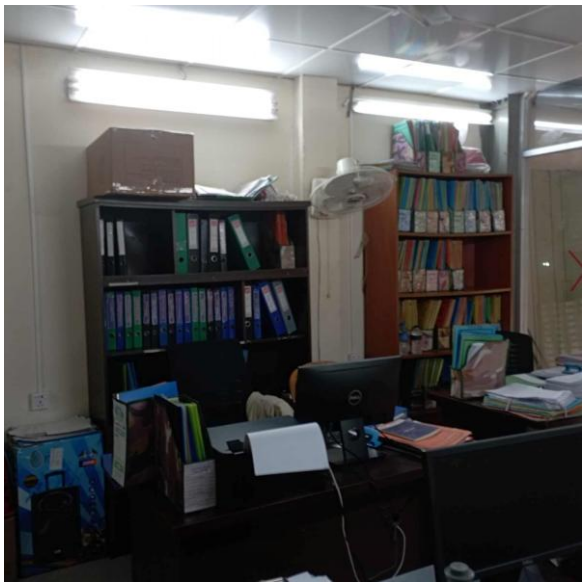

Description: Nonstructural elements were found unanchored/unbraced. The building engineer is required to anchor/brace all nonstructural elements within the factory.

Observation-9: Lack of design documents. (Generator & Substation Building)



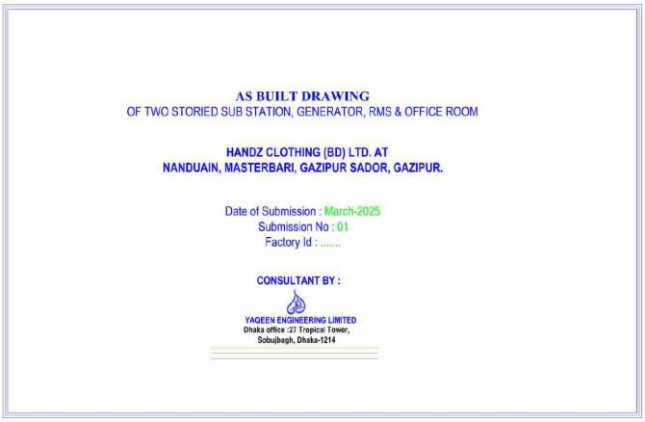

Description: As per BNBC, every building or structure designed shall have its design documents prepared in accordance with the provisions of Section 1.9.1. The design documents shall include a design report and a set of structural drawings, which shall be prepared in compliance with section 1.9.1.1 and section 1.9.1.2 as per BNBC.

At the time of inspection, design documents (including design report, load plan, and material test reports) were not available, which are required to be prepared in compliance with section 1.9.1 (part-6, BNBC). However, a set of as-built drawings was available onsite.

Observation-10: Dampness on the beam, column, and brick wall. (Generator & Substation Building)





Description: Dampness was observed on the beam, column, and brick wall at the east side of the building. Building engineer to seal the source of water and repair the dampness with a suitable method.

Observation-11: Non-structural elements found unbraced/not anchored. (Generator & Substation Building)



Description: Non-structural elements suspended from, attached to, or resting atop the structure shall be adequately anchored and braced to resist earthquake forces. Factory is required to brace/anchor all non-structural elements.

Observation-12: Exposed rebar on the roof level. (Generator & Substation Building)






Description: Exposed rebar was observed on the roof, which is prone to corrosion. The building engineer is required to provide anti-corrosive coating on the exposed rebar.

Observation 13: Apparently non-engineered connection/Shed. (Medical & Childcare Shed)






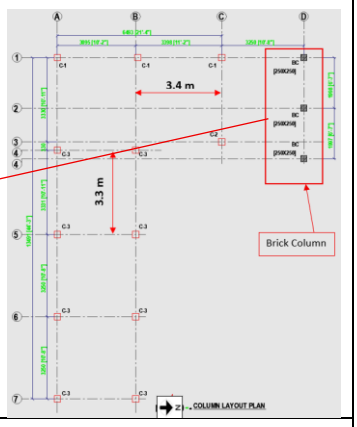

Description: Steel rafter (box section) rested on the brick wall. The building engineer is required to check the adequacy of the connection of the lightweight roof against the uplift pressure of the wind as part of the engineering assessment. Also, three brick columns are shared by the Generator & Substation Building and the Medical & Childcare Shed. The building engineer is required to separate the connection and provide a new column for the structure. Otherwise, analyze these buildings as a single structure.

Observation 14: Discrepancy in the as-built drawing (Medical & Childcare Shed)

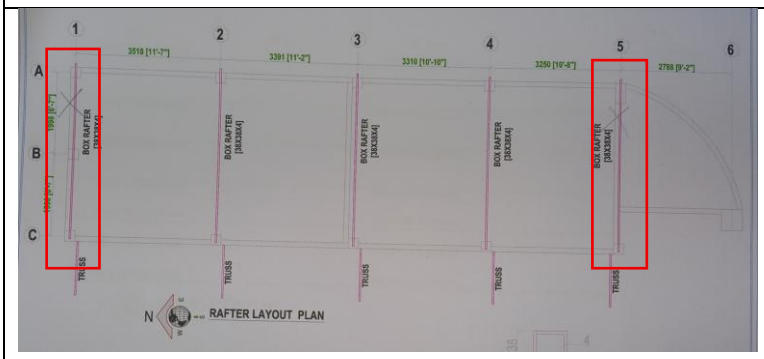



Description: Marked rafter was not found on-site as per the provided as-built drawing. The building engineer is required to survey the whole structure and prepare an accurate as-built drawing.

Observation 15: Exposed rebar on the roof level. (Security Room)



Description: Exposed rebar was observed on the roof, which is prone to corrosion. The building engineer is required to provide anti-corrosive coating on the exposed rebar.

Observation-16: Lack of anchorage between the steel member and the brick wall (Cartoon Godown Shed).



Description: Lack of anchorage found between the steel member and the brick wall. Prepare the proper connection details of the steel rafter to the Brick wall connection as part of the safety check report and submit it to RSC for review. Implement remediation work, as per the accepted drawing from RSC.

3. Action Plan

Item No.	Observation	Action Plan	Timeline
1.	Lack of lateral stability (Main Production Shed)	The building engineer is required to check the lateral stability of the structure as part of the DEA and propose a remediation plan if required.	within 6 weeks
2.		Verify in-situ steel strength.	within 6 weeks
3.		Carryout suggested remedial works.	within 6 months
4.	Lack of a geotechnical investigation report (Main Production Shed).	A geotechnical engineer must be engaged to prepare a geotechnical investigation report to determine the soil bearing capacity.	within 6 weeks
5.		Based on geotechnical data, check the foundation adequacy as part of DEA.	within 6 weeks
6.	Faulty connection in vertical bracing (Main Production Shed).	The building engineer is required to check the load path and connection adequacy and propose a remediation plan.	within 6 weeks
7.	Possibility of construction of a new mezzanine floor (Main Production Shed).	Any addition to the new existing structure not shown in the permit drawing, the building engineer is required to take a fresh permit from the local authority and carry out a Detailed Engineering Assessment (DEA) in compliance with BNBC 2020.	within 6 months
8.	Discrepancy and missing information in the provided drawing (Main Production Shed).	The building engineer is required to update the as-built drawing.	within 6 weeks
9.	Corrosion on steel members (Main Production Shed).	The building engineer is required to remove the corrosion and provide rust-proof paint on steel members.	within 6 weeks
10.	Loose cable bracing (Main Production Shed).	Tighten all loose bracings.	within 6 weeks
11.	Non-structural elements found unanchored/braced (Main Production Shed).	The building engineer is required to anchor/brace all nonstructural elements within the factory.	within 6 weeks

12.	Lack of design documents. (Generator & Substation Building)	The building engineer is required to prepare design documents (including design reports, material test reports, and live load plan) in compliance with section 1.9.1 (part 6, BNBC).	within 6 weeks
13.		Produce accurate as-built drawings.	within 6 weeks
14.		Carry out the suggested remedial works.	within 6 months
15.	Dampness on the beam, column, and brick wall. (Generator & Substation Building)	Building engineer to prepare an investigation report, seal the source of water, and repair the dampness as per the investigation report.	within 6 weeks
16.	Non-structural elements found unbraced/not anchored. (Generator & Substation Building)	The factory is required to brace/anchor all non-structural elements.	within 6 weeks
17.	Exposed rebar on the roof level. (Generator & Substation Building)	The building engineer is required to provide anti-corrosive coating on the exposed rebar.	within 6 weeks
18.	Apparently non-engineered connection/Shed. (Medical & Childcare Shed)	The building engineer is required to check the connection of the steel roof for the uplift pressure of wind as part of the Engineering Assessment (EA).	within 6 weeks
19.		The building engineer is required to separate the connection and provide new columns for structures. Otherwise, analyze these buildings as a single structure.	within 6 months
20.		Complete implementation of remedial works if required.	within 6 months
21.	Discrepancy in the as-built drawing (Medical & Childcare Shed)	The building engineer is required to survey the whole structure and prepare an accurate as-built drawing.	within 6 weeks
22.	Exposed rebar on the roof level. (Security Room)	The building engineer is required to provide anti-corrosive coating on the exposed rebar.	within 6 weeks
23.	Lack of anchorage between the steel member and the brick wall (Cartoon Godown Shed).	Prepare the proper connection details of the steel rafter to the Brick wall connection as part of the safety check report and submit it to RSC for review.	within 6 weeks
24.		Implement remediation work, as per the accepted drawing from RSC.	within 6 months