FIRE SAFETY INSPECTION REPORT

Factory Name: Nassa Spinners and Garments Ltd

ACCORD ID: 23699

ADDRESS:
Plot No.- 197-200, Comilla EPZ, Comilla
23.449242, 91.184862

Other Factories: None



ACCORD
on Fire and Building Safety in Bangladesh

Inspected By: Mohammad Atick Al Zaman & Ahammad Kabir
Date: 25th July, 2019

Fire Safety Inspection Report

Factory Name: Nassa Spinners and Garments Ltd

Introduction:

Nassa Spinners and Garments Ltd was surveyed for fire safety on 25th July, 2019 by The Accord Inspection Team. This summary identifies the major deficiencies that were identified during the inspection.

The purpose of this survey was to identify significant fire safety issues and to provide recommendations for remediation based on applicable standards specified by the Accord. The scope of this initial fire safety inspection was limited to the review and identification of major fire safety issues. The inspection did not include identification of minor deficiencies, which will be further addressed as part of follow-up inspections. Table 1 summarizes the major fire safety issues identified during the inspection.
Recommendations have been provided to address each issue.

An implementation schedule shall be developed by the factory to remediate each of the findings. The specific timing of improvements, including any requested extensions due to design / installation constraints, shall be submitted to the Accord for approval


Findings & Recommendations :

Factory Name: Nassa Spinners and Garments Ltd
This table summarizes the major fire safety issues identified during the inspection of new shed. Recommendations have been provided to address each issue.

An implementation schedule shall be developed by the factory to remediate each of the findings. The specific timing of improvements, including any requested extensions due to design / installation constraints, shall be submitted to the Accord for approval.


Table-1:

Sl No.	Category	Findings	Required Action	Remediation Time Frame
F-1	Fire Rated Construction	The exit stair enclosures are separated from work areas and other spaces on each floor by fire-rated construction. Fire Doors have been provided with proper hour rating. But doors are kept open and installation of magnetic hold open device to interface with Fire Alarm System have been done but the devices are not interfaced with any approved FACP. Moreover Exit stair enclosures have unprotected openings within 10 feet towards production floor at two stairs.	The exit stair enclosure shall be provided with a minimum 1-hr fire resistance rating for buildings with 3 or fewer stories and a minimum of 2- hr. fire resistance rating for buildings 4 or more stories. Provide 0.75 hr. fire rated door and seal all penetrations and openings by 1 hr. fire rated fire rated barrier construction for building with 3 or fewer stories. Provide 1.5 hr. fire rated door and seal all penetrations and openings by 2 hr. fire rated fire rated barrier construction for building with 4 or more stories. Provide a fire-resistive rated assembly between the exterior exit stairs and the building up to 10 ft. beyond the end of the stair to achieve the required separation. The rated assembly shall be approved and/or designed by a qualified fire protection engineer. Ensure that the fire doors are self-closing and positive latching and that they are provided with fire exit (panic) hardware where serving production floors. If fire doors are	Within 3 months

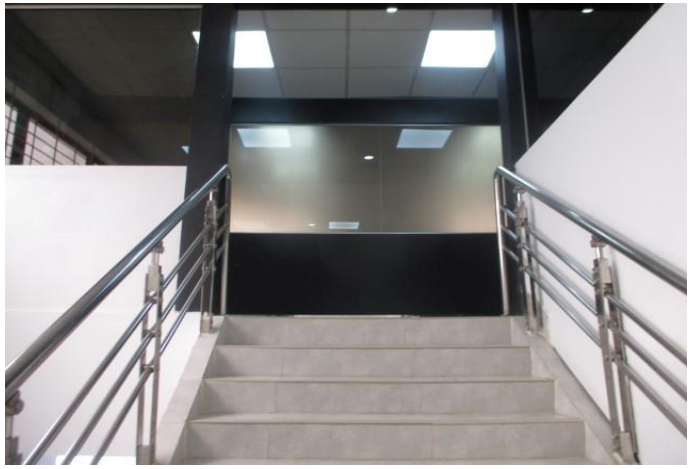



F-2	Interior Exit Discharge	Exit stair(s) is discharge the occupants inside the building.	1. Modify stair to discharge directly outside. Or 2. Provide 2-hr fire-rated exit passageway leading directly outside (vestibules to separate any storage areas). Or 3. Provide sprinkler protection for discharge floor in accordance with NFPA 13.	Within 3 months

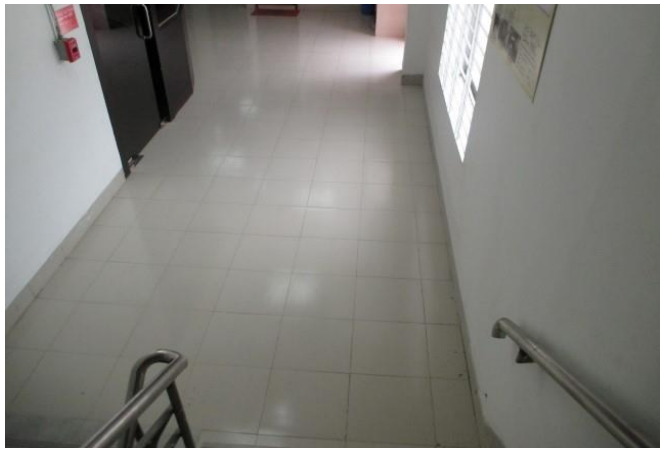



F-3	Exterior Exit stairs	The exterior exit stair is not separated from the building.	Exterior exit stairs shall be separated from the building with a rating requirement of 1 hr. fire rating for 3 or fewer stories or 2 hr. fire rating for 4 or more stories. The rating of the exterior wall shall extend 3.05 m (10ft) beyond the ends of the stair structure.	Within 3 months





F-4	Fire Rated Construction	Rooms used for combustible storage are not separated by fire rated construction. Location: wastage go down shed at ground floor adjacent to the mail building	Separate the dedicated storage rooms by minimum 1-hr fire-rated construction. Provide 0.75 hr. fire rated door and seal all penetrations and openings by 1 hr. fire rated fire rated barrier construction.	Within 3 months





F-5	Fire Detection and Alarm System	The existing fire alarm & detection system is not installed properly. Still few areas are out of detection system.	Submit the as-built design/drawing of fire alarm & detection system to Accord for review.	Within 06 Months (Design review & Modification of the system)





F-6	Storage in Exit Stair	Storage was located in the exit stair.	Remove all storage from exit stairs.	Immediately
				
F-7	Emergency Egress Lighting	Based on the number and location of emergency lights observed, adequate illumination levels are not anticipated along egress routes.	Test the emergency lighting system on each floor and provide additional emergency fixtures to provide adequate illumination along the means of egress. Provide a minimum illumination of 10 lux at the floor level within exit stairs and exit discharge paths and minimum 2.5 lux along exit access aisles.	Within 3 months

F-8	Manual On/Off Switch	Manual on-off switch is provided for emergency lighting / exit signage units.	Remove manual on/off switches from emergency lighting / exit signage units to prevent them from being switched off.	Within 1 month
F-9	Dead End Corridor	Dead-end aisles exceed 30 meter. Location: Mezzanine floor-office area.	Reconfigure the egress arrangement to reduce the maximum dead-end distance to not more than 30 meter.	Within 3 months
				

F-10	Fire Detection System (ITM)	Inspection, testing, and maintenance for the fire alarm system is not in accordance with NFPA 72 or as per Accord standard.	Inspect, test and maintain the fire alarm system, and keep written records on-site, in accordance with NFPA 72 or as per Accord standard.	Within 3 month (After completion of the installation)
F-11	Inspection, testing, and maintenance	Inspection, testing, and maintenance for the exit sign and emergency lighting system was not in accordance with The ACCORD standard.	Inspect, test and maintain the exit sign and emergency lighting system in the accordance with The ACCORD standard. Keep written records on-site.	Within 3 Months
F-12	Inspection, testing, and maintenance	Inspection, testing and maintenance of portable fire extinguishers is not in accordance with NFPA 10.	Inspect, test and maintain the portable fire extinguishers and keep written records on- site, in accordance with NFPA 10 and ACCORD standards.	Within 3 Months
F-13	Stair designation	Building did not have stair designation signs and occupant load signs at required locations.	Provide stair designation signs and occupant load signs at required locations.	Within 1 week



ACCORD
on Fire and Building Safety in Bangladesh