Nassa Spinners and Garments Ltd.

Plot No.- 197-200, Comilla EPZ, Comilla.
Co-ordinates: 23.449240N, 91.185205E
25th July 2019



ACCORD
on Fire and Building Safety in Bangladesh

পর্যবেক্ষণসমূহ

ACCORD
on Fire and Building Safety in Bangladesh

Faulty connection

Observation : Main Production Shed

ACCORD
on Fire and Building Safety in Bangladesh



Number of bolts required to verify



Bolt and welded connection



Bolt hole excessive larger than the bolt diameter



Significant gap in connection



Welded connection in place of bolted connection


Building engineer is required to investigate the connections and prepare an adequacy report.

Observation : Main Production Shed

Discrepancies in drawings

Observation : Main Production Shed

ACCORD
on Fire and Building Safety in Bangladesh

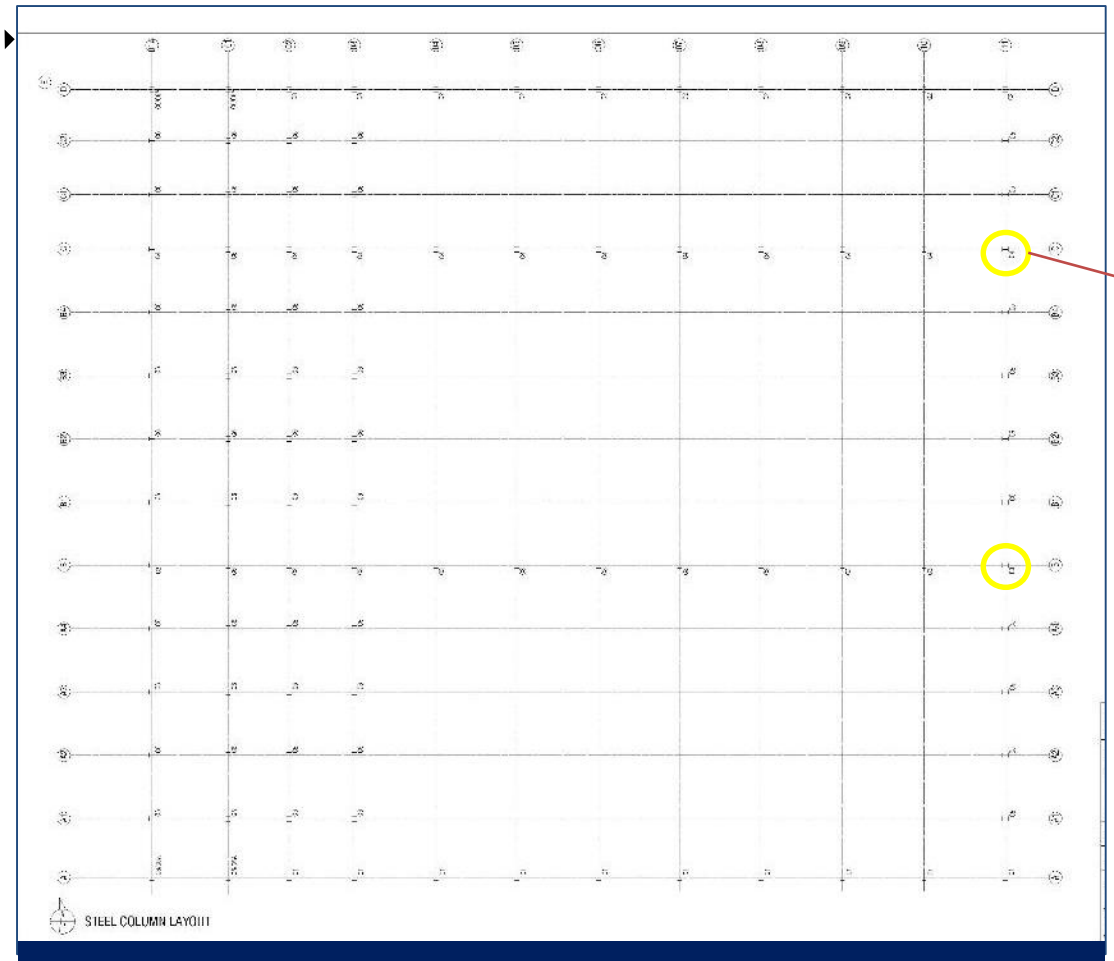


Steel column layout plan




Orientation of this columns not matched.

Observations: Main Production Shed

ACCORD
on Fire and Building Safety in Bangladesh

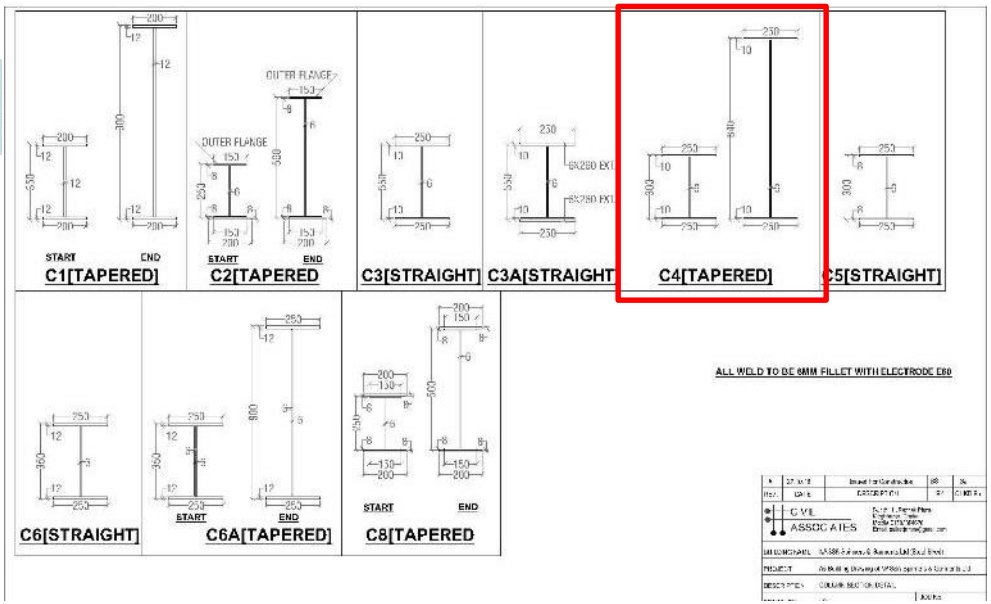


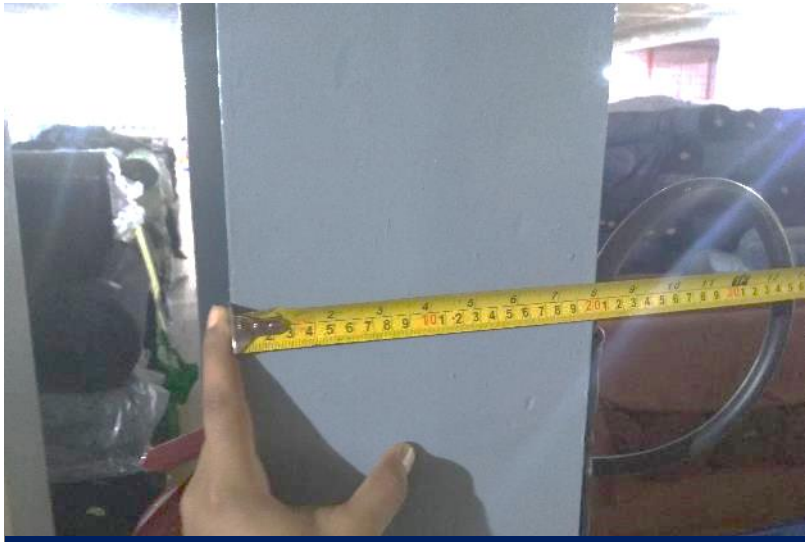

C4 column flange width measured 200 mm instead of 250 mm



Grade slab details not incorporated in drawings

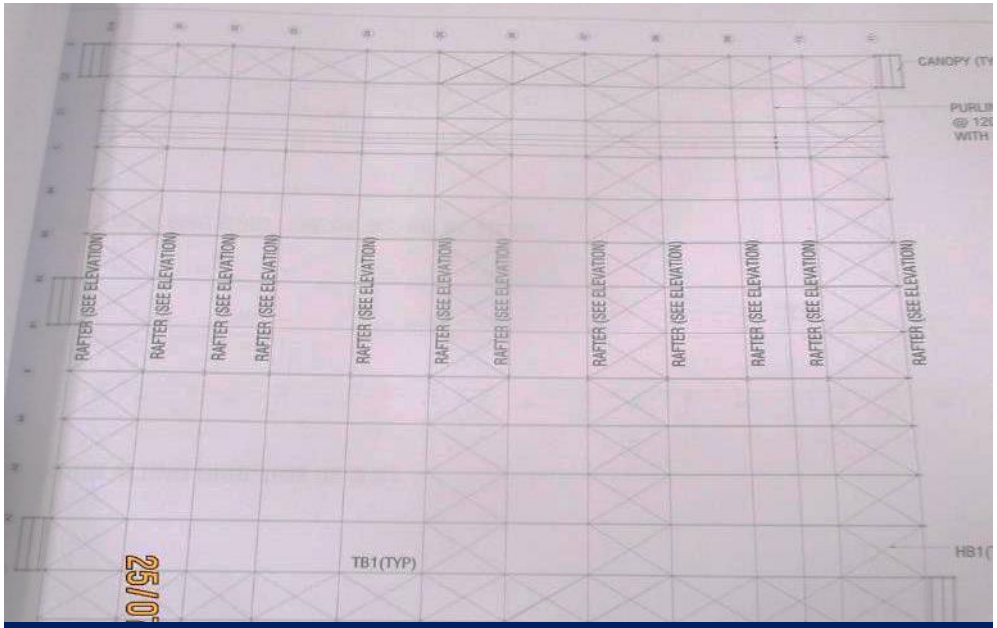

Compression strut detailing not available.

Observations: Main Production Shed

ACCORD on Fire and Building Safety in Bangladesh

Damage in beam, column & bracing

Observation : Main Production Shed





Damaged column



Damaged bracing




Damaged beam

Damage in beam, column & bracing observed in several locations. Building engineer is required to implement remedial action based on assessment report.

Observations: Main Production Shed

Proposed retrofit strengthening not implemented

Observations: Main Production Shed

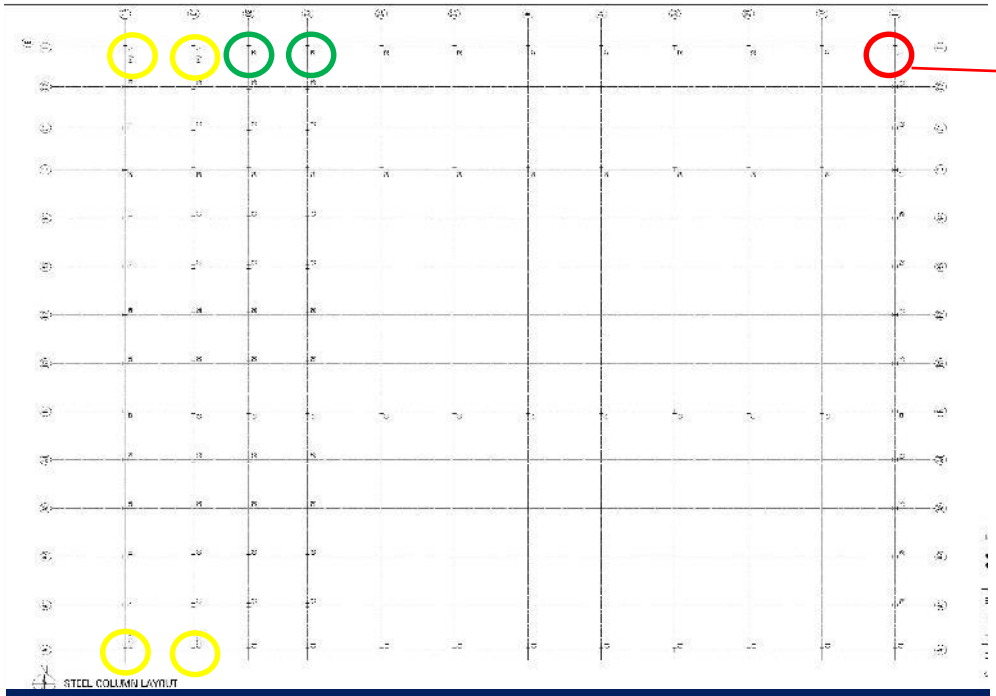

Steel column layout plan



Retrofitting not implemented



Retrofitting not done as per drawing

Retrofitting not done as per drawing

Retrofitting not completed

Doubt in retrofitting



This portion of retrofitting not done for columns.

Observations: Main Production Shed

Problems Observed

Main Production Shed:

01: Faulty connection.

02: Discrepancies in drawings.

03: Damage in beam, column & bracing.

04: Proposed retrofit strengthening not implemented.

Priority Actions

Item No.	Observation	Recommended Action Plan	Recommended Timeline
১	Faulty connection	Building engineer is required to investigate the connections and prepare an adequacy report with proper remedial actions.	৬ সপ্তাহ
২	Faulty connection	Carry out any remedial actions as per the adequacy report.	৬ মাস
৩	Discrepancies in drawings	Building Engineer is required to survey the as-built structure and update the as-built drawings.	৬ সপ্তাহ
৪	Discrepancies in drawings	Based on the as-built drawings review the design.	৬ সপ্তাহ
৫	Discrepancies in drawings	Carry out remedial works if necessary.	৬ মাস
৬	Damage in beam, column & bracing	Building engineer is required to take remedial action for the damage elements.	৬ সপ্তাহ
৭	Proposed retrofit strengthening not implemented	Building engineer is required to review the retrofitting scheme.	৬ সপ্তাহ
৮	Proposed retrofit strengthening not implemented	Carry out all the required remedial works as per the reviewed remedial drawings.	৬ মাস