INITIAL FIRE SAFETY INSPECTION REPORT

Nassa Spinners and Garments Ltd (Extension)

RSC ID: 24732

Plot# 200 (part)- 208 (part), Cumilla EPZ, Cumilla-3500

Google Coordinate: 23.44946338885423, 91.18606247698331

Other Factories: Nassa Spinners and Garments Ltd (ID-23699)



RSC | RMG SUSTAINABILITY COUNCIL

Inspected By: Nainin Nowrose

Date: 09 November 2023

Fire Safety Inspection Report

Nassa Spinners and Garments Ltd (Extension)

Introduction:

Nassa Spinners and Garments Ltd (Extension) complex was surveyed for fire safety on **09/11/2023** by The RSC Inspection Team. The purpose of the survey was to identify significant fire safety issues and to provide recommendations for remediation based on applicable standards specified by the RSC. The scope of this initial fire safety inspection was limited to the review and identification of major fire safety issues. The inspection did not include identification of minor deficiencies, which will be further addressed as part of follow-up inspections.

Limitations

The information in this fire safety inspection report was obtained during a visit to the facility and during interviews with local factory management. It has not been possible to provide independent verification for all the information and data collected, and, therefore, The RSC cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.
The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

General Factory Information

Factory Building name(s): There are total 5 structures in the premises under this ID. Those are :

1. Extension Shed (Single storied Shed),
Design Approved by BEPZA (Dhaka) on 22 March 2007
Construction Period Existing.
Total area of the Shed: 5205 sqm.

2. Utility Building

3. Wastage Room

4. Fire Pump Room

5. Security Building & Fire Control Room

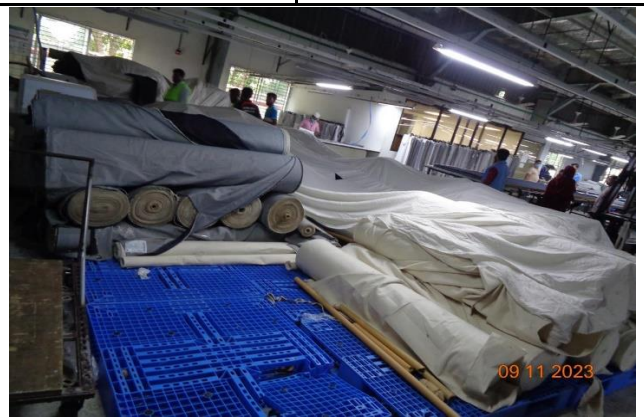
Factory Address: Plot# 200 (part)- 208 (part), Cumilla EPZ, Cumilla-3500

Findings & Recommendations :

Table 1 summarizes the major fire safety issues identified during the inspection. Recommendations have been provided to address each issue.
An implementation schedule shall be developed by the factory to remediate each of the findings. The specific timing of improvements, including any requested extensions due to design / installation constraints, shall be submitted to the RSC for review.

Table-1:

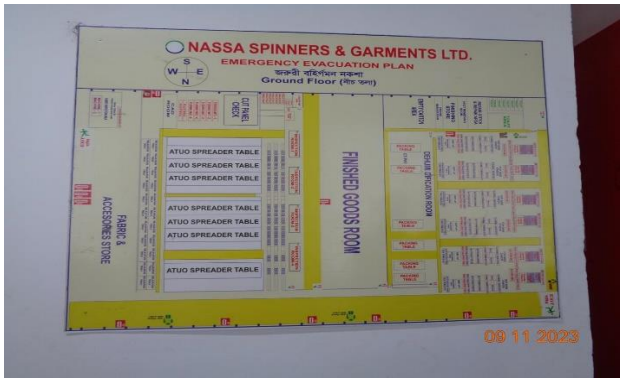
Sl No.	Category	Findings	Required Action	Remediation Time Frame
F-1	Fire Rated Construction	Room used for combustible storage are not separated by fire rated construction. **Location:** Extension Shed.	Provide dedicated storage rooms separated by minimum 1-hr fire-rated construction. Where separate storage rooms are not feasible, provide defined storage areas and limit the storage arrangement as follows: - Maximum height of 2.4m and maximum area of 23m2 - If sprinkler protected: maximum height of 3.66m and maximum area of 93m2 Separate areas of unenclosed combustible storage by a minimum clear distance of 3m.	Within 3 months
				

F-2	Fire Rated Construction	Areas used for combustible storage are not separated by fire rated construction. **Location:** Extension Shed	Provide defined storage areas and limit the storage arrangement as follows: - Maximum height of 2.4m and maximum area of 23m2 - If sprinkler protected: maximum height of 3.66m and maximum area of 93m2 Separate areas of unenclosed combustible storage by a minimum clear distance of 3m.	Within 3 months
				
F-3	Egress Lighting	Manual on-off switch is provided for emergency lighting / exit sign units.	Remove manual on/off switches from emergency lighting / exit signage units to prevent them from being switched off.	Within 1 month

				
F-4	Egress Lighting	The directional signs are not provided where there is a change in direction and where the continuation of the egress path is not obvious. **Location:** Extension Shed.	Illuminated directional signs shall be provided where there is a change in the direction for the path of travel and the direction to an exit is not obvious.	Within 1 month
				

F-5	Egress Lighting	Based on the number and location of emergency lights observed, adequate illumination levels are not anticipated along egress routes. **Location:** Extension Shed.	Test the emergency lighting system on each floor and provide additional emergency fixtures to provide adequate illumination along the means of egress. Provide a minimum illumination of 10 lux at the floor level within exit stairs and exit discharge paths and minimum 2.5 lux along exit access aisles.	Within 1 month
		 		
F-6	Egress Lighting	Exit signs were placed in areas that were not exits.	Remove exit signs (double sided) from noted areas to avoid confusion from actual exits.	Within 1 month

				
F-7	ITM of Egress Lighting	Inspection, testing, and maintenance for the exit sign and emergency lighting system was not in accordance with RSC Technical Guidelines (Standard).	Inspect, test and maintain the exit sign and emergency lighting system in the accordance with RSC Technical Guidelines (Standard). Keep written records on-site.	Within 1 month
F-8	Means of Egress	The egress court (east exit discharge path) is found unprotected.	Seal all penetrations and openings along the discharge path, up to a height of 10 ft., to provide a minimum 1-hr fire seperation. Alternatively, provide a second remote discharge path to the public way (only include this if feasible).	Within 3 months

				
F-9	Means of Egress	Fire evacuation maps posted at the entrance of the exits were not updated.	Fire evacuation maps shall be posted at the entrance of each exits and maps shall be updated regularly when required.	Within 1 month
				

F-10	Means of Egress	Occupant load signs at required exits are not posted in accordance with the RSC Technical Guidelines (StandardV1.0) section 6.4.4.	Provide occupant load signs at required locations.	Within 1 month
F-11	Means of Egress	Sliding doors are provided at building exits.	Replace all collapsible and sliding doors along the means of egress with side-hinged, swinging egress doors.	Within 1 month
				

F-12	ITM of Fire Extinguisher	Inspection, testing and maintenance of portable fire extinguishers is not in accordance with NFPA 10.	Inspect, test and maintain the portable fire extinguishers and keep written records onsite, in accordance with NFPA 10.	Within 1 month
F-13	Fire Alarm and Detection System (FADS)	The fire alarm system installation requires detailed review to confirm compliance with NFPA 72 and RSC technical guidelines (standard).	Submit as-built drawings, testing records, equipment certification and other relevant documentation to the RSC for review. Once reviewed, install or modify the fire detection and alarm system (where required) throughout the building in accordance with RSC technical guidelines (standard). and NFPA 72. The factory management shall contact RSC to conduct the final acceptance testing after the installation, testing & commissioning.	Design- within 1 Month Modification if required- within 3 Months

	   			
F-14	ITM of Fire Alarm and Detection System (FADS)	Inspection, testing and maintenance for the fire detection and alarm system was not in accordance with NFPA 72.	Inspect, test and maintain the fire alarm system and keep written records on-site, in accordance with Table-14.3.1 of NFPA 72.	1 Month after installation.