Nassa Spinners and Garments Ltd. (Extension)

Plot# 200 (part)- 208 (part), Cumilla EPZ, Cumilla-3500

(23.449398,91.186384)

9 November 2023



RMG SUSTAINABILITY COUNCIL

Level 5, Shanta Forum, 187, 188/B,
Bir Uttam Mir Shawkat Sarak, Tejgaon,
Dhaka- 1208, Bangladesh
PABX: +880 2 41081863-6
www.rsc-bd.org

1. Building Information

Extension Shed: Single storied prefabricated steel shed.

Utility Building: Single storied RC Building.

Wastage Room: Single storied prefabricated steel structure.


Fire Pump Room: Underground basement structure (RC).

Security Building: Single storied RC Building.

2. Observations

Extension Shed

Observation-1: Lack of information in Assessment Report

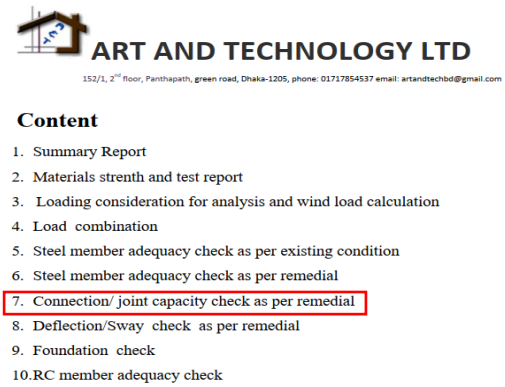

ART AND TECHNOLOGY LTD

152/1, 2nd floor, Panthapath, green road, Dhaka-1205, phone: 01717854537 email: artandtechbd@gmail.com


Content

1. Summary Report
2. Materials strenth and test report
3. Loading consideration for analysis and wind load calculation
4. Load combination
5. Steel member adequacy check as per existing condition
6. Steel member adequacy check as per remedial
7. Connection/ joint capacity check as per remedial
8. Deflection/Sway check as per remedial
9. Foundation check
10. RC member adequacy check

Connection adequacy shown in table of content.

Description: Connection adequacy shown in table of content but not provided in main report. The building engineer is required to update the Assessment Report including all checks as per 1.9.1 of BNBC.

Observation-2: Lack of information in as-built drawing

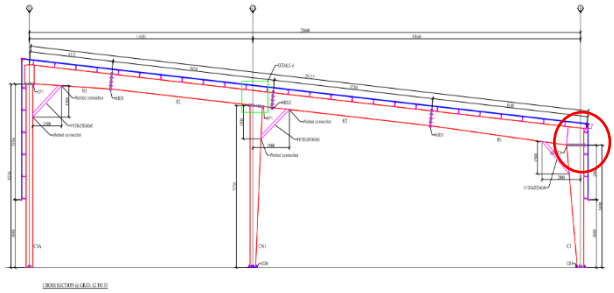

Connection details not provided for marked location.

Description: Connection details not provided for marked location. The building engineer is required to update the as-built drawing providing connection details for all types of connections.

Observation-3: Gap in connection of column to baseplate and corrosion on steel members.



Gap between column and baseplate with corrosion

Description: Gap was found between column and baseplate. The factory is required to fill the gaps as per guidance by factory engineer. Also, provide rust proof paint on steel members to prevent corrosion.

Observation-4: Non-structural elements found unbraced/not anchored.



Storage rack found within the building

Description: Storage rack was found within the building as unbraced/not anchored. Factory is required to brace/anchor all nonstructural elements.

Utility Building, Wastage Shed, Fire pump Room, Security Building:

Building Observation-5: Lack of as-built drawing.



Utility Building



Wastage Room



Fire Pump Room



Security Building

Description: At the time of inspection, as-built drawing was not available on site for any of the structures. The building engineer is required to produce the as-built drawing.

Wastage Room:

Observation-6: Corrosion on steel members.



Corrosion on steel members

Description: Corrosion was found on steel members. Factory is required to provide rust proof paint on steel members to prevent corrosion.

3. Action Plan

Observation	Action Plan	Timeline
Extension Shed		
Lack of information in Assessment Report (Extension Shed)	The building engineer is required to update the Assessment Report including all adequacy checks as per 1.9.1 of BNBC.	within 6 weeks
Lack of information in Assessment Report (Extension Shed)	Implement remediation work if required	within 6 months
Lack of information in as-built drawing (Extension Shed)	The building engineer is required to update the as-built drawing.	within 6 weeks
Gap in connection of column to baseplate and corrosion on steel members (Extension Shed)	The building engineer is required to fill the gaps with a suitable method.	within 6 weeks
Gap in connection of column to baseplate and corrosion on steel members (Extension Shed)	Provide rust proof paint on steel members to prevent corrosion.	within 6 weeks
Non-structural elements found unbraced/not anchored (Extension Shed)	The building engineer is required to brace/anchor all nonstructural elements.	within 6 weeks
Utility Building, Wastage Shed, Fire pump Room, Security Building		
Lack of as-built drawing (Utility Building, Wastage Shed, Fire pump Room, Security Building)	The building engineer is required to produce the as-built drawing.	within 6 weeks
Wastage Room		
Corrosion on steel members (Wastage Room)	Provide rust proof paint on steel members to prevent corrosion.	within 6 weeks