FIRE SAFETY INSPECTION REPORT

A.M.C.S. TEXTILES LIMITED

41 & 52 AEPZ NARAYANGONJ BANGLADESH



ACCORD

on Fire and Building Safety in Bangladesh

May 22, 2014

SUMMARY

A.M.C.S. Textiles Limited was surveyed for fire safety on 5/22/2014 by Hughes Associates, Inc. This summary identifies the major deficiencies that were identified during the inspection.

The purpose of this survey was to identify significant fire safety issues and to provide recommendations for remediation based on applicable standards specified by the Accord. The scope of this initial fire safety inspection was limited to the review and identification of major fire safety issues. The inspection did not include identification of minor deficiencies, which will be further addressed as part of follow-up inspections.


Table 1 summarizes the major fire safety issues identified during the inspection. Recommendations have been provided to address each issue.

An implementation schedule shall be developed by the factory to remediate each of the findings. The specific timing of improvements, including any requested extensions due to design / installation constraints, shall be submitted to the Accord for approval.

Table 1. Findings And Recommendations

No.	Category	Finding	Recommendation	Remediation Timeframe
F-1	Fire Rated Construction	The exit stairs are not separated from work areas, on each floor by fire-rated construction.	Provide a minimum 2.0-hr fire-rated stair enclosure with1.5-hr fire rated doors and seal all unprotected openings to separate the exit stairs from work areas and other building spaces on all floor levels. Ensure that the fire doors are self-closing and positive latching and that they are provided with fire exit (panic) hardware where serving production floors. If fire doors are required to be held open for functional reasons, provide automatic-closing devices tied to the fire alarm system.	Within 3 months



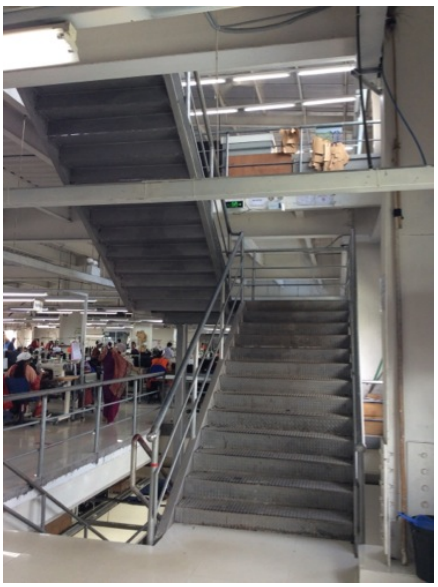



F-2	Fire Rated Construction	Areas used for combustible storage at the ground floor are not separated by fire-rated construction.	Provide dedicated storage rooms separated by minimum 1-hr fire-rated construction.	Within 3 months







F-3	Fire Rated Construction	The boiler room is not separated by fire-rated construction. Electrical boilers were located at the ground floor without proper fire-rated separation.	Separate the boiler room by a minimum 1-hr fire-rated construction. Seal and/or protected all openings to maintain the required fire separations	Within 3 months





F-4	Fire Rated Construction	Unprotected windows are located in front of exterior exit stair.	Seal all penetrations and openings in exit stair enclosure walls to maintain the fire separation.	Within 3 months



F-5	Fire Rated Construction	The exit discharge path serving most exits is less than 10 ft wide and is not separated from the building interior.	Seal all penetrations and openings to the interior of the building along the discharge path, up to a height of 10 ft., to provide a minimum 1-hr fire separation.	Within 6 months





F-6	Egress	Egress gates with locking features are provided at most building exits. All lockable openings were open and unlocked during the inspection.	Remove locking features from all egress gates. If locks are required for security reasons, utilize special door locking features complying with NFPA 101.	Immediate



F-7	Egress	Storage was located in the exit stair. Combustible material were located at the bottom of west exit stair.	Remove all storage from exit stairs and egress paths.	Immediate



F-8	Egress	Sliding gates are provided at most exit discharges and some exit stairs.	Replace all gates along the means of egress with side-hinged, swinging egress doors. If locks are required for security reasons, utilize special door locking features complying with NFPA 101.	Within 3 months








F-9	Egress	Exit stairs discharge inside the building. Exit stair located at the east side discharge into an open storage area at ground floor.	Provide 2-hr fire-rated exit passageway leading direclty outside.	Within 6 months





F-10	Fire Protection	Inspection, testing, and maintenance for the fire alarm system was not in accordance with NFPA 72.	Inspect, test and maintain the fire alarm system, and keep written records on-site, in accordance with NFPA 72.	Within 3 months

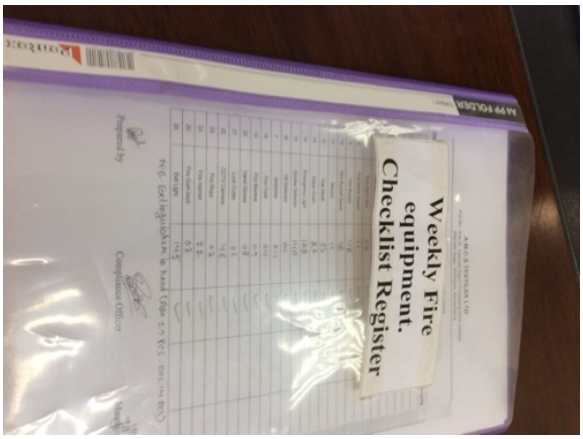

F-11	Egress Lighting	Inspection, testing, and maintenance records for the emergency lighting system were not available.	Inspect, test and maintain the emergency lighting system in accordance with The ACCORD standard. Keep written records on-site.	Within 3 months

