Taratex Fashion Ltd. (10071)

6/1, Naimuddin Mollah Road, North Augh Para, Tongi, Gazipur, Dhaka

(+ 23.916304N, 90.392278E)

17.AUGUST.2014



ACCORD on Fire and Building Safety in Bangladesh

WSP


Identified Priority 1 Concerns

(None)

Identified Priority 2 Concerns

- Inadequacies between the drawings and the actual as-built conditions.
- Capacity check of roof slab supporting water tanks.
- No loading plans exist for the structure.

1st Priority 2 Concern

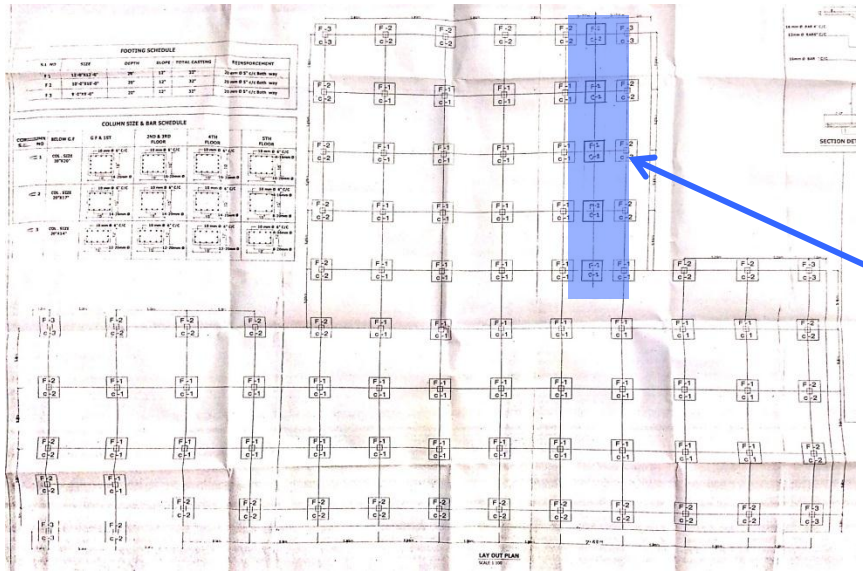

The columns in area shown on the structural drawings were not found.



There are also some 25” x 21” columns noted. These columns are not specified in the structural drawings.

Column layout plan and column schedule need to be revised.

ACCORD on Fire and Building Safety in Bangladesh

WSP

1st Priority 2 Concern



Beam layout plan and some beam details are missing in the structural drawings.




Beam layout plan is required and beam details need to be revised.

ACCORD on Fire and Building Safety in Bangladesh

WSP

1st Priority 2 Concern

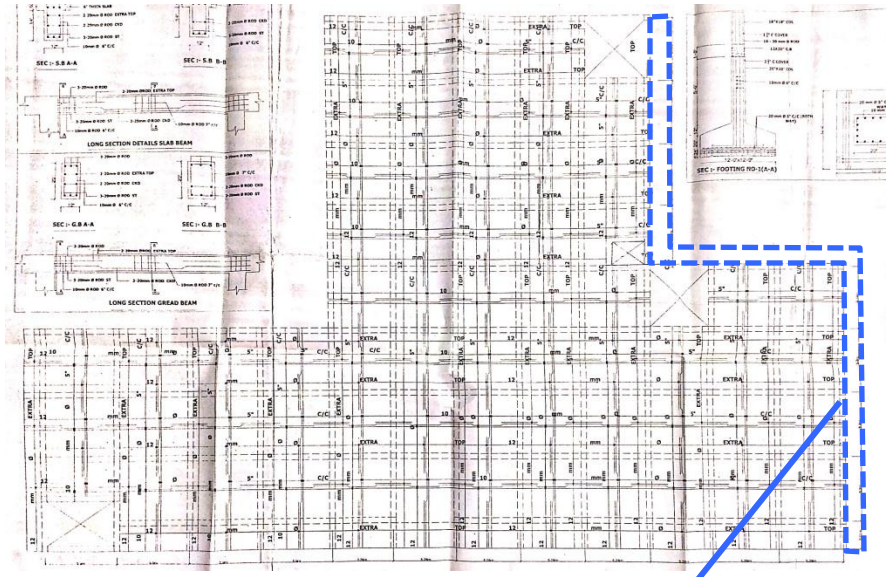

There are cantilevered slabs noted in area shown on the left picture. These do not match the structural drawings.



Floor plans and slab details need to be revised.


ACCORD on Fire and Building Safety in Bangladesh

WSP

2nd Priority 2 Concern





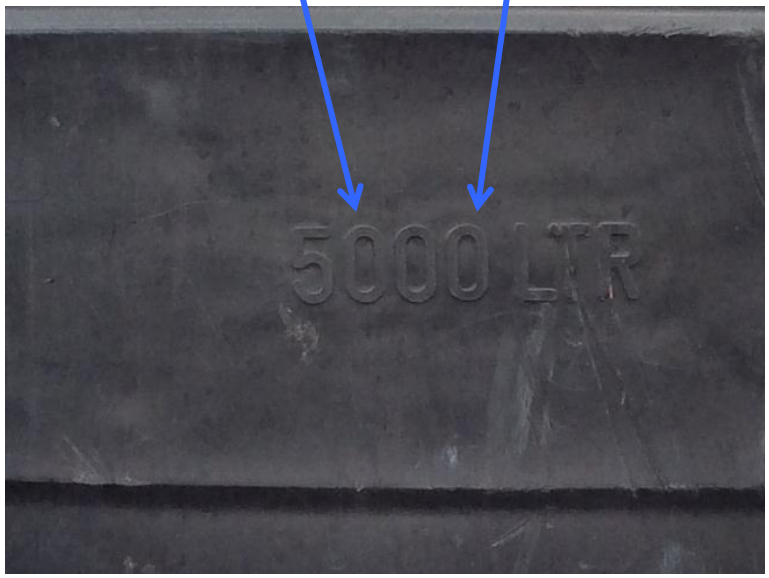

Concerns on the roof slab supporting 5000 Litre water tanks. A capacity check of these slabs and all related elements need to be carried out.

ACCORD on Fire and Building Safety in Bangladesh

WSP

3rd Priority 2 Concern







There are no loading plans for the structure in any area.

ACCORD on Fire and Building Safety in Bangladesh

WSP

Identified Priority 3 Concerns

- Reinforcement left exposed at top level.

1st Priority 3 Concern







Reinforcement is left exposed at top level of building.

ACCORD on Fire and Building Safety in Bangladesh

WSP

Overall Stability System

ACCORD on Fire and Building Safety in Bangladesh

WSP



The lateral loading resistance for this 6-storey building is provided by moment frame action without any shear wall and the façade brickwork walls lack moment capacity due to their poor connections with the surrounding columns and beams.

We require that the stability of this building is investigated as part of an Engineering Assessment.



ACCORD on Fire and Building Safety in Bangladesh

WSP

Water Ingress

ACCORD on Fire and Building Safety in Bangladesh

WSP







There is no water distress noted on slabs, beams and columns during our inspection. However water ponding was found at top level of building.

ACCORD on Fire and Building Safety in Bangladesh

WSP

Priority Actions

ACCORD on Fire and Building Safety in Bangladesh

WSP

Problems Observed Summary

ITEM 1:	**(Priority 2)**	**Inadequacies between the drawings and the actual as-built conditions.**
ITEM 2:	**(Priority 2)**	**Capacity check of roof slab supporting water tanks.**
ITEM 3:	**(Priority 2)**	**No loading plans exist for the structure.**
ITEM 4:	**(Priority 2)**	**Overall stability system.**
ITEM 5:	**(Priority 3)**	**No waterproofing materials.**
ITEM 6:	**(Priority 3)**	**Reinforcement left exposed at top level.**

ACCORD on Fire and Building Safety in Bangladesh

WSP

Item No.	Observation	Recommended Action Plan	Recommended Timeline
1	Priority 2 - Inadequacies between the drawings and the actual as-built conditions.	Factory Engineer to survey the actual conditions and revise the drawings. Any results of the Engineering Assessment which affect the structure should be taken on board.	6-weeks
2	Priority 2 - Inadequacies between the drawings and the actual as-built conditions.	Continue to implement load plan.	6-months
3	Priority 2 - Capacity check of roof slab supporting water tanks.	Factory Engineer to review design, loads and related elements in area identified above to confirm capacity for these items. Or The items in the area identified above should be removed.	6-weeks
4	Priority 2 - No loading plans exist for the structure.	An Engineering Assessment is required to review the design and loads. Factory Engineer to state the maximum weight that is allowed per square meter. State the values clearly on notice boards in these areas. (Loading Plans).	6-weeks
5	Priority 2 - No loading plans exist for the structure.	Maintain standards of quality control to ensure that storage procedures are correctly followed.	6-months
6	Priority 2 - Overall stability system.	An Engineering Assessment of the overall building to be carried out and in particular, stability and foundation aspects should be investigated in detail.	6-weeks
7	Priority 3 - No waterproofing materials.	Waterproofing on the roof slab is to be applied. Moreover the roof slab drainage system should be investigated and improved.	6-months
8	Priority 3 - Reinforcement left exposed at top level.	For both durability and serviceability, rust proof paint or any appropriate methods is recommended.	6-months