INITIAL FIRE SAFETY INSPECTION REPORT

ULTIMATE FASHIONS LIMITED (EXTENSION)

RSC ID: 25994

Geographical Coordinates: 23.883321, 90.318371

Address: SOUTH GOURIPUR, ASHULIA, SAVAR, DHAKA, BANGLADESH.

Other Factories: ULTIMATE FASHIONS LIMITED (ID-12547)



RSC RMG SUSTAINABILITY COUNCIL

Inspected By: Muntasir Ahmad Nasif

Date: 20-February-2025

Fire Safety Inspection Report

ULTIMATE FASHIONS LIMITED (EXTENSION)

Introduction:

RSC ID : 25994

ULTIMATE FASHIONS LIMITED (EXTENSION) complex was surveyed for fire safety on **20-Feb-2025** by The RSC Inspection Team. The purpose of the survey was to identify significant fire safety issues and to provide recommendations for remediation based on applicable standards specified by the RSC. The scope of this initial fire safety inspection was limited to the review and identification of major fire safety issues. The inspection did not include identification of minor deficiencies, which will be further addressed as part of follow-up inspections.

Limitations

The information in this fire safety inspection report was obtained during a visit to the facility and during interviews with local factory management. It has not been possible to provide independent verification for all the information and data collected, and, therefore, The RSC cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

General Factory Information

There are total 6 structures covered under this RSC ID 25994. The buildings are as below:

SL No	Building Name & Type	Building Construction Period	Approval Date & Authority	Occupied	Area (Sq.ft.)	Construction Category
1	Name: Warehouse Rack Shed Type: (G+4 Mezzanines)Steel Shed	Sep-2017 to Mar-2018	24-Dec-2019 (RAJUK) 12-Jan-2023 (DIFE)	Dec-2018	11472.5	Interim
2	Name: Female Toilet Building Type: Two storied RC structure (G+1)	Jan-2010 to Aug-2010		Aug-2015	1007.93	Interim
3	Name: Electrical Maintenance Room Type: Single storied (RCC)	Jan-2016 to Apr-2016		Jun-2016	140	Interim
4	Name: Jhut Boiler Room Type: Single storied shed	Jan-2017 to Dec-2017		Mar-2018	857	Interim
5	Name: Workers Dining Hall Type: Single storied shed	Jan-2017 to Aug-2017		Jan-2018	2553	Interim
6	Name: Multipurpose Shed Type: Single storied shed	Jan-2017 to Dec-2017		Mar-2018	2168	Interim

Factory Address: SOUTH GOURIPUR, ASHULIA, SAVAR, DHAKA, BANGLADESH.

Points of contact:

Md. Muzibur Rahman
General Manager (Admin & Planning)
01715-006505
Mail: muzib@ufl-bd.com



Nuruzzaman
Assistant Manager-(Electrical & Utility)
01713-824850
Mail: utility@ufl-bd.com



Findings & Recommendations :

Table-1 summarizes the major fire safety issues identified during the inspection. Recommendations have been provided to address each issue. An implementation schedule shall be developed by the factory to remediate each of the findings. The specific timing of improvements, including any requested extensions due to design / installation constraints, shall be submitted to the RSC for review.

Table-1: All structures in this ID-25994.

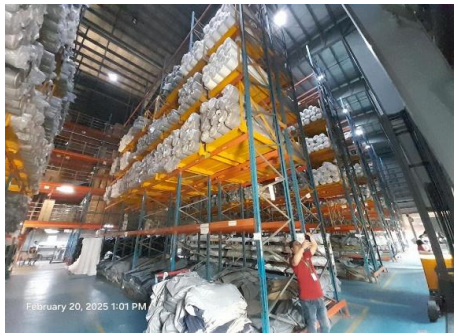
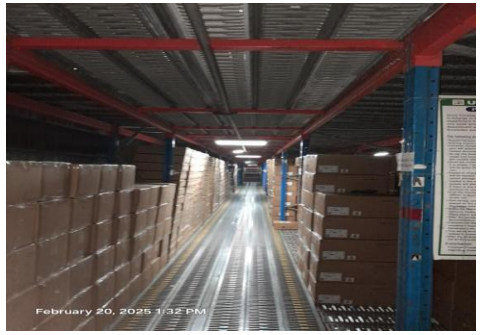
Sl No.	Category	Findings	Required Action	Remediation Time Frame
F-01	Fire Rated Construction	Rooms used for combustible storage are not separated by fire rated construction. Locations: Ground floor (Jhut Boiler Shed), Idle machine room (Multipurpose Shed).	Rooms used for storage of combustible materials shall be separated from the surrounding occupancy with a minimum 1 hour construction in accordance with section 3.4.2.1.5 of RSC Technical Guideline (Standard).	Within 3 months
	  			

F-02	Fire Rated Construction	The main structural elements of the building (peak height 51 ft (15.545m)) are constructed by steel which is non-rated and were found in exposed condition without any fire protection. (Interim Structure). Location: Warehouse Rack Shed.	The construction type is unprotected steel construction. As per RSC Technical Guideline and BNBC 2006, The Fire rating of the structure requires to be confirmed as per BNBC 2006. The "Ministry of Housing and Public Works" has issued a resolution based on the recommendations from the House Building Research Institute (HBRI) and the Public Works Department (PWD) to assess structural fire protection requirements of steel buildings (unprotected non-combustible construction type) according to BNBC 2020. The construction type shall confirm to be in accordance with BNBC 2020 Part-3, Table 3.1.7. Ensure fire resistive rated construction following Table 3.3.1 (a) Part 3 Section-3, Table 3.2.2 and Table 3.2.3 Part 3 Section 2 and Table 4.1.1 from BNBC 2020 Part 4 Section 1. Provide design philosophy to determine the construction type as per BNBC 2020. If any construction rating requires, Consult a qualified fire protection engineer to achieve the require fire rating. Submit the design philosophy along with the required documents to RSC for review the required construction type. Once the design philosophy is reviewed, provide fire ratings of structural members.	Within 6 months
  				

F-03	Means of Egress	Installed fire doors are not functional properly due to non-functional door accessories including door coordinators, closing device, magnetic door holders and panic hardwares. Credible certifications required.	Ensure that the fire doors are self-closing and positive latching and that they are provided with fire exit panic) hardware where serving production floors. If fire doors are required to be held open for functional reasons, provide automatic closing devices tied to the fire alarm system. The clearance under the bottom of a fire door shall be a maximum of 3⁄4 in. (19 mm).	Within 2 months
  				

F-04	Means of Egress	The exit stair enclosures are not separated from work areas and other spaces on each floor by fire-rated construction. Location: Warehouse Rack Shed (Exit stairs from mezzanine floors).	The exit stair enclosure shall be provided with a minimum 1-hr fire resistance rating for buildings with 3 or fewer stories and a minimum of 2- hr. fire resistance rating for buildings 4 or more stories. Provide 1-hr. fire rated door and seal all penetrations and openings by 1 hr. fire rated fire rated barrier construction for building with 3 or fewer stories. Provide 1.5 hr. fire rated door and seal all penetrations and openings by 2 hr. fire rated fire rated barrier construction for building with 4 or more stories in accordance with section 6.3.1.2 of RSC Technical Guidelines (Standard)[1] V1.0. Provide a fire-resistive rated assembly between the exterior exit stairs and the building up to 10 ft. beyond the end of the stair to achieve the required separation. The rated assembly shall be approved and/or designed by a qualified fire protection engineer. Ensure that the fire doors are self-closing and positive latching and that they are provided with fire exit (panic) hardware where serving production floors. If fire doors are required to be held open for functional reasons, provide automatic closing devices tied to the fire alarm system.	Within 3 months

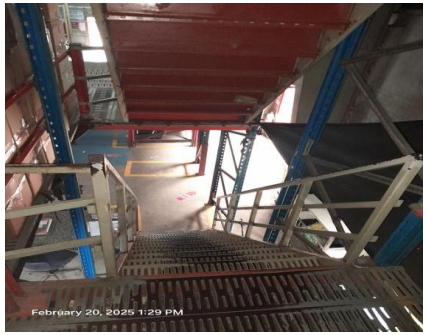

February 20, 2025 1:29 PM

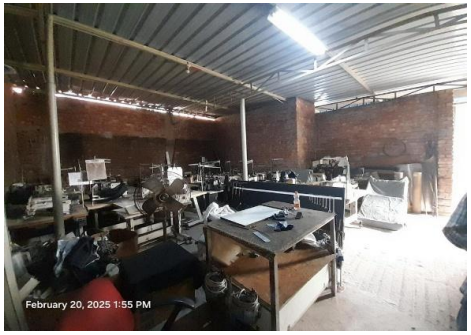
F-05	Fire Rated Construction	A catwalk (deck) has been constructed on the high-rack storage, and the area of the intermediate deck creates a separate floor, as the size of the decks exceeds 33% of the total floor area, requiring fire-rated separation. Location: Warehouse Rack Shed.	Remove the catwalk of the intermediate deck. Or , The floor must adhere to the RSC building standards and BNBC 2006 regulations regarding fire rated construction and egress features.	Within 3 months
	  			

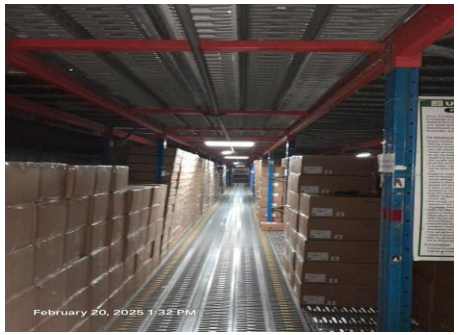
F-06	Means of Egress	The available Travel distance (142 ft) exceeds the maximum allowable limit where only a single means of exit has been provided and does not meet the requirements of Section 6.13 of RSC Technical Guidelines (Standard). . Location: 1st floor of 2-storied female toilet building.	Reconfigure the egress arrangement or provide additional exits so that the travel distance shall not exceed 45 m. or, Provide a standpipe system in accordance with the RSC Technical Guidelines (Standard) along with the automatic fire detection system, and portable fire extinguishers to increase the travel distance limitations for G2 (RMG factories) to 60 m (200 ft). or, Provide a complete automatic sprinkler system in accordance with the RSC Technical Guidelines (Standard) along with the automatic fire alarm system, and portable fire extinguishers to increase the travel distance limitations for G2 (RMG factories) to 122 m (400 ft).	Within 3 months
				
F-07	Means of Egress	The available Dead-end corridor distance (100 ft) exceeds the maximum allowable limit. Location: 1st floor of 2-storied female toilet building.	Reconfigure the egress arrangement to reduce the maximum dead-end corridor to meet Table 6.13.3 of RSC Technical Guidelines (Standard).	Within 3 months

				
F-08	Fire Rated Construction	Boiler shed is not separated from other occupancies by fire rated construction. Location: boiler shed and multipurpose shed.	Boilers or other heat producing equipment shall be separated from other occupancies by a minimum 1-hr fire rated construction (wall, floor, slab etc.). Seal all penetrations and openings (door, window etc.) should be protected by 0.75-hr (45 min) fire rated materials to maintain the fire separation if required. All exhaust systems shall discharge to the exterior of the building in a safe location. Or Relocate it to exterior of the building and maintain a minimum 3m (10 ft.) spatial separation distance from the building. Boiler room separation shall meet section 3.4.2.1.2 of RSC Technical Guideline (Standard).	Within 3 months

	   			
F-09	Means of Egress	Non-compliant doors (Sliding type doors) are provided along with the means of egress at several locations. Location: Multipurpose shed.	Replace all collapsible/sliding/shutter type doors & gates by the side-hinged swinging type doors in accordance with section 6.8.1 of RSC Technical Guidelines (Standard)[1] V1.0. All doors in a means of egress shall be of the side-hinged swinging type. Roll--down and sliding gates and shutters shall not be allowed. Doors serving an occupant load of more than 50 shall swing in the direction of egress travel.	Within 1 month
	 			

F-10	Means of Egress	Stair width is found less than 60 in. (found 31 in.) from high rack deck. Location: Warehouse Rack Shed.	Stairs shall have a minimum clear width of 60 in. for all industrial occupancies as per RSC Technical Guideline (Standard) section of 6.5.6.	Within 3 months
		  		
F-11	Means of Egress	Aisles marking was not provided on several areas. locations: Multipurpose shed.	Aisles shall be provided with a minimum unobstructed clear-width of 0.9 m (36 in.) in accordance with section 6.5.1 of RSC Technical Guidelines (Standard)[1] V1.0.	Within 1 month

				
F-12	Means of Egress	Updated evacuation map is not posted at the entrance of all exit stairs on each floors.	Update the fire evacuation map and shall be posted at the entrance to each exit stair in accordance with RSC Technical Guidelines (Standard)[1] V1.0 Section 13.3.	Within 1 month
F-13	Means of Egress	Building did not have updated occupant load signs at all required locations on each floors.	Post the occupant load for every assembly and production floor in a facility in a conspicuous space near the main exit or exit access doorway for the space in accordance with RSC Technical Guidelines (Standard)[1] V1.0 Section 6.4.4.	Within 1 month
F-14	Means of Egress	The directional signs are not provided where there is a change in direction and where the continuation of the egress path is not obvious.	Illuminated directional signs shall be provided where there is a change in the direction for the path of travel and the direction to an exit is not obvious in accordance with RSC Technical Guidelines (Standard)[1] V1.0 Section 6.11.3.	Within 1 month

		 		
F-15	Means of Egress	illuminated Exit signs are not provided at all exits.	Lighted exit signs shall be placed at entrance to an exit. Additional directional exit signs shall be placed throughout the facility anywhere the continuation of the egress is not obvious. Lighted exit signs shall be provided with either battery backup or uninterruptable power supply systems and shall be continuously illuminated at all times. Exit Sign shall provide in accordance with RSC Technical Guidelines (Standard)[1] V1.0 Section 6.11.	Within 1 month
				

F-16	Means of Egress	Based on the number and location of emergency lights observed, adequate illumination levels are not anticipated along egress routes. Location: Each floors.	Test the emergency lighting system on each floor and provide additional emergency fixtures to provide adequate illumination along the means of egress. Provide a minimum illumination of 10 lux at the floor level within exit stairs and exit discharge paths and minimum 2.5 lux along exit access aisles. Illumination on means of egress shall meet in accordance with RSC Technical Guidelines (Standard)[1] V1.0 Section 10.12.2.	Within 1 month
				
F-17	Inspection, Testing & Maintenance (Fire)	Inspection, testing, and maintenance for the exit sign and emergency lighting system were not in accordance with the RSC Technical Guidelines (Standard).	Inspect, test and maintain the exit sign and emergency lighting system in the accordance with the RSC Technical Guidelines (Standard)[1] V1.0. Keep written records on-site.	Within 1 month

F-18	Fire Alarm & Detection System (FADS)	Automatic fire alarm & detection system installation requires detailed review to confirm compliance with NFPA-72 and RSC Technical Guidelines (Standard).	Submit the fire alarm and detection system design to RSC for review. Once the design is reviewed, install and modify the fire detection and alarm system throughout the building in accordance with review comment, RSC Technical Guidelines (Standard) and NFPA 72. After installation the owner shall conduct internal testing and commissioning and then contact the RSC for witness of final acceptance testing.	Design within 2 month and modification/ installation with 4 months
	   			
F-19	Inspection, Testing & Maintenance (Fire)	Inspection, testing and maintenance for the fire alarm system is not in accordance with NFPA 72 and The RSC Technical Guidelines (Standard).	Inspect, test and maintain the fire alarm system and keep written records on-site, in accordance with NFPA 72 and RSC Technical Guidelines (Standard)[1] V1.0.s.	Within 1 month (after installation)

F-20	Fire Suppression System (SUPS)	The multistoried Warehouse Rack Shed building has an occupied floor height (41 feet 6 inch) greater than 10 meters (33 feet). So that standpipe system is required throughout the building. Fire Pump and Standpipe system installation requires detailed review to confirm compliance with NFPA 13, 14, 20, 22, 24 & RSC Technical Guidelines (Standard).	A standpipe system shall be installed in buildings with the highest occupiable floor 10 m (33 ft.) above grade or more to meet section 5.4.2 of RSC Technical Guideline (Standard). If the building is protected throughout by an approved automatic sprinkler system a class I system shall be permitted.) Installation of the Standpipe system shall be in accordance with RSC Technical Guidelines (Standard)[1] V1.0. section 5.4 and NFPA 14. Submit the standpipe system drawing to RSC for review. Once reviewed, install or modify the standpipe system throughout the building in accordance with RSC Technical Guidelines (Standard)[1] V1.0. and NFPA 14,20,22 and 24. After installation the owner shall contact the RSC for witness of conducting the final acceptance testing of the standpipe system.	Design within 2 month and modification/ installation with 4 months
	   			
F-21	Inspection, Testing & Maintenance (Fire)	Inspection, testing and maintenance of the fire pump system is not in accordance with NFPA 25.	Inspect, test and maintain the fire pump system and keep written records on-site, in accordance with NFPA 25 and RSC Technical Guidelines (Standard)[1] V1.0.s.	Within 1 month (after installation)

F-22	Inspection, Testing & Maintenance (Fire)	Inspection, testing and maintenance of the standpipe system is not in accordance with NFPA 25.	Inspect, test and maintain the standpipe system and keep written records on-site, in accordance with NFPA 25 and RSC Technical Guidelines (Standard)[1] V1.0.s.	Within 1 month (after installation)
F-23	Inspection, Testing & Maintenance (Fire)	Inspection, testing and maintenance of portable fire extinguishers is not in accordance with NFPA 10.	Inspect, test and maintain the portable fire extinguishers and keep written records onsite, in accordance with NFPA 10 and RSC Technical Guidelines (Standard).	Within 1 month