# ULTIMATE FASHIONS LIMITED (EXTENSION)

SOUTH GOURIPUR, ASHULIA, SAVAR, DHAKA, Bangladesh.

(23.882820, 90.318403)

20 February 2025









RSC RMG SUSTAINABILITY COUNCIL

Level 5, Shanta Forum, 187, 188/B,
Bir Uttam Mir Shawkat Sarak, Tejgaon,
Dhaka- 1208, Bangladesh
PABX : +880 2 41081863-6
www.rsc-bd.org

# 1. Building Information:

**i)** Rack Shed
**ii)** Female Toilet Building
**iii)** Electrical Maintenance Room
**iv)** Jhut Boiler Room
**v)** Worker Dining Hall
**vi)** Multipurpose Shed.

## 2. Observation:

**Observation 1**: Lack of design report (RACK Shed).



**Description:** As per BNBC, every building or structure designed shall have its design documents prepared in accordance with the provision of Section 1.9.1. The design document shall include a design report, and a set of structural drawings, which shall be prepared in compliance with section 1.9.1.1 and section 1.9.1.2 as per BNBC. At the time of inspection, the design report was not available which is required to be prepared in compliance with section 1.9.1 (part-6, BNBC).

**Observation 2**: Distorted bracing on steel racks (RACK Shed).




**Description:** Distorted bracing was found on steel racks at a few locations. The building engineer is required to replace distorted bracing of steel racks.

**Observation 3**: Missing bolt in steel connections (RACK Shed).



**Description:** Missing bolt in steel connections was observed at a few locations. The building engineer is required to Install the missing bolt.

**Observation 4**: High stress in flat slab that requires immediate design review (Female Toilet Building).

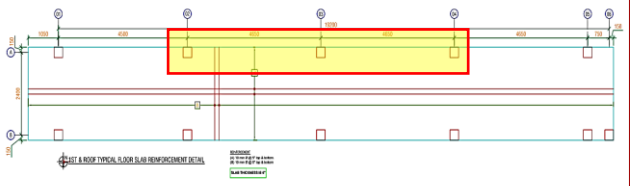




**Description:** Cursory calculation indicates the high stress in flat slab at marked locations on 1st floor due to heavy brick partition walls, considering the live load 2 kPa and minimum concrete strength (14.1 MPa) based on aggregate type. The building engineer is required to check the adequacy of flat slab and prepare a Detailed Engineering Assessment (DEA). Submit it to RSC for review.

**Observation 5**: Dampness on a brick wall (Female Toilet Building).



**Description:** Dampness was observed on the brick wall at several locations. The building engineer is required to repair the dampness with a suitable method.


**Observation-6:** Nonstructural elements found not anchored/braced (Electrical Maintenance Room).

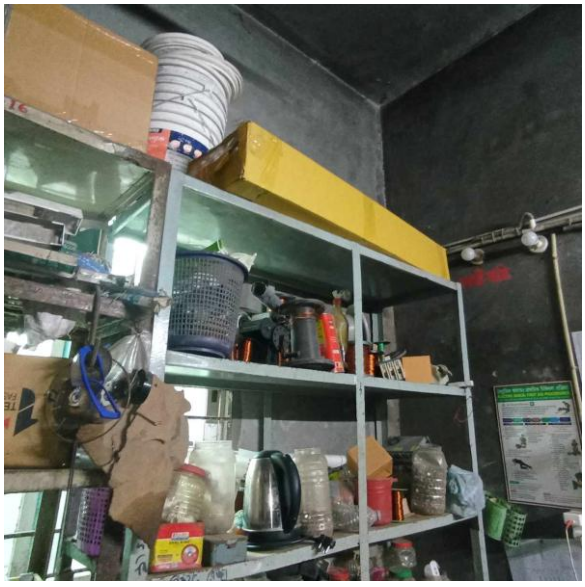

**Description:** Nonstructural elements (storage racks) were found not anchored/braced. The building engineer is required to anchor/brace all nonstructural elements within the factory.

**Observation 7**: Lack of lateral stability (Multipurpose Shed).



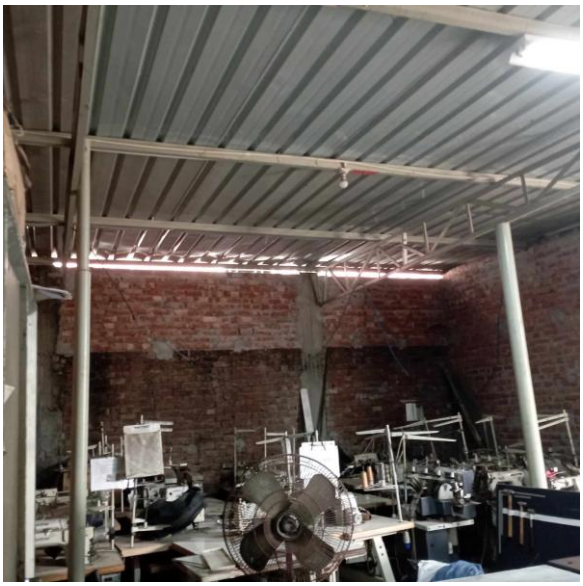


**Description:** No load transfer media, horizontal bracing and vertical bracing are provided to transfer and resist the lateral load. The building engineer is required to check the lateral stability of the shed and prepare an Engineering Assessment (EA) report as per 1.9.1 BNBC.

**Observation 8**: Lack of lateral stability (Workers Dining Hall).



**Description:** No load transfer media, horizontal bracing and vertical bracing are provided to transfer and resist the lateral load. The building engineer is required to check the lateral stability of the shed and prepare an Engineering Assessment (EA) report as per 1.9.1 BNBC.

**Observation 9**: Absence of bracing system and poor connection (Jhut Boiler).

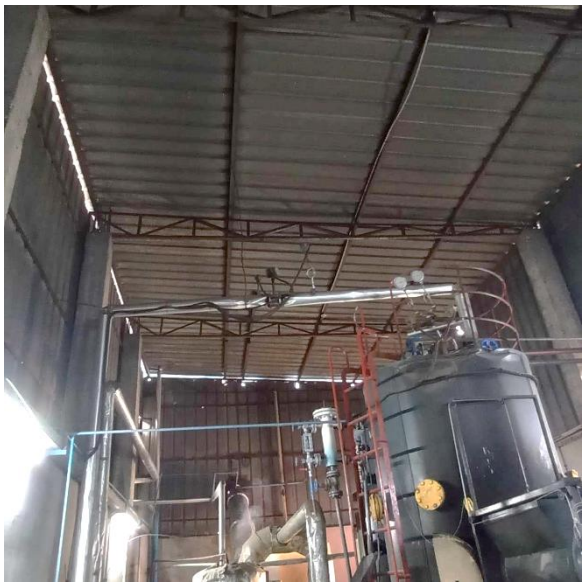

**Description:** No load transfer media, horizontal bracing and vertical bracing are provided to transfer and resist the lateral load. The building engineer is required to prepare safety check report with remediation plan incorporating bracing and proper connection.

## 3. Action Plan

| Item No. | Observation | Action Plan | Timeline |
|---|---|---|---|
| 1. | Lack of design report (RACK Shed). | The building engineer is required to prepare in compliance with section 1.9.1 (part-6, BNBC). | within 6 weeks |
| 2. | | Implement remediation work if required. | within 6 months |
| 3. | Distorted bracing on steel racks (RACK Shed). | The building engineer is required to replace distorted bracing of steel racks. | within 6 weeks |
| 4. | Missing bolt in steel connections (RACK Shed). | The building engineer is required to install the missing bolt. | within 6 weeks |
| 5. | High stress in flat slab that requires immediate design review (Female Toilet Building). | Take minimum 4 concrete cores (100 mm diameter) from both column and flat slab to verify in-situ concrete strength. | Immediate |
| 6. | | The building engineer is required to check the adequacy of flat slab and prepare a Detailed Engineering Assessment (DEA). Submit DEA documents to the RSC for review. | Immediate |
| 7. | | Produce and actively manage a floor load plan. | within 6 weeks |
| 8. | | Implement remediation work if required. | within 6 weeks |
| 9. | | Implement floor load plan. | within 6 weeks |
| 10. | Dampness on a brick wall (Female Toilet Building). | The building engineer is required to repair the dampness with a suitable method. | within 6 weeks |
| 11. | Nonstructural elements found not anchored/ braced (Electrical Maintenance Room). | The building engineer is required to anchor/brace all nonstructural elements within the factory. | within 6 months |
| 12. | Lack of lateral stability (Multipurpose Shed). | The building engineer is required to check the lateral stability of the shed and prepare an Engineering Assessment (EA) report as per 1.9.1 BNBC. | within 6 weeks |
| 13. | | Implement remediation work if required. | within 6 months |

| | | | |
|---|---|---|---|
| 14. | Lack of lateral stability (Workers Dining Hall). | The building engineer is required to check the lateral stability of the shed and prepare an Engineering Assessment (EA) report as per 1.9.1 BNBC. | within 6 weeks |
| 15. | | Implement remediation work if required. | within 6 months |
| 16. | Absence of bracing system and poor connection (Jhut Boiler). | The building engineer is required to prepare safety check report with a remediation plan incorporating bracing and proper connection. | within 6 weeks |
| 17. | | Implement remediation work where required. | within 6 months |

# Survey Limitations and Assumptions

This report is for the private and confidential use of RSC for whom it was prepared together with their professional advisors as appropriate. It should not be reproduced in whole or in part or relied upon by third parties for any use without the express written permission of RSC.

This report can be used in discussion with the supplier or factory owner as a means to rectify or address any observations made. The report is not comprehensive and is limited to what could be observed during a visual inspection of the building.

This Report is not intended to be treated as a generalized inspection and does not cover the deterioration of structural members through dampness, fungal or insect attack, nor does it deal with problems and defects of a non-structural nature. Other non-structural aspects of the building such as fire safety have not been assessed in this survey.

Except as otherwise noted, drains and other services were not viewed or tested during our inspection and are therefore similarly excluded from this Report. We have not inspected any parts of the structure which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

External inspection of the façade walls has generally been carried out from ground level only by visual sighting. No opening up works were carried out (except as noted) and we rely on the Architects and Engineers drawings provided to us for our views on concealed parts of the structure and in particular foundations. Strengths of materials and components are untested and we recommend that the factory owners Building Engineer carries out in situ testing over and above those suggested to satisfy themselves with the material strengths and component details.

Recommendations, where given, are for the purpose of providing indicative advice only, are not exhaustive, relate solely to identifying key and obvious structural defects as identified in this presentation, and do not take the form of or constitute a specification for works. We take no responsibility for the works as constructed. This report does not interfere with the factory owners Building Engineers responsibility for the structural performance of this building, The Building Engineer remains fully responsible for the structural adequacy of the building.

This report does not comment in detail on the future seismic performance of the building and only highlights the fact that the building may experience significant damage or collapse in a seismic event along with many others in the Dhaka region.

The observations in this report are based on the Engineering Judgement of the lead surveyor/engineer at the time of the survey. We assume in making these observations that no covering up of faults defects, filling or plastering over cracking or significant repair work has been carried out by the building owner. Any future alteration or additional work by the building owner will void this report.