Issue	**1**
Factory ID	**26310**
Date of Issue	**19-May-2026**

A A Garments

Chak 220 RB, Street 01, Block A, Babu Wala, Jhang Road
38001 Faisalabad
Punjab Pakistan

Latitude: [31.4137], longitude: [72.9984]
Date of inspection: 09-Mar-2026

Fire Safety Inspection Report

Observations & Actions



Authors	**Muhammad Naseer**
Reviewed by	**Waqar Sami**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 09-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Contents

1. Executive Summary 5
2. Building Extents 7
3. Building Description 9
   - 3.1 Building Means of Egress Details 10
   - 3.2 Building Use 11
4. Documentation 13
5. Fire Safety Measures 14
6. Remediation Support 15
   - 6.1 Engineering Support 15
7. Means of Escape 16
   - 7.1 Escape doors 16
   - 7.2 Exit access 18
   - 7.3 Exit capacity 20
   - 7.4 Protection of stairs 22
   - 7.5 Escape stair condition 24
   - 7.6 Exit signage 26
8. Fire Rated Construction 28
   - 8.1 Separation of high-risk areas 28
   - 8.2 Separation of high-risk areas 30
   - 8.3 Separation of shafts 32
   - 8.4 Separation of occupancies 34
   - 8.5 Storage 36

9. Hazardous Materials 38
9.1 Gas storage 38
10. Fire Safety Management 40
10.1 Fire drills 40
10.2 Records of system testing 41
10.3 Records of systems maintenance 42
10.4 Emergency Action Plan 43
11. Assessment Limitations and Assumptions 44

1. Executive Summary

On 09-Mar-2026, Shehroz Javed and Muhammad Naseer on behalf of the Pakistan Accord carried out an initial fire inspection for A A Garments, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Sohail Alvi (Manager export), Mr. Waseem (Compliance advisor), and other staff members of A A Garments.

The factory operates in one general shift, with approximately 200 workers operate in the factory, with 15 workers being females.
The factory comprises of 4 buildings. The facility was owned by AA Garments. During the inspection, the building highlighted in Figure 1.1 was surveyed, with the site boundary indicated in red.

1 Main Building – is mainly a 2 storey (B+G+1) above grade plane, RC MRF building with a covered area (footprint) of 1530 sq.m. with height to the occupied floor from fire vehicle access is 5m. 5 staircase serves the building, out of which four discharge internally. The building is used for solar panels (roof), stitching (1st floor), finishing & packing (Ground floor) and fabric storage & cutting(Basement). The building was constructed in 2022.

2 Office Building – is a 2 storey (G+1) RC MRF building with a covered area (footprint) of 177 sq. m. 1 staircase serves the building which discharge internally. The building is used for unoccupied (roof), Offices (Ground & 1st floor). The building was constructed in 2022.

3 Utility Building – is a 2 storey (G+1) RC MRF building with a covered area (footprint) of 56 sq. m. 1 staircase serves the building which discharge externally. The building is used for unoccupied (roof), Prayer area (1st floor) and generator room (Ground floor). The building was constructed in 2022.

4 Canteen Building – is a 2 storey (G+1) RC MRF building with a covered area (footprint) of 70 sq. m. 1 staircase serves the building which discharge externally. The building is used for unoccupied (roof), Offices (1st floor) and Canteen (Ground floor). The building was constructed in 2022.

We were presented with Architectural Layouts, Civil Defence Certificate, fire drill records, and Staff Training documents.
A summary of the main concerns identified during the inspection includes (non-exhaustive):
- Lockable mechanisms observed in escape route across the whole facility.
-Basement is not fire separated from rest of the building.
-There is no fire separation between stairs and lift shats to the rest of the building.
-Multiple stair discharges inside the buildings.

We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents



Figure 1.1. Satellite image – Red dashed line indicates site boundary

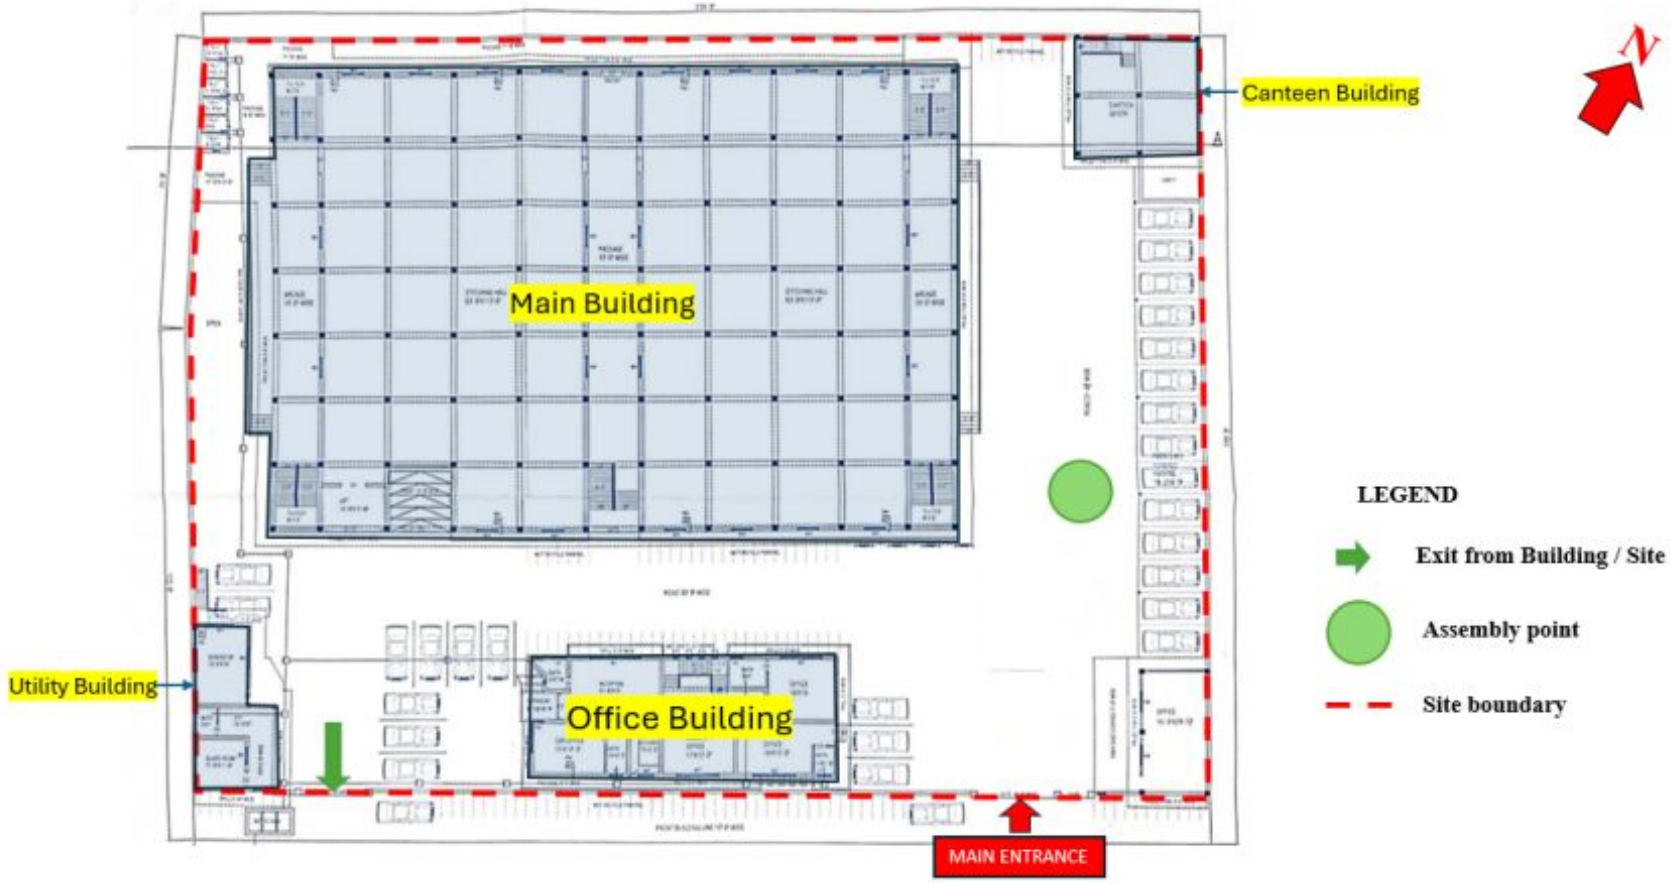


Figure 1.2. Site layout. Red dashed line indicates site boundary

3. Building Description

The factory comprises of 4 buildings. The facility was owned by AA Garments. During the inspection, the building highlighted in Figure 1.1 was surveyed, with the site boundary indicated in red.

1 Main Building – is mainly a 2 storey (B+G+1) above grade plane, RC MRF building with a covered area (footprint) of 1530 sq.m. with height to the occupied floor from fire vehicle access is 5m. 5 staircase serves the building, out of which four discharge internally. The building is used for solar panels (roof), stitching (1st floor), finishing & packing (Ground floor) and fabric storage & cutting(Basement). The building was constructed in 2022.

2 Office Building – is a 2 storey (G+1) RC MRF building with a covered area (footprint) of 177 sq. m. 1 staircase serves the building which discharge internally. The building is used for unoccupied (roof), Offices (Ground & 1st floor). The building was constructed in 2022.

3 Utility Building – is a 2 storey (G+1) RC MRF building with a covered area (footprint) of 56 sq. m. 1 staircase serves the building which discharge externally. The building is used for unoccupied (roof), Prayer area (1st floor) and generator room (Ground floor). The building was constructed in 2022.

4 Canteen Building – is a 2 storey (G+1) RC MRF building with a covered area (footprint) of 70 sq. m. 1 staircase serves the building which discharge externally. The building is used for unoccupied (roof), Offices (1st floor) and Canteen (Ground floor). The building was constructed in 2022.

3.1 Building Means of Egress Details

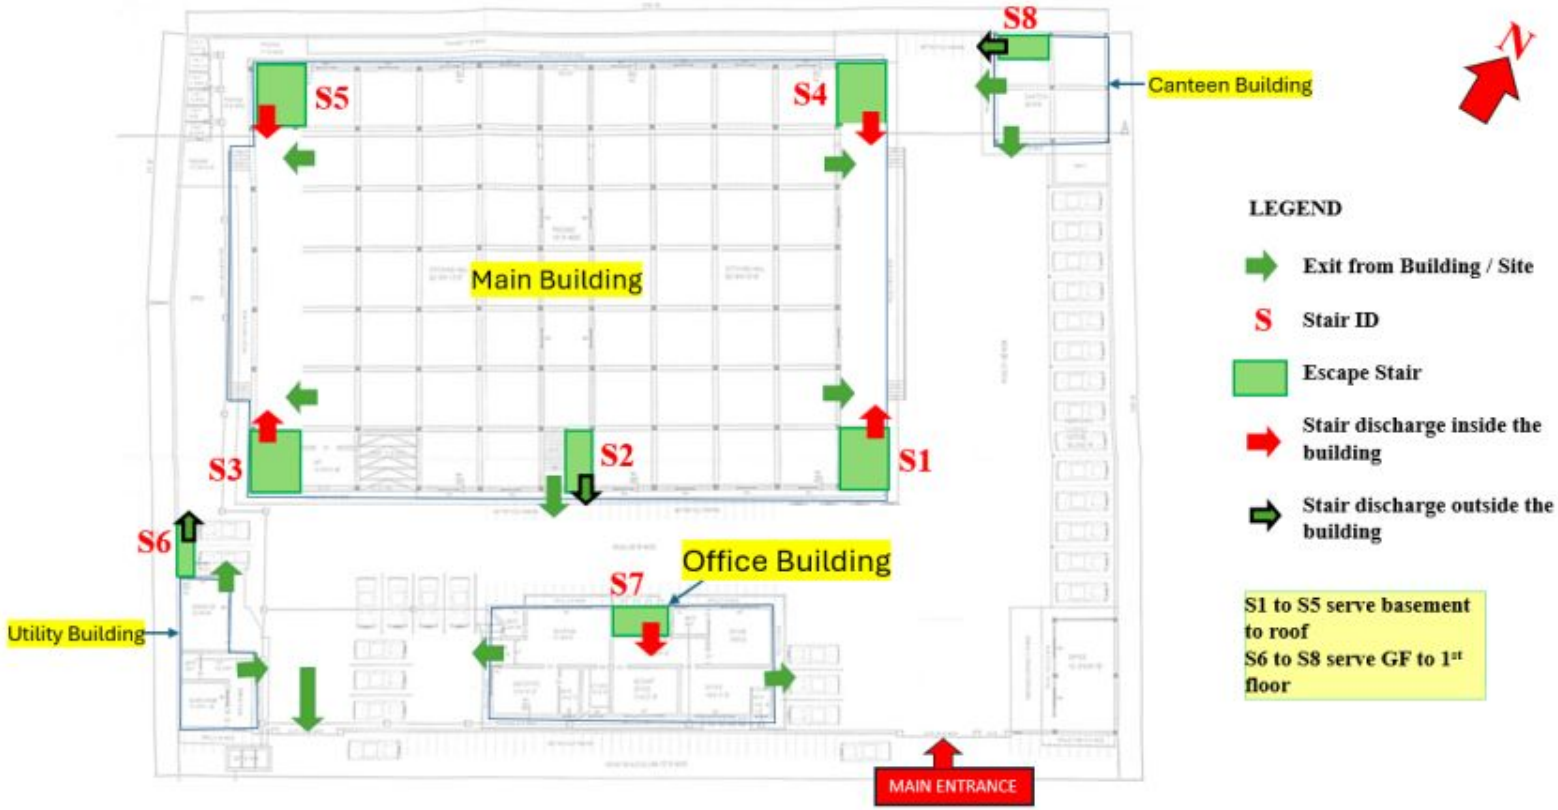


Figure 1.3. Egress layout- all four buildings (Ground floor)

3.2 Building Use

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Main Building						
Roof	Solar panels	-	5	-	-	-
1st floor	Stitching	350	5	-	-	-
Ground floor	Finishing & Packing	200	5	-	-	-
Basement floor	Fabric storage & cutting	100	5	-	-	-
Office Building						
Roof	Un-occupied	-	-	-	-	-
1st floor	Offices	10	1	-	-	-
Ground floor	Offices	20	2	-	-	-
Utility Building						
Roof	Un-occupied	-	-	-	-	-
1st floor	Prayer area	40	1	-	-	-
Ground floor	Generator room	2	2	-	-	-
Canteen Building						
Roof	Un-occupied	-	-	-	-	-
1st floor	Offices	10	1	-	-	-

Ground floor	Canteen	40	2	-	-	-

There is sufficient exit capacity & number of exits in all the buildings.

4. Documentation

This table shows the details about the documentation provided by the factory.

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defence Certificate (NOC)		Yes	04-02-2026	-
2.	Architecture Layout		No	-	-
3.	Sectional Layout		No	-	-
4.	Evacuation Maps		Yes	-	Missing at some places
5.	Emergency Action Plan		No	-	-
6.	Inspection	Fire extinguishers	No	-	-
		Exit signage	No	-	-
7.	Testing	Fire extinguishers	No	-	-
		Exit signage	No	-	-
8.	Maintenance	Fire extinguishers	No	-	-
		Exit signage	No	-	-
9.	Evidence of Fire Drills		Yes	07-03-2025	Only single drill record was presented with no attendance sheet and pictorial evidence.
10.	Staff Training		Yes	16-04-2025	First Aid & Firefighting (Attendance sheet & pictorial evidence were not provided)

5. Fire Safety Measures

During our fire site inspection of A A Garments, a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within A A Garments. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202603-064313

Timeline	Remediation Plan
Immediate CAP-0075651	Factories should begin remediation of CAP items such as installing extinguishers, signage, and clearing escape routes using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required.

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.
- Doors into stairs, stair discharge doors, final exit doors from site, and all doors serving areas with more than 50 occupants shall swing in the direction of escape

This is not always achieved, examples include (list not exhaustive):
- Most of the escape doors are lockable at all over the facility.

Recommended remedial actions are provided below.F-202603-064293

Timeline	Remediation Plan
Immediate CAP-0076060	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term CAP-0076061	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5.
Longer Term CAP-0076062	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Lockable escape door at Main Building (1st floor)

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.

This is not always achieved, examples include (list not exhaustive):
- Stairs S1, S3 , S4, S5 and S7 discharges inside the building at a distance from building exit.

Recommended remedial actions are provided below.F-202603-064294

Timeline	Remediation Plan
Medium Term CAP-0076066	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks)
Longer Term CAP-0076067	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted.



Figure 2.2 - Stair S7 discharge inside the building

7.3 Exit capacity

Exits should be sufficiently wide so that the building occupants can evacuate rapidly in the event of an emergency. Pakistan Accord Standard provides the details of the egress route width required.

This is not always achieved, examples include (list not exhaustive):
- Insufficient exit capacity on Canteen Building as Stair S8 doesn't meet the minimum requirement connecting 1st floor.

Recommended remedial actions are provided below.F-202603-064297

Timeline	Remediation Plan
Medium Term CAP-0077085	Prepare a rectification plan with drawings and submit to Accord for review and approval prior to commencing rectification works.
Longer Term CAP-0077086	Implement the rectification plan as agreed with Accord.



Figure 2.3 - Stair S8 doesn't meet the minimum width connecting 1st floor

7.4 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- There should be no fire load and/or services passing through a stair.

This is not always achieved, examples include (list not exhaustive):
- Missing fire rated enclosure and fire doors in stair S1 to S5, S7 and S8 (all floors).
- Fire load under stair S5 (basement floor).

Recommended remedial actions are provided below.F-202603-064307

Timeline	Remediation Plan
Immediate CAP-0076087	Remove fire load and any other obstructions due to stored items from stairs
Medium Term CAP-0076088	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.
Longer Term CAP-0076089	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.4 - Missing fire rated enclosure and fire door in S4 (basement floor)



Figure 2.5 - Fire load under stair S5 (basement floor)

7.5 Escape stair condition

Per Pakistan Accord Standard, escape stairs should be designed to be safe for use, including day to day use.

This is not always achieved, examples include (list not exhaustive):
- Handrails are too low found 27" in most of the stairs in the building e.g. S1 (all floors) & balustrade is not safe in S1 at 3rd floor.
- Obstructed door installed in S1 to S5 connecting basement to Ground floor.
- Effective width of S8 doesn't meet the minimum requirement (1st floor).
- Missing 1 side handrail in S8(1st floor).

Recommended remedial actions are provided below.F-202603-064292

Timeline	Remediation Plan
Immediate CAP-0076057	Remove all obstructions from stairs.
Medium Term CAP-0076058	Handrails to be provided on both sides of each stair and meet the required height of handrails. Ensure the handrails are at appropriate height. Ensure the stairs meet the minimum criteria as per Pakistan Accord Building Standards.



Figure 2.6 - Handrails are too low found 27" in most of the stairs in the building e.g. S1 (3rd floor) & balustrade is not safe in S1 at 3rd floor



Figure 2.7 - Effective width of S8 doesn't meet the minimum requirement (1st floor) and missing 1 side handrail



Figure 2.8 - Obstructed door installed in S1 to S5 connecting basement to Ground floor

7.6 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs at entry into stair S3 (1st floor).
-Misleading exit signs installed at Main Building (Ground floor) - exit sign installed at entry into other partition of production area.
- Electrically powered exit signs are not a tested and listed system at whole facility.

Recommended remedial actions are provided below.F-202603-064291

Timeline	Remediation Plan
Immediate CAP-0076054	Remove misleading directional escape signs.
Medium Term CAP-0076055	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3
Longer Term CAP-0076056	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.9 - Misleading exit signs at Main Building (Ground floor)- exit sign installed at entry into other partition of production area



Figure 2.10 - Missing exit sign at entry into stair S3 (1st floor)

8. Fire Rated Construction

8.1 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- Fire pump room is not fire separated from the rest of the building
- Electrical and generator room is not fire separated from each other and rest of the building with fire rated construction at Utility Building (Ground floor).
- Gas steam generator is not fire separated from rest of the building at Mian Building (1st floor).
- Kitchen is not fire separated with fire rated construction from rest of the building (offices) at Admin Building (Ground floor) and Canteen Building(Ground floor).

Recommended remedial actions are provided below.F-202603-064305

Timeline	Remediation Plan
Medium Term CAP-0076076	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0076077	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.11 - Kitchen is not fire separated with fire rated construction from rest of the building at Admin Building (Ground floor)



Figure 2.12 - Electrical and generator room is not fire separated from each other and rest of the building with fire rated construction at Utility Building (Ground floor)



Figure 2.13 - Gas steam generator is not fire separated from rest of the building at Mian Building (1st floor)

8.2 Separation of high-risk areas

Per Pakistan Accord Standard, electric steam generators (pressure vessels) in occupied areas require blast protection consisting of:
- Minimum 3 m high reinforced concrete/ block masonry wall to separate it from the rest of the occupied portions of the building.
- Door to be solid steel door with a self-closer and a positive latch.
- Opening from the steam generator room to outside the building to release the blast out from the building.

The aim of these provisions is to protect the occupants nearby from the effects of a potential blast.

The following deficiencies have been observed on site at Main Building (1st floor), including (list not exhaustive):

- Steam generator door is not a sturdy door
- Steam generator doors do not have a self-closer and/or a latch
- Steam generator rooms are not enclosed in minimum 3m high sturdy construction to separate them from occupied areas
- Steam generator rooms do not have a permanent opening outside the building

Recommended remedial actions are provided below.F-202603-064309

Timeline	Remediation Plan
Medium Term CAP-0076092	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0076093	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.14 - Electric steam generator not separated from rest of the building at Main Building (1st floor)

8.3 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction to maintain compartmentation between floors.

The following deficiencies have been observed on site, including (list not exhaustive):

- Lift shaft is not separated with fire rated construction from rest of the building (all floors).

Recommended remedial actions are provided below.F-202603-064295

Timeline	Remediation Plan
Medium Term CAP-0076068	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0076069	Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.15 - Lift shaft is not separated with fire rated construction from rest of the building (production areas)

8.4 Separation of occupancies

Pakistan Accord Standard requires different occupancy types to be fire separated from each other. The aim is to limit the fire to only one occupancy type.

The following deficiencies have been observed on site, including (list not exhaustive):
- Basement is not fire separated from the rest of the building at Main Building.

Recommended remedial actions are provided below.F-202603-064298

Timeline	Remediation Plan
Medium Term CAP-0076072	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Different occupancy types in the building - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0076073	Provide fire rated separation between occupancies as per proposal reviewed by Pakistan Accord

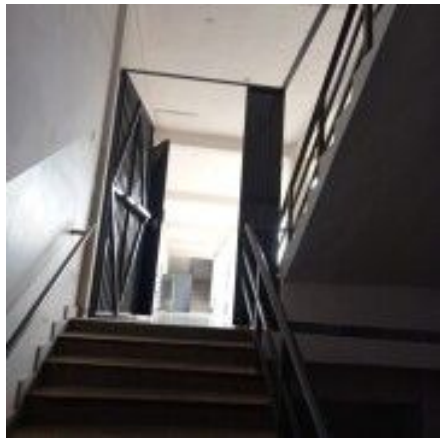


Figure 2.16 - Basement is not fire separated from the rest of the building at Main Building.

8.5 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area
- Storage height is less than 2.45m
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated with fire rated construction from rest of the building e.g. storage area at Main Building (Ground floor & basement floor) is not separated from production area.

Recommended remedial actions are provided below.F-202603-064306

Timeline	Remediation Plan
Medium Term CAP-0076085	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction).
Longer Term CAP-0076086	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard.



Figure 2.17 - Storage not separated from production area at Main Building (Basement floor)

9. Hazardous Materials

9.1 Gas storage

Flammable gas storage areas should be fire separated from the rest of the building. Adequate ventilation should be provided.

The following deficiencies have been observed on site, including (list not exhaustive):
- Gas storage areas are not fire separated from the rest of the building at Main Building (Ground floor).

Recommended remedial actions are provided below.F-202603-064470

Timeline	Remediation Plan
Medium Term CAP-0076096	Prepare drawings showing gas storage areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of gas storage areas - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction) - Ventilation provisions to each of these rooms
Longer Term CAP-0076097	Implement the above plan on site. All gas storage areas to be compliant with Pakistan Accord Standard.



Figure 2.18 - Gas storage areas are not fire separated from the rest of the building at Main Building (Ground floor)

10. Fire Safety Management

10.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- No regular fire drills
- Fire drill documentation is of poor standard.

Recommended remedial actions are provided below.F-202603-064296

Timeline	Remediation Plan
Medium Term CAP-0076070	Conduct a fire drill and make records, including findings and recommended future improvements.
Longer Term CAP-0076071	Ensure fire drills are performed a minimum of 2 times per year.

10.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of testing of Fire Extinguishers.
- No records of testing of Emergency Exit Signage.

Recommended remedial actions are provided below.F-202603-064289

Timeline	Remediation Plan
Medium Term CAP-0075668	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0075669	#NAME?

10.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of maintenance of Fire Extinguishers
-No records of maintenance of Emergency Exit Signage

Recommended remedial actions are provided below.F-202603-064308

Timeline	Remediation Plan
Medium Term CAP-0076090	- Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0076091	#NAME?

10.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023.
Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation
plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid firefighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):
- Escape diagrams are missing on some levels.
- There is no EAP document which details procedures, roles and responsibilities in the event of fire.

Recommended remedial actions are provided below.F-202603-064299

Timeline	Remediation Plan
Medium Term CAP-0076074	Ensure that evacuation plans are provided on each level. Prepare an Emergency Action Plan report.
Longer Term CAP-0076075	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

11. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.