Issue	**1**
Factory ID	**26310**
Date of Issue	**22-Apr-2026**

A A Garments

Chak 220 RB, Street 01, Block A, Babu Wala, Jhang Road
38001 Faisalabad
Punjab Pakistan

Latitude: [31.4137], longitude: [72.9984]
Date of inspection: 09-Mar-2026

Structural Safety Inspection Report

Observations & Actions



Authors	**Ausama Iqbal**
Reviewed by	**Qaseem Uz Zaman Khan**
Approved by	**Paul Rigby**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 09-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 4
2. Building Extents 6
   2.1 Structural System 13
3. Documentation 15
4. Structural Safety Measures 16
5. Remediation Support 18
   5.1 Engineering Support 18
6. Other Damage/Defects 19
   6.1 Health and Safety 19
7. Structural Documentation 21
   7.1 Documentation unavailable 21
   7.2 Lack of safe load plans 22
8. Assessment Limitations and Assumptions 23

1. Executive Summary

On 09-Mar-2026, Ausama Iqbal and Muhammad Asim on behalf of the Pakistan Accord carried out an initial structural inspection for A A Garments, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Sohail Alvi (Manager export), Mr. Waseem (Compliance advisor), and other staff members of A A Garments.

The factory operates in one general shift, with approximately 200 workers operate in the factory, with 15 workers being females.

The factory comprises 4 buildings owned by A A Garments. During the inspection, the buildings highlighted in Figure 1.1 were inspected, with the site boundary indicated in red.

- **Main Building** is a 3 storey (Basement + Ground + 1), RC Moment resisting frame building with infill masonry panels. The building is used for fabric store and cutting (basement), packing (ground floor), stitching (1st floor) and solar panels (roof). The construction year of building is 2022.
- **Office Building** is a 2 storey (Ground + 1), load bearing masonry structure. The building is used for offices (ground and 1st floor). The construction year of building is 2022.
- **Utility Building** is a 2 storey (Ground + 1), RC Moment resisting frame building with infill masonry panels. The building is used for utilities (ground floor) and prayer area (1st floor). The construction year of building is 2022.
- **Canteen Building** is a 2 storey (Ground + 1), RC Moment resisting frame building with infill masonry panels. The building is used for canteen (ground floor), 1st floor is not occupied. The construction year of building is 2022.

There is accessibility constraint at roof of utility building and canteen building.

We were presented with approved architectural layout plan, some structural drawings and stability certificate as listed in Table 2.

There is a Health & safety issue regarding edge protection at roof of office building, which present a risk of potential injury resulting from slip, trip or fall from building. For further details, please refer to section 6.

A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:

- Structural drawings of main building mismatching with the existing building.
- Structural drawings of utility and canteen building are not available.

We see no reason to suspend operations in the facility due to these concerns, subject to the actions identified being addressed within the specified timeframes.
Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1 - Building Summary

Building	Use	No. of stories	Year of construction	Structural system	Roof structural system	Any Extension / modifications	Engineer access issues
Main Building	Fabric store and cutting (basement) Packing (ground floor) Stitching (1st floor) Solar panels (roof)	3 storey (Basement + Ground + 1)	2022	RC moment resisting frame	-	-	-
Office Building	Offices (ground and 1st floor)	2 storey (Ground + 1)	2022	Load bearing masonry structure	-	-	-
Utility Building	Utilities (ground floor) Prayer area (1st floor)	2 storey (Ground + 1)	2022	RC moment resisting frame	-	-	Inaccessible roof
Canteen Building	Canteen (ground floor) Unoccupied (1st floor)	2 storey (Ground + 1)	2022	RC moment resisting frame	-	-	Inaccessible roof



Figure 1.1. Site plan (Satellite view) - Red dashed line indicates site boundary, highlighted (blue) area indicated area inspected.

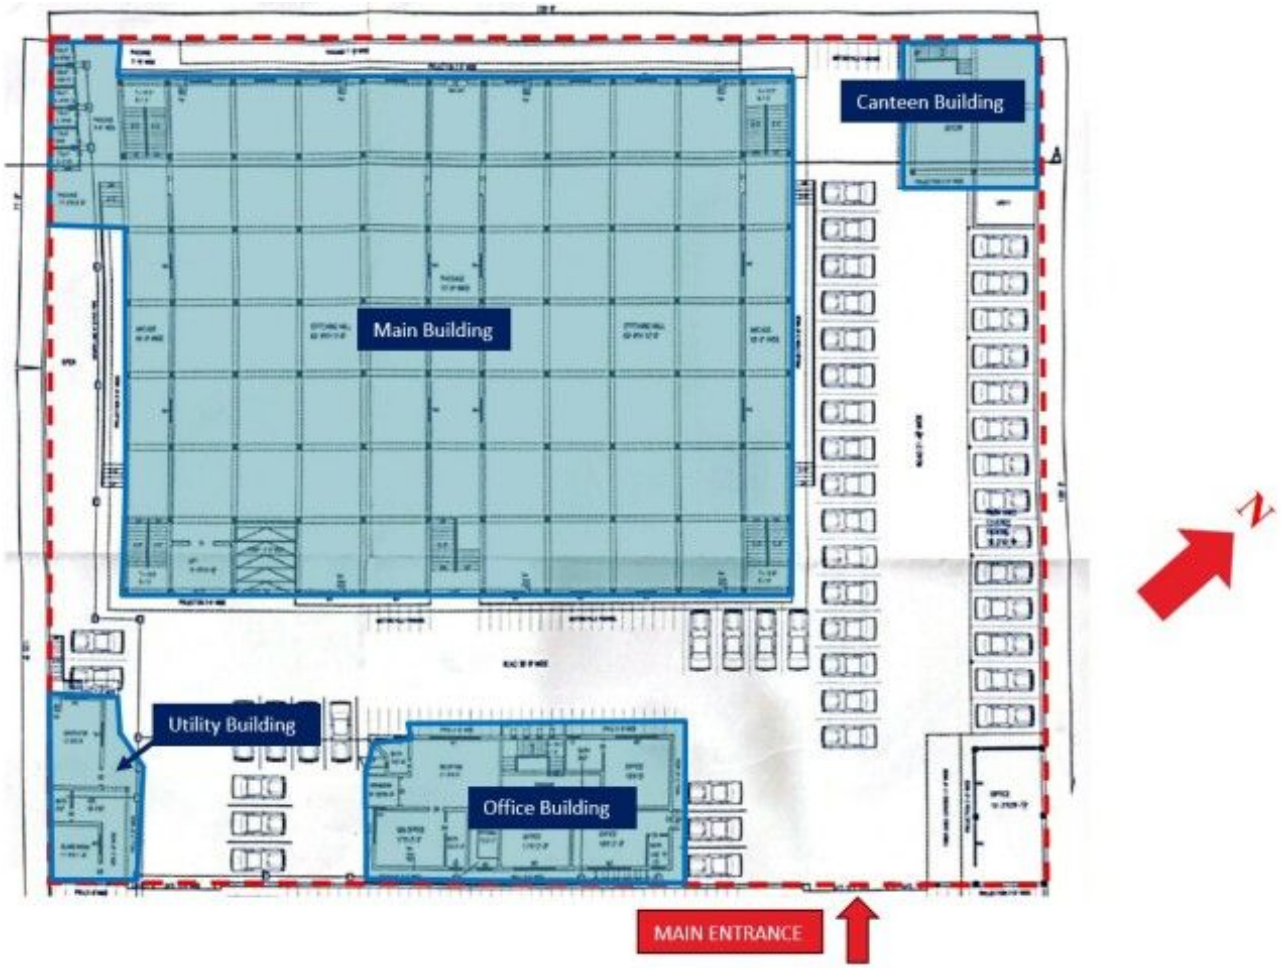


Figure 1.2. Site layout. Red dashed line indicates site boundary, highlighted area (blue) indicates buildings inspected.



Figure 1.3. Perspective view showing front and side elevations of main building



Figure 1.4. Perspective view showing front and side elevations of office building



Figure 1.5. Front elevation utility building



Figure 1.6. Side elevation of canteen building



Figure 1.7. Main building: Typical activity in basement



Figure 1.8. Main building: Typical activity at ground floor



Figure 1.9. Main building: Typical activity at 1st floor



Figure 1.10. Main building: Solar panels at roof



Figure 1.11. Office building: Typical activity at ground and 1st floor



Figure 1.12. Office building: Roof of the building



Figure 1.13. Canteen building: Typical activity at ground floor



Figure 1.14. Utility building: Typical activity at ground floor



Figure 1.15. Utility building: Typical activity at 1st floor

2.1 Structural System

Building	Main Building
Stability system	RC Moment Resisting Frame
Column size (m)	0.375 x 0.375
Grid (m)	4.83 x 4.98 (max grid)
Primary beam size (m)	0.35 x 0.34
Secondary beam size (m)	-
Slab depth (m)	0.15
Finishes depth (m)	0.075
Ceiling height (m)	3.9 (basement) 3.9 (ground floor) 3.6 (1st floor)


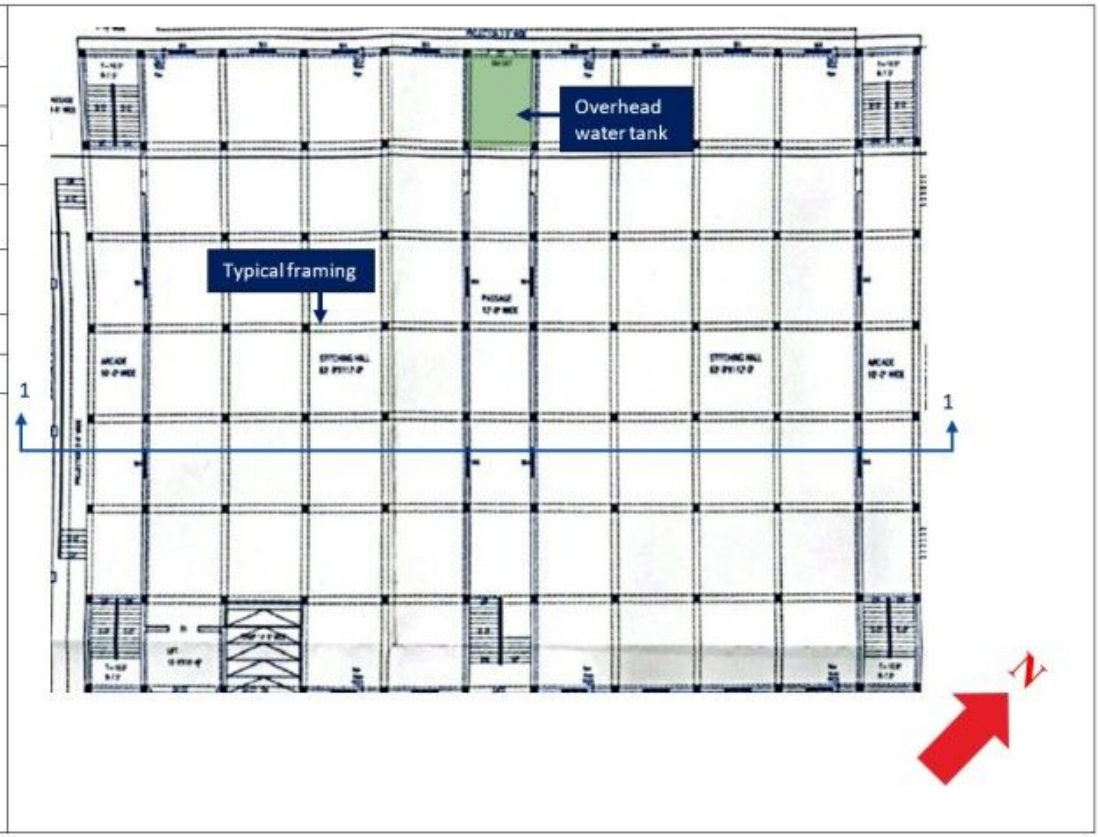


Figure 1.16. Main building: Typical beam framing layout plan

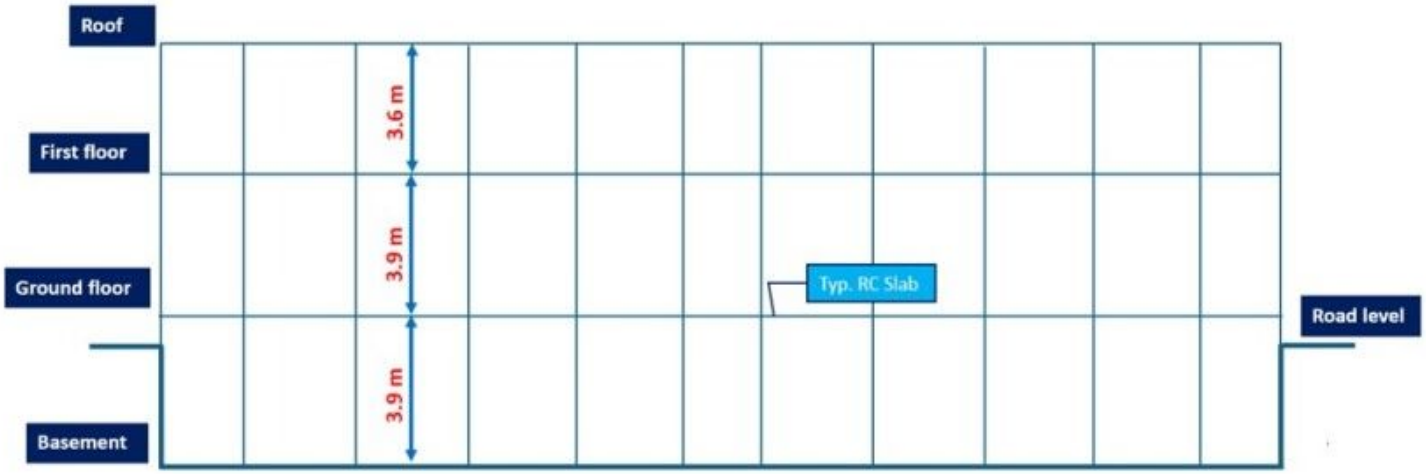

Structural System Notes

Column size is the structural dimension and excludes render thickness

Grid measurements are from centre of column to centre of column

Beam sizes do not include slab depth

Figure 1.17. Main building: Section 1-1 of the building

3. Documentation

We were presented with the following documentation.

Table 2 - Documentation

Building	Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plan	Stability certificate	Inspection reports	Materials testing
Main Building	No	Yes	No	Yes	No	No	Yes	No	No
Office Building	No	Yes	No	Yes	No	No	Yes	No	No
Utility Building	No	Yes	No	Yes (Architecture only)	No	No	Yes	No	No
Canteen Building	No	Yes	No	Yes (Architecture only)	No	No	Yes	No	No

4. Structural Safety Measures

During our structural site inspection of A A Garments, a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within A A Garments. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3: Summary of issues by building

Building	Potential Overstress	Structural system	Cracking	Loading	Other damage and defects	Structural documentation
Main building	-	-	-	-	-	Lack of safe load plan Documentation unavailable
Office building	-	-	-	-	Health & Safety -Edge protection	-
Utility building	-	-	-	-	-	Documentation unavailable
Canteen building	-	-	-	-	-	Documentation unavailable

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-064564

Timeline	Remediation Plan
Medium Term CAP-0076864	Factories should begin remediation of CAP items—such as surface cracks or non-structural repairs—using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Other Damage/Defects

6.1 Health and Safety

It concerns with inadequate edge protection which present a risk of potential injury resulting from slip, trip or fall from roof of office building where height of parapet wall is insufficient – Health & Safety concern F-202604-064563

Timeline	Remediation Plan
Immediate CAP-0076211	Provide adequate edge protection at roof, and on any other part of the factory with the same issue.

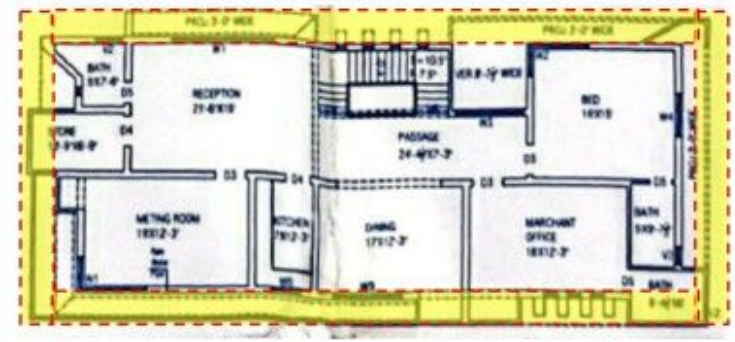


Figure 2.1 - Office building: Plan showing location of the area at roof



Figure 2.2 - Office building: Insufficient edge protection at roof



Figure 2.3 - Office building: Insufficient edge protection at roof



Figure 2.4 - Office building: Insufficient edge protection at roof

7. Structural Documentation

7.1 Documentation unavailable

This issue pertains to the utility and canteen buildings, for which structural drawings are not available. Additionally, in the main building, discrepancies have been observed in the number of spans and grid dimensions. F-202604-064566

Timeline	Remediation Plan
Longer Term CAP-0076214	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete as-built documentation.

7.2 Lack of safe load plans

No safe loading plans were posted on any of the floors in main building. F-202604-064565

Timeline	Remediation Plan
Longer Term CAP-0076212	Building structural engineer to review design documentation to confirm load capacity of the structure. Develop safe load plans and submit to Pakistan Accord for review
Longer Term CAP-0076213	Factory to post safe load plans on each floor

8. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.