Issue	**2**
Factory ID	**920016**
Date of Issue	**01-Apr-2026**

Agility Textile (Pvt.) Ltd.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Kahna Rohi Nala, Gujjar Chowk, Tibba Lahore
54000 Lahore
Punjab Pakistan

Latitude: [31.393564], longitude: [74.323596]
Date of inspection: 26-Feb-2026

Electrical Safety Inspection Report

Observations & Actions



Authors	**Azka Riaz**
Reviewed by	**Shahzeb Anis**
Approved by	

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 26-02-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
   2.1 Building Use 9
   2.2 Utility Source 10
   2.3 Backup source 11
3. Documentation 12
4. Electrical Safety Measures 13
5. Remediation Support 14
   5.1 Engineering Support 14
6. Diagrams & Drawings 15
   6.1 Sub-station room layout drg 15
   6.2 Single Line Diagram (SLD) 16
   6.3 Electrical layout drawing 17
7. DBs & Elec Protection Systems 18
   7.1 Circuit breakers 18
   7.2 Hot Spots 21
   7.3 Earthing system 25
   7.4 Panel/cabling/busbar 28
   7.5 Loop Connection 30
   7.6 Multiple Connections 32
   7.7 Openings 34
   7.8 Adequate accessibility 36

7.9 Lint & dust inside panel board 38
7.10 Lightning Protection System (LPS) 40
8. Fire Alarm & Detection System (FADS) 42
8.1 Non-functional or incomplete 42
9. Emergency Lighting 45
9.1 Provided but insufficient 45
9.2 Independent power source 48
9.3 General Lighting 49
10. Generator, Transformer & Sub-Station Room 51
10.1 Battery 51
11. Cabling & Wiring 54
11.1 Cable support and protection 54
11.2 Cable trench and channel cleanliness 56
11.3 Splicing of cables 58
11.4 Colour coding 61
11.5 Fixtures 63
12. Assessment Limitations and Assumptions 66

1. Executive Summary

On 26-Feb-2026, Azka Riaz and Muhammad Bilal Butt on behalf of the Pakistan Accord carried out an initial electrical inspection for Agility Textile (Pvt.) Ltd., a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Asad Ali (Head admin), Mr. Talal Mehmood (Civil representative), and other staff members of Agility Textile (Pvt.) Ltd.

The factory operates in a general single shift. Approximately 120 workers operate in the factory, with 15 workers being female.

The factory comprises one main building and four ancillary structures rented by Agility Textile (Pvt.) Ltd. The basement and ground floor of the main building were rented by Cross Stitch factory; however first and second floor was rented by Agility Textile (Pvt.) Ltd. During the inspection, the area highlighted in blue in Figure 1.1 was inspected, with the site boundary indicated in red.

- **Main Building** is a four storey (Basement+Ground+2) building. The building is used for solar panels (roof), offices, storage (second floor), pressing, packing, sampling, accessory store, sewing storage offices (first floor), washing area, kitchen, storage (ground floor), offices, storage, (basement).
- **Ancillary Structure**: There are four ancillary structures details of which are given below:
  - **Gate office** is a single storey (Ground only) structure. The structure is used for gate office (ground floor).
  - **Mess area** is a single storey (Ground only) structure. The structure is empty (ground floor).
  - **Compressor room** is a single storey (Ground only) structure. The structure is used for compressor room (ground floor).
  - **Fire pump room** is a single storey (Ground only) structure. The structure is used for fire pump room (ground floor).

A summary of the main concerns in relation to life safety systems identified during the inspection (non-exhaustive) that should be actioned is as follows:

- **Abnormal Temperature:** Within electrical panels, abnormal temperatures were recorded at various locations (refer to section 7.2 for further details). Hotspots within panels can cause short circuits and fire due to insulation damage and overheating of cables or electrical components.
- **Fire Alarm Detection System:** There was an addressable fire alarm control panel serving the main building; however, several deficiencies were identified in the fire alarm and detection system, including a battery fault at the panel, faulty and improperly located manual call points, lack of detection and alarm coverage in ancillary structures, use of non-fire-rated cables, and absence of proper design documentation, posing a significant life safety risk in the event of a fire emergency.
- **Emergency lighting System:** The emergency lighting system was found to have inadequate coverage, with no emergency lighting arrangement in the basement, no available UPS backup battery calculations, improper placement of the UPS units, and the use of non-fire-rated cables. These deficiencies may hinder safe evacuation during power outages and increase the risk of accidents.
- **Earthing system:** The earthing system was found to be inadequate in several areas of the facility. Earthing pits were inaccessible, and some distribution boards lacked earthing conductors. The lack of a proper earthing system poses significant safety risks, such as electric shocks, fire hazards, and potential equipment damage.

We see no reason to suspend operations in the facility due to these concerns, subject to the actions identified being addressed within the specified timeframes.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents



Figure 1.1. Site plan (Satellite View) – Red dashed line indicates site boundary, highlighted area (blue) indicates buildings inspected

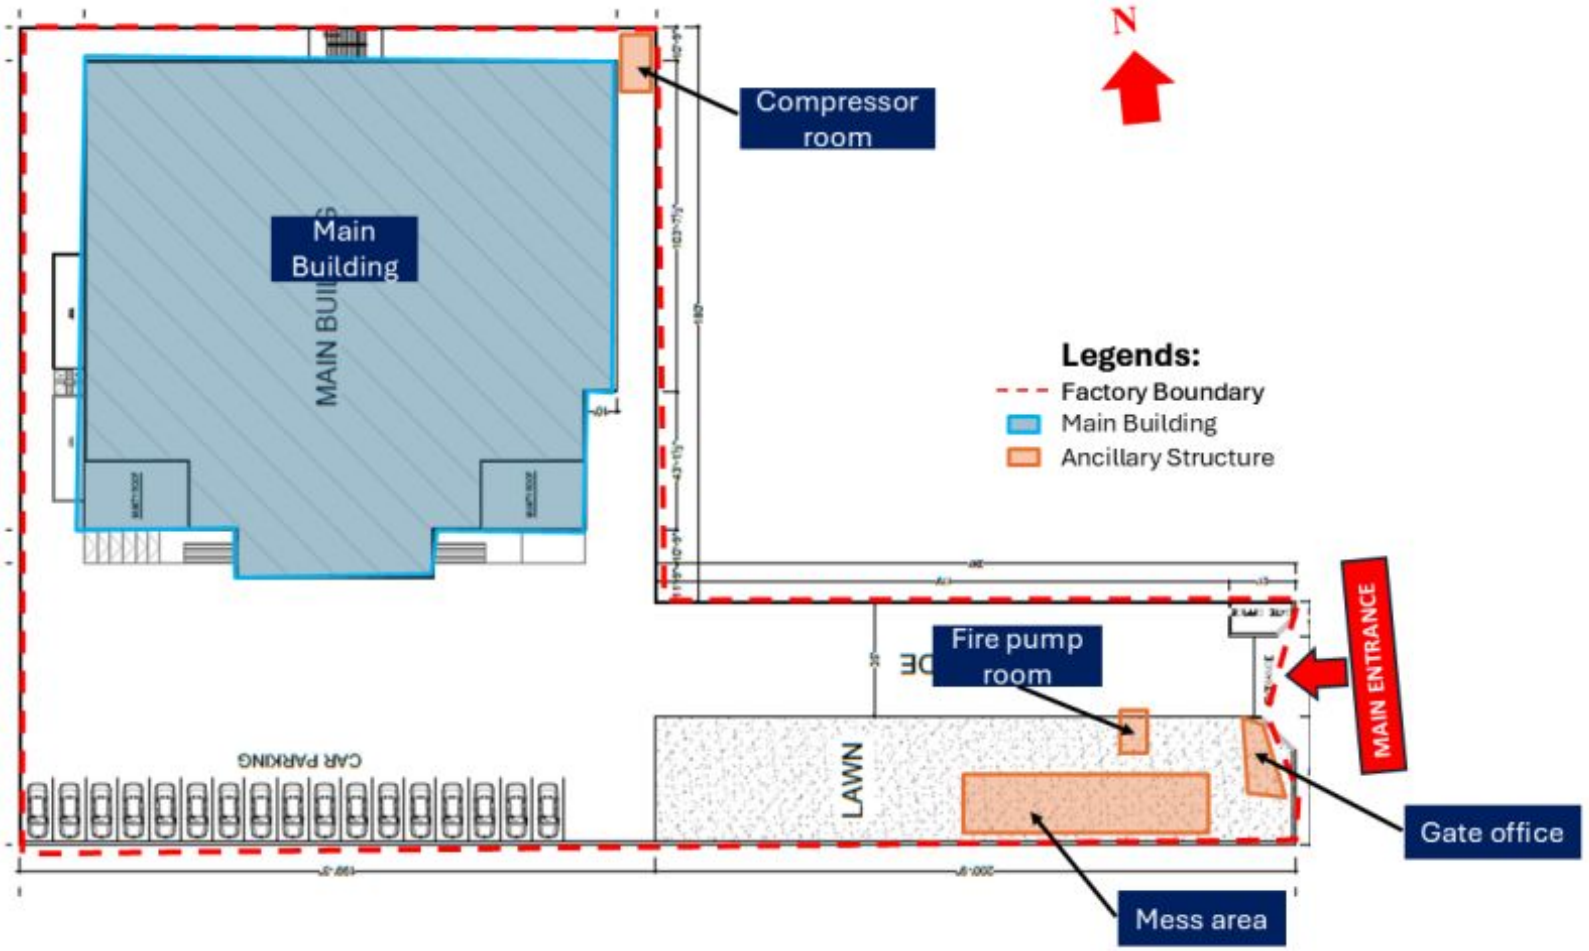


Figure 1.2. Site layout Plan; Red dashed line indicates site boundary, highlighted area indicates buildings inspected

2.1 Building Use

The factory comprises one main building and four ancillary structures. The floor-wise activity details are as follows:

Main Building:
B01 - Basement: Offices and storage.
L00 – Ground Floor: Washing area, kitchen, and storage.
L01 – First Floor: Pressing, packing, sampling, accessory store, sewing, storage, and offices.
L02 – Second Floor: Offices and storage.
L99 – Roof: Solar panel.

Ancillary Structure:
Four ancillary structures are as follows:

- **Gate office:**

L00 – Ground Floor: Gate office.

- **Mess area:**

L00 – Ground Floor: Vacant.

- **Compressor room:**

L00 – Ground Floor: Compressor room.

- **Fire pump room:**

L00 – Ground Floor: Fire pump room.

2.2 Utility Source

The facility receives a 400 V connection from Lahore Electric Supply Company (LESCO) as its primary power source, supplied through LESCO-owned step-down transformer rated at 630 kVA, installed near the main gate. The incoming power is routed to the Low Tension (LT) panel located near the main gate, from where it is distributed throughout the facility via underground cables to various distribution boards. The facility also has a 225 kW solar system synchronized with the primary power supply.

2.3 Backup source

The facility has one 325 kVA low-voltage diesel generator serving as the primary backup power source and an additional 100 kVA low-voltage diesel generator provided as a standby. Both generators were placed near the gate office in an open area under canopies. Additionally, UPS and built-in battery backups support the emergency lighting and exit signage, while the fire alarm system is equipped with a built-in battery backup only.

3. Documentation

This table shows the details of the documentation provided by the factory.

S.NO	Description	Available (Y/N)	Created Date	Status / Remarks
1	Electrical Layout Drawing	No		
2	Single Line Diagrams	No		
3	Fire Alarm Drawing	No		
4	Earth Test Report	No		
5	Thermographic Test Report	No		
6	Insulation Resistance Test Report	No		
7	LPS Risk Assessments	No		
8	Periodic Maintenance Record	No		
9	Transformer Oil Testing Report	N/A		

4. Electrical Safety Measures

During our electrical site inspection of Agility Textile (Pvt.) Ltd., a number of electrical issues were identified.

It is essential to address these electrical safety issues promptly to enhance safety and compliance within Agility Textile (Pvt.) Ltd.. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

All survey, testing, and design activities specified in this report shall be performed by a qualified electrical engineer. The recommended installation and modification tasks should be executed by a licensed professional electrician.

Before commencing any installation and/or modification works, the proposed design must be submitted to the Pakistan Accord for approval.

Upon completion of the works, the necessary evidence required to verify that the tasks have been completed to the agreed standards will be determined during the development of the Corrective Action Plan (CAP).

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202603-063657

Timeline	Remediation Plan
Medium Term CAP-0074327	Factories should begin remediation of CAP items such as cleaning, cable organization, and basic corrections using internal resources. For systems or design-related remediation, engagement of a qualified Electrical Engineer is required.

6. Diagrams & Drawings

6.1 Sub-station room layout drg

This section refers to the electrical rooms within the facility.

During the inspection conducted, it was observed that there were no substation room layout drawings available for the factory.

There are no visible indications of substation equipment locations or pathways for maintenance and emergency access.

The absence of substation room layout drawings poses significant risks to life and fire safety within the factory premises. Without these critical documents, emergency responders and maintenance personnel may face difficulties in locating and isolating electrical faults during emergencies. This delay can result in prolonged exposure to electrical hazards, increasing the risk of electrical fires and endangering lives. Furthermore, the lack of layout drawings complicates routine maintenance, potentially leading to undetected faults and increased likelihood of equipment failure. F-202603-063652

Timeline	Remediation Plan
Medium Term CAP-0074331	Develop detailed substation room layout drawings in accordance with the requirements outlined in Sections 132.12 and 132.13 of BS7671 18th Edition + A2 (2022). Ensure that all critical equipment and pathways are accurately documented. Retain the drawings along with all O&M information for the facility.
Longer Term CAP-0074332	Regularly update and review the substation room layout drawings to reflect any changes in equipment or configuration. Provide training sessions for maintenance personnel and emergency responders on how to interpret and utilize the layout drawings.

6.2 Single Line Diagram (SLD)

This section refers to the entire facility.

It was found that the electrical single line diagrams (SLDs) for the factory were missing.

This deficiency was noted in all electrical rooms and areas where SLDs should be prominently displayed.

The factory lacks documented diagrams that illustrate the electrical distribution system, including the connection and configuration of all electrical components.

Single line diagrams are crucial for understanding the electrical distribution network and for troubleshooting issues effectively. Without these diagrams, maintenance personnel and emergency responders lack critical information necessary for isolating faults and managing power during emergencies. This can lead to delays in addressing electrical issues, increasing the risk of electrical fires and potential harm to personnel. Moreover, the lack of SLDs complicates routine maintenance and inspection processes, potentially resulting in undetected electrical faults and system inefficiencies.F-202603-063651

Timeline	Remediation Plan
Medium Term CAP-0074333	Develop comprehensive electrical single line diagrams for the entire facility in accordance with the requirements outlined in Section 514.9.1 of BS7671 18th Edition + A2 (2022). Ensure all components and connections are accurately represented. Retain the drawings along with all O&M information for the facility.
Longer Term CAP-0074334	Implement a regular review and update process for the single line diagrams to reflect any changes in the electrical system. Conduct training sessions for maintenance personnel and emergency responders on interpreting and using the diagrams.

6.3 Electrical layout drawing

This section refers to the entire facility.

During the survey, it was noted that the factory lacked electrical layout drawings - including small power layouts, lighting layouts, and containment layouts.

This absence was consistent across all areas where such documentation should be available.

These drawings are vital for understanding the placement and connections of electrical systems, which is crucial for identifying and mitigating potential hazards. In emergencies, the lack of detailed layouts can delay the identification and isolation of electrical faults, increasing the risk of fire and electrical accidents. Additionally, without proper layout drawings, routine inspections and maintenance may overlook critical issues, potentially leading to system failures and safety breaches.F-202603-063659

Timeline	Remediation Plan
Medium Term CAP-0074329	Develop comprehensive electrical layout drawings in accordance with the requirements outlined in Sections 132.12 and 132.13 of BS7671 18th Edition + A2 (2022). To avoid drawings becoming overcrowded, separate drawings shall be prepared for each electrical system. Retain the drawings along with all O&M information for the facility.
Longer Term CAP-0074330	Implement a regular review and update process for the electrical layout drawings to reflect any changes in the system. Conduct training sessions for maintenance personnel and emergency responders on interpreting and using the layouts.

7. DBs & Elec Protection Systems

7.1 Circuit breakers

This section refers to the entire facility.

During the survey, the circuit breakers installed throughout the facility inside the electrical panels and distribution boards were inspected.

i. It was found that a single-phase load was fed from a three-pole breaker in the ground-floor distribution board of the main building. Using a single phase of a three-pole breaker can lead to unbalanced load conditions. This can cause the breaker to trip unexpectedly or, in some cases, fail to trip when necessary, compromising the safety of the system.

ii. It was also found in the compressor room that an idle circuit breaker was installed without a protective enclosure, posing a risk of short circuits or electrical incidents during adverse weather conditions.

iii. It was observed that multiple circuit breakers had ratings that were not appropriate for the connected cable sizes.
a. In the LT panel, a 200A circuit breaker was connected to 16 mm^2 PVC cables.
b. In the compressor distribution board, a 160A circuit breaker was connected to 6 mm^2 PVC cables.
c. In the second-floor distribution board, a 100A circuit breaker was connected to 6 mm^2 PVC cables.

Specifically, some circuit breakers had higher ratings than the cables could safely handle, which poses a significant risk of overheating and potential fire hazards. Conversely, other circuit breakers had lower ratings than necessary, resulting in frequent and unnecessary tripping. To ensure both safety and operational efficiency, corrective action is required to align the circuit breaker ratings with the cable capacities. This adjustment will mitigate the risks associated with overheating and improve the reliability of the electrical system. F-202603-063644

Timeline	Remediation Plan
Medium Term CAP-0074759	i. Remove single-phase connections from three-pole breakers and replace them with appropriate single-pole breakers, ensuring compliance with standard current-carrying capacities and preventing load imbalance.

Medium Term CAP-0074760	ii. Remove idle circuit breakers that are no longer in use. If required to remain in service, enclose them in compliant metallic or insulated enclosures, in accordance with BS 7671 Section 416 (Barriers and Enclosures for Basic Protection).
Medium Term CAP-0074761	iii. Evaluate the breaker ratings and cable sizes for all circuits in the facility according to Section 433.1.1 and Appendix 4 of BS 7671 18th Edition + A2 (2022). Ensure that the breaker rating does not exceed the cable's current-carrying capacity. If the breaker has adjustable settings, they must be configured to allow current within the cable's ampacity after applying derating factors.



Figure 2.1 - 160A circuit breaker connected to 6 mm² PVC cables in the compressor distribution board



Figure 2.2 - Single phase load fed from three-pole breaker found in the ground floor distribution board, main building



Figure 2.3 - 100A circuit breaker connected to 6 mm² PVC cables in the second floor distribution board, main building



Figure 2.4 - 200A circuit breaker connected to 16 mm² PVC cables in the LT panel



Figure 2.5 - Idle circuit breaker installed without protective enclosure in the compressor room

7.2 Hot Spots

This relates to the entire facility.

During the inspection, Thermographic surveys were conducted on the electrical boards.

The survey identified numerous hot spots within panels and distribution boards. Hot spots in electrical distribution systems can be caused by several factors, including:

> Loose connections
> Overloaded circuits
> Faulty components
> Improper sized cable
> Insulation degradation

It was also found that the thermographic report was not available at the site. Without thermography testing, faults such as overheating components or loose connections may go unnoticed, which increases the risk of fire. Early detection through thermography can prevent fire incidents.

The categories of identified hot spots have been evaluated as per the ANSI NETA MTS 2019 standard, Table 100.18. Hot spots were observed, particularly at the following locations:
i. 164°C at the circuit breaker cable connection in the stitching distribution board on the first floor near the cargo lift.
ii. 138°C at the switchboard on the first floor of the main building.
iii. 58°C at the power socket in the basement hall of the main building.

Circuit breakers are typically designed to operate safely within an ambient temperature range of -20°C to 40°C. Commonly used PVC insulated cables typically have a maximum operating temperature of 70°C. Prolonged exposure to temperatures above these can degrade the insulation of the breaker as well as the cable and result in reduced performance.

Hot spots in electrical systems pose significant life safety risks due to several factors. Overheated components can ignite surrounding materials, leading to electrical fires. This is particularly dangerous in densely packed panels and distribution boards where flammable materials may be present. Hot spots can degrade insulation on wires and components, increasing the risk of electrical shock to personnel who might come into contact with exposed conductive parts. Overheating can contribute to conditions that might trigger an arc flash, a dangerous high-temperature event that can cause severe injuries or fatalities to personnel working near the affected equipment.F-202603-063643

Timeline	Remediation Plan
Immediate CAP-0074739	Any circuits identified on site with temperatures exceeding 40°C above the ambient temperature, operating above 90°C or exhibiting visual signs of burning must be immediately isolated and taken out of service. These circuits should remain de-energized until a thorough review has been conducted and appropriate remedial actions have been implemented to resolve the underlying issues.
Medium Term CAP-0074740	During the inspection, several circuits were identified where the temperature was exceeding 20°C above ambient temperature. It is recommended that the factory conducts comprehensive thermographic surveys of all electrical panels to detect similar issues. Identified hot spots should be thoroughly reviewed to determine their underlying causes. Corrective actions must be taken to address and resolve these issues, ensuring safe and reliable operation of the electrical systems.
Longer Term CAP-0074741	Regular thermographic inspections should be incorporated into the maintenance schedule to proactively manage and mitigate the risks associated with overheating.



Figure 2.6 - Hot spot found on the circuit breaker cable connection in the stitching distribution board on the first floor

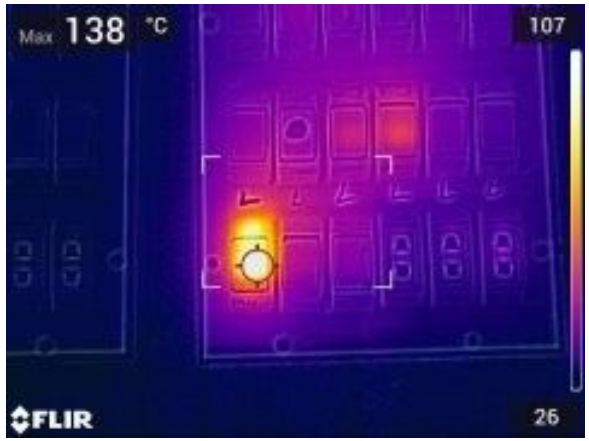


Figure 2.8 - Hot spot found on the switchboard on the first floor of main building



Figure 2.7 - Hot spot found on the circuit breaker cable connection in the stitching distribution board on the first floor



Figure 2.9 - Hot spot found on the switchboard on the first floor of main building



Figure 2.10 - Hot spot found on the power socket in the basement hall of main building



Figure 2.11 - Hot spot found on the power socket in the basement hall of main building

7.3 Earthing system

This relates to the entire facility.

During the inspection of the facility's electrical panels, distribution boards, and machinery, several observations with the earthing system were identified.

i. No earthing system design documentation or records of earth pit testing and maintenance were provided by the factory, indicating a lack of verification of the earthing system’s compliance and ongoing performance in accordance with relevant standards.

ii. The earth pits were inaccessible and unsuitably located. This issue was specifically observed near the main LT panel and the generator area.

ii. The earthing cables inside the main LT panel were not appropriately sized according to the relevant earthing standards.

iii. The earthing system was absent in multiple locations. Several distribution boards lacked earthing cables, and many electrical machines did not have proper earth connections. This issue was specifically observed with the distribution boards installed in the mess area and compressor room.

v. Equipotential bonding for the cable trays and metallic panel covers was missing. This issue was specifically observed in the basement and on the first floor of the main building.

The lack of a proper earthing system throughout the facility poses substantial safety risks, such as electric shocks, fires, and equipment damage. Implementing appropriate earthing measures is crucial to prevent hazardous voltage levels and ensure operational safety. F-202603-063649

Timeline	Remediation Plan
Medium Term CAP-0074745	i. Develop a complete earthing system design for the facility and prepare earthing layout drawings in accordance with BS 7671 (18th Edition + A2:2022) Chapter 54. Submit the earthing system design and drawings to Pakistan Accord for review and approval.
Medium Term CAP-0074746	ii. Relocate and redesign earth pits to make them easily accessible for maintenance and inspection, complying with BS 7671 18th Edition + A2 (2022) Chapter 54.
Medium Term CAP-0074747	iii. Replace all earthing cables with appropriately sized cables as per the requirements of BS 7671 18th Edition + A2 (2022) Appendix 4, Section 5. Verify that all earthing conductors meet the minimum cross-sectional area specified.

Medium Term CAP-0074748	iv. Install earthing systems where absent, ensuring compliance with BS 7671 18th Edition + A2 (2022) Chapter 54. Fit all electrical boards with the required earthing cables. Ensure that earthing conductors are properly connected and comply with BS 7671 18th Edition + A2 (2022) Section 543.1.
Medium Term CAP-0074749	v. Implement equipotential bonding for all cable trays to comply with BS 7671 Regulation 411.3.1.2. Ensure all exposed conductive parts are bonded to the main earthing terminal.
Longer Term CAP-0074750	Establish a schedule for regular maintenance and inspection of the earthing system and protective devices as per BS 7671 Regulation 651.2. Document all inspections and maintenance activities to ensure ongoing compliance. Provide training to facility maintenance personnel on proper earthing practices and the importance of maintaining electrical safety standards in line with BS 7671 requirements.



Figure 2.12 - Inappropriately sized earthing cable observed in the LT panel



Figure 2.13 - Earthing pit inaccessible in the generator area



Figure 2.14 - Earth connection missing inside the compressor distribution board



Figure 2.15 - Equipotential bonding missing for the cable trays on the first floor of main building



Figure 2.16 - Equipotential bonding missing for panel doors in the basement of main building



Figure 2.17 - Earthing pit inaccessible and unsuitably near the LT panel

7.4 Panel/cabling/busbar

This relates to the entire facility.

The visual site inspection included an examination of the electrical panels, cables, and busbars throughout the facility.

The following observations were noted in the main LT panel:

i. The LT panel exhibited signs of corrosion, indicating potential exposure to moisture or other corrosive elements.

ii. Phase separators were missing in the LT panel, posing the risk of accidental contact between phases.

iii. Inadequate cable dressing was observed in the LT panel, with conductors not properly arranged, secured, or terminated neatly. This resulted in untidy wiring, poor segregation between circuits, and unnecessary strain on terminations, which can lead to loose connections, overheating, and difficulty during inspection or fault-finding.

The utilization of electrical equipment that is either unsuitable for its operating environment or physically damaged poses significant safety risks. These risks include potential electrical failures, increased likelihood of short circuits, and the heightened risk of fire and electrical shock. F-202603-063646

Timeline	Remediation Plan
Medium Term CAP-0074754	i. Replace or refurbish corroded electrical panels to prevent further degradation and potential safety hazards. Implement protective measures such as installing weatherproof enclosures or using corrosion-resistant materials.
Medium Term CAP-0074755	ii. Install phase separators between adjacent live conductors of different phases within distribution boards to ensure proper segregation and protection against accidental contact, in accordance with BS 7671 Regulation 416.2.
Medium Term CAP-0074756	iii. Ensure proper cable management by organizing and securing cables within the panels using cable ties, clips, or ducting. Verify that all connections are neatly arranged and labelled to improve safety, ease of maintenance, and compliance with the electrical standard BS7671 18th Edition + A2 (2022).

Longer Term CAP-0074757	Establish a schedule for regular maintenance and inspection of the panel, cabling and busbars. Document all inspections and maintenance activities to ensure ongoing compliance. Provide training to facility maintenance personnel on the importance of maintaining electrical safety standards in line with BS 7671 requirements.



Figure 2.18 - Corrosion observed on the LT panel



Figure 2.19 - Phase separators missing and inadequate cable dressing observed in the LT panel

7.5 Loop Connection

This relates to the entire facility.

During the inspection, loop connections were identified within the electrical panels. This issue was specifically observed in the main LT panel as well as distribution boards installed in the basement and second floor of the main building.

In these loop connections, one circuit breaker is energized by the live part of another circuit breaker, creating loops within the panel instead of using a busbar system.

Avoiding loop connections is crucial due to several significant risks. Loop connections can complicate maintenance activities, making it difficult to trace and isolate circuits. These connections can lead to increased resistance and overheating, potentially damaging components. Loop connections raise the risk of accidental phase mixing, which can result in short circuits. The above issues compromise personal safety and significantly increase the risk of fire.F-202603-063648

Timeline	Remediation Plan
Medium Term CAP-0074751	All electrical panels shall be modified to eliminate loop connections. A busbar system within the electrical panels shall be utilized to provide each circuit with the required live, neutral, and earth connections.



Figure 2.20 - Loop connections found in the second floor distribution board, main building



Figure 2.21 - Loop connections found in the LT panel

7.6 Multiple Connections

This relates to the whole facility.

During our inspection, multilooping was observed in a number of electrical panels across the facility. This issue was specifically observed in the LT panel and distribution boards located in the mess area, in the basement, and on the first floor of the main building.

In these cases, multiple circuits were being protected by a single circuit breaker.

Multilooping can result in improper distribution of electrical current, leading to voltage drops and potential electrical hazards. To mitigate these risks and ensure the safety and reliability of the electrical system, it is essential to adhere to proper installation practices. This includes using appropriate dedicated circuit breakers for each circuit.F-202603-063645

Timeline	Remediation Plan
Medium Term CAP-0074758	The electrical installation throughout the facility shall be modified to ensure each circuit is protected by a dedicated circuit breaker of a suitable type and rating for each individual circuit in accordance with Section 430 of BS 7671 18th Edition + A2 (2022).



Figure 2.22 - Multiple connections found in the mess area distribution board



Figure 2.24 - Multiple connections found in the basement distribution board, main building



Figure 2.23 - Multiple connections found in the LT panel



Figure 2.25 - Multiple connections found in the first floor distribution board, main building

7.7 Openings

This relates to the entire facility of the factory.

During the visual inspection, the electrical panels and distribution boards were examined for unsealed openings to ensure compliance with the IP rating requirements.

Unsealed openings and missing base plates were observed in the LT panel, cargo lift panel, as well as distribution boards located in the mess area, compressor room, and basement of the main building.

These deficiencies pose multiple hazards. Unsealed openings and missing panels expose live electrical components, significantly increasing the risk of accidental contact and electric shock to personnel working nearby. The unsealed openings allow dust, debris, and moisture to enter, which can lead to short circuits and increase the risk of fire. The absence of proper sealing compromises the IP rating of the panels, which is crucial for ensuring safety and protection against environmental factors.F-202603-063647

Timeline	Remediation Plan
Medium Term CAP-0074752	Corrective actions are required to seal all openings and replace missing panels to restore the integrity and safety of the electrical systems. The electrical system shall ensure compliance with Sections 614.2.1, 412.2.2, and 512.2 of BS 7671 18th Edition + A2 (2022).
Longer Term CAP-0074753	Conduct regular maintenance and maintain comprehensive records for all electrical panels to ensure there are no openings and that the IP ratings of the panels remain uncompromised.



Figure 2.26 - Unsealed openings observed in the compressor distribution board



Figure 2.27 - Base plate missing in the cargo lift panel on the rooftop of main building



Figure 2.28 - Base plate missing in the LT panel



Figure 2.29 - Unsealed openings observed in the basement distribution board, main building

7.8 Adequate accessibility

This relates to the entire facility.

During the visit, the electrical panels and distribution boards were examined for adequate accessibility.

It was observed that the cargo lift electrical panel in the rooftop lift room of the main building does not possess the required space for inspection or easy access to the panels and their components.

Limited accessibility to distribution panels and machine panels hampers effective maintenance and inspection procedures. This can potentially cause delays in addressing emergencies and troubleshooting electrical problems. These accessibility challenges could compromise the operational reliability and safety of the premises, as prompt maintenance and emergency responses are hindered. F-202603-063650

Timeline	Remediation Plan
Medium Term CAP-0074742	Electrical equipment shall be arranged to provide sufficient space for the initial installation and later replacement of individual items of electrical equipment. Sufficient allowance shall also be made for sufficient space for the initial installation and later replacement of individual items of electrical equipment in accordance with Section 132.12 of BS7671 18th Edition + A2 (2022).



Figure 2.30 - Inadequate accessibility provided for the cargo lift electrical panel in the rooftop lift room

7.9 Lint & dust inside panel board

This relates to the entire facility.

During the inspection, the cleanliness of electrical panels, distribution boards, and electrical containment was assessed.

The inspection revealed a significant accumulation of lint and dust in most of the distribution boards, panels, and trunking systems, particularly in the mess area distribution board and office distribution board on the first floor of the main building.

The presence of lint and dust inside distribution boards poses several hazards. Accumulated lint and dust can act as fuel for fires if exposed to electrical currents or sparks, significantly increasing the risk of electrical fires. The cooling capacity of electrical components can also be impaired by the presence of dust and lint, leading to overheating.

Additionally, the accumulation of dust and lint can obstruct proper operation and maintenance, thereby impairing the functionality of the electrical components.F-202603-063653

Timeline	Remediation Plan
Medium Term CAP-0074737	All electrical panels and trunking runs shall be inspected and cleaned of any dust or lint in accordance with Section 522.4.2 of BS7671 18th Edition + A2 (2022).
Longer Term CAP-0074738	A regular maintenance procedure shall be established to ensure routine inspection and cleaning of all electrical panels and trunking runs. This will prevent the accumulation of lint and dust, thereby maintaining the safety and efficiency of the electrical systems.



Figure 2.31 - Lint and dust observed in the mess area distribution board

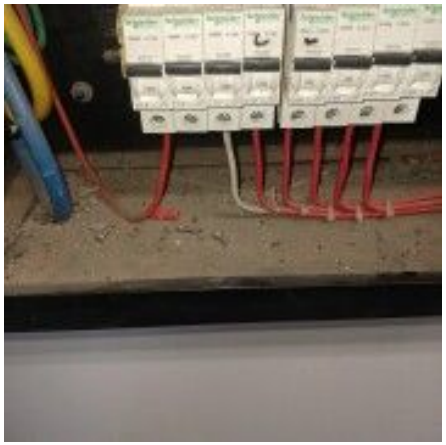


Figure 2.32 - Lint and dust observed in the office distribution board, main building

7.10 Lightning Protection System (LPS)

During the inspection, the lightning protection strategy of the factory was assessed.

It was observed that a lightning protection system was provided; however, there was no study available to confirm its adequacy, and no risk assessment was available.

Lightning strikes can cause significant damage to buildings, primarily through the ignition of fires. When lightning strikes a structure, it can cause an electrical surge that ignites flammable materials. Without a proper lightning protection system (LPS), the energy from a lightning strike can travel through the building's electrical and plumbing systems, creating sparks and starting fires. F-202603-063655

Timeline	Remediation Plan
Medium Term CAP-0074366	Engage a qualified lightning protection specialist to perform a comprehensive risk assessment according to BS EN 62305 (Protection against Lightning) standard. This assessment will determine the necessity of a lightning protection system (LPS) based on factors such as building height, location, occupancy, and the presence of sensitive electronic equipment.
Longer Term CAP-0074367	If the risk assessment concludes that an LPS is necessary, then hire a qualified engineer to perform an adequacy study of the existing LPS. This study should evaluate whether the current system meets the necessary design and performance standards according to BS EN 62305. If the study finds that the current LPS is inadequate, make the necessary upgrades to bring the system up to standard.



Figure 2.33 - Lightning protection system installed on the rooftop of the main production building



Figure 2.34 - Lightning protection system installed on the rooftop of the main production building

8. Fire Alarm & Detection System (FADS)

8.1 Non-functional or incomplete

This section refers to the entire facility.

During the inspection, the Fire Alarm and Detection System (FADS) for the facility was evaluated.

One addressable fire alarm control panel was serving the main building. Several deficiencies were identified in the fire alarm and detection system, including the fire alarm panel indicating a battery fault, faulty and inappropriately located manual call points in the main building, lack of detection and alarm coverage in ancillary structures, use of non-fire-rated cables, and the unavailability of proper design documentation, posing a significant life safety risk in the event of a fire emergency.

A non-functional/incomplete FADS significantly increases the risk of worker injury or fatality, substantial property damage, operational disruptions, legal liabilities, reputational damage, and environmental harm. A delayed response during a fire event can significantly increase the impact on personnel, goods, and propertyF-202603-063661

Timeline	Remediation Plan
Immediate CAP-0074356	Ensure the functionality and performance of the existing alarm and detection system within the building, and rectify any faults to maintain the fire alarm control panel in a healthy condition without fault indications.
Medium Term CAP-0074357	i. Submit design documentation for the new replacement of FADS system to Pakistan Accord for review before purchasing any new equipment. Design documentation to include drawings, technical data sheets, and product certifications of all listed equipment to show full compliance with the Fire Alarm and Detection System (FADS) with NFPA 72.
Longer Term CAP-0074358	ii. Submit documentation to the Pakistan Accord showing that an L/C has been opened for import of any components required for the FADS design submitted earlier.
Longer Term CAP-0074359	iii. Submit documentation to the Pakistan Accord demonstrating that all materials, both imported and locally procured, have been purchased and are available on-site for installation.

Longer Term CAP-0074360	iv. Once installation of the FADS system is complete, the factory is to submit full "as-built" documentation of the system to the Pakistan Accord for review.
Longer Term CAP-0074361	v. Factory to advise Pakistan Accord when FADS installation is fully completed and ready for review. Pakistan Accord will then arrange a verification inspection to ensure that the installation fully complies with the previously reviewed design documentation.
Longer Term CAP-0074362	vi. Provide full testing and commissioning (T&C) certification from the FADS system installer and make provision for attendance of the system installer, factory technical personnel, and Pakistan Accord technical team to witness a final T&C demonstration verification on site. On successful completion of this T&C verification inspection, remediation of the FADS system will be complete.



Figure 2.35 - Addressable fire alarm control panel showing fault indications installed in the gate office



Figure 2.36 - Fire detection coverage missing in cargo lift motor room on rooftop of main building



Figure 2.37 - Fire alarm and detection coverage missing in mess area, ancillary structure



Figure 2.38 - Fire alarm and detection coverage missing in the compressor room, ancillary structure



Figure 2.39 - Manual call point missing near emergency exit door on first floor of main building



Figure 2.40 - Non-fire rated cables and faulty manual call point observed at first floor of main building

9. Emergency Lighting

9.1 Provided but insufficient

The section refers to the entire facility.

During the inspection, the emergency lighting arrangement throughout the facility was assessed.

The following observations were made:

i. Several areas lacked sufficient emergency lighting and exit directional sign coverage. This issue was specifically observed in the basement, along the egress routes on the first floor, and on the staircases leading to the rooftop of the main building, as well as within the ancillary structures.

ii. A central UPS was utilized to provide backup power to the normal lighting on the first floor of the main building; however, battery autonomy calculations were not provided, non-fire-rated cables were used for the emergency lighting circuits, and the UPS placement does not comply with the standard requirements.

iii. External emergency lighting was not provided, particularly in the external emergency stairs and assembly area, preventing people from reaching a place of safety outside the facility during nighttime evacuations.

Adequate and functional emergency lighting throughout the facility is crucial for providing necessary illumination during power failures or other emergencies, ensuring the safe evacuation of workers.F-202603-063654

Timeline	Remediation Plan
Medium Term CAP-0074417	i. Conduct a comprehensive survey to identify areas lacking adequate emergency lighting. Install additional emergency luminaires and exit directional signs in these areas to meet the coverage requirements specified in the Building Code of Pakistan Fire Safety Provisions 2016, ensuring sufficient illumination for safe evacuation. Submit the emergency light design to the Pakistan Accord for review.
Medium Term CAP-0074418	ii. Prepare and submit verified UPS battery autonomy calculations to demonstrate compliance with emergency lighting duration requirements, replace non-fire-rated cables with compliant fire-rated cabling for emergency lighting circuits, and relocate or enclose the UPS in accordance with applicable fire and electrical safety standards.

Medium Term CAP-0074419	iii. Install external emergency luminaires to enable safe evacuation during hours of darkness, all the way to a safe place outside the building(s).
Longer Term CAP-0074420	Establish a regular maintenance and testing schedule to routinely check the functionality of emergency lighting systems. This should include periodic tests, inspections, and prompt maintenance actions to address any issues. Maintain detailed records of all inspections, tests, repairs, and maintenance activities. Train facility maintenance staff on the procedures for inspecting and maintaining emergency lighting systems to ensure ongoing reliability and compliance with safety standards.



Figure 2.41 - Emergency light and exit sign not provided in the staircase leading to the rooftop, main building



Figure 2.42 - External emergency lights not provided in the assembly area



Figure 2.43 - Insufficient emergency light in the egress route on the first floor of the main building



Figure 2.44 - Emergency light missing in the fire hydrant room, ancillary structure



Figure 2.45 - Insufficient emergency light in the egress route on the basement of the main building



Figure 2.46 - External emergency lights not provided for emergency stairs, main building

9.2 Independent power source

The section refers to the entire facility.

During the inspection, it was observed that the emergency lighting within the facility was not connected in a manner that would ensure automatic activation upon the loss of power to the general lighting in various spaces.

Proper circuitry is crucial to ensure that emergency lighting is automatically activated when general lighting fails. This automatic activation is essential for maintaining sufficient illumination, allowing for the safe evacuation of occupants and preventing panic during power outages. Further the emergency lights and exit signs should be reconfigured to be connected on a dedicated single circuit, which must not include any other load except for the emergency lighting system. According to the Building Code of Pakistan Fire Safety Provisions 2016, emergency lighting systems must be designed to provide immediate illumination in the event of power loss to ensure a clear and safe path for evacuation.

Ensuring that the emergency lighting is integrated with the facility's power system to activate automatically during power failures is critical for life safety. This integration helps prevent hazardous conditions that can arise in the dark, such as trips, falls, and confusion, thereby facilitating orderly and efficient evacuation during emergencies.F-202603-063656

Timeline	Remediation Plan
Medium Term CAP-0074364	Reconfigure the emergency lighting circuitry to ensure that emergency lights activate immediately upon failure of general lighting power as required by the Building Code of Pakistan Fire Safety Provisions 2016. Emergency lighting shall be powered from a source independent of that supplying the normal lighting.
Longer Term CAP-0074365	Establish a regular maintenance and testing schedule to routinely check the functionality of emergency lighting systems. This should include periodic tests, inspections, and prompt maintenance actions to address any issues. Maintain detailed records of all inspections, tests, repairs, and maintenance activities. Train facility maintenance staff on the procedures for inspecting and maintaining emergency lighting systems to ensure ongoing reliability and compliance with safety standards.

9.3 General Lighting

The section refers to the entire facility.

During the inspection, the general lighting throughout the facility was assessed.

It was observed that general lighting was not provided along the staircases from the second floor to the rooftop on both sides of the main building.

Insufficient general lighting in several locations can increase the risk of accidents and impede safe evacuation during emergencies, while controlling general lighting via breakers instead of light switches poses operational inefficiencies and safety hazards. This setup can delay emergency responses and heighten the risk of electrical faults or fires due to frequent breaker use. Addressing these issues is crucial for enhancing everyday safety and ensuring effective emergency preparedness in the facility.F-202603-063658

Timeline	Remediation Plan
Medium Term CAP-0074363	Conduct a thorough assessment of lighting throughout the facility to find areas with insufficient illumination. Install additional lighting fixtures in these spots to ensure adequate brightness. Ensure the new lighting design meets safety and efficiency guidelines to provide clear visibility for all tasks and emergency situations.



Figure 2.47 - No general lighting along staircases to rooftop of the main building.

10. Generator, Transformer & Sub-Station Room

10.1 Battery

During the inspection of the battery system, the battery cells, connections, and enclosures were thoroughly examined.

The following observations were noted with the battery system:

i. Noticeable spills of battery fluid were observed, which can lead to corrosion and pose a chemical hazard.

ii. Several battery terminals were exposed and not properly insulated, increasing the risk of electrical shock or short circuits.

iii. The placement of some batteries did not comply with safety regulations, potentially hindering safe access and proper ventilation.

These observations were noted for the generator batteries and UPS batteries located in the basement and on the first floor of the main building.

Proper monthly and annual maintenance of the battery system is crucial for fire safety. Spilled fluid can cause corrosion and fires, while bare terminals increase the risk of electrical shocks and short circuits, potentially igniting fires or explosions. Non-compliant battery placement can obstruct ventilation, leading to hazardous gas buildup and fire risks. Addressing these issues is essential to prevent fires and ensure battery system safety.F-202603-063660

Timeline	Remediation Plan
Medium Term CAP-0074340	i. Clean any battery fluid spills using appropriate neutralizing agents and safety equipment to prevent corrosion and chemical hazards. Inspect and repair any affected battery cells or enclosures to prevent further leakage.
Medium Term CAP-0074341	ii. Insulate exposed battery terminals using appropriate insulating materials to prevent electrical shock and short circuits. Conduct a thorough inspection of all connections to ensure that there are no immediate risks of exposure.
Medium Term CAP-0074342	iii. Reposition batteries that are improperly placed to ensure they comply with safety regulations, allowing for safe access and adequate ventilation. Mark and clear pathways around battery installations to ensure easy and safe access for maintenance and emergencies.

Longer Term CAP-0074343	i. Implement a regular maintenance schedule to monitor and address potential leaks, ensuring that any spills are promptly managed.
Longer Term CAP-0074344	ii. Establish a routine inspection and maintenance protocol to check and maintain proper insulation of all battery terminals regularly.
Longer Term CAP-0074345	iii. Conduct regular audits of battery placements to ensure ongoing compliance with safety standards and regulations.



Figure 2.48 - Fluid spillage and exposed terminals observed on the basement UPS batteries



Figure 2.49 - Inappropriate placement for UPS batteries under the stairs in basement of main building



Figure 2.50 - Exposed terminals observed on the standby generator batteries

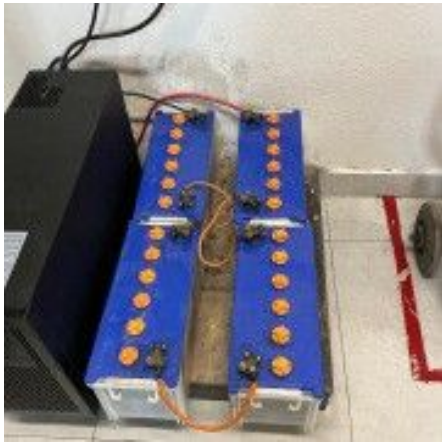


Figure 2.51 - Exposed terminals observed on the UPS batteries located on first floor of main building

11. Cabling & Wiring

11.1 Cable support and protection

This section refers to the entire facility.

During the inspection of the entire facility, a visual survey of the cable containment system was conducted.

Proper supports were not provided for cables; they were laid directly on the ground and hung along the walls. Inadequate cable support results in sagging or stress on cables, which can lead to damage or failure. This issue was specifically observed with the main LT panel outgoing cables, the boundary wall light cables, and the cables outside the compressor room.F-202603-063639

Timeline	Remediation Plan
Medium Term CAP-0074569	Secure cables with appropriate supports and insulate any exposed connections to prevent sagging, stress, and potential hazards. (Reference: BS 7671 18th Edition + A2 (2022) Regulation 522.8.5 for mechanical support and 526.5 for proper terminations).
Medium Term CAP-0074570	Implement a comprehensive cable management system with regular inspections to ensure cables remain properly supported and insulated over time.



Figure 2.52 - Inadequate cable support for the main outgoing LT panel cables



Figure 2.54 - Inadequate cable support outside compressor room



Figure 2.53 - Inadequate cable support for the boundary wall lights outside the main building

11.2 Cable trench and channel cleanliness

This is related to the whole facility.

The following observations were noted during the inspection of the cable trunking systems:

i. The cleanliness of the cable trunking system had not been maintained. The trunking systems were found filled with a significant accumulation of fluff and dust, posing a potential fire hazard.

ii. Power cables and compressed air pipes were routed together in electrical cable trays in the stitching hall, posing a potential safety risk due to moisture from air leakage or condensation and possible mechanical damage to the cables.

These issues were observed with the cable trays on the first floor of the main building.

Accumulated dust and fluff can ignite when exposed to sparks or high temperatures, potentially leading to a fire hazard. Maintaining a clean cable trunking system is essential to minimize fire risks associated with accumulated debris.F-202603-063642

Timeline	Remediation Plan
Medium Term CAP-0074735	i. Clean all cable trunking systems to remove accumulated dust and fluff, ensuring that any potential fire hazards are mitigated.
Medium Term CAP-0074736	ii. Ensure that power cables and compressed air pipes are routed separately in accordance with relevant safety codes and standards to prevent potential hazards.
Longer Term CAP-0075299	Implement a regular maintenance schedule that includes routine inspections and cleaning of the cable trunking systems to prevent future accumulation of dust and fluff, thereby maintaining a safe environment and complying with safety standards.



Figure 2.55 - Dust inside the cable tray in the stitching hall, first floor, main building



Figure 2.56 - Power cables and compressed air pipes routed together in the stitching hall cable tray

11.3 Splicing of cables

This relates to the whole facility.

During the inspection, the cable installation was visually surveyed throughout the facility.

The following observations were noted:

i. Cables terminations within panels and switchgears were made without cable lugs, resulting in broken strands and loose connections. This presents a significant fire risk due to the potential for electrical arcing and overheating, which can ignite nearby materials and cause a fire. Furthermore, loose connections can cause voltage drops and equipment malfunctions, posing a life safety hazard. This issue was observed in the distribution boards on the first floor of the main building.

ii. PVC tape joints were found in several locations - including within distribution boards - where cables were either damaged or two cables were being joined together. This method of jointing is unreliable and can deteriorate over time, increasing the risk of electrical shorts and fires. The adhesive on PVC tape can degrade, leading to exposed conductors that can spark and ignite surrounding materials, presenting both fire and life safety risks. This issue was specifically observed in the main LT panel, cable trays on the first floor, and the water pump connections on the rooftop.

iii. A low-quality PVC connector was used in the main LT panel, posing a potential short-circuit hazard due to poor insulation.

For any future electrical work, the termination of stranded cables must be done with cable lugs and PVC tape joints shall not be utilized. Proper termination ensures secure and reliable connections, reducing the risk of electrical failures and enhancing overall safety. F-202603-063640

Timeline	Remediation Plan
Medium Term CAP-0074590	i. Install cable lugs on all improperly terminated cables within panels and switchgears to secure connections and prevent breaking strands and loose connections in accordance with Regulation 526.1 of BS7671 18th Edition + A2 (2022).
Medium Term CAP-0074591	ii. Replace all PVC tape joints with proper terminal blocks or connectors to ensure secure and stable connections in accordance with Regulation 526.1 of BS7671 18th Edition + A2 (2022). Replace all damaged cabling with new wiring.

Medium Term CAP-0074592	iii. Replace the PVC connector with a standard quality terminal block in accordance with BS7671 18th Edition + A2 (2022).
Longer Term CAP-0074593	i. Implement a standard operating procedure (SOP) requiring the use of cable lugs for all future cable terminations. Regularly train and audit personnel to ensure compliance with this procedure, thus maintaining safe and reliable electrical connections.
Longer Term CAP-0074594	ii. Establish a policy prohibiting the use of PVC tape for electrical jointing. Regularly inspect and maintain electrical installations to ensure compliance, and provide continuous training for staff on proper jointing techniques.
Longer Term CAP-0074595	iii. Establish a plan to replace all low-quality PVC connectors with compliant electrical terminal blocks and integrate this into regular maintenance to ensure ongoing safety and compliance.



Figure 2.57 - Low-quality PVC connector and PVC tape joints found in the main LT panel



Figure 2.58 - PVC tape joints found in the water pump connections on the rooftop



Figure 2.59 - PVC tape joints found in the cable tray on the first floor of main building

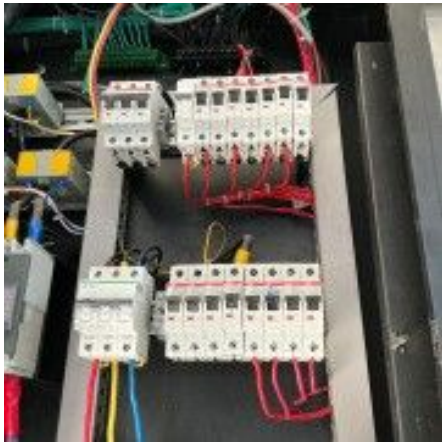


Figure 2.60 - Cable terminations without lugs observed in the first floor distribution board, main building

11.4 Colour coding

This relates to the whole facility.

During the inspection of several distribution boards, deviations from standard cable colour coding practices were identified. Such deviations pose significant risks, as they can lead to the misinterpretation and misidentification of cables. This misidentification can result in incorrect connections, potentially causing unsafe working conditions and increasing the likelihood of electrical accidents, such as shocks or fires. This issue was observed in the distribution boards located in the mess area and the basement of the main building.

To mitigate these risks, it is imperative that all future electrical work strictly adheres to standardized colour coding as prescribed by BS 7671. This will ensure accurate identification of conductors, thereby enhancing overall safety and operational efficiency. F-202603-063641

Timeline	Remediation Plan
Medium Term CAP-0074596	Conduct a comprehensive audit of all distribution boards to identify and correct any deviations from the standard cable colour coding. This involves re-labelling or re-insulating the cables with the appropriate colour codes as specified in BS 7671. Specifically, adhere to BS 7671 Regulation 514.3.1, which mandates the correct identification of conductors.
Longer Term CAP-0074597	Develop and enforce a strict protocol for cable colour coding to be followed for all future installations and maintenance activities. This protocol should include regular training sessions for electricians and maintenance personnel to keep them updated on the latest standards and practices. Additionally, periodic audits should be conducted to ensure ongoing compliance with the standardized colour coding system, thereby preventing future deviations and ensuring sustained safety and operational efficiency.



Figure 2.61 - Incorrect color coding observed in the basement distribution board, main building



Figure 2.62 - Incorrect color coding observed in the mess area distribution board

11.5 Fixtures

This relates to the whole facility.

During the inspection, the electrical fixtures throughout the facility were visually surveyed.

The following observations were noted:

i. A power receptacle mounted on combustible wooden ply was observed on the first floor of the main building. Installing receptacles on combustible materials like wooden ply increases the risk of fire if a short circuit or overheating occurs. Combustible materials can easily ignite, leading to potential fire hazards and endangering life safety.

ii. A broken and exposed power receptacle was observed in the gate office. Damaged receptacles with exposed parts can lead to loose connections and increased electrical resistance. This condition can cause overheating, potentially igniting surrounding materials and increasing the risk of electrical fires, posing a serious life safety threat.

iii. Lighting tube rods and LED bulbs were found suspended directly from cables, and several fixtures were broken due to a lack of proper support, particularly in the basement storage area of the main building and the mess area, posing a risk of cable strain, electrical faults, or fire hazards. F-202603-063638

Timeline	Remediation Plan
Medium Term CAP-0074545	i. Replace combustible wooden ply backings with non-combustible materials to reduce fire risk.
Medium Term CAP-0074546	ii. Replace or repair broken and exposed power receptacles immediately to restore safe and secure connections.
Medium Term CAP-0074547	iii. Install appropriate lighting fixtures with secure mounting provisions to support bulbs and LED tube lights independently, without relying on electrical cables.
Longer Term CAP-0074548	i. Establish a facility-wide standard to use only non-combustible materials for mounting electrical components, and conduct regular audits for compliance.

Longer Term CAP-0074549	ii. Implement a preventive maintenance program that includes periodic checks and timely replacement of damaged electrical components to maintain safety standards.
Longer Term CAP-0074550	iii. Establish and implement a facility-wide standard for the proper installation of all lighting fixtures using durable supports, to prevent stress on electrical wiring and ensure long-term safety and reliability.



Figure 2.63 - Broken lighting fixture due to inadequate support found in the mess area



Figure 2.64 - Inadequate support for the lighting tube rods in the basement of main building



Figure 2.65 - Power receptacle installed with wooden backing on the first floor, main building



Figure 2.66 - Damaged power receptacle found in the gate office

12. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.