Issue	**1**
Factory ID	**920016**
Date of Issue	**22-Apr-2026**

Agility Textile (Pvt.) Ltd.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Kahna Rohi Nala, Gujjar Chowk, Tibba Lahore
54000 Lahore
Punjab Pakistan

Latitude: [31.393564], longitude: [74.323596]
Date of inspection: 26-Feb-2026

Fire Safety Inspection Report

Observations & Actions



Authors	**Naveed Anjum**
Reviewed by	**Muhammad Naseer**
Approved by	**Paul Rigby**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 26-02-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
3. Building Description 10
   - 3.1 Building Means of Egress Details 11
   - 3.2 Building Use 12
4. Documentation 13
5. Fire Safety Measures 14
6. Remediation Support 15
   - 6.1 Engineering Support 15
7. Means of Escape 16
   - 7.1 Escape doors 16
   - 7.2 Exit access 18
   - 7.3 Travel distance 20
   - 7.4 Number of exits 21
   - 7.5 Protection of stairs 22
   - 7.6 Escape stair condition 25
   - 7.7 Exit signage 27
8. Fire Rated Construction 30
   - 8.1 Separation of high-risk areas 30
   - 8.2 Separation of high-risk areas 32
   - 8.3 Separation of shafts 34
   - 8.4 Floor openings 36

8.5 Separation of occupancies..... 38
8.6 Storage..... 40
9. Fire Suppression..... 42
9.1 Standpipe system..... 42
9.2 Fire pumps..... 44
9.3 Water supply..... 46
10. Fire Safety Management..... 47
10.1 Fire drills..... 47
10.2 Records of system testing..... 48
10.3 Records of systems maintenance..... 49
10.4 Emergency Action Plan..... 50
11. Assessment Limitations and Assumptions..... 51

1. Executive Summary

On 26-Feb-2026, Abdul Hayee and Naveed Anjum on behalf of the Pakistan Accord carried out an initial fire inspection for Agility Textile (Pvt.) Ltd., a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Asad Ali (Head admin), Mr. Rana Fahid Rasheed (HR Manager), and other staff members of Agility Textile (Pvt.) Ltd. As the assessment was being carried out as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Accord were also present and the team was led by Abdul Hayee Pakistan Accord.
The factory comprises of one main building and four ancillary structures rented by **Agility Textile (Pvt)** Ltd. The basement and ground floor of main building was rented by cross stitch however first and second floor was rented by Agility Textile (Pvt) Ltd. Some area of 2nd floor was in use of cross stich also. Details of buildings provided below:

- **Main Building**

Is a three story (B+G+2) above grade plan. The structural system of the building consists of an RC moment-resisting frame system with covered area foot print of 2382 sq.m. with the height of 7.73m measured from the fire department vehicle access to the topmost occupied floor. Building has 5 staircases out of which 2 discharge internally. The building is used for solar panels (roof), Mess, Offices & Storage (second floor) Pressing, Packing, Sampling, Accessory store, Sewing, Stitching, Storage & Offices (first floor), washing area, kitchen, storage, Vacant Hall (ground floor), Offices, Storage, (basement). The construction year of the building is 2020.

- **Ancillary Structure**

There are four ancillary structures details of which are given below:

- **Gate office** is a single story (Ground only) structure having load bearing brick masonry wall supporting RC slab. The structure is used for gate office (ground floor). The construction year of building is 2020.
- **Mess Area** is a single story (Ground only) structure having load bearing brick masonry wall supporting precast girder and slab panels. The structure is empty (ground floor). The construction year of structure is 2020.
- **Compressor room** is a single story (Ground only) structure having load bearing brick masonry walls supporting precast girders and slab panels. The structure is used for compressor room (ground floor). The construction year of building is 2023.
- **Fire Pump Room** is a single story (Ground only) structure having load bearing brick masonry walls supporting precast girders and slab panels. The structure is used for compressor room (ground floor). The construction year of building is unknown.

The factory operates in single general shift. Factory employs approximately 120 workers with 15 female representations.
We were presented with Civil defence certificate & architectural layout.

A summary of the main concerns identified during the inspection includes (non-exhaustive):

- Lockable mechanisms observed in escape route across the whole facility.

- There is no fire separation between stairs and the rest of the building.
- Multiple protected stairs discharge inside the building.
- Storage areas are not fire separated from rest of the building.
- Main Building is not protected by Standpipe system.
- Fire pump set comprise of non-listed product.

We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes.)

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents



Figure 1.1. Satellite view (Red dashed line indicates site boundary)


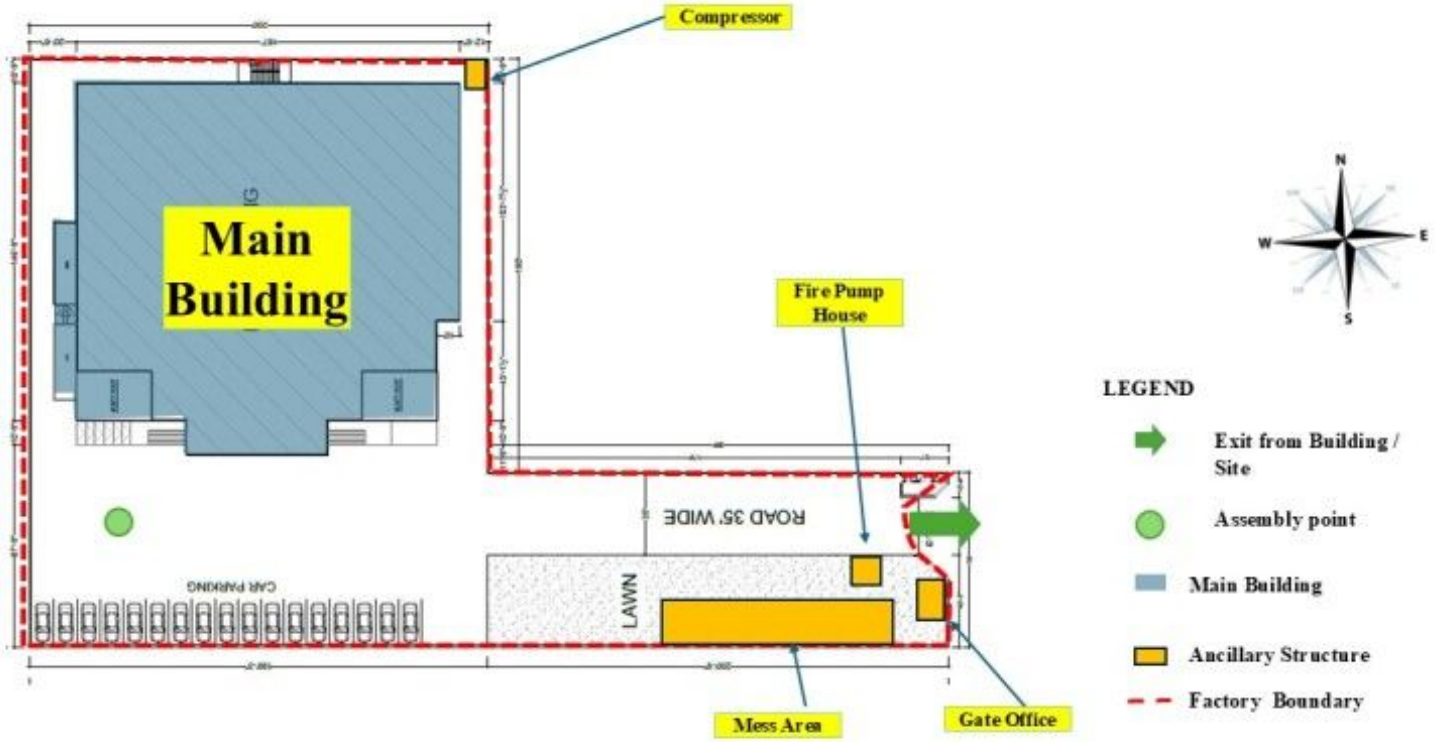


Figure 1.2. Site layout. Red dashed line indicates site boundary

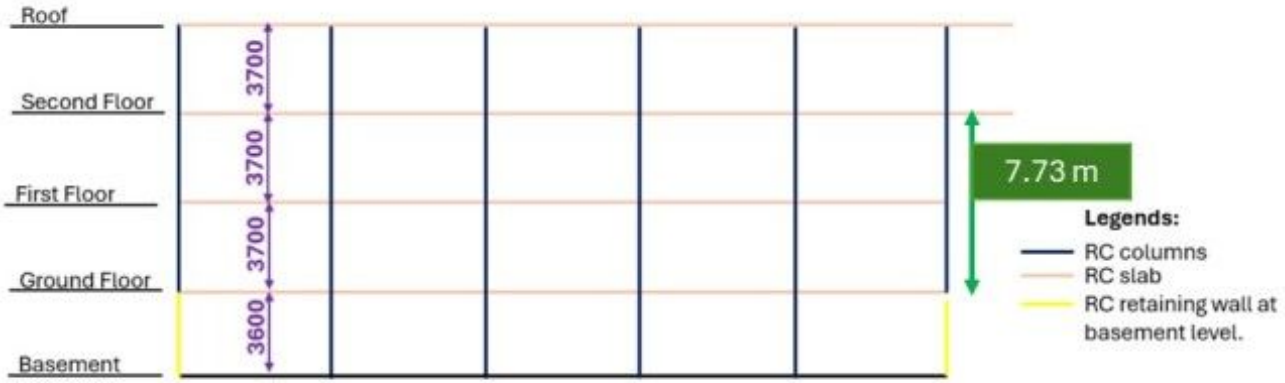

7.73 m Height from fire department access road to top most occupied floor

Figure 1.3. Typical Building cross-section of Main building

3. Building Description

The factory comprises of one main building and four ancillary structures rented by **Agility Textile (Pvt)** Ltd. The basement and ground floor of main building was rented by cross stitch however first and second floor was rented by Agility Textile (Pvt) Ltd. Details of buildings provided below:

- **Main Building**

Is a three story (B+G+2) above grade plan. The structural system of the building consists of an RC moment-resisting frame system with covered area foot print of 2382 sq.m. with the height of 7.73m measured from the fire department vehicle access to the topmost occupied floor. Building has 5 staircases out of which 2 discharge internally. The building is used for solar panels (roof), Mess, Offices & Storage (second floor) Pressing, Packing, Sampling, Accessory store, Sewing, Stitching, Storage & Offices (first floor), washing area, kitchen, storage, Vacant Hall (ground floor), Offices, Storage, (basement). The construction year of the building is 2020.

- **Ancillary Structure**

There are four ancillary structures details of which are given below:

- **Gate office** is a single story (Ground only) structure having load bearing brick masonry wall supporting RC slab. The structure is used for gate office (ground floor). The construction year of building is 2020.
- **Mess Area** is a single story (Ground only) structure having load bearing brick masonry wall supporting precast girder and slab panels. The structure is empty (ground floor). The construction year of structure is 2020.
- **Compressor room** is a single story (Ground only) structure having load bearing brick masonry walls supporting precast girders and slab panels. The structure is used for compressor room (ground floor). The construction year of building is 2023.
- **Fire Pump Room** is a single story (Ground only) structure having load bearing brick masonry walls supporting precast girders and slab panels. The structure is used for compressor room (ground floor). The construction year of building is unknown.

3.1 Building Means of Egress Details

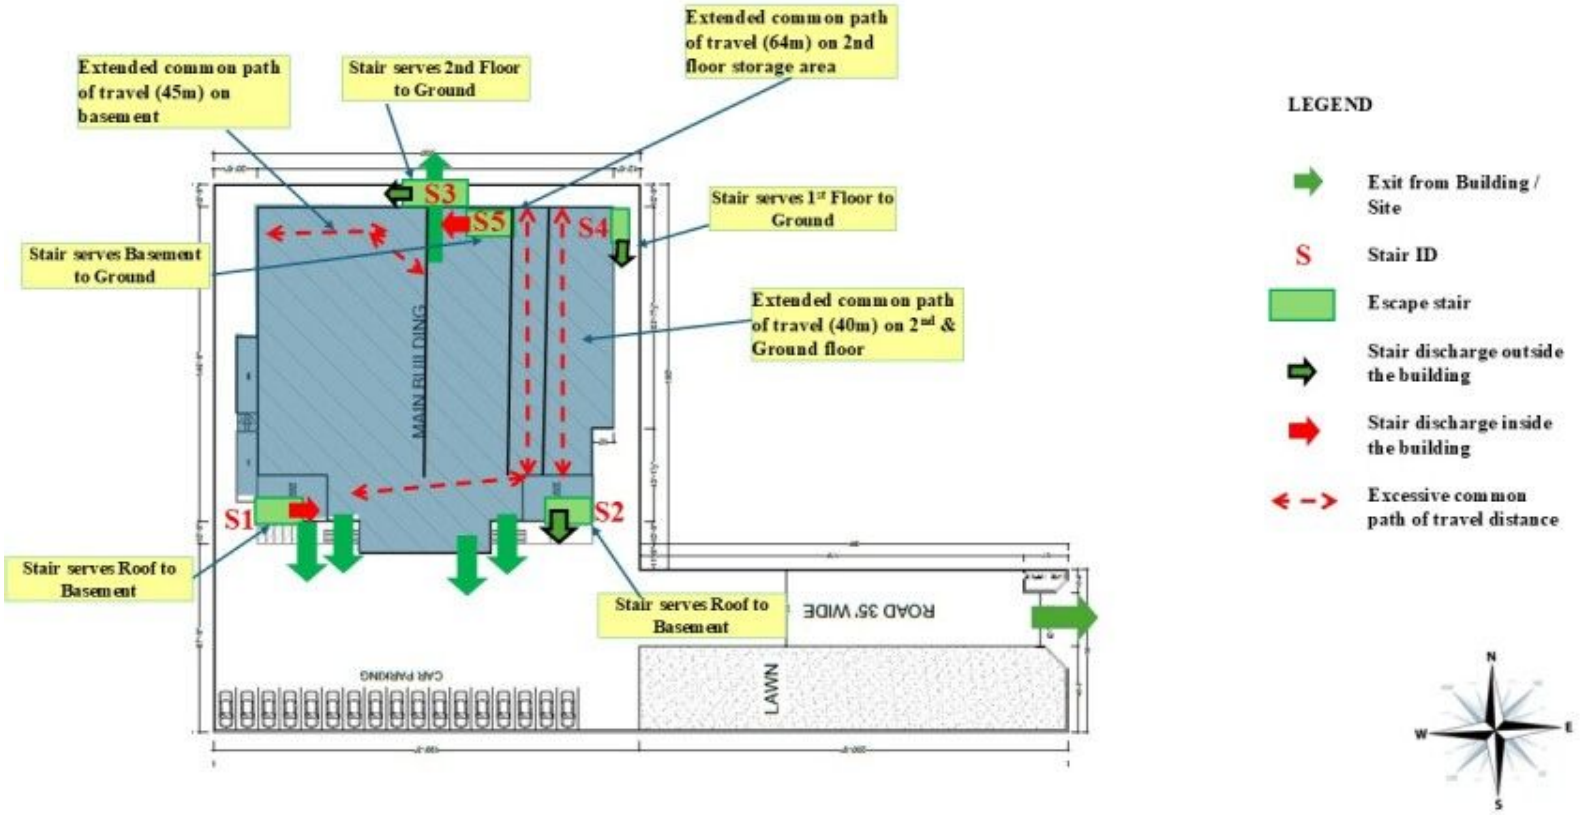


Figure 1.4. Egress layout plan of Main building

3.2 Building Use

Main Building

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternative Paths	Common Path	Dead End
Basement	Offices, Storage	30	3	-	45m	-
Ground	Washing area, Kitchen, Storage, Vacant Hall	20	5	-	40m	-
1st Floor	Pressing, Packing, Sampling, Accessory store, Sewing, Stitching, Storage & Offices	80	4	-	-	-
2nd Floor	Mess, Offices & Storage	60 60	1 2	-	40m 64m	-
Roof	Solar Panels	-	2	-	-	-

There is sufficient exit capacity in building & travel distance Common path exceed permitted limits. e.g. Extended Common path of travel in Main building in different locations like 45m on basement ,40m on ground floor & second floor studio office & 64m on storage area 2nd floor. Single exit issue observed at the mess area on the second floor.

4. Documentation

This table shows the details about the documentation provided by the factory.

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defence Certificate (NOC)		Yes	15-01-2026	
2.	Architecture Layout		Yes		
3.	Sectional Layout		Yes		
4.	Evacuation Maps		Yes		On floors
5.	Emergency Action Plan		No		
6.	Inspection	Fire extinguishers	Yes	09-02-2026	Not as per Pakistan Accord Building Standard.
		Exit signage	No		
		Fire Door	No		
7.	Testing	Fire extinguishers	No		
		Exit signage	No		
		Fire Door	No		
8.	Maintenance	Fire extinguishers	No		
		Exit signage	No		
		Fire Door	No		
9.	Evidence of Fire Drills		Yes	6-01-2026	Not as per Pakistan Accord Building Standard.
10.	Staff Training		-	No	

Table 1: Documentation

5. Fire Safety Measures

During our fire site inspection of Agility Textile (Pvt.) Ltd., a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within Agility Textile (Pvt.) Ltd.. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support F-202603-064468

Timeline	Remediation Plan
Immediate CAP-0076031	Factories should begin remediation of CAP items—such as installing extinguishers, signage, and clearing escape routes—using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required.

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.
- Doors into stairs, stair discharge doors, final exit doors from site, and all doors serving areas with more than 50 occupants shall swing in the direction of escape.

This is not always achieved, examples include (list not exhaustive):
- Escape doors are lockable throughout the facility .
- Doors serving areas with over 50 occupants swing against the direction of escape in office area 2nd floor & Mess area 2nd floor of Main Building ,
- Discharge doors from stairs swing against the direction of escape .e.g. Main building exit door ground floor S1.

Recommended remedial actions are provided below.F-202603-063515

Timeline	Remediation Plan
Immediate CAP-0073985	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term CAP-0073986	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5.
Longer Term CAP-0073987	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Lockable fire doors 1st floor Main Building



Figure 2.2 - Opposite direction door from Mess Area 2nd Floor Main Building



Figure 2.3 - Main exit door at ground floor from S1 opposite direction

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.

This is not always achieved, examples include (list not exhaustive):
- Obstructions on escape route. For example, storage was observed on the basement exit route, and a door was creating an obstruction in the exit path.
- Protected stair discharges inside the building at a distance from building exit e.g. Stairs S1 & S5 discharge inside the building

Recommended remedial actions are provided below.F-202603-063505

Timeline	Remediation Plan
Immediate CAP-0073903	Remove obstructions on escape routes and keep them clear for escape.
Medium Term CAP-0073904	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks) Submit the proposal to Pakistan Accord for review.

Longer Term CAP-0073905	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted.



Figure 2.4 - Obstruction on escape route at basement of Main Building



Figure 2.5 - Stairs discharge inside building ground floor S1

7.3 Travel distance

Travel distances should meet the limits in the Pakistan Accord Standard. The standard provides limitations on:
- Common path of travel, i.e. the distance the occupants have to travel before there is a choice of escape routes.

This is not always achieved, examples include (list not exhaustive):
- Common path of travel distances exceed permitted limits. e.g. Extended Common path of travel in Main building in different locations like 45m on basement ,40m on ground floor & second floor studio office & 64m on storage area 2nd floor .

Recommended remedial actions are provided below.F-202603-063501

Timeline	Remediation Plan
Immediate CAP-0073871	Reduce the common path of travel distance to a maximum of 46 m in the areas with higher common path of travel or vacate the area until the travel distance is reduced.
Medium Term CAP-0073872	Propose a plan for addressing the excessive travel distance through alternative escape routes and/or additional exits and submit to Pakistan Accord for review prior to commencing any rectification works on site. Review travel distances from all areas in the building(s) to ensure that they meet the limits in the Pakistan Accord Standard.
Longer Term CAP-0073873	Implement the plan previous reviewed by Pakistan Accord and ensure all travel distances to emergency exits meet the requirements of the Pakistan Accord Standard.

7.4 Number of exits

Per Pakistan Accord Standard, the exit provisions should meet the following:
- Minimum 2 exits from every occupied floor.

This is not always achieved, examples include (list not exhaustive):

- Single exit from some of the occupied floors e.g. Single exit from Mess Area 2nd floor Main building .

Recommended remedial actions are provided below.F-202603-063500

Timeline	Remediation Plan
Medium Term CAP-0073867	Review each floor and area to ensure that the number of exits complies with Pakistan Accord Standard. Develop plans and drawings to provide additional exits where necessary. Submit the plan and drawings to Pakistan Accord for review and approval prior to commencing rectification works.
Longer Term CAP-0073868	Implement the above plan as agreed with Pakistan Accord. Number of exits from all floors and parts of the building should comply with Pakistan Accord Standard.

7.5 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- Stair discharge routes should be protected to the same level of safety as the stair.
- There should be no fire load and/or services passing through a stair.
- Stairs should not be discharged to a roof.

This is not always achieved, examples include (list not exhaustive):
- Unprotected openings into stairs e.g. Openings in S2,S3 & S4.
- Missing fire rated enclosure and fire doors in stair S1 & S2 all levels .
- Fire load in Basement Stairs S1,S2, & S5
- Services passing through or within stairs e.g. Services passing from S1 1st floor.

Recommended remedial actions are provided below.F-202603-063511

Timeline	Remediation Plan
Immediate CAP-0073952	Remove fire load and any other obstructions due to stored items from stairs
Medium Term CAP-0073953	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.

Longer Term CAP-0073954	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.6 - Missing fire rated enclosure stairs S2



Figure 2.7 - Fire load in Stairs S5 Basement



Figure 2.8 - Fire load in Stairs S2 Basement



Figure 2.9 - Services passing from Stairs S1



Figure 2.10 - unprotected opening in stairs S2



Figure 2.11 - Unprotected Opening in S3

7.6 Escape stair condition

Per Pakistan Accord Standard, escape stairs should be designed to be safe for use, including day to day use.

This is not always achieved, examples include (list not exhaustive):

- Handrails on one side of the stairs are missing at S1 and S2.

Recommended remedial actions are provided below.F-202603-063507

Timeline	Remediation Plan
Medium Term CAP-0073913	Handrails to be provided on both sides of each stair. Ensure the handrails are at appropriate height.



Figure 2.12 - Handrail is missing on one side of Staircase S1



Figure 2.13 - Handrail is missing on one side of Staircase S2

7.7 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs at entry into stairs e.g. Entry into stairs S1 & S2 all levels
- Missing exit signs at stair discharge routes. Exit from S1 Ground floor .
- Missing exit signs in production areas Main Building 1st floor
- Missing exit signs in offices areas Main building 2nd floor .
- Electrically powered exit signs are not a tested and listed system

Recommended remedial actions are provided below.F-202603-063504

Timeline	Remediation Plan
Medium Term CAP-0073886	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3
Longer Term CAP-0073887	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.14 - Missing Exit sign S1 entry 1st floor Main Building



Figure 2.16 - Missing exit signs ground floor Main Building exit from S1



Figure 2.15 - Missing exit sign in office area Main Building 2nd floor



Figure 2.17 - Missing Exit signs in Basement area Main Building



Figure 2.18 - Missing Exit sign 2nd floor Office area Main Building



Figure 2.19 - Missing exit signs 2nd floor storage area Main Building



Figure 2.20 - Missing Exit signs in production area 1st floor Main Building

8. Fire Rated Construction

8.1 Separation of high-risk areas

Per Pakistan Accord Standard, electric steam generators (pressure vessels) in occupied areas require blast protection consisting of:
- Minimum 3 m high reinforced concrete/ block masonry wall to separate it from the rest of the occupied portions of the building.
- Door to be solid steel door with a self-closer and a positive latch.
- Opening from the steam generator room to outside the building to release the blast out from the building.

The aim of these provisions is to protect the occupants nearby from the effects of a potential blast.

There are three electric steam generators located on the 1st floor of the Main Building. The following deficiencies were observed during the site inspection (list not exhaustive)

- Steam generator door is not a sturdy door
- Steam generator doors do not have a self-closer and/or a latch
- Steam generator rooms are not enclosed in minimum 3m high sturdy construction to separate them from occupied areas
- Steam generator rooms do not have a permanent opening outside the building

Recommended remedial actions are provided below.F-202603-063502

Timeline	Remediation Plan
Medium Term CAP-0073877	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Separation to electric steam generator up to 3 m above the finished floor level. This should be achieved using reinforced concrete / masonry walls with solid steel doors. - The door must have a self-closer and a positive latch. - Blast vent should be provided to outside the building.
Longer Term CAP-0073878	Implement the above plan on site. All buildings to be compliant with Pakistan Accord Standard.



Figure 2.21 - Unprotected Electric Steam Generator 1st floor Main Building

8.2 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):

- Electrical rooms are not fire separated from production hall & Exit route ground floor Main building .
- Kitchen area is not fire separated from mess area in Main Building 2nd floor.

Recommended remedial actions are provided below.F-202603-063510

Timeline	Remediation Plan
Medium Term CAP-0073937	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g. storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0073938	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.22 - Kitchen area is not fire separated from Mess area Main Building 2nd Floor



Figure 2.23 - Electrical Panel room is not fir separated from Exit route & Production Hall

8.3 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction to maintain compartmentation between floors.

The following deficiencies have been observed on site, including (list not exhaustive):

- Lift shafts are not separated with fire rated construction in Main Building all floors .

Recommended remedial actions are provided below.F-202603-063506

Timeline	Remediation Plan
Medium Term CAP-0073907	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0073908	Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.24 - Lift shaft is not fire separated in Main Building

8.4 Floor openings

Per Pakistan Accord Standard, each floor should be fire separated using 2 hours fire resisting construction with 90 minutes fire rated door/shutter assemblies.

The following deficiencies have been observed on site, including (list not exhaustive):

There is an unprotected opening from 1st floor to 2nd floor .

Recommended remedial actions are provided below.F-202603-063514

Timeline	Remediation Plan
Medium Term CAP-0073975	Prepare a plan and drawings showing the proposed fire separation details. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of floor openings - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0073976	Provide fire rated separation between floors by implementing the plan reviewed previously by Pakistan Accord.



Figure 2.25 - Unprotected Opening from 1st to 2nd floor Main Building

8.5 Separation of occupancies

Pakistan Accord Standard requires different occupancy types to be fire separated from each other. The aim is to limit the fire to only one occupancy type.

The following deficiencies have been observed on site, including (list not exhaustive):
- Basement is not fire separated from the rest of the Main Building.
- Large office areas not fire separated from the production areas e.g. 1st floor office area Main Building
- Day care is not fire separated from storage area in Main Building Ground Floor.
- Areas with above 50 occupants is not fire separated from the rest of the building e.g. Canteen Area is not Fire separated from design studio .

Recommended remedial actions are provided below.F-202603-063516

Timeline	Remediation Plan
Medium Term CAP-0073993	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Different occupancy types in the building - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0073994	Provide fire rated separation between occupancies as per proposal reviewed by Pakistan Accord



Figure 2.26 - Large office area not fire separated from production area 1st floor Main Building



Figure 2.27 - Child care is not fire separated from rest of the building ground floor Main Building



Figure 2.28 - Canteen Area is not fire separated from Design studio 2nd floor Main Building



Figure 2.29 - Basement is not fire separated from rest of the Main Building

8.6 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area
- Storage height is less than 2.45m
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from the office area 2nd floor Main Building & ground floor from child room & production area.

Recommended remedial actions are provided below.F-202603-063512

Timeline	Remediation Plan
Medium Term CAP-0073966	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0073967	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard



Figure 2.30 - Ground floor storage area is not fire separated from day care ground floor Main Building



Figure 2.31 - Storage area is not fire separated from office area Main Building 2nd floor

9. Fire Suppression

9.1 Standpipe system

Per Pakistan Accord Standard a Class-I standpipe systems is required in the building. The system should be designed and installed in accordance with NFPA 14.
Main Building requires standpipe system due to the number of stories exceeding 2 with a fire floor area exceeding 2325 sq m.

The following deficiencies have been observed on site, including (list not exhaustive):
- There are no standpipes in the main building.
- Missing standpipe outlets in stairs of Main Building .

Recommended remedial actions are provided below.F-202603-063509

Timeline	Remediation Plan
Medium Term CAP-0073920	(1) Submit design documentation for the required standpipe system and supporting infrastructure to Pakistan Accord for review before purchasing any new equipment. Design documentation to include drawings, technical data sheets, and product certifications of all listed equipment to show full compliance of the system with NFPA 14, 20, 22, and 24.
Medium Term CAP-0073921	(2) Submit documentation to Pakistan Accord showing that an L/C has been opened for import of any components required for the system design submitted earlier.
Longer Term CAP-0073922	(3) Submit documentation to Pakistan Accord demonstrating that all materials, both imported and locally procured, have been purchased and are available on site for installation of the system.
Longer Term CAP-0073923	(4) Once installation of the system is complete, factory to submit full "as-built" documentation of the system to Pakistan Accord for review.
Longer Term CAP-0073924	(5) Factory to advise Pakistan Accord when system installation is fully completed and the system is fully functional. Pakistan Accord will then arrange a verification inspection to ensure that the installation fully complies with the previously reviewed design documentation

Longer Term CAP-0073925	(6) Provide full testing and commissioning (T&C) certification from the system installer and make provision for attendance of the system installer, factory technical personnel, and Pakistan Accord technical team to witness a final T&C demonstration verification on site. On successful completion of this T&C verification inspection, remediation of the system will be complete

9.2 Fire pumps

Per Pakistan Accord Standard, a complete fire pump set is required. The pump set should be designed and installed in accordance with NFPA 20. The system should comprise of a) Electric pump (Main), b) Diesel Pump (Back-Up), and c) Jockey Pump. Each pump should be provided with individual drivers and controllers. Pumps shall be installed with positive suction. These measures are intended to provide a level of resilience whereby a failure of a pump or lack of power in the building will not compromise fire water supply in the building.

The following deficiencies have been observed on site, including (list not exhaustive):

- Fire pump set is not listed.

Recommended remedial actions are provided below.F-202603-063497

Timeline	Remediation Plan
Longer Term CAP-0073849	Provide electric duty pump, diesel backup fire pumps, and jockey pumps, together with individual drivers and controllers, in accordance with NFPA 20 as part of the supporting infrastructure to the SUPS system by following the steps (1) to (6) above.



Figure 2.32 - Non-listed Fire Pump

9.3 Water supply

Fire water storage provisions on site should comply with NFPA 22.

The following deficiencies have been observed on site, including (list not exhaustive):

-No design documents were provided to verify the availability of a dedicated fire water supply.

Recommended remedial actions are provided below.F-202603-063503

Timeline	Remediation Plan
Longer Term CAP-0073883	Provide fire water supply and storage that complies with Building Code of Pakistan and NFPA 22 & NFPA 24 as part of the supporting infrastructure to the SUPS system by following the steps (1) to (6) above.

10. Fire Safety Management

10.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):

- Fire drill documentation is of poor standard; for example, the provided pictorial evidence does not include date and time stamps.

Recommended remedial actions are provided below.F-202603-063498

Timeline	Remediation Plan
Medium Term CAP-0073855	Conduct a fire drill and make records, including findings and recommended future improvements.
Longer Term CAP-0073856	Ensure fire drills are performed a minimum of 2 times per year.

10.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):

- No records of testing of Fire Extinguishers
- No records of testing of Fire Doors
- No records of testing of Emergency Exit Signage

Recommended remedial actions are provided below.F-202603-063513

Timeline	Remediation Plan
Medium Term CAP-0073971	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0073972	- Ensure all systems are being tested as per the schedule agreed with Accord. - Keep testing records.

10.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):

- No records of maintenance of Fire Extinguishers
- No records of maintenance of Fire Doors
-No records of maintenance of Emergency Exit Signage

Recommended remedial actions are provided below.F-202603-063508

Timeline	Remediation Plan
Medium Term CAP-0073915	- Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0073916	- Ensure all systems are being maintained as per the schedule agreed with Accord. - Keep maintenance records.

10.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023.
Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation
plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid firefighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):

- There is no EAP document which details procedures, roles and responsibilities in the event of fire.

Recommended remedial actions are provided below.F-202603-063499

Timeline	Remediation Plan
Medium Term CAP-0073858	Ensure that evacuation plans are provided on each level. Prepare an Emergency Action Plan report.
Longer Term CAP-0073859	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

11. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.