Issue	**1**
Factory ID	**920016**
Date of Issue	**07-Apr-2026**

Agility Textile (Pvt.) Ltd.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Kahna Rohi Nala, Gujjar Chowk, Tibba Lahore
54000 Lahore
Punjab Pakistan

Latitude: [31.393564], longitude: [74.323596]
Date of inspection: 26-Feb-2026

Structural Safety Inspection Report

Observations & Actions



Authors	**Muhammad Asim**
Reviewed by	**Talha Akram Khan**
Approved by	**Paul Rigby**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 26-02-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 4
2. Building Extents 6
   2.1 Structural System 14
3. Documentation 16
4. Structural Safety Measures 17
5. Remediation Support 19
   5.1 Engineering Support 19
6. Other Damage/Defects 20
   6.1 Corrosion of reinforcement 20
   6.2 Health and Safety 22
7. Structural Documentation 24
   7.1 Documentation unavailable 24
   7.2 Lack of safe load plans 25
8. Assessment Limitations and Assumptions 26

1. Executive Summary

On 26-Feb-2026, Owais Raza and Muhammad Asim on behalf of the Pakistan Accord carried out an initial structural inspection for Agility Textile (Pvt.) Ltd., a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Asad Ali (Head Admin), Mr. Talal Mehmood (Compliance Consultant), and other staff members of Agility Textile (Pvt.) Ltd.
The factory operates in a general single shift. Approximately 120 workers operate in the factory with 15 workers being females.
The factory comprises of one main building and four ancillary structures. The basement and ground floor of main building was used by the owner, however first and second floor of the main building and all ancillary structures were rented by Agility Textile (Pvt.) Ltd. During the inspection, the area highlighted in blue in Figure 1.1 was inspected, with the site boundary indicated in red.

- **Main Building** is a four storey (Basement+Ground+2) building. The structural system of the building consists of an RC moment-resisting frame system with RC retaining wall at periphery of basement level. The building is used for solar panels (roof), offices, storage (second floor) pressing, packing, sampling, accessory store, sewing storage offices (first floor), washing area, kitchen, storage (ground floor), offices, storage, (basement). The construction year of the building is 2020.
- **Ancillary Structure** consist of four ancillary structures details of which are given below:
    - **Gate office** is a single storey (Ground only) structure having load bearing brick masonry wall supporting RC slab. The structure is used for gate office (ground floor). The construction year of building is 2020.
    - **Mess area** is a single storey (Ground only) structure having load bearing brick masonry wall supporting precast girder and slab panels. The structure is used for dinning area (ground floor). The construction year of structure is 2020.
    - **Compressor room** is a single storey (Ground only) structure having load bearing brick masonry walls supporting precast girders and slab panels. The structure is used for compressor room (ground floor). The construction year of building is 2023.
    - **Fire pump room** is a single storey (Ground only) structure having load bearing brick masonry walls supporting precast girders and slab panels. The structure is used for fire pump room (ground floor). The construction year of building is unknown.

Incomplete site layout, architectural drawings, structural drawings and stability certificate were provided by the factory. For further details, refer to table 2 of the documentation.
There is one Health and Safety issue which should be addressed immediately, regarding the lack of edge protection at the roof of main building. Further details are provided in Section 6.
A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:

- Exposed and corroded column dowel reinforcement were observed at roof level and second floor of main building.

We see no reason to suspend operations in the facility due to these concerns, subject to the actions identified being addressed within the specified timeframes.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1 - Building Summary

Building	Use	No. of stories	Year of construction	Structural System	Roof structure system	Any extension/Modification	Engineer access issue
Main Building	Solar panels (roof), offices, storage (second floor) pressing, packing, sampling, accessory store, sewing storage offices (first floor), washing area, kitchen, storage (ground floor), offices, storage, (basement).	Four storeys (Basement+Ground+2)	2020	RC moment-resisting frame system with RC retaining wall at periphery of basement level.	-	-	-
Ancillary Structure							

Gate office	Gate office (ground floor).	Single storey (Ground only)	2020.	Load bearing brick masonry wall supporting RC slab	-	-	-
Mess Area	Dinning area (ground floor).	Single storey (Ground only)	2020.	Load bearing brick masonry wall supporting precast girders and slab panels	-	-	-
Compressor room	Compressor room (ground floor)	Single storey (Ground only)	2023.	Load bearing brick masonry wall supporting precast girders and slab panels	-	-	-
Fire pump room	fire pump room (ground floor)	Single storey (Ground only)	Unknown	Load bearing brick masonry wall supporting precast girders and slab panels	-	-	-



Figure 1.1. Site plan (Satellite View) – Red dashed line indicates site boundary, highlighted area (blue) indicates buildings inspected

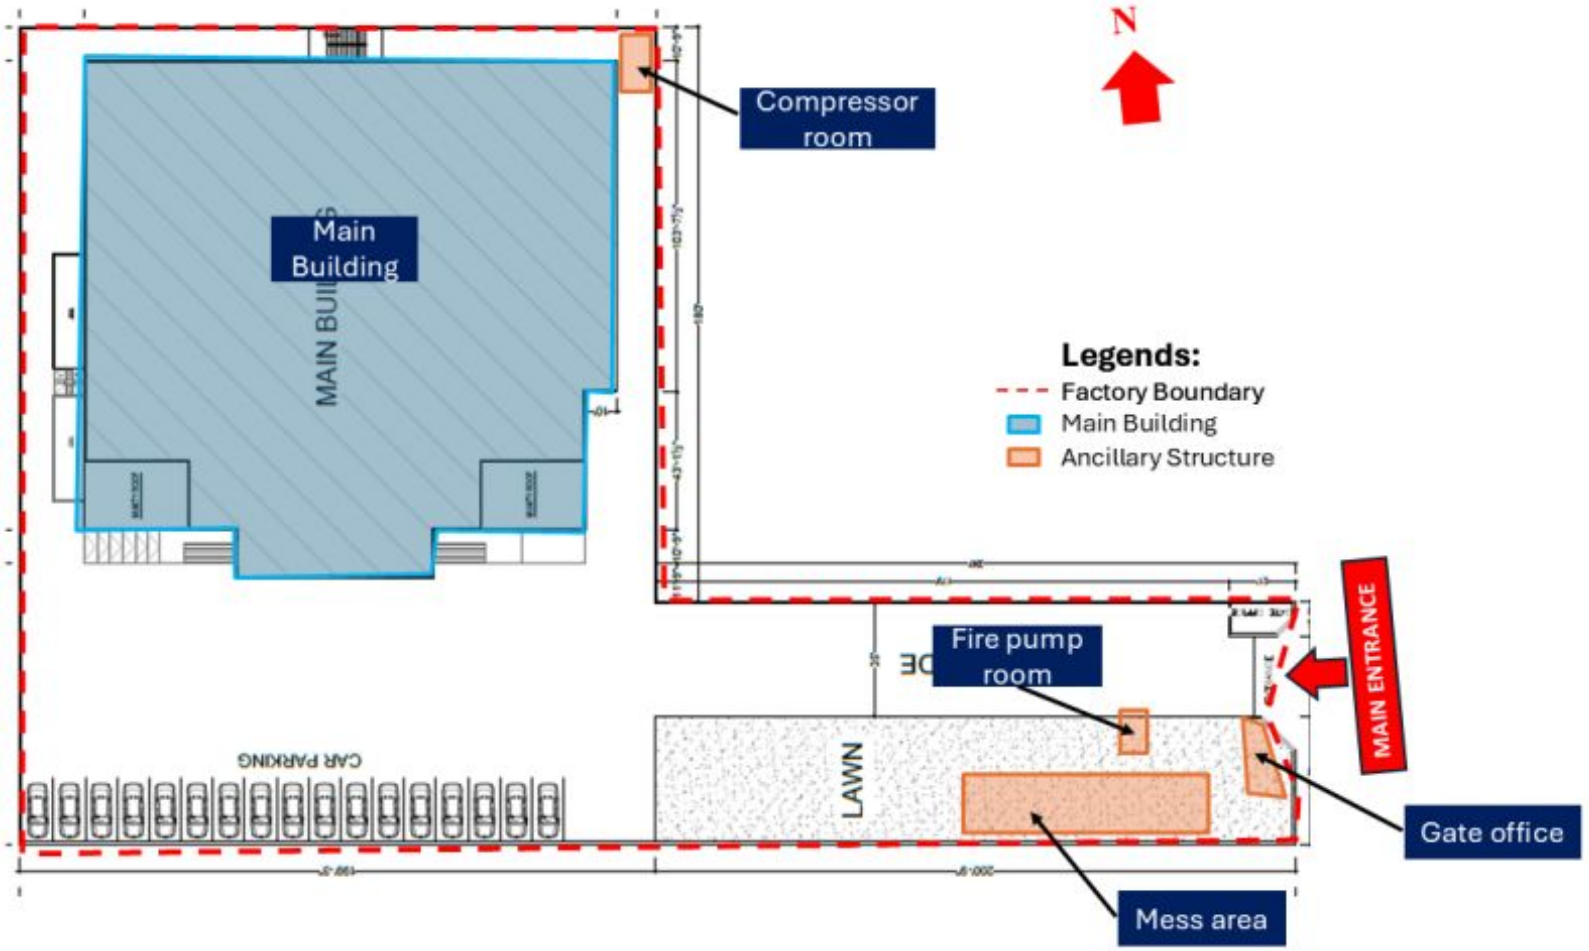


Figure 1.2. Site layout Plan; Red dashed line indicates site boundary, highlighted area indicates buildings inspected



Figure 1.3. Main Building - Front elevation



Figure 1.4. Main Building - Solar panles at roof level



Figure 1.5. Main Building - Offices at second floor



Figure 1.6. Main Building - Storage at second floor



Figure 1.7. Main Building - Pressing at first floor



Figure 1.8. Main Building - Packing at first floor



Figure 1.9. Main Building - Sampling at first floor



Figure 1.10. Main Building - Accessory store at first floor



Figure 1.11. Main Building - Offices at first floor



Figure 1.12. Main Building - Washing and kitchen at ground floor



Figure 1.13. Main Building - Storage at ground floor



Figure 1.14. Main Building - Storage at basement



Figure 1.15. Main Building - Offices at basement



Figure 1.16. Ancillary structure (gate office) - Gate office at ground floor



Figure 1.17. Ancillary structure (mess area) - Mess area at ground floor



Figure 1.18. Ancillary structure (compressor room) - Compressor room at ground floor

2.1 Structural System

Building	Main Building
Stability System	RC moment resisting frame system with RC retaining wall at basement level. Load bearing brick masonry wall system
Column Size (m)	0.63 dia
Grid (m)	9.35x6.75 (Max grid)
Primary Beam Size (m)	0.30x0.62 (Basement) 0.25x0.62 (Typical) 0.30x0.48 (Basement) 0.25x0.48 (Typical)
Secondary Beam Size (m)	0.30x0.48 (Basement) 0.25x0.48 (Typical)
Slab Depth (m)	0.165
Finishes Depth (m)	0.135
Floor to Ceiling Height (m)	3.60 (Basement - Ground) 3.70 (Typical)


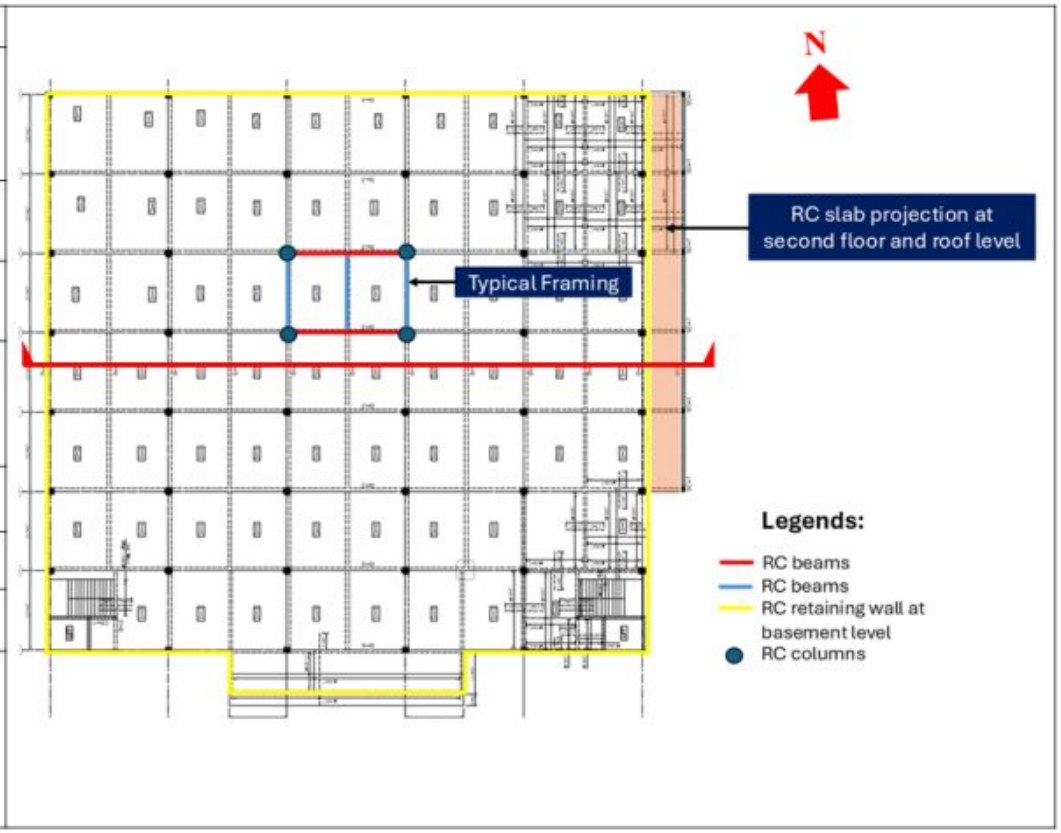


Figure 1.19. Typical floor framing plan detail of main building

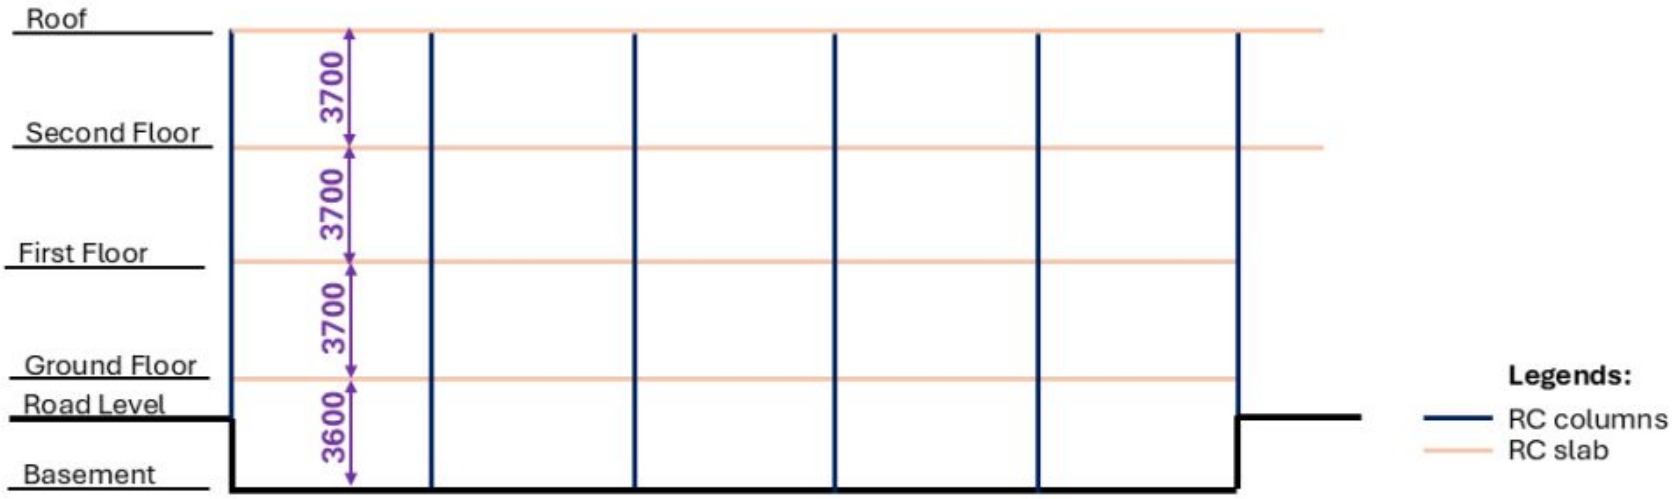

Structural System Notes

Column size is the structural dimension and excludes the render thickness.

Grid measurements are from centre of column to centre of column.

Beam sizes do not include slab depth.

Figure 1.20. Typical section of main building

3. Documentation

We were presented with incomplete site layout plan, architectural drawings, structural drawings, geotech report and stability certificate at the factory.

Table 2 - Documentation

Building	Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plan	Stability certificate	Inspection reports	Materials testing
Main Building	Yes (Incomplete)	No	Yes	Yes	Yes	No	Yes	No	No
Ancillary Structure									
Gate office	No	No	Yes	No	No	-	Yes	No	No
Mess Area	No	No	Yes	No	No	-	Yes	No	No
Compressor room	No	No	Yes	No	No	-	Yes	No	No
Fire pump room	No	No	Yes	No	No	-	Yes	No	No

4. Structural Safety Measures

During our structural site inspection of Agility Textile (Pvt.) Ltd., a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within Agility Textile (Pvt.) Ltd.. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3: Summary of issues by building

Building	Potential Overstress	Structural system	Cracking	Loading	Other damage & defects	Structural documentation
Main Building	-	-	-	-	Health and safety issues – lack of edge protection. Corrosion of reinforcement.	Lack of safe load plans.
Ancillary Structure						
Gate office	-	-	-	-	-	Documentation Unavailable
Mess Area	-	-	-	-	-	Documentation Unavailable
Compressor	-	-	-	-	-	Documentation Unavailable

room						
Fire pump room	-	-	-	-	-	Documentation Unavailable

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202603-063539

Timeline	Remediation Plan
Medium Term CAP-0074231	Factories should begin remediation of CAP items such as surface cracks or non-structural repairs using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Other Damage/Defects

6.1 Corrosion of reinforcement

This refers to the exposed rebars on the roof level and second floor of main building where the rebars were corroded because of being exposed to the atmosphere. This corrosion can lead to reduction in the capacity of the rebars over time F-202603-063632

Timeline	Remediation Plan
Medium Term CAP-0074242	Propose the remedial measure to protect the dowel reinforcement from future atmospheric corrosion and submit to Pakistan Accord for review.
Longer Term CAP-0074243	Implement the required remedial work.



Figure 2.1 - Main building - Identified location of corrosion of dowelreinforcement at roof level and second floor



Figure 2.2 - Main building - Corrosion of dowel reinforcement at second floor.



Figure 2.3 - Main building - Corrosion of dowel reinforcement at roof level.

6.2 Health and Safety

It concerns with lack of edge protection on the roof of main building and at the ground floor staicase, which present a risk of potential injury resulting from slip, trip or fall from roof during the access and maintenance of services – Health & Safety concern. F-202603-063633

Timeline	Remediation Plan
Immediate CAP-0074244	Provide adequate edge protection on the roof level, at ground floor staircase, and on any other part of the factory with the same issue.



Figure 2.4 - 1A01 Main building - Identified location of lack of edge protection at roof level and at ground floor staircase



Figure 2.6 - Main building - Lack of edge protection at roof level



Figure 2.5 - Main building - Lack of edge protection at roof level



Figure 2.7 - Main building - Lack of edge protection at ground floor staircase.

7. Structural Documentation

7.1 Documentation unavailable

As built drawings of all ancillary strucutres are not avaiable. Additionally compressor room and fire pump room are not marked on site layout plan and needs to be updated. F-202603-063635

Timeline	Remediation Plan
Longer Term CAP-0074248	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete as built documentation.

7.2 Lack of safe load plans

No safe load plans were posted on any floor of main building. F-202603-063634

Timeline	Remediation Plan
Longer Term CAP-0074245	Building structural engineer to review design documentation to confirm load capacity of the structure.
Longer Term CAP-0074246	Develop safe load plans and submit to Pakistan Accord for review.
Longer Term CAP-0074247	Factory to post safe load plans on each floor.

8. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.