Issue	**1**
Factory ID	**25333**
Date of Issue	**22-Apr-2026**

Ali Trading Company (Pvt.) Ltd.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

6 Km Daska Road
51310 Sialkot
Punjab Pakistan

Latitude: [32.45229], longitude: [74.49852]
Date of inspection: 12-Mar-2026

Fire Safety Inspection Report

Observations & Actions



Authors	**Abdul Hayee**
Reviewed by	**Fraz Hayder**
Approved by	**Paul Rigby**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 12-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 8
3. Building Description 12
   - 3.1 Building Means of Egress Details 15
   - 3.2 Building Use 23
4. Documentation 27
5. Fire Safety Measures 28
6. Remediation Support 29
   - 6.1 Engineering Support 29
7. Means of Escape 30
   - 7.1 Escape doors 30
   - 7.2 Exit access 33
   - 7.3 Travel distance 36
   - 7.4 Number of exits 37
   - 7.5 Protection of stairs 38
   - 7.6 Escape stair condition 41
   - 7.7 Exit discharge 42
   - 7.8 Exit signage 44
8. Fire Rated Construction 46
   - 8.1 Separation of high-risk areas 46
   - 8.2 Separation of high-risk areas 48
   - 8.3 Separation of shafts 51

8.4 Atrium 53
8.5 Separation of occupancies 55
8.6 Separation of occupancies 57
8.7 Separation of occupancies 59
8.8 Storage 61
9. Fire Suppression 64
9.1 Fire extinguishers 64
10. Hazardous Materials 66
10.1 Chemicals handling 66
10.2 Chemicals storage 68
11. Fire Safety Management 70
11.1 Fire drills 70
11.2 Records of system testing 71
11.3 Records of systems maintenance 72
11.4 Emergency Action Plan 73
12. Assessment Limitations and Assumptions 74

1. Executive Summary

On 12-Mar-2026, Ghulam Azam and Abdul Hayee on behalf of the Pakistan Accord carried out an initial fire inspection for Ali Trading Company (Pvt.) Ltd., a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Syed Ghayyoor Abbas (GM Sustainability), Ms. Muqadas Shahzadi (EMS Manager), Mr. Aaqib Riaz(Electrical Engineer), Mr. Muhammad Rizwan (Structural Engineer), Mr. Muhammad Zeeshan (HR & Compliance Manager) along with other staff members of the factory. As the assessment was being carried out as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Accord were also present and the team was led by Mr. Abdul Hayee from Pakistan Accord.
The factory comprises of 8 buildings and 12 ancillary structures.
Details of buildings are provided below:

1. **Management Block Building** is a 2 storey B+G+1 (basement is not counted as a storey) RC moment resisting frame building, with a covered area (footprint) of 613 sq. m. Building has 4 staircases out of which 2 discharge internally. The building is used for document store (basement), offices (ground floor), offices, kitchen, daycare, dining area (first floor), and unoccupied roof. The building was constructed in 2003.

2. **Football Production 1 Building** is a 3 storey G+2 RC moment resisting frame building, with a covered area (footprint) of 1900 sq. m. The height of the building is 8.9m measured from the fire department vehicle access to the topmost occupied floor. A total of 2 staircase serves the building out of which one staircase discharges internally. The building is used for press cutting, manual cutting, football issue, finish good warehouse (ground floor); football stitching, offices, thermos-bonded ball manufacturing, textile checking and textile packing (first floor); football printing & panel sorting (second floor); solar panels (roof) .The ground and first floor of the building was constructed in 2003 and second floor of the building was constructed in 2021.

3. **Football Production 2 Building** is a 3 storey G+2 RC moment resisting frame building, where part of the building is PEB Shed, with a covered area (footprint) of 1450 sq. m. The height of the building is 8.9m measured from the fire department vehicle access to the topmost occupied floor. A total of 2 staircase serves the building both staircases discharges externally. The building is used for raw material warehouse and bladder inspection (ground floor); football machine stitching and quality control (first floor); panel punching, bladder winding, stitcher printing and thermos bonding ball production (second floor) and unoccupied roof. The ground and first floor of the building was constructed in 2003, and second floor of the building was constructed in 2021.

4. **Football Production 3 Building** is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 1360 sq. m. A total of 2 staircase serves the building both staircases discharges externally. The building is used for washing, packing & final inspection (ground floor); molding, gluing, final stitch & bladder pasting (first floor); and solar panels (roof) .The building was constructed in 2013.

5. **Composite & Textile Production Building** is a 2 storey G+M1+M2+1 RC moment resisting frame building, with a covered area (footprint) of 3520 sq. m. A total of 6 staircase serves the building, three staircases discharges externally and three staircases serve mezzanines. The building is used for paddle racket production, field hockey production, offices, chemical store, bag production, molding, pre-peg & paint booths (ground floor); storage (mezzanine 1); printing & offices (mezzanine 2); stitching, offices, cutting, packing & storage (first floor); and solar panels (roof) .The building was constructed in 2003.

6. **Chemical Warehouse** is a two storey G+1 Load bearing brick masonry system building, with a covered area (footprint) of 240 sq. m. A total of 2 staircase serves the building; both staircases discharge externally. The building is used for storage (ground and first floor) and unoccupied roof. The building was constructed in 2019.

7. **Composite Production 1** is a G only Load bearing brick masonry system building, with a covered area (footprint) of 2150 sq. m. The building is used for composite semi finish, spray paint area, wooden hockey production, sanding and storage (ground floor). The building was constructed in 2003 and 2021.

8. **Composite Production 2** is a G only Load bearing brick masonry system building, with a covered area (footprint) of 155 sq. m. The building is used for padel racket drilling, composite semi finishing and waste storage (ground floor). The building was constructed in 2007.

Details of ancillaries are provided below:

1. **Security room, purchase office and clinic** is a G only Load bearing brick masonry structure. The structure is used for Security room, purchase office and clinic. The structure was constructed in 2003.
2. **Electrical workshop and driver room** is a G only Load bearing brick masonry structure. The structure is used for Security room, purchase office and clinic. The structure was constructed in 2003.
3. **Mosque** is a G only Load bearing brick masonry structure. The structure is used for prayer area. The structure was constructed in 2003.
4. **Generator room 1** is a G only Load bearing brick masonry structure. The structure is used for generators and electric panels. The structure was constructed in 2003.
5. **Generator room 2 and compressor room** is a G only Load bearing brick masonry structure. The structure is used for generators, electric panels and compressors. The structure was constructed in 2015 and 2022.
6. **Security guard room** is a G only Load bearing brick masonry structure. The structure is used for security guard residencies. The structure was constructed in 2022.
7. **Canteen** is G only Load bearing brick masonry structure. The structure is used for dining area. The structure was constructed in 2024.
8. **Cooking area** is G only Load bearing brick masonry structure. The structure is used for dining area. The structure construction year was unknown.
9. **R & D Lab** is a G only Load bearing brick masonry structure. The structure is used for laboratory. The structure was constructed in 2024.
10. **Press cutting hall** is a G only Load bearing brick masonry structure. The structure is used for cutting operation. The structure was constructed in

2010.
11. Lamination hall is a G only Load bearing brick masonry structure. The structure is used for lamination operation. The structure was constructed in 2010.
12. Welding workshop is a G only steel shed. The structure is used for welding operation. The structure was constructed in 2022.

The factory complex is entirely occupied by Ali Trading Company (Pvt.) Ltd. as owner.
The factory operates in general shift with approximately 1500 workers out of which approximately 15% employees are female.
We were presented with Architectural Layouts, Section layout, Evacuation Maps, Emergency Action Plan, Civil Defence Certificate, Inspection record, Fire Drills and Staff Training documents.


A summary of the main concerns identified during the inspection includes (non-exhaustive):
- Lockable mechanisms observed in escape route across the whole facility.
- Travel Distances exceeding permitted limits.
- There is no fire separation between stairs, lift shafts and the rest of the building.
- Multiple stairs discharge inside the building.
- Storage areas are not fire separated from rest of the building.

We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes.)

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

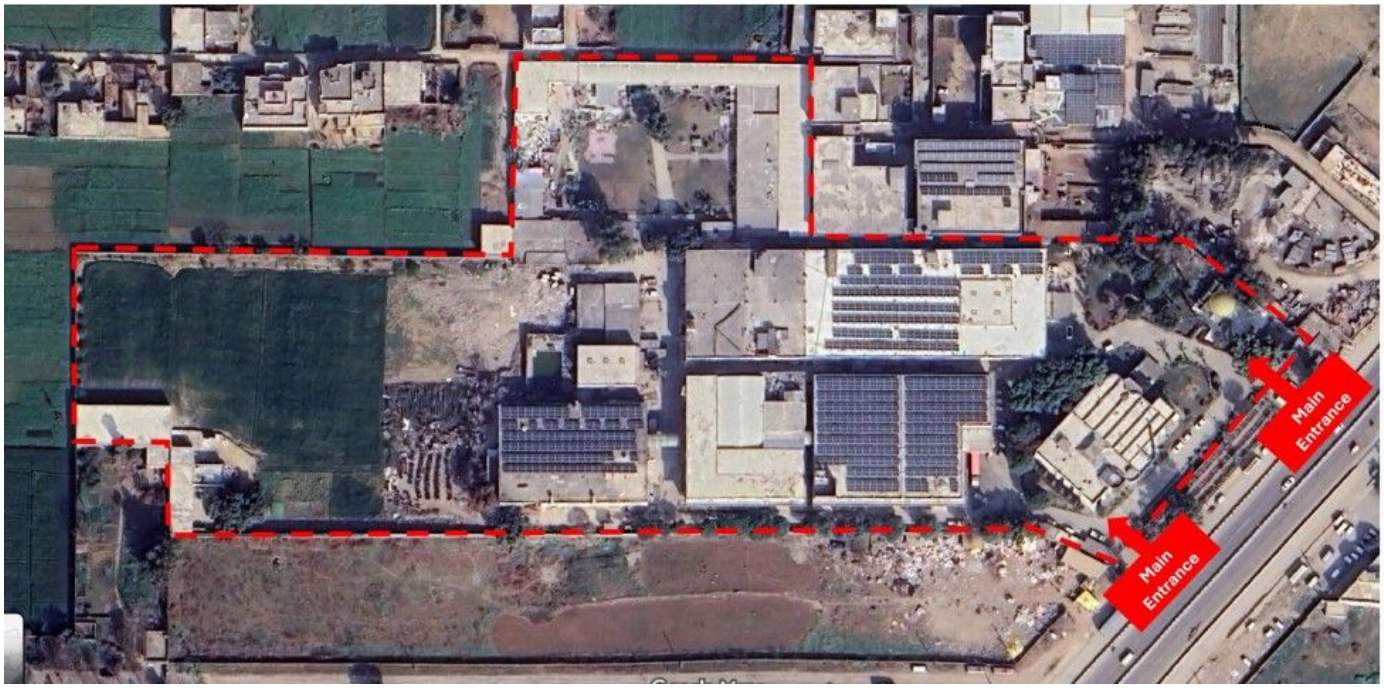

Approx. factory boundary

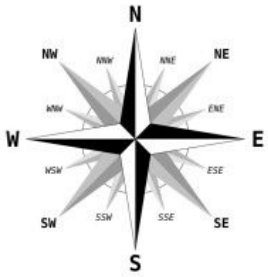


Figure 1.1. Satellite View of the Factory Premises



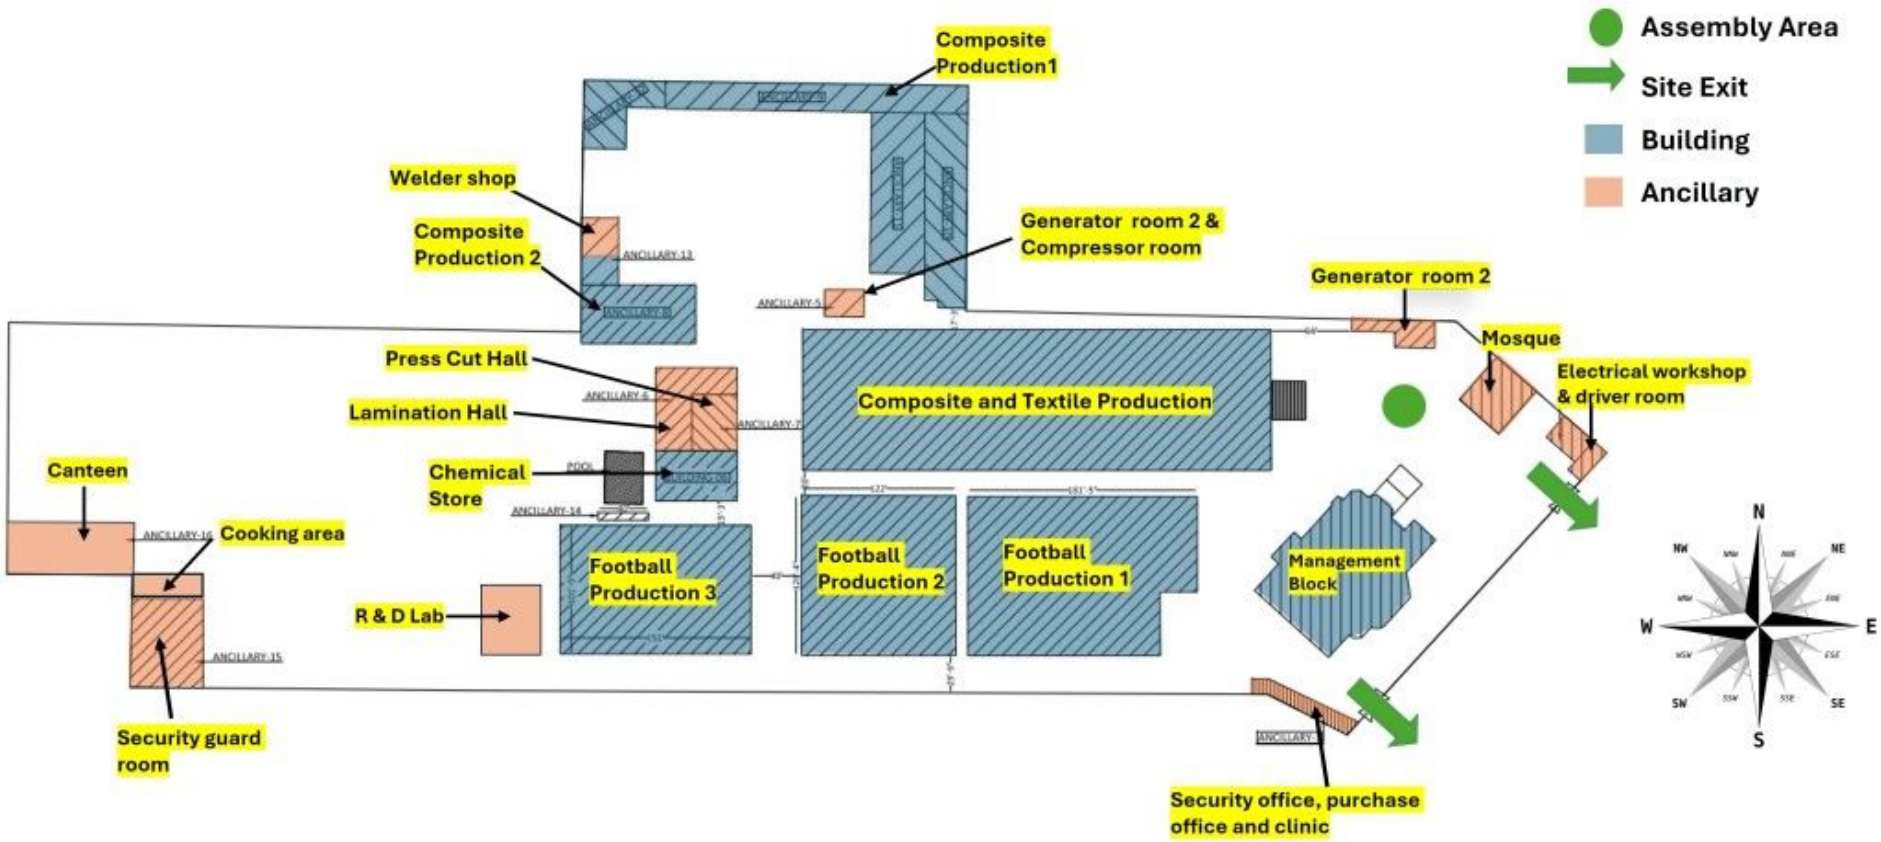


Figure 1.2. Site layout

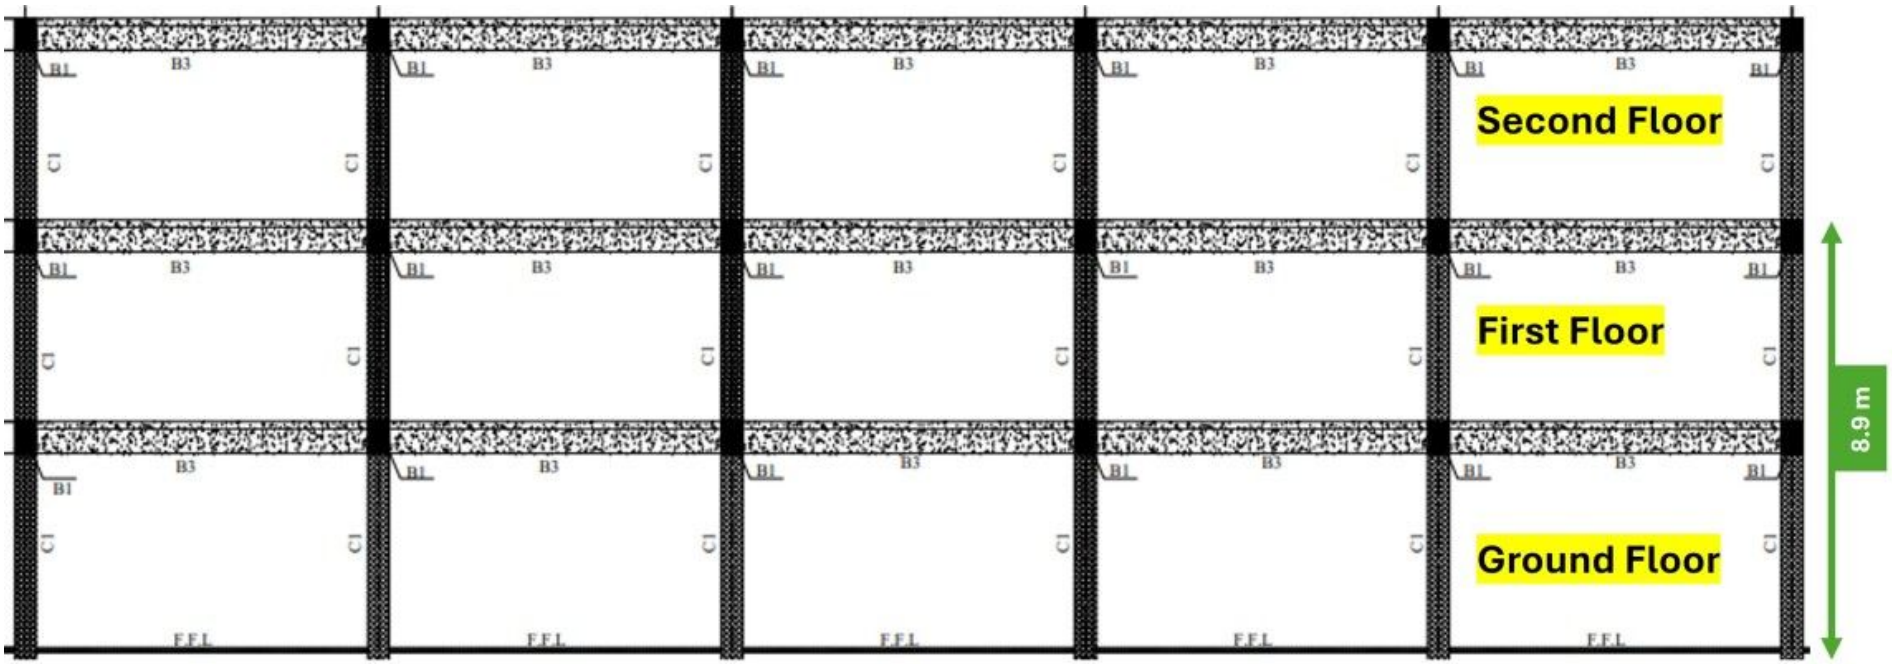

Height is 8.9m from fire department access road to the topmost occupied floor

Figure 1.3. Section layout of the Football Production 1 Building

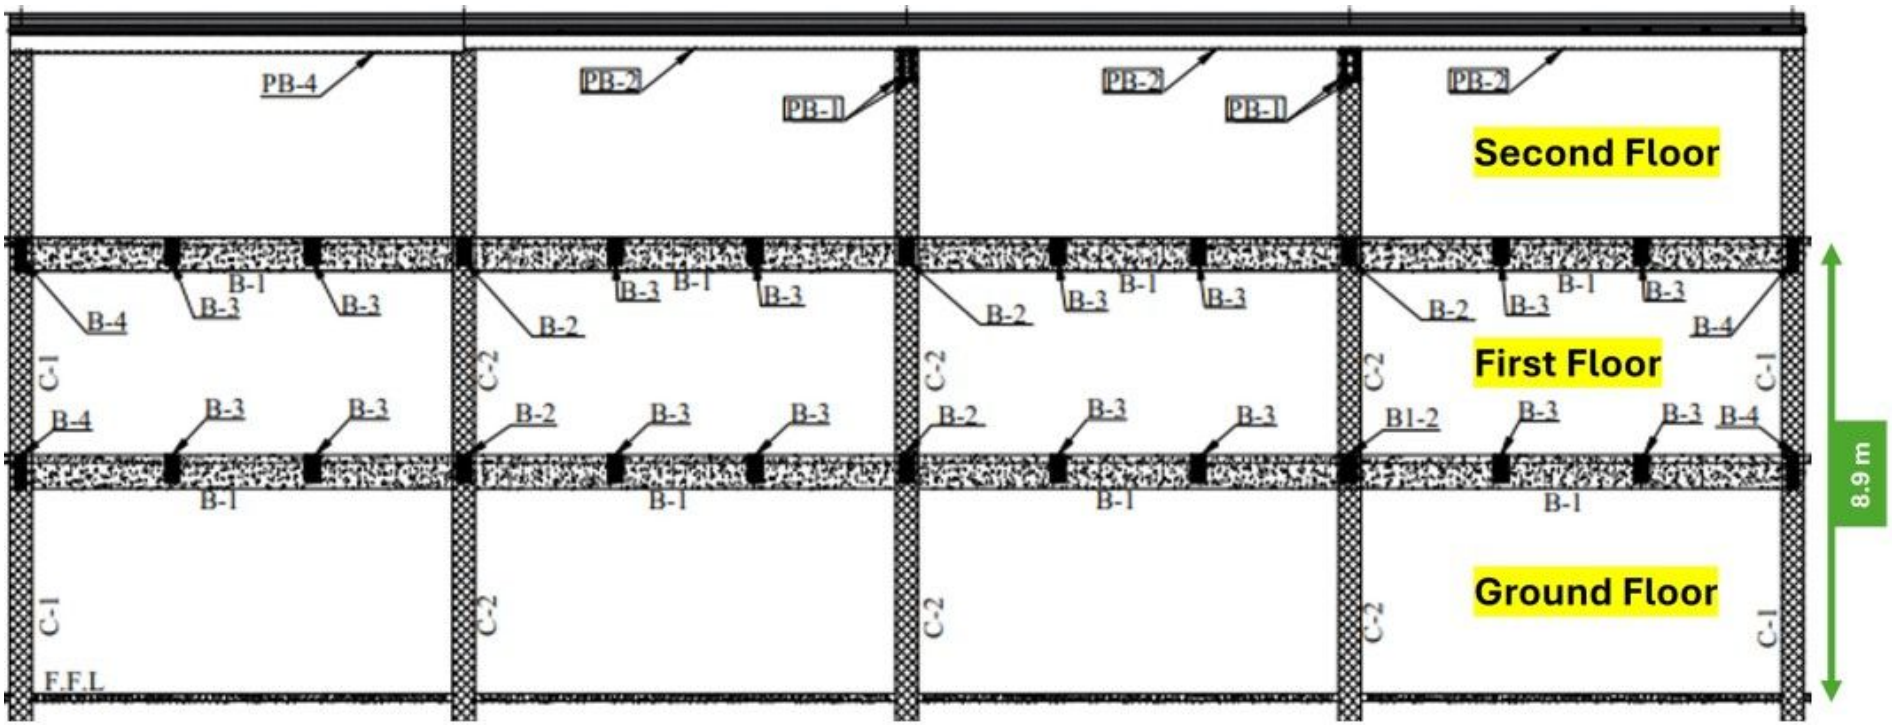

Height is 8.9m from fire department access road to the topmost occupied floor

Figure 1.4. Section layout of the Football Production 2 Building

3. Building Description

The factory comprises of 8 buildings and 12 ancillary structures.
Details of buildings are provided below:

1. **Management Block Building** is a 2 storey B+G+1 (basement is not counted as a storey) RC moment resisting frame building, with a covered area (footprint) of 613 sq. m. Building has 4 staircases out of which 2 discharge internally. The building is used for document store (basement), offices (ground floor), offices, kitchen, daycare, dining area (first floor), and unoccupied roof. The building was constructed in 2003.

2. **Football Production 1 Building** is a 3 storey G+2 RC moment resisting frame building, with a covered area (footprint) of 1900 sq. m. The height of the building is 8.9m measured from the fire department vehicle access to the topmost occupied floor. A total of 2 staircase serves the building out of which one staircase discharges internally. The building is used for press cutting, manual cutting, football issue, finish good warehouse (ground floor); football stitching, offices, thermos-bonded ball manufacturing, textile checking and textile packing (first floor); football printing & panel sorting (second floor); solar panels (roof) .The ground and first floor of the building was constructed in 2003 and second floor of the building was constructed in 2021.

3. **Football Production 2 Building** is a 3 storey G+2 RC moment resisting frame building, where part of the building is PEB Shed, with a covered area (footprint) of 1450 sq. m. The height of the building is 8.9m measured from the fire department vehicle access to the topmost occupied floor. A total of 2 staircase serves the building both staircases discharges externally. The building is used for raw material warehouse and bladder inspection (ground floor); football machine stitching and quality control (first floor); panel punching, bladder winding, stitcher printing and thermos bonding ball production (second floor) and unoccupied roof. The ground and first floor of the building was constructed in 2003, and second floor of the building was constructed in 2021.

4. **Football Production 3 Building** is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 1360 sq. m. A total of 2 staircase serves the building both staircases discharges externally. The building is used for washing, packing & final inspection (ground floor); molding, gluing, final stitch & bladder pasting (first floor); and solar panels (roof) .The building was constructed in 2013.

5. **Composite & Textile Production Building** is a 2 storey G+M1+M2+1 RC moment resisting frame building, with a covered area (footprint) of 3520 sq. m. A total of 6 staircase serves the building, three staircases discharges externally and three staircases serve mezzanines. The building is used for paddle racket production, field hockey production, offices, chemical store, bag production, molding, pre-peg & paint booths (ground floor); storage

(mezzanine 1); printing & offices (mezzanine 2); stitching, offices, cutting, packing & storage (first floor); and solar panels (roof) .The building was constructed in 2003.

6. Chemical Warehouse is a two storey G+1 Load bearing brick masonry system building, with a covered area (footprint) of 240 sq. m. A total of 2 staircase serves the building; both staircases discharge externally. The building is used for storage (ground and first floor) and unoccupied roof. The building was constructed in 2019.

7. Composite Production 1 is a G only Load bearing brick masonry system building, with a covered area (footprint) of 2150 sq. m. The building is used for composite semi finish, spray paint area, wooden hockey production, sanding and storage (ground floor). The building was constructed in 2003 and 2021.

8. Composite Production 2 is a G only Load bearing brick masonry system building, with a covered area (footprint) of 155 sq. m. The building is used for padel racket drilling, composite semi finishing and waste storage (ground floor). The building was constructed in 2007.

Details of ancillaries are provided below:

1. Security room, purchase office and clinic is a G only Load bearing brick masonry structure. The structure is used for Security room, purchase office and clinic. The structure was constructed in 2003.

2. Electrical workshop and driver room is a G only Load bearing brick masonry structure. The structure is used for Security room, purchase office and clinic. The structure was constructed in 2003.

3. Mosque is a G only Load bearing brick masonry structure. The structure is used for prayer area. The structure was constructed in 2003.

4. Generator room 1 is a G only Load bearing brick masonry structure. The structure is used for generators and electric panels. The structure was constructed in 2003.

5. Generator room 2 and compressor room is a G only Load bearing brick masonry structure. The structure is used for generators, electric panels and compressors. The structure was constructed in 2015 and 2022.

6. Security guard room is a G only Load bearing brick masonry structure. The structure is used for security guard residencies. The structure was constructed in 2022.

7. Canteen is G only Load bearing brick masonry structure. The structure is used for dining area. The structure was constructed in 2024.

8. Cooking area is G only Load bearing brick masonry structure. The structure is used for dining area. The structure construction year was unknown.

9. R & D Lab is a G only Load bearing brick masonry structure. The structure is used for laboratory. The structure was constructed in 2024.

10. Press cutting hall is a G only Load bearing brick masonry structure. The structure is used for cutting operation. The structure was constructed in 2010.
11. Lamination hall is a G only Load bearing brick masonry structure. The structure is used for lamination operation. The structure was constructed in 2010.
12. Welding workshop is a G only steel shed. The structure is used for welding operation. The structure was constructed in 2022.

3.1 Building Means of Egress Details

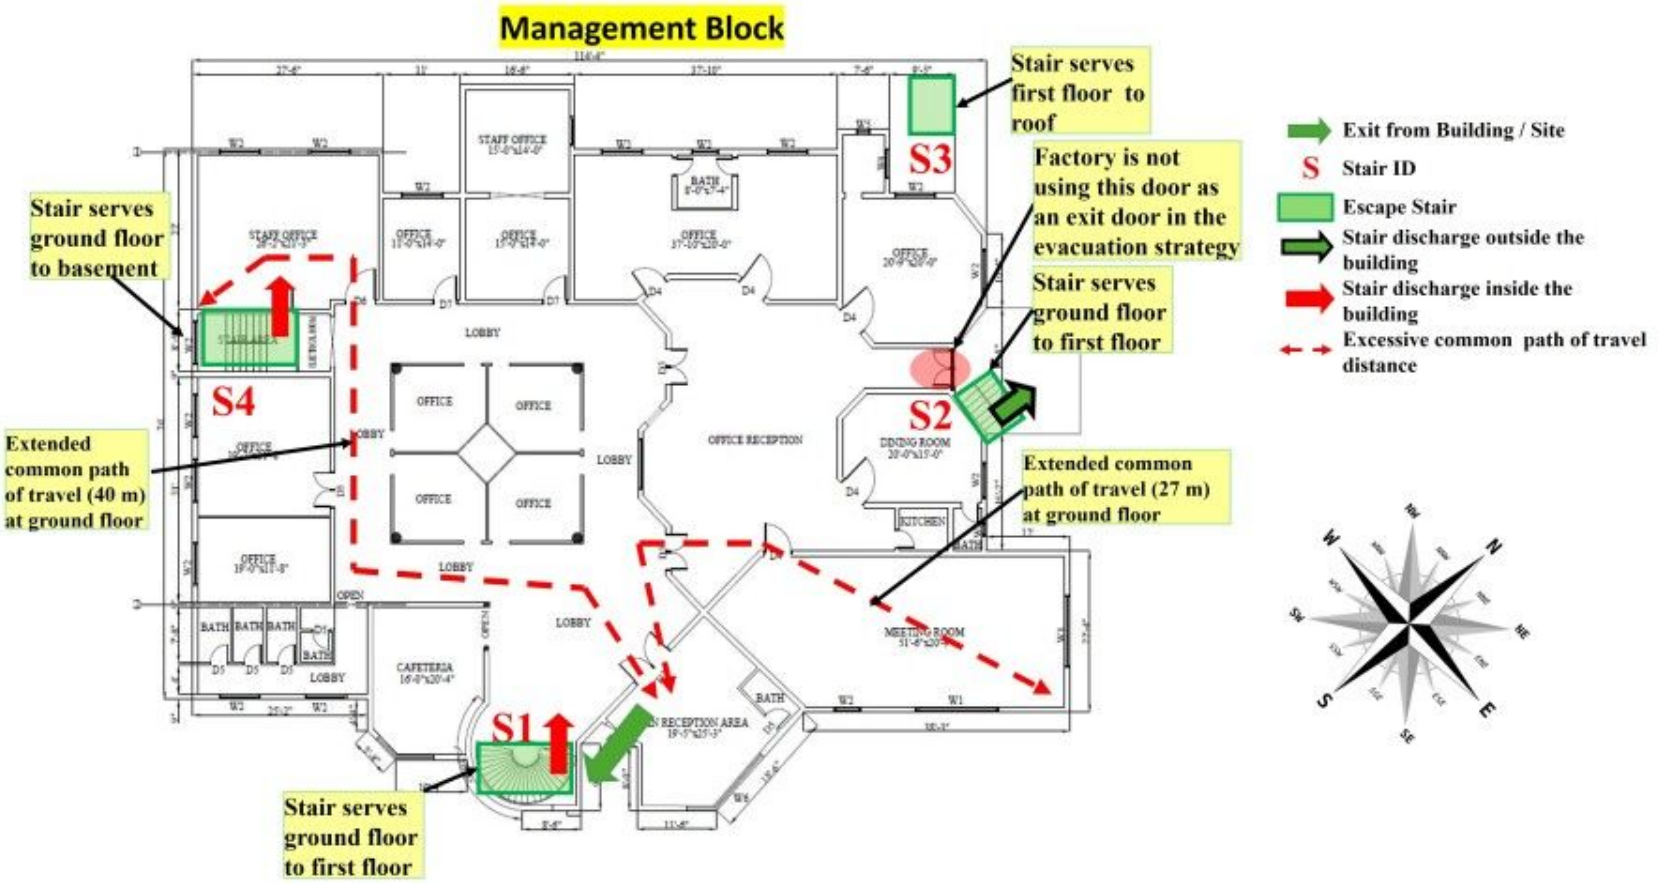


Figure 1.5. Egress layout for Management Block Building

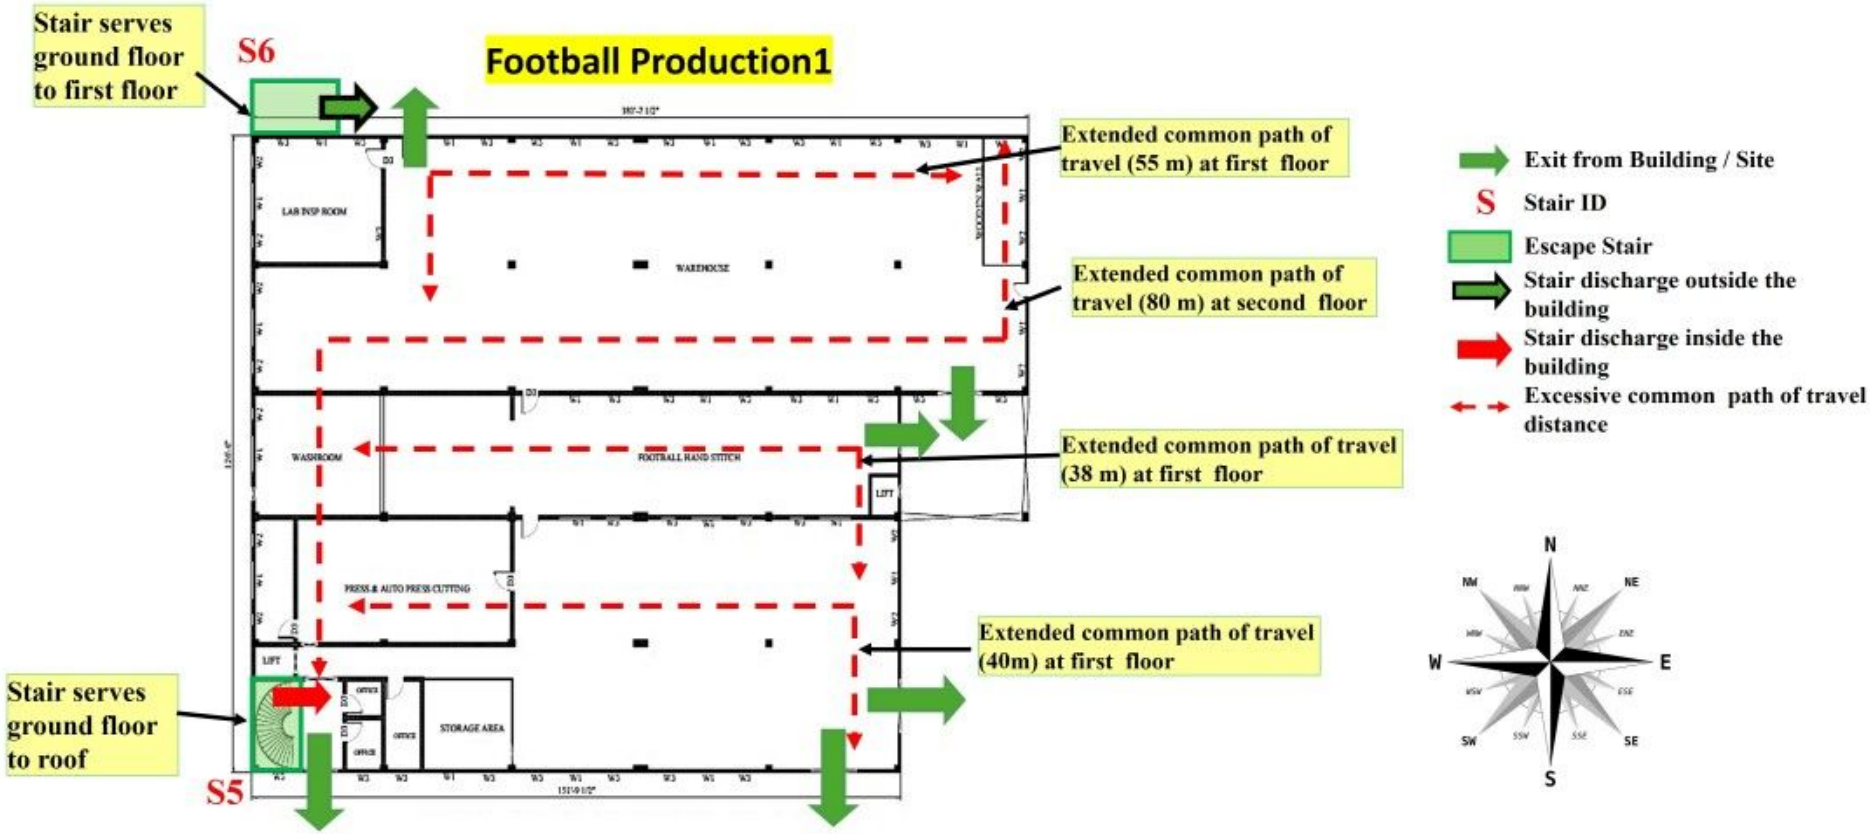


Figure 1.6. Egress layout for Football Production 1 Building

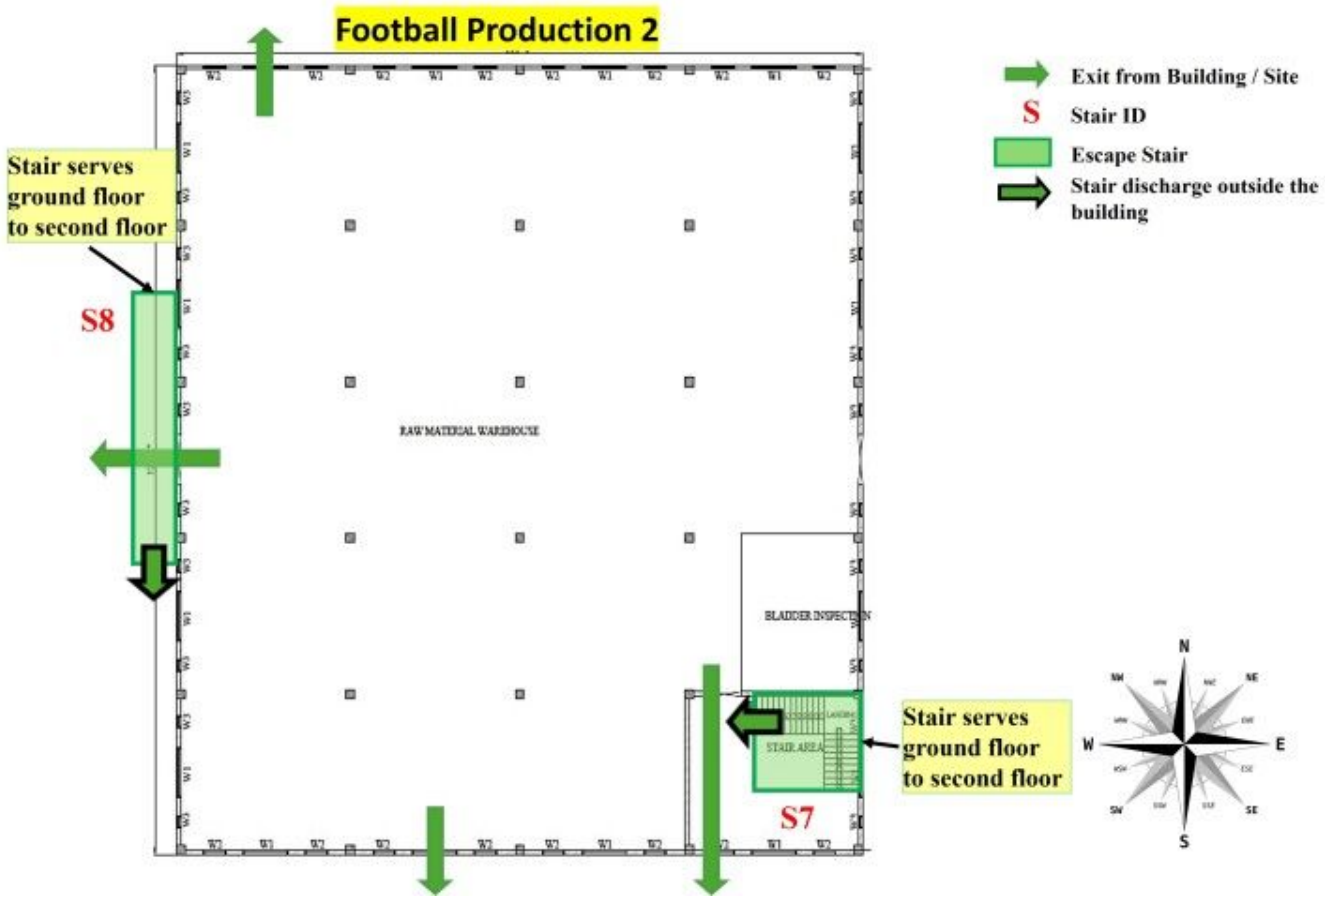


Figure 1.7. Egress layout for Football Production 2 Building

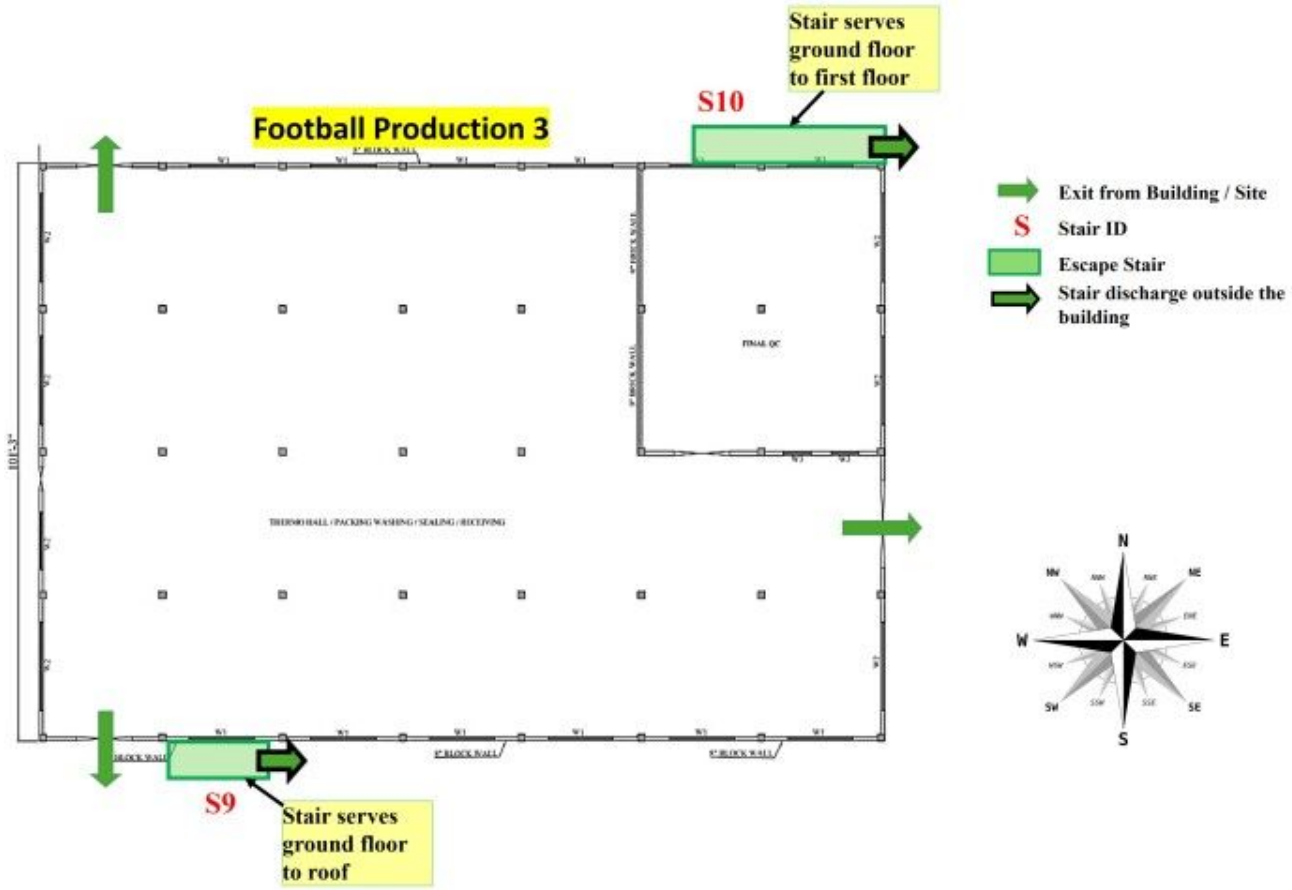


Figure 1.8. Egress layout for Football Production 3 Building

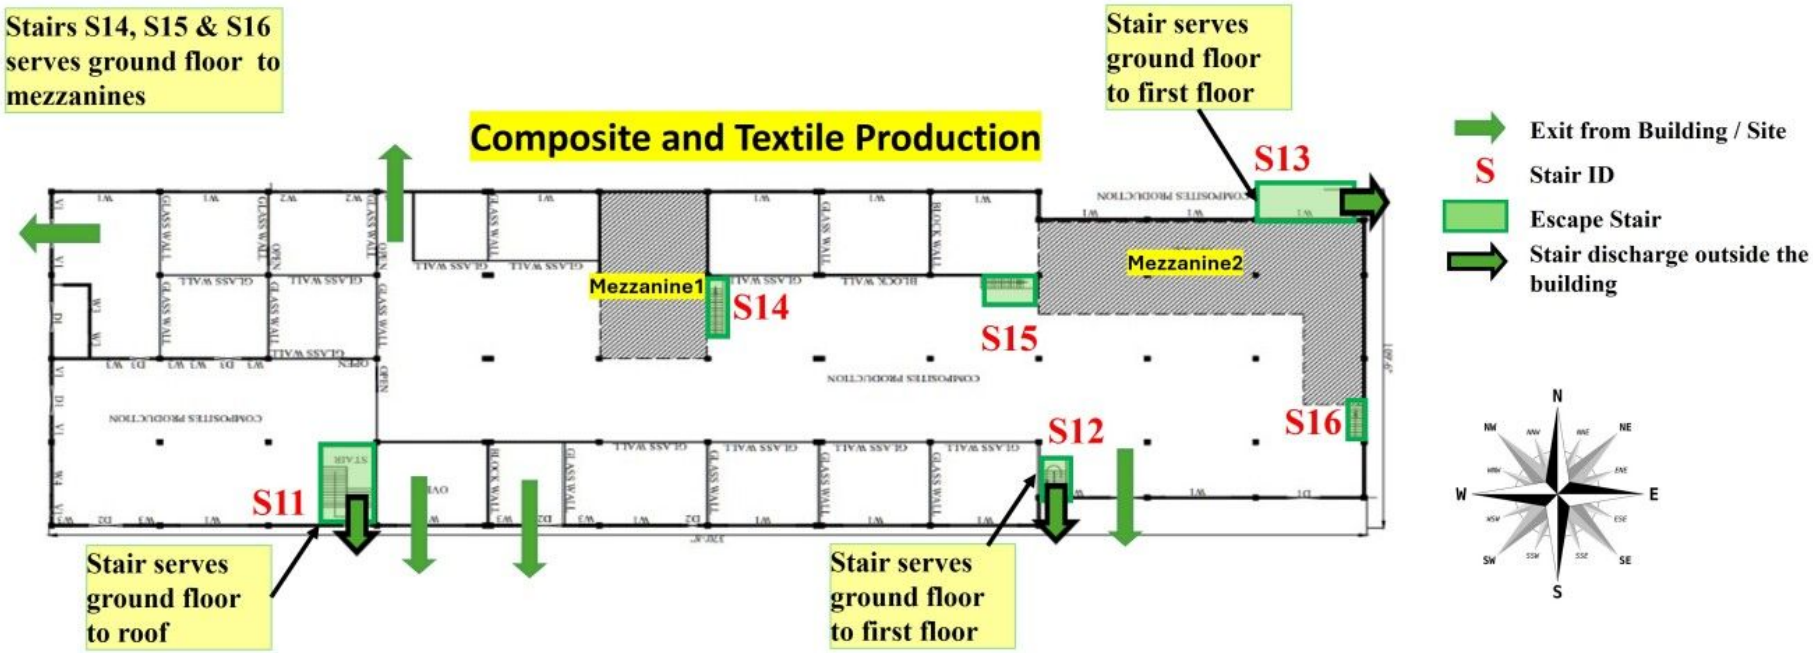


Figure 1.9. Egress layout for Composite and Textile Production Building

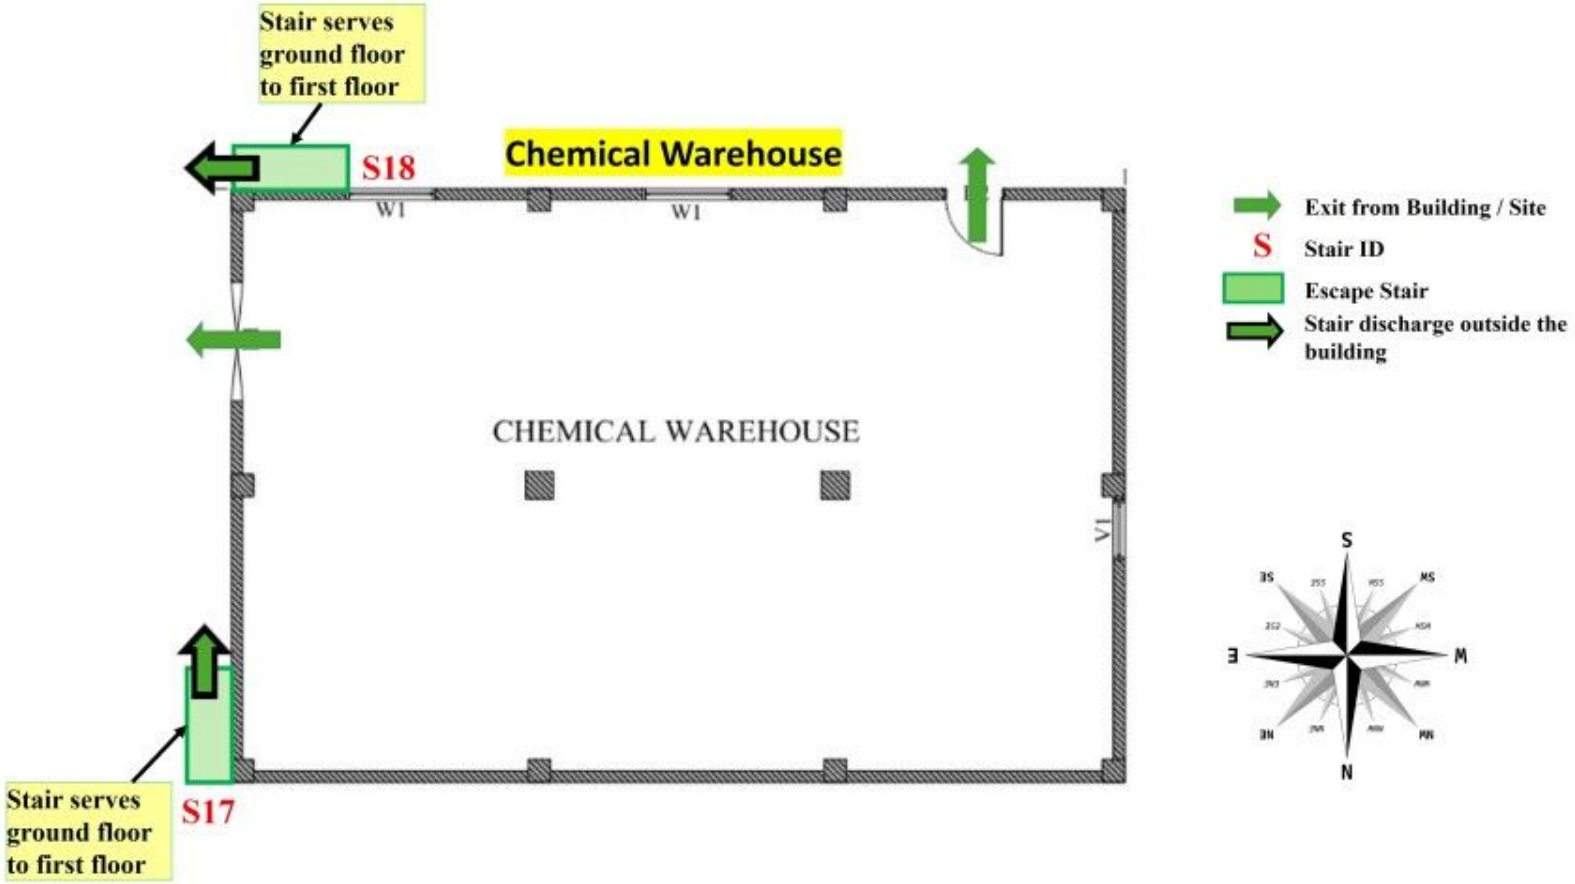


Figure 1.10. Egress layout for Chemical Warehouse Building

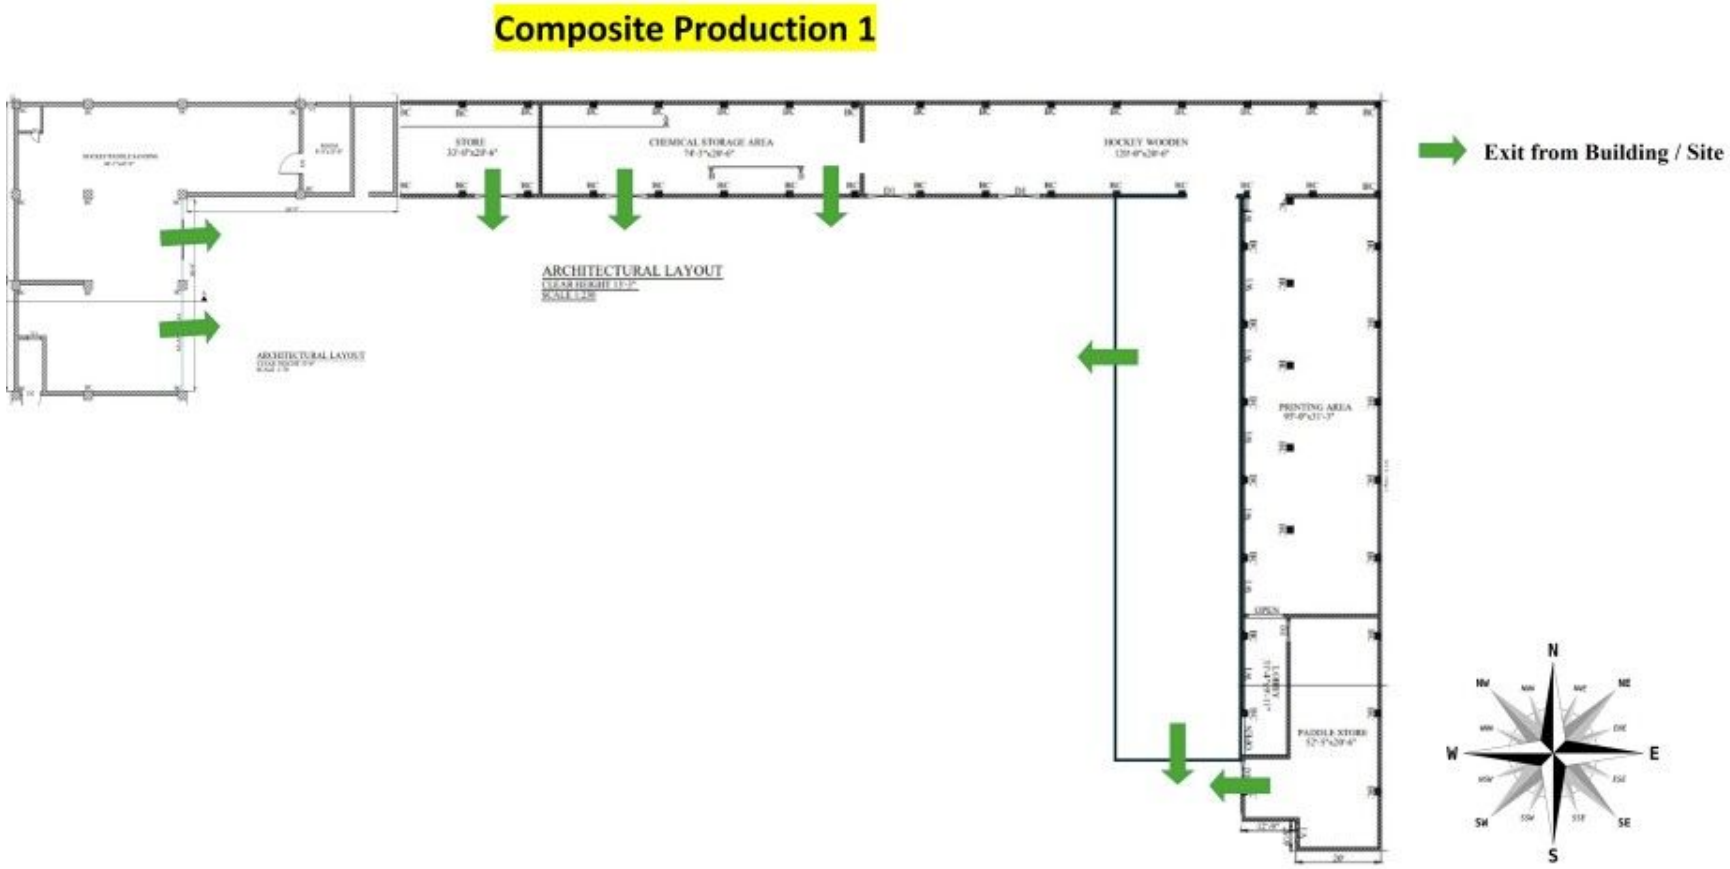


Figure 1.11. Egress layout for Composite Production 1 Building

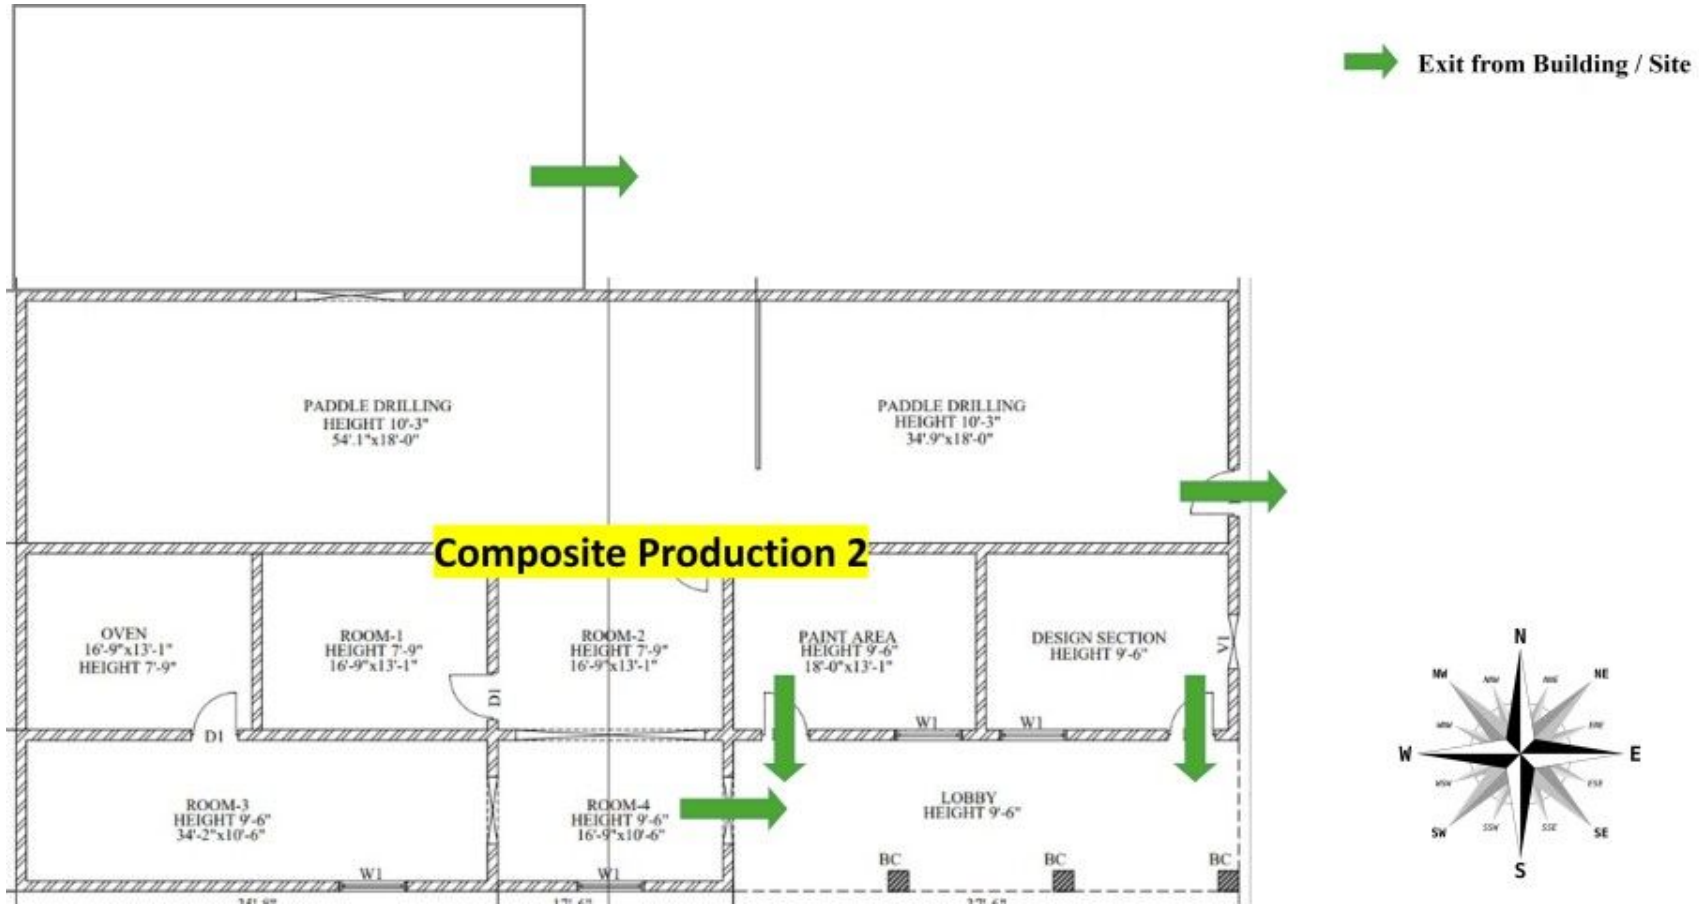


Figure 1.12. Egress layout for Composite Production 2 Building

3.2 Building Use

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
Management Building				Total Travel Distance	Common Path	Dead End
Roof	Unoccupied	-	1	-	-	-
First floor	Offices, kitchen, daycare, dining area	25	2	-	-	-
Ground Floor	Offices	50	1	-	40m & 27m	-
Basement	Document store	4	1	-	-	-
Football Production 1 Building						
Roof	Solar Panels	-	1	-	-	-
Second Floor	Football printing & panel sorting	150	1	-	80m	-
First Floor	Football stitching machine, offices, thermo bonded ball manufacturing, textile checking and textile packing	180	1	-	38m, 55m & 40m	-
Ground Floor	Press cutting, manual cutting,	80	6	-	-	-

	football issue, finish good warehouse					
Football Production 2 Building						
Roof	Unoccupied	-	1	-	-	-
Second Floor	Panel punching, bladder winding, stitcher printing and thermos bonding ball production	100	2	-	-	-
First Floor	Football machine stitching and quality control	90	2	-	-	-
Ground Floor	Raw material warehouse and bladder inspection	80	3	-	-	-
Football Production 3 Building						
Roof	Solar Panels	-	1	-	-	-
First Floor	Molding, gluing, final stitch & bladder pasting	70	2	-	-	-
Ground Floor	Washing, packing & final inspection	60	3	-	-	-
Composite & Textile Production Building						

Roof	Solar Panels	-	1	-	-	-
First Floor	Stitching, offices, cutting, packing & storage	280	2	-	-	-
Mezzanine 2	Printing & offices	30	2	-	-	-
Mezzanine 1	Storage	5	1	-	-	-
Ground Floor	Paddle racket, production, field hockey production, offices, chemical store, bag production, molding, pre-peg & paint booths	200	4	-	-	-
	sublimation	5	1	-	-	-
Chemical Warehouse						
Roof	Unoccupied	-	-	-	-	-
First Floor	Storage	15	2	-	-	-
Ground Floor	Storage	15	2	-	-	-
Composite Production 1						
Ground floor	Composite semi finish, spray paint	80	8	-	-	-

	area, wooden hockey production, sanding and storage					
Composite Production 2						
Ground Floor	Padel racket drilling and composite semi finishing	20	2	-	-	-
	Waste store	4	1	-	-	-
	Waste store	4	1	-	-	-
	Waste store	8	1	-	-	-

The travel distance issues were observed at Management Building (ground floor) and Football Production Building 1 (second & first floor). Single exit issue was observed at ground floor of the Management Block Building and second floor of the Football Production 1 Building. Moreover, exits do not meet the remoteness criteria at first floor of the Football Production 1 Building.

4. Documentation

This table shows the details about the documentation provided by the factory.

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defence Certificate (NOC)		Yes	16-10-2025	-
2.	Architecture Layout		Yes	27-09-2023	Not as built
3.	Sectional Layout		Yes	27-09-2023	Not as built
4.	Evacuation Maps		Yes	-	On floors
5.	Emergency Action Plan		Yes	15-March-2020	Not as per Pakistan Accord Building Standard
6.	Inspection	Fire extinguishers	Yes	07-March-2026	Not as per Pakistan Accord Building Standard
		Exit signage	No	-	Not available
7.	Testing	Fire extinguishers	No	-	Not available
		Exit signage	No	-	Not available
8.	Maintenance	Fire extinguishers	No	-	Not available
		Exit signage	No	-	Not available
9.	Evidence of Fire Drills		Yes	16-10-2025 -	Not as per Pakistan Accord Building Standard.
10.	Staff Training		Yes	16-10-2025	Firefighting Training

5. Fire Safety Measures

During our fire site inspection of Ali Trading Company (Pvt.) Ltd., a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within Ali Trading Company (Pvt.) Ltd.. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202603-064111

Timeline	Remediation Plan
Immediate CAP-0075165	Factories should begin remediation of CAP items such as installing extinguishers, signage, and clearing escape routes using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required.

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.
- Doors into stairs, stair discharge doors, final exit doors from site, and all doors serving areas with more than 50 occupants shall swing in the direction of escape
- Sliding doors shall not serve for escape from areas with more than 10 occupants

This is not always achieved, examples include (list not exhaustive):
- Escape doors are lockable throughout the facility.
- Doors serving areas with over 50 occupants swing against the direction of escape i.e. main escape door (ground floor) of the Management Block Building swing against the direction of escape.
- Doors into stairs swing against the direction of escape i.e. door into S2 (first floor) swing against the direction of escape.
- Sliding doors serve for escape from areas with more than 10 occupants i.e. sliding door installed at warehouse (ground floor) of Football Production 1 Building, sliding door installed into stair S1 (first floor).

Recommended remedial actions are provided below.F-202603-063984

Timeline	Remediation Plan
Immediate CAP-0074899	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term CAP-0074900	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5. Replace sliding doors with swing doors or provide bypass doors nearby or pocket doors built into the existing sliding door, that are side swinging and open in the direction of travel to an exit.

Longer Term CAP-0074901	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Sliding door installed at warehouse (ground floor) of Football Production 1 Building



Figure 2.2 - Lockable escape door in warehouse (ground floor) of Football Production 1 Building



Figure 2.3 - Main escape door (ground floor) of the Management Block Building swing against the direction of escape



Figure 2.4 - Door into S2 (first floor) swing against the direction of escape

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.
- Headroom along escape route should be more than 2.05m.

This is not always achieved, examples include (list not exhaustive):
- Blocked and obstructed escape route in multiple buildings i.e. blocked escape route in Chemical Warehouse Building (ground & first floor).
- Stair discharges inside the building at a distance from building exit i.e. S1, S4, S5
- Insufficient headroom along escape route (i.e. headroom height is less than 2.05m) i.e. 1.87m headroom height in S11 (intermediate landing between first and ground floor), 1.2m headroom height at mezzanine 1 of Composite and Textile Production Building.

Recommended remedial actions are provided below.F-202603-063981

Timeline	Remediation Plan
Immediate CAP-0074892	Remove obstructions and blockage on escape routes and keep them clear for escape. Provide warning signs where headroom height is less than 2.05 m on escape routes.
Medium Term CAP-0074893	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks) Propose modifications to ensure 2.05m headroom height is achieved along the escape routes or propose alternative egress routes that comply. Submit the proposal to Pakistan Accord for review.

Longer Term CAP-0074894	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted. Implement measures to ensure adequate clear head height is achieved along all escape routes.



Figure 2.5 - 1.2m headroom height at mezzanine 1 of Composite and Textile Production Building



Figure 2.6 - Blocked escape route in Chemical Warehouse Building (first floor)



Figure 2.7 - Stair S1 discharge inside the building

7.3 Travel distance

Travel distances should meet the limits in the Pakistan Accord Standard. The standard provides limitations on:
- Common path of travel, i.e. the distance the occupants have to travel before there is a choice of escape routes.

This is not always achieved, examples include (list not exhaustive):
- Common path of travel distances exceed permitted limits at following locations:
1. 40m & 27m (ground floor) of the Management Block Building.
2. 80m (second floor) of the Football Production 1 Building.
3. 38m, 40m, & 55m (first floor) of the Football Production 1 Building.

Recommended remedial actions are provided below.F-202603-063985

Timeline	Remediation Plan
Immediate CAP-0074915	Reduce the common path of travel distance to a maximum of 46 m in the areas with higher common path of travel or vacate the area until the travel distance is reduced.
Medium Term CAP-0074916	Propose a plan for addressing the excessive travel distance through alternative escape routes and/or additional exits and submit to Pakistan Accord for review prior to commencing any rectification works on site. Review travel distances from all areas in the building(s) to ensure that they meet the limits in the Pakistan Accord Standard.
Longer Term CAP-0074917	Implement the plan previous reviewed by Pakistan Accord and ensure all travel distances to emergency exits meet the requirements of the Pakistan Accord Standard.

7.4 Number of exits

Per Pakistan Accord Standard, the exit provisions should meet the following:
- Minimum 2 exits from every occupied floor.
- Minimum 2 exits from every occupied area with more than 50 occupants.
- Exits to be sufficiently spaced apart to be classed as alternative exits.
- Alternative exits should not converge in a single point of failure.

This is not always achieved, examples include (list not exhaustive):

- Single exit from some of the occupied floors i.e. ground floor of the Management Block Building, second floor of the Football Production 1 Building.
- Exits do not meet the remoteness criteria i.e. first floor of the Football Production 1 Building.

Recommended remedial actions are provided below.F-202603-063991

Timeline	Remediation Plan
Medium Term CAP-0074949	Review each floor and area to ensure that the number of exits complies with Pakistan Accord Standard. Develop plans and drawings to provide additional exits where necessary. Submit the plan and drawings to Pakistan Accord for review and approval prior to commencing rectification works.
Longer Term CAP-0074950	Implement the above plan as agreed with Pakistan Accord. Number of exits from all floors and parts of the building should comply with Pakistan Accord Standard.

7.5 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- Stair discharge routes should be protected to the same level of safety as the stair.
- There should be no fire load and/or services passing through a stair.

This is not always achieved, examples include (list not exhaustive):
- Unprotected openings into stairs i.e. S6 (first floor & ground floor), S8 (first & ground floor), S11 (ground floor), S18 (ground floor)
- Missing fire rated enclosure and fire doors in stairs. i.e. S1 (all floors), S5 (all floors)
- Doors are not fire doors. i.e. S7 (all floors), S8 (first floor), S11 (first & ground floor)
- Fire load in or under stairs i.e. S10 (ground floor), S11 (ground floor), S4 (first floor)

Recommended remedial actions are provided below.F-202603-063988

Timeline	Remediation Plan
Immediate CAP-0074930	Remove fire load and any other obstructions due to stored items from stairs
Medium Term CAP-0074931	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.

Longer Term CAP-0074932	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.8 - Unprotected openings into stair S11 (ground floor)



Figure 2.9 - Missing fire rated enclosure and fire doors in stair S5 (all floors)



Figure 2.10 - Fire load under stair S10 (ground floor)



Figure 2.11 - Door is not fire door into stair S11 (first floor)

7.6 Escape stair condition

Per Pakistan Accord Standard, escape stairs should be designed to be safe for use, including day to day use.

This is not always achieved, examples include (list not exhaustive):
- One side handrail is missing at stairs S4, S2.

Recommended remedial actions are provided below.F-202603-063986

Timeline	Remediation Plan
Medium Term CAP-0074918	Handrails to be provided on both sides of each stair. Ensure the handrails are at appropriate height.



Figure 2.12 - One side handrail is missing at stair S4

7.7 Exit discharge

Exit discharge routes outside the building should be sufficiently protected so that people can escape safely in the event of a fire anywhere in the building. This includes:
- Escape discharge route should be free of obstruction and trip hazards.

This is not always achieved, examples include (list not exhaustive):
- Obstructions, uneven surface and trip hazard on escape route of Canteen Ancillary Structure.

Recommended remedial actions are provided below.F-202603-063989

Timeline	Remediation Plan
Immediate CAP-0074941	Remove obstructions on external escape routes and keep them clear for escape. Cover any holes and uneven areas in external escape routes.



Figure 2.13 - Obstructions, uneven surface and trip hazard on escape route of Canteen Ancillary Structure

7.8 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs in production areas i.e. first floor of Football Production 3 Building
- Missing exit signs in offices i.e. office (first floor) of the Management Block Building
- Exit signs are not clear / misleading i.e. exit signs leads to chemical store (ground floor) of Composite and Textile Production Building
- Electrically powered exit signs are not a tested and listed system

Recommended remedial actions are provided below.F-202603-063990

Timeline	Remediation Plan
Immediate CAP-0074946	Remove misleading directional escape signs.
Medium Term CAP-0074947	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3
Longer Term CAP-0074948	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.14 - Missing exit sign in offices (first floor) of the Management Block Building



Figure 2.16 - Missing exit signs in production areas (first floor) of Football Production 3 Building



Figure 2.15 - Misleading exit sign leads to chemical store (ground floor) of Composite and Textile Production Building

8. Fire Rated Construction

8.1 Separation of high-risk areas

Per Pakistan Accord Standard, electric steam generators (pressure vessels) in occupied areas require blast protection consisting of:
- Minimum 3 m high reinforced concrete/ block masonry wall to separate it from the rest of the occupied portions of the building.
- Door to be solid steel door with a self-closer and a positive latch.
- Opening from the steam generator room to outside the building to release the blast out from the building.

The aim of these provisions is to protect the occupants nearby from the effects of a potential blast.

The following deficiencies have been in electric steam generator (first floor) placed at Football Production 1 Building (list not exhaustive):

- Steam generator door is not a sturdy door
- Steam generator doors do not have a self-closer and/or a latch
- Steam generator rooms are not enclosed in minimum 3m high sturdy construction to separate them from occupied areas
- Steam generator rooms do not have a permanent opening outside the building

Recommended remedial actions are provided below.F-202603-063972

Timeline	Remediation Plan
Medium Term CAP-0074952	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Separation to electric steam generator up to 3 m above the finished floor level. This should be achieved using reinforced concrete / masonry walls with solid steel doors. - The door must have a self-closer and a positive latch. - Blast vent should be provided to outside the building.
Longer Term CAP-0074953	Implement the above plan on site. All buildings to be compliant with Pakistan Accord Standard.



Figure 2.17 - Electric steam generator (first floor) placed at Football Production 1 Building

8.2 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- Electrical workshop is not fire separated from driver rest room area in Electrical workshop and driver room ancillary structure.
- Compressors areas are not fire separated from Football Production 1 Building and Composite and Textile Production Building at ground floor .
- Kitchen is not fire separated from dining area at first floor of the Management Block Building .
- Oven areas are not fire separated from the production halls throughout the factory i.e. oven is not fire separated from production hall (ground floor) of the Composite and Textile Production Building.
- Gas steam generators are not fire separated from Composite and Textile Production Building.
- Welder workshop is not fire separated Composite Production 2 Building.
- Generator rooms are not fire separated from Electric Panels and compressor room.

Recommended remedial actions are provided below.F-202603-063973

Timeline	Remediation Plan
Medium Term CAP-0074963	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0074964	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.18 - Welder workshop is not fire separated Composite Production 2 Building



Figure 2.19 - Gas steam generators are not fire separated from Composite and Textile Production Building



Figure 2.20 - Kitchen is not fire separated from dining area at first floor of the Management Block Building



Figure 2.21 - Compressors area is not fire separated from Football Production 1 Building



Figure 2.22 - oven is not fire separated from production hall (ground floor) of the Composite and Textile Production Building



Figure 2.24 - Electrical workshop is not fire separated from driver rest room



Figure 2.23 - Generator rooms are not fire separated from Electric Panels and compressor room



Figure 2.25 - Compressors area is not fire separated from Football Production 1 Building

8.3 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction to maintain compartmentation between floors.

The following deficiencies have been observed on site, including (list not exhaustive):

- Lift shafts are not separated with fire rated construction i.e. lift shaft connecting ground floor to first floor of the Management Block Building,

Recommended remedial actions are provided below.F-202603-063978

Timeline	Remediation Plan
Medium Term CAP-0074971	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0074972	Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.26 - Lift shaft connecting ground floor to first floor of the Management Block Building is not fire separated with the fire rated construction

8.4 Atrium

An atrium is a large-volume space created by floor openings connecting two or more stories and covered at the top. Escape via an atrium is not permitted unless the building is fully sprinklered, among other conditions.
Per Pakistan Accord Standard, an atrium must be separated from the adjacent spaces by 1 hour fire resisting construction with opening protectives and a smoke control system may needed.

The following deficiencies have been observed on site, including (list not exhaustive):
- Large opening between two floors of the Management Block Building.

Recommended remedial actions are provided below.F-202603-063983

Timeline	Remediation Plan
Medium Term CAP-0075049	Prepare drawings showing the proposed fire separation and means of escape from all areas bordering on the atrium and submit to Pakistan Accord for review.
Longer Term CAP-0075050	Provide fire rated construction including opening protection assemblies i.e. fire doors and alternative means of escape as needed and according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.27 - Large opening between two floors of the Management Block Building

8.5 Separation of occupancies

Residential sleeping areas should comply with special measures required for sleeping occupancies. Such measures include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key.
- Providing an automatic fire detection and alarm system

The following deficiencies have been observed in dormitory (Security Guard Room Ancillary), including (list not exhaustive):
- Locking devices on doors do not allow for free escape under all circumstances
- No adequate automatic fire detection and alarm system

Recommended remedial actions are provided below.F-202603-063974

Timeline	Remediation Plan
Medium Term CAP-0074967	Document proposals for design of remedial measures to ensure compliance with all fire safety requirements for sleeping occupancies to comply with Pakistan Accord Standard. Submit proposals to Pakistan Accord for review.
Longer Term CAP-0074968	Implement remediation measures to ensure full compliance with dormitory requirements of Pakistan Accord Standard and Pakistan Building Code in accordance with previously reviewed design.



Figure 2.28 - Sleeping area in Security Guard Room Ancillary

8.6 Separation of occupancies

Pakistan Accord Standard requires different occupancy types to be fire separated from each other. The aim is to limit the fire to only one occupancy type.

The following deficiencies have been observed on site, including (list not exhaustive):
- Basement is not fire separated from the rest of the building in Management Block Building.
- Day care is not fire separated from the rest of the building at first floor of the Management Block Building.

Recommended remedial actions are provided below.F-202603-063980

Timeline	Remediation Plan
Medium Term CAP-0074976	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Different occupancy types in the building - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0074977	Provide fire rated separation between occupancies as per proposal reviewed by Pakistan Accord



Figure 2.29 - Day care is not fire separated from the rest of the building at first floor of the Management Block Building



Figure 2.30 - Basement is not fire separated from the rest of the building in Management Block Building

8.7 Separation of occupancies

Pakistan Accord Standard requires close proximity buildings to be fire separated from each other. The aim is to limit the fire to only one building.

The following deficiencies have been observed on site, including (list not exhaustive):
- Football Production 1 Building is not fire separated from Football Production 2 Building.

Recommended remedial actions are provided below.F-202603-064021

Timeline	Remediation Plan
Medium Term CAP-0075060	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Proposed fire separation details (including fire rating of walls, windows and doors)
Longer Term CAP-0075061	Provide fire rated separation between occupancies as per proposal reviewed by Pakistan Accord



Figure 2.31 - Football Production 1 Building is not fire separated from Football Production 2 Building

8.8 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area
- Storage height is less than 2.45m
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from the rest of the building i.e. warehouse is not fire separated from cutting hall (ground floor) of the Football Production 1 Building, Material store is not fire separated from production gall (first floor) of the Composite and Textile Production Building, Paddle storage is not fire separated from semi finish hall (ground floor) of the Composite Production 2 Building.
- Presence of areas where storage does not meet miscellaneous in-process storage requirements (listed above) i.e. excessive in-process storage in cutting area (first floor) of the Composite and Textile Production Building

Recommended remedial actions are provided below.F-202603-063982

Timeline	Remediation Plan
Medium Term CAP-0074978	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0074979	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard



Figure 2.32 - Warehouse is not fire separated from cutting hall (ground floor) of the Football Production 1 Building



Figure 2.33 - Paddle storage is not fire separated from semi finish hall (ground floor) of the Composite Production 2 Building



Figure 2.34 - Excessive in-process storage in cutting area (first floor) of the Composite and Textile Production Building

9. Fire Suppression

9.1 Fire extinguishers

Extinguisher coverage and type of extinguishers used should comply with NFPA 10.

The following deficiencies have been observed on site, including (list not exhaustive):
- Incorrect type of extinguishers in kitchen (first floor) of the Management Block Building.
- Insufficient coverage of fire extinguishers in multiple Buildings.

Recommended remedial actions are provided below.F-202603-064150

Timeline	Remediation Plan
Medium Term CAP-0075315	Ensure that all building areas are protected using fire extinguishers. The coverage and type of extinguishers used should follow NFPA 10.
Longer Term CAP-0075316	Monitor fire extinguishers for coverage and extinguisher type to comply with NFPA 10.



Figure 2.35 - Incorrect type of extinguishers in kitchen (first floor) of the Management Block Building

10. Hazardous Materials

10.1 Chemicals handling

Chemical handling procedures should follow the best international practice.

The following deficiencies have been observed on site, including (list not exhaustive):
- Unsafe handling procedures of chemicals throughout the factory

Recommended remedial actions are provided below.F-202603-064148

Timeline	Remediation Plan
Medium Term CAP-0075308	Develop a chemical handling strategy for the building. Identify dangerous chemicals, how they will be used and handled, the standards that will be followed, and the people responsible for the implementation of the strategy. Submit to Accord for review.
Longer Term CAP-0075309	Implement the chemical handling strategy on site as agreed with Accord.



Figure 2.36 - Unsafe chemical handling

10.2 Chemicals storage

This relates to storage, handling, and use of flammable chemicals and combustible liquids and solids.
Chemical storage areas should be fire separated from the rest of the building.

The following deficiencies have been observed on site, including (list not exhaustive):
- Chemical stores are not stored in a fire separated room from the production hall i.e. chemical store is not fire separated from printing area (second floor) Football Production 1 Building, chemical store is not fire separate from production hall (ground floor) Composite and Textile Production Building.

Recommended remedial actions are provided below.F-202603-063987

Timeline	Remediation Plan
Medium Term CAP-0075064	Factory to collect MSDS sheets for all chemicals stored, classify materials, and propose storage arrangements to meet NFPA 30 requirements. Prepare drawings showing the proposed chemical storage areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all chemical storage areas - Locations of fire rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0075065	Implement the above plan on site. All chemical storage areas to be compliant with Pakistan Accord Standard.



Figure 2.37 - Chemical store is not fire separated from printing area (second floor) Football Production 1 Building

11. Fire Safety Management

11.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Evidence of fire drills is not as per standard (missing date and time stamp on pictorials).

Recommended remedial actions are provided below.F-202603-063979

Timeline	Remediation Plan
Medium Term CAP-0075104	Conduct a fire drill and make records, including findings and recommended future improvements.
Longer Term CAP-0075105	Ensure fire drills are performed a minimum of 2 times per year.

11.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of testing of Fire Extinguishers
- No records of testing of Emergency Exit Signage

Recommended remedial actions are provided below.F-202603-063976

Timeline	Remediation Plan
Medium Term CAP-0075082	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0075083	- Ensure all systems are being tested as per the schedule agreed with Accord. - Keep testing records.

11.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
-No records of maintenance of Fire Extinguishers
-No records of maintenance of Emergency Exit Signage

Recommended remedial actions are provided below.F-202603-063975

Timeline	Remediation Plan
Medium Term CAP-0075080	- Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0075081	- Ensure all systems are being maintained as per the schedule agreed with Accord. - Keep maintenance records.

11.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023.
Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation
plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid fire fighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):

- An Emergency Action Plan (EAP) document is available; however, it does not comply with the required standard.

Recommended remedial actions are provided below.F-202603-063977

Timeline	Remediation Plan
Medium Term CAP-0075094	Ensure that evacuation plans are provided on each level. Prepare an Emergency Action Plan report.
Longer Term CAP-0075095	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

12. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.