Issue	**1**
Factory ID	**25333**
Date of Issue	**28-May-2026**

Ali Trading Company (Pvt.) Ltd.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

6 Km Daska Road
51310 Sialkot
Punjab Pakistan

Latitude: [32.45229], longitude: [74.49852]
Date of inspection: 12-Mar-2026

Structural Safety Inspection Report

Observations & Actions



Authors	**Owais Raza**
Reviewed by	**Qaseem Uz Zaman Khan**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 12-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 8
   2.1 Structural System 29
3. Documentation 40
4. Structural Safety Measures 42
5. Remediation Support 46
   5.1 Engineering Support 46
6. Potential Overstress 47
   6.1 Highly stressed columns 47
   6.2 Highly stressed columns 49
7. Structural System 51
   7.1 Lack of local stability 51
8. Other Damage/Defects 53
   8.1 Corrosion of reinforcement 53
   8.2 Corrosion of reinforcement 54
   8.3 Corrosion of reinforcement 55
   8.4 Column impact damage 56
   8.5 Excessive deflection or vibration 58
   8.6 Health and Safety 60
   8.7 Health and Safety 61
   8.8 Health and Safety 62
9. Structural Documentation 63

9.1 Documentation unavailable..... 63
9.2 Differs from as-built structure..... 64
9.3 Non-engineered structure..... 65
9.4 Non-engineered structure..... 67
9.5 Lack of safe load plans..... 69
10. Assessment Limitations and Assumptions..... 70

1. Executive Summary

On 12-Mar-2026, Haris Mahmood and Owais Raza on behalf of the Pakistan Accord carried out an initial structural inspection for Ali Trading Company (Pvt.) Ltd., a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with Syed Gahyyoor Abbas (GM Sustainability), Muqadas Shahzadi (EMS Manager), Muhammad Rizwan (Structural Engineer) other staff members of Ali Trading Company Pvt Ltd. The assessment was conducted as part of an overall Structural, Fire, and Electrical initial inspection.
The factory operates in single shift. Approximately 1700 workers operate in the factory with 100 workers being females.
The factory consists of 20 structures owned by Ali Trading Company Pvt Ltd. During the inspection, the areas highlighted in Figure 1.1 were surveyed, with the site boundary indicated in red dashed line.

- **Management Block** is a three storey (Basement + Ground + 1) building having a combination of RC moment resisting frame system and load bearing brick masonry system. The basement structural system consists of an RC retaining walls at the periphery supporting RC beam slab. The building's partial roof structural system consists of RC inverted beam. The building is used for Record Room (Basement), offices (Ground Floor), offices, kitchen, daycare and dining area (First Floor). The building was constructed in 2003.
- **Football Production 1** is a three storey (Ground + 2) building having a RC moment resisting frame system. The building is used for press cutting, manual cutting, football issue, finished goods warehouse (Ground Floor), football machine stitch, football offices, thermo-bonded ball manufacturing, textile checking, textile packing (First Floor), football printing, panel sorting (Second Floor) and solar panels (Roof). The ground floor and first floor of building was constructed in 2003 while the second floor was constructed in 2021. The opening at the first floor slab was covered with an RC slab during the construction of the second floor.
- **Football Production 2** is a three storey (Ground + 2) building having a RC moment resisting frame system. The building's roof structural system consists of load bearing brick masonry wall system supporting different slab configuration i.e. steel girder covered with corrugated roofing sheet, steel truss shed and precast girder and slab panels. The building is used for raw material warehouse, bladder inspection (Ground Floor), football machine stitching, quality control (First Floor), panel punching, bladder winding, sticker printing, thermos-bonding ball production (Second Floor). The ground floor and first floor of building was constructed in 2003 while the second floor was constructed in 2021.
- **Football Production 3** is a two story (Ground + 1) building having a RC moment resisting frame system and load bearing brick masonry system. The building is used for washing, packing, final inspection (Ground Floor), moulding, gluing, final stitch, bladder pasting (First Floor) and solar panels (Roof). The building was constructed in 2013.
- **Composite and Textile Production** is a three story (Ground + Mezzanine + 1) building having a RC moment resisting frame system. Some portion of the roof had opening, which was covered with precast girders and slab panels. The building is used for composites production (padel racket and field hockey), office area, bag production, moulding, pre- preg, paint boots (Ground Floor), printing (Mezzanine Floor), textile production (cut to pack) (First Floor) and solar panels (Roof). The building was constructed in 2003.

- **Chemical Store** is a two storey (Ground + 1) building having a RC moment resisting frame system. The building's roof structural system consists of load bearing brick masonry system supporting precast girder and slab panels. The building is used for chemical storage (Ground and First Floor). The building was constructed in 2019.
- **Composite Production 1** is a single storey (Ground only) building having a load bearing brick masonry system supporting precast girder and slab panels. The building is used for composites semi finish, spray paint, wooden hockey production, sanding, chemical store (Ground Floor). The building was constructed in 2003 while some portion of the building horizontally extended in 2021.
- **Composite Production 2** is a single storey (Ground only) building having a load bearing brick masonry system supporting precast girder and slab panels. The building is used for composites semi finish, padel racket drilling (Ground Floor). The building was constructed in 2007.
- **Lamination Hall** is a single storey (Ground only) structure having a load bearing brick masonry system supporting precast girder and slab panels. The structure is used for lamination (Ground Floor). The structure was constructed in 2010.
- **Press Cut Hall** is a single storey (Ground only) structure having a load bearing brick masonry system supporting precast girder and slab panels. The structure is used for cutting (Ground Floor). The structure was constructed in 2010.
- **R and D Lab** is a single storey (Ground only) structure having a load bearing brick masonry system supporting precast girder and slab panels. The structure is used for laboratory (Ground Floor). The structure was constructed in 2025.
- **Canteen** is a single storey (Ground only) structure having a load bearing brick masonry system supporting precast girder and slab panels. The structure is used for dining (Ground Floor). The structure was constructed in 2024.
- **Kitchen** is a single storey (Ground only) structure having a load bearing brick masonry system supporting precast girder and slab panels. The structure is used for cooking (Ground Floor). The structure was constructed in 2024.
- **Security Guard Room** is a single storey (Ground only) structure having a load bearing brick masonry system supporting precast girder and slab panels. The structure is used for residency (Ground Floor). The structure was constructed in 2022.
- **Welder Shop** is a single storey (Ground only) structure having a steel shed consists of consists of steel roof trusses covered with corrugated sheet. The structure is used for workshop (Ground Floor). The structure was constructed in 2022.
- **Generator Room 1** is a single storey (Underground / Ground only) structure having a RC retaining wall at underground level and load bearing brick masonry system supporting RC slab above ground level. The structure is used for generators and electric panels (Underground Floor). The structure was constructed in 2003.
- **Generator Room 2 and Compressor Room** is a single storey (Ground only) structure having a load bearing brick masonry system supporting precast girder and slab panels. The structure is used for generators, electric panels and compressor room (Ground Floor). The structure was constructed in 2015.
- **Mosque** is a single storey (Ground only) structure having a load bearing brick masonry system supporting RC slab. The structure is used for prayer area (Ground Floor). The structure was constructed in 2003.
- **Electrical Workshop and Driver Room** is a single storey (Ground only) structure having a load bearing brick masonry system supporting RC slab. The structure is used for workshop and waiting room (Ground Floor). The structure was constructed in 2003.
- **Security Room, Purchase Office and Clinic** is a single storey (Ground only) structure having a load bearing brick masonry system supporting RC slab. The structure is used for office and dispensary (Ground Floor). The structure was constructed in 2003.

The Football Production 1, 2, 3 and Composite and Textile Production Building are interconnected through connecting bridges at the first and second

floor.
An incomplete site layout plan and as-built drawings were presented. For further details, refer to Table 2 of the documentation.
There is a health and safety concern including the lack of edge protection at the roof of Football Production 1, Football Production 3 and Composite and Textile Production Building which should be addressed immediately. For Further details refer to section 8 of this report.
A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:

- Excessive deflection and visible distress were observed in the steel roof trusses of the welder shop. It must be temporary evacuated until safety issues addressed.
- Highly stressed internal columns were observed in Football Production 1 and 2.
- The lateral stability of the Football Production 1 Building needs to be evaluated.
- Damaged to the concrete columns was observed at the ground and first floor of Football Production 3.
- The column dowel reinforcement is exposed to atmospheric corrosion at the roof of Football Production 1, Football Production 3 and Composite and Textile Production Building.
- The steel staircases have structural strength and stability issues in the Football Production 1 and Football Production 2.

Beyond the restriction noted above we see no reason to suspend operations in the facility due to these concerns.
Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1: Building Summary

Building	Use	No. of stories	Year of construction	Structural system	Roof structural system	Any Extension / modifications	Engineer access issues
Management Block	Record Room (Basement) Offices (Ground Floor), Offices, kitchen, daycare and dining area (First Floor)	Three (Basement + Ground + 1)	2003	RC moment resisting frame system, RC retaining wall and load bearing brick masonry system	Partial roof consists of RC inverted beam	-	-

Football Production 1	Press cutting, manual cutting, football issue, finished goods warehouse (Ground Floor) Football machine stitch, football offices, thermo-bonded ball manufacturing, textile checking, textile packing (First Floor) Football printing, panel sorting (Second Floor) Solar panels (Roof)	Three (Ground + 2)	2003	RC moment resisting frame system	-	The opening at the first-floor slab was covered with an RC slab during the construction of the second floor. The Second Floor was constructed in 2021.	-

Football Production 2	Raw material warehouse, bladder inspection (Ground Floor) Football machine stitching, quality control (First Floor) Panel punching, bladder winding, sticker printing, thermos-bonding ball production (Second Floor)	Three (Ground + 2)	2003	RC moment resisting frame system	Load bearing brick masonry wall system supporting steel girder covered with corrugated roofing sheet, steel truss shed and precast girder and slab panels	Second Floor was constructed in 2021	No access to the roof
Football Production 3	Washing, packing, final inspection (Ground Floor) Moulding, gluing, final stitch, bladder pasting (First Floor) Solar panels (Roof)	Two (Ground + 1)	2013	RC moment resisting frame system and load bearing brick masonry system	-	-	-

Composite and Textile Production	Composites production (padel racket and field hockey), office area, bag production, moulding, pre-preg, paint boots (Ground Floor) Printing (Mezzanine Floor) Textile production (cut to pack) (First Floor) Solar panels (Roof)	Three (Ground + Mezzanine + 1)	2003	RC moment resisting frame system	-	Roof opening covered with Precast girders and slab panels	-
Chemical Store	Chemical storage (Ground and First Floor)	Two (Ground + 1)	2019	RC moment resisting frame system	Load bearing brick masonry system supporting precast girder and slab panels	-	No access to the roof

Composite Production 1	Semi finish, spray paint, wooden hockey production, sanding, chemical store (Ground Floor)	Single storey (Ground Only)	2003	Load bearing brick masonry system supporting precast girder and slab panels	-	Horizontally extended in 2021	-
Composite Production 2	Composites semi finish, padel racket drilling (Ground Floor)	Single storey (Ground Only)	2007	Load bearing brick masonry system supporting precast girder and slab panels	-	-	-
Lamination Hall	Lamination (Ground Floor)	Single storey (Ground Only)	2010	Load bearing brick masonry system supporting precast girder and slab panels	-	-	-
Press Cut Hall	Cutting (Ground Floor)	Single storey (Ground Only)	2010	Load bearing brick masonry system supporting precast girder and slab panels	-	-	-

R and D Lab	Laboratory (Ground Floor)	Single storey (Ground Only)	2025	Load bearing brick masonry system supporting precast girder and slab panels	-	-	-
Canteen	Dining (Ground Floor)	Single storey (Ground Only)	2024	Load bearing brick masonry system supporting precast girder and slab panels	-	-	-
Kitchen	Cooking (Ground Floor)	Single storey (Ground Only)	2024	Load bearing brick masonry system supporting precast girder and slab panels	-	-	-
Security Guard Room	Residency (Ground Floor)	Single storey (Ground Only)	2022	Load bearing brick masonry system supporting precast girder and slab panels	-	-	-
Welder Shop	Workshop	Single storey	2022	Steel truss	-	-	-

	(Ground Floor)	(Ground Only)		shed with corrugated Sheeting			
Generator Room 1	Generators and electric panels (Underground Floor)	Single storey (Underground only)	2003	Load Bearing brick masonry walls supporting RC Slab	-	-	-
Generator Room 2 and Compressor Room	Generators, electric panels and compressor room (Ground Floor)	Single storey (Ground Only)	2015	Load bearing brick masonry system supporting precast girder and slab panels	-	-	-
Mosque	Prayer Area (Ground Floor)	Single storey (Ground Only)	2003	Load bearing brick masonry walls supporting RC Slab	-	-	-
Electrical Workshop and Driver Room	Workshop and waiting room (Ground Floor)	Single storey (Ground Only)	2003	Load bearing brick masonry walls supporting RC Slab	-	-	-

Security Room, Purchase Office and Clinic	Office and dispensary (Ground Floor)	Single storey (Ground Only)	2003	Load bearing brick masonry walls supporting RC Slab	-	-	-



Figure 1.1. Satellite View of the Factory Premises; Red Dashed Line Indicates Site Boundary and Highlighted Area Indicates Buildings Inspected

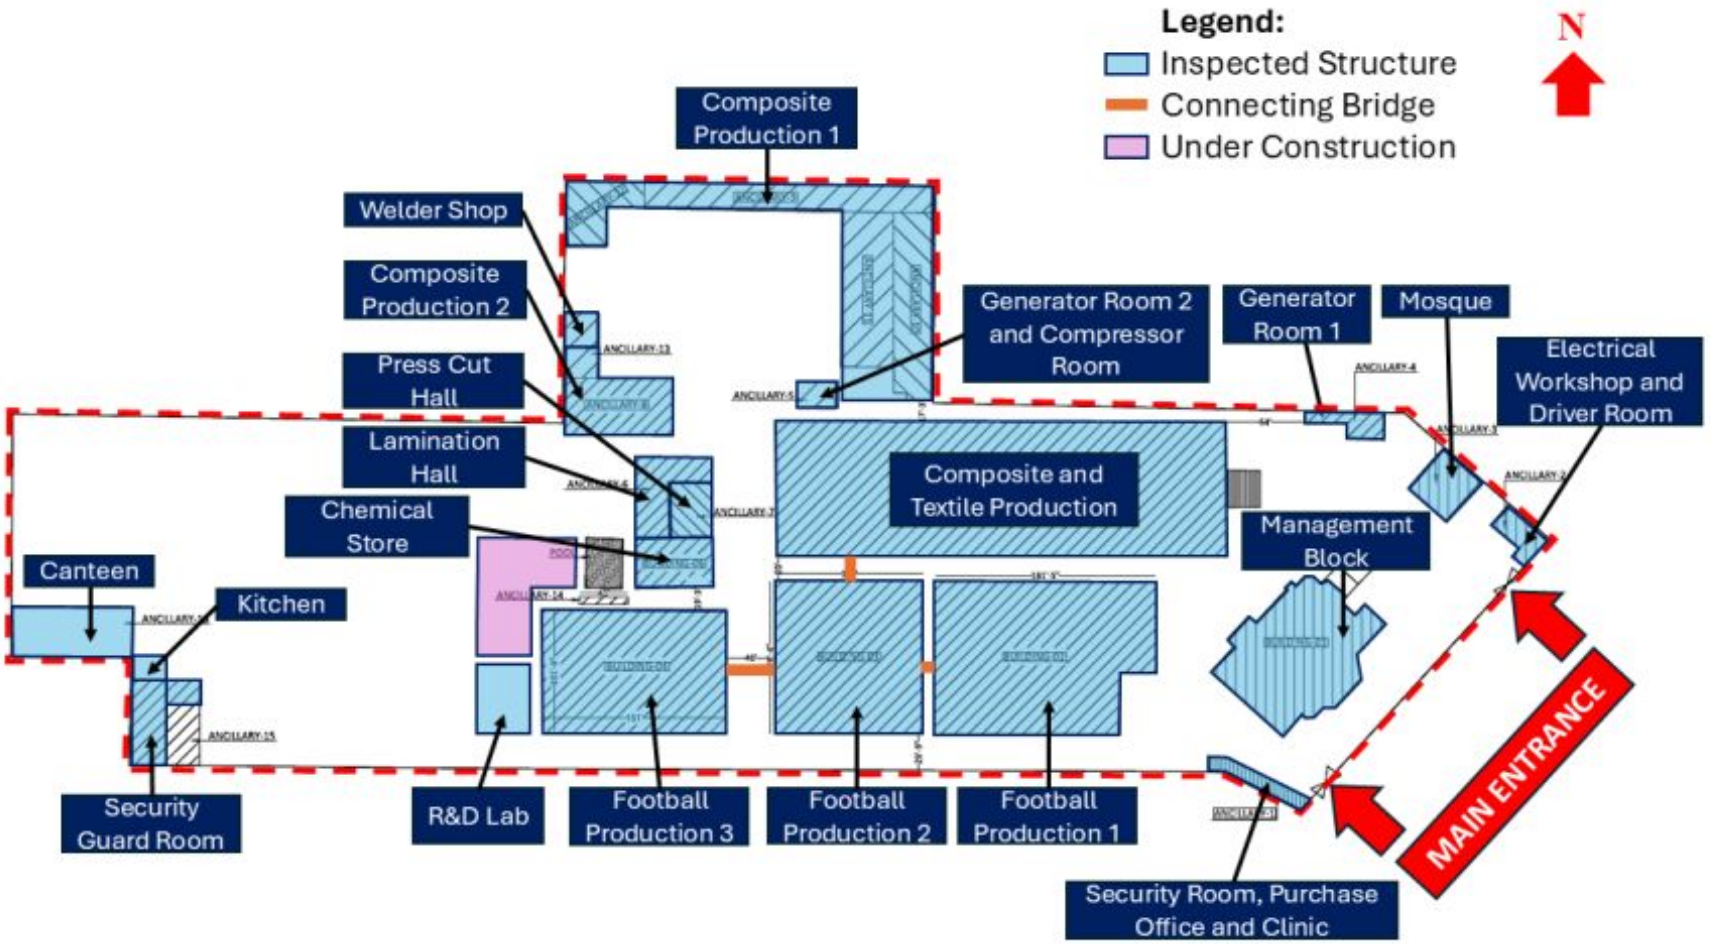


Figure 1.2. Site Layout Plan of the Factory Premises; Red Dashed Line Indicates Site Boundary and Highlighted Area Indicates Buildings Inspected



Figure 1.3. Management Block - Front Elevation



Figure 1.4. Football Production 1 - Front and Side Elevations



Figure 1.5. Football Production 2 - Front and Side Elevations



Figure 1.6. Football Production 3 - Front Elevation



Figure 1.7. Composite and Textile Production - Front Elevation



Figure 1.8. Chemical Store - Front Elevation



Figure 1.9. Composite Production 1 - Front Elevation



Figure 1.10. Composite Production 2 - Front Elevation



Figure 1.11. Lamination and Press Cut Hall - Front Elevation



Figure 1.12. R and D Lab - Front Elevation



Figure 1.13. Canteen and Kitchen - Front Elevation



Figure 1.14. Security Guard Room - Front Elevation



Figure 1.15. Welder Shop - Front Elevation



Figure 1.16. Generator Room 1 - Front Elevation



Figure 1.17. Generator Room 2 and Compressor Room - Front Elevation



Figure 1.18. Mosque - Front Elevation



Figure 1.19. Electrical Workshop and Driver Room - Front Elevation



Figure 1.20. Security Room, Purchase Office and Clinic - Front Elevation



Figure 1.21. Typical Roof Activity of Management Block



Figure 1.22. Typical First Floor Activity of Management Block



Figure 1.23. Typical Ground Floor Activity of Management Block



Figure 1.24. Typical Basement Activity of Management Block



Figure 1.25. Typical Roof Activity of Football Production 1



Figure 1.26. Typical Second Floor Activity of Football Production 1



Figure 1.27. Typical First Floor Activity of Football Production 1



Figure 1.28. Typical Ground Floor Activity of Football Production 1



Figure 1.29. Roof of Football Production 2



Figure 1.30. Typical Second Floor Activity of Football Production 2



Figure 1.31. Typical First Floor Activity of Football Production 2.



Figure 1.32. Typical Ground Floor Activity of Football Production 2



Figure 1.33. Typical Roof Activity of Football Production 3



Figure 1.34. Typical First Floor Activity of Football Production 3



Figure 1.35. Typical Ground Floor Activity of Football Production 3



Figure 1.36. Typical Roof Activity of Composite and Textile Production



Figure 1.37. Typical First Floor Activity of Composite and Textile Production



Figure 1.38. Typical Mezzanine Floor Activity of Composite and Textile Production



Figure 1.39. Typical Ground Floor Activity of Composite and Textile Production



Figure 1.40. Typical First Floor Activity of Chemical Store



Figure 1.41. Typical First Floor Activity of Chemical Store



Figure 1.42. Typical Ground Floor Activity of Composite Production 1



Figure 1.43. Typical Ground Floor Activity of Composite Production 2

2.1 Structural System

Building	Management Block
Stability System	RC moment resisting frame system and load bearing brick masonry system. RC retaining walls at the basement level periphery supporting RC beam slab.
Column Size (m)	-
Grid (m)	-
Primary Beam Size (m)	0.47 x 0.75
Secondary Beam Size (m)	-
Slab Depth (m)	0.15
Finishes Depth (m)	0.1
Floor to Ceiling Height (m)	3 (Typical) 2.5 (Basement)

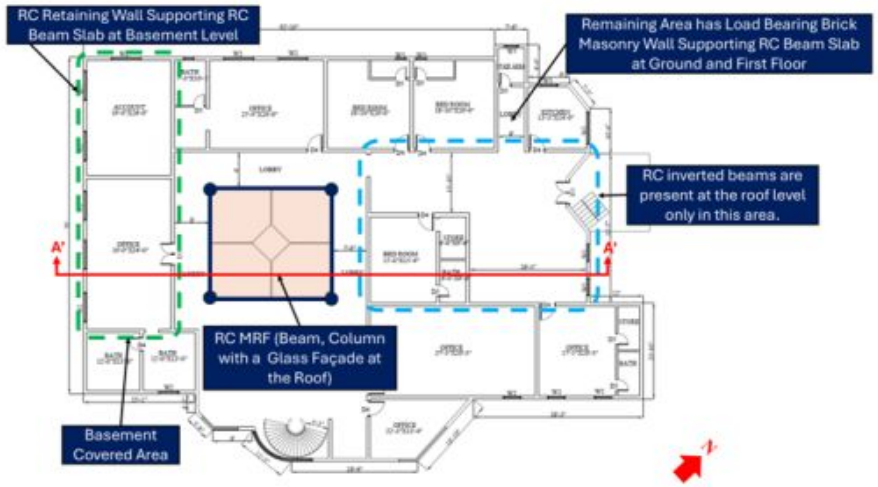


Figure 1.44. Typical Floor Framing Plan of Management Block

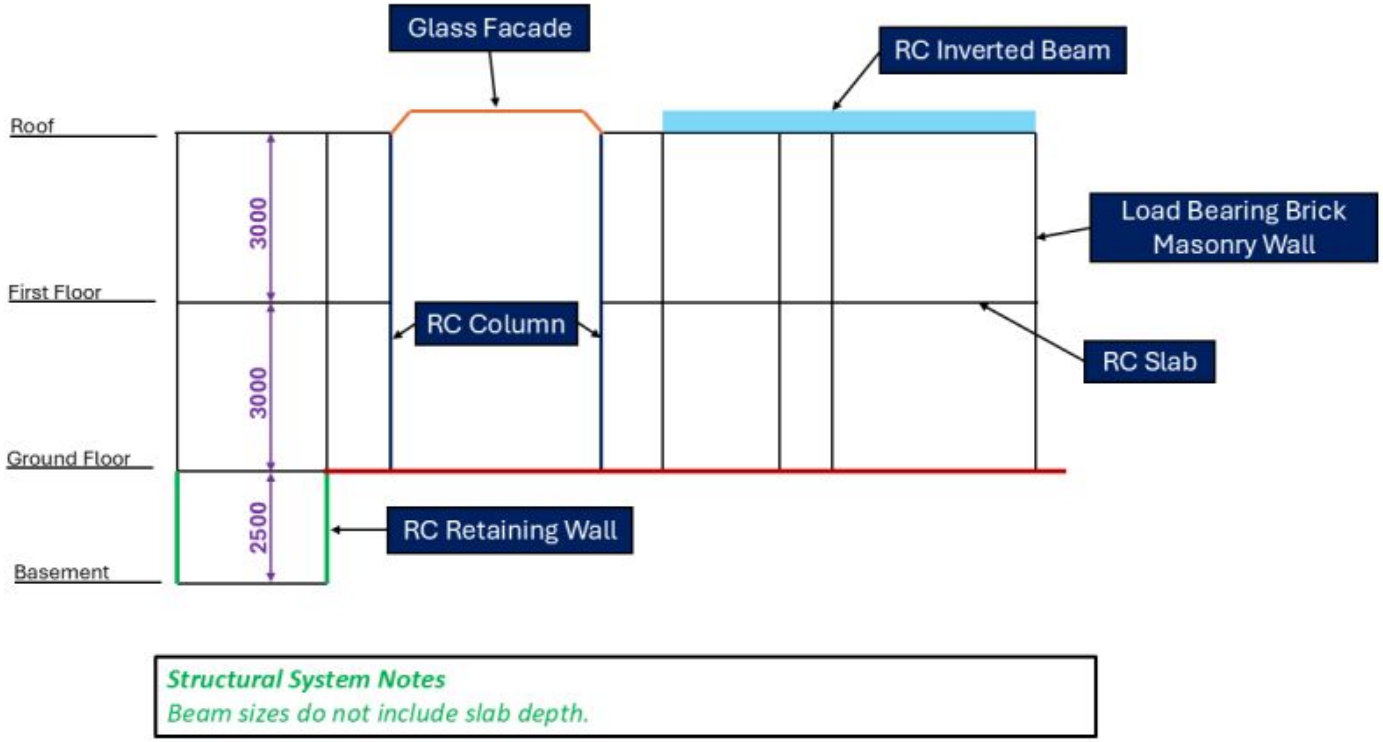


Figure 1.45. Section A'-A' of Management Block

Building	Football Production 1
Stability System	RC moment resisting frame.
Column Size (m)	0.45 x 0.45
Grid (m)	9 x 7.6
Primary Beam Size (m)	0.48 x 0.45 0.3 x 0.38
Secondary Beam Size (m)	0.30 x 0.38
Slab Depth (m)	0.15
Finishes Depth (m)	0.1
Floor to Ceiling Height (m)	4.2


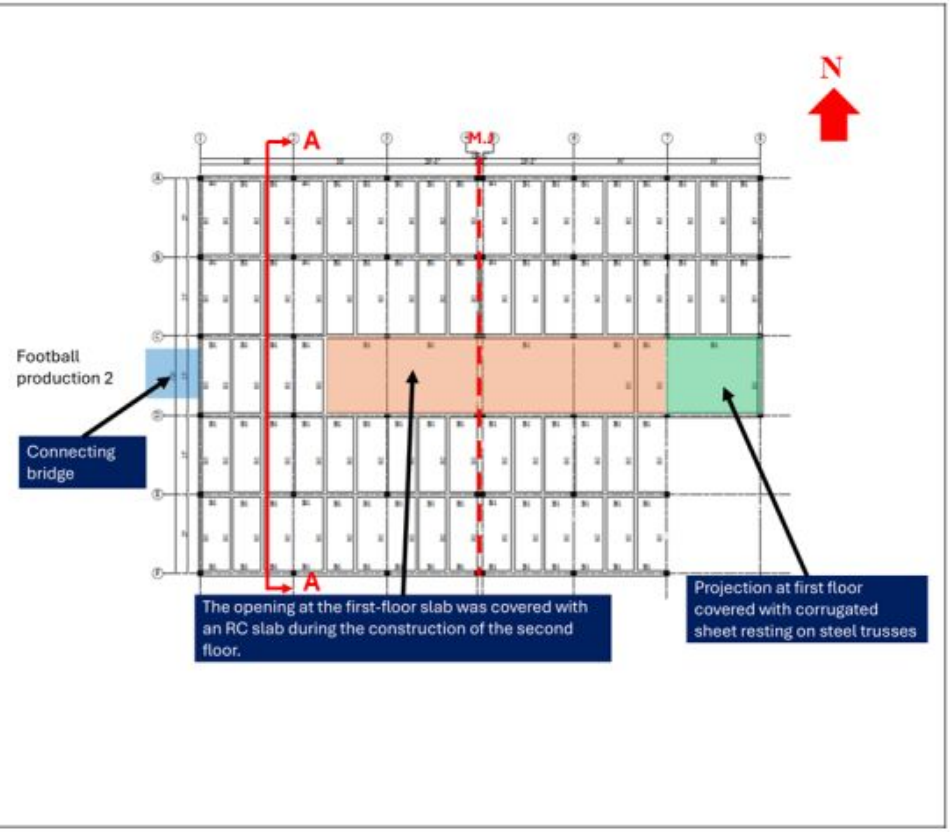


Figure 1.46. Typical floor framing plan detail of football production 1

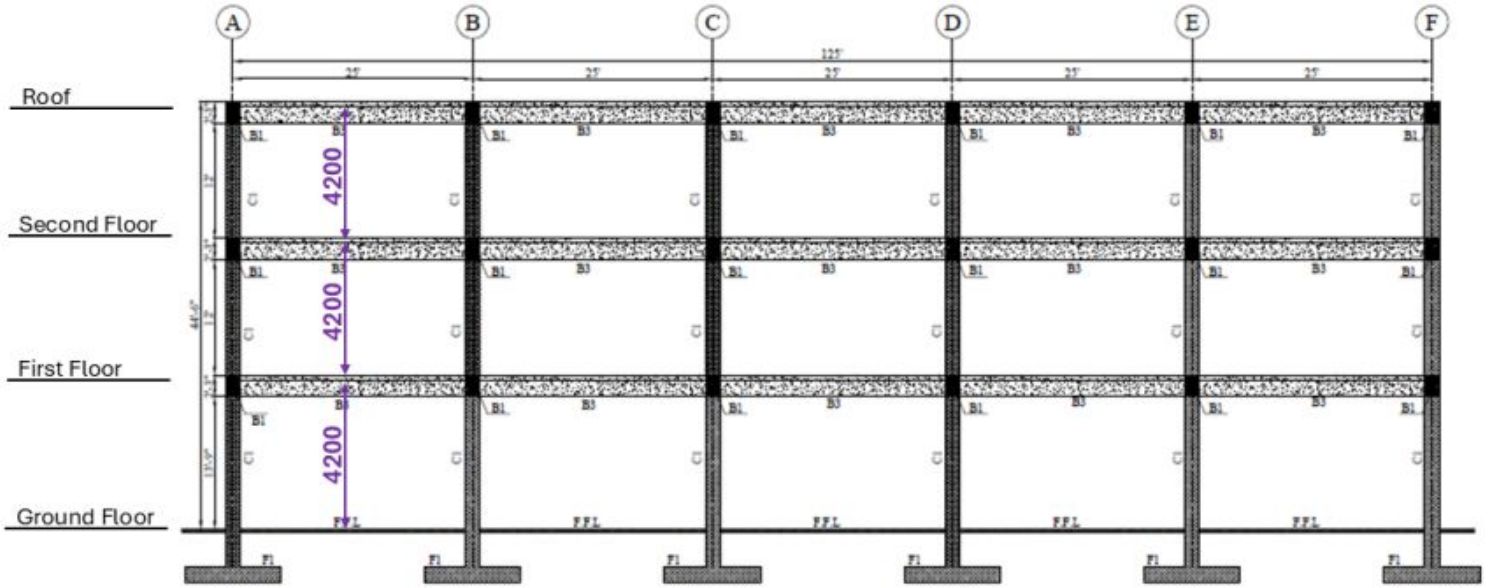

Structural System Notes

Column size is the structural dimension and excludes the render thickness.

Grid measurements are from centre of column to centre of column.

Beam sizes do not include slab depth.

Figure 1.47. Section A-A of football production 1

Building	Football Production 2
Stability System	RC moment resisting frame system.
Column Size (m)	0.45 x 0.45
Grid (m)	9.18x7.68
Primary Beam Size (m)	0.48x0.53 0.35 x 0.37
Secondary Beam Size (m)	0.35x0.37
Slab Depth (m)	0.15
Finishes Depth (m)	0.1
Floor to Ceiling Height (m)	4.2

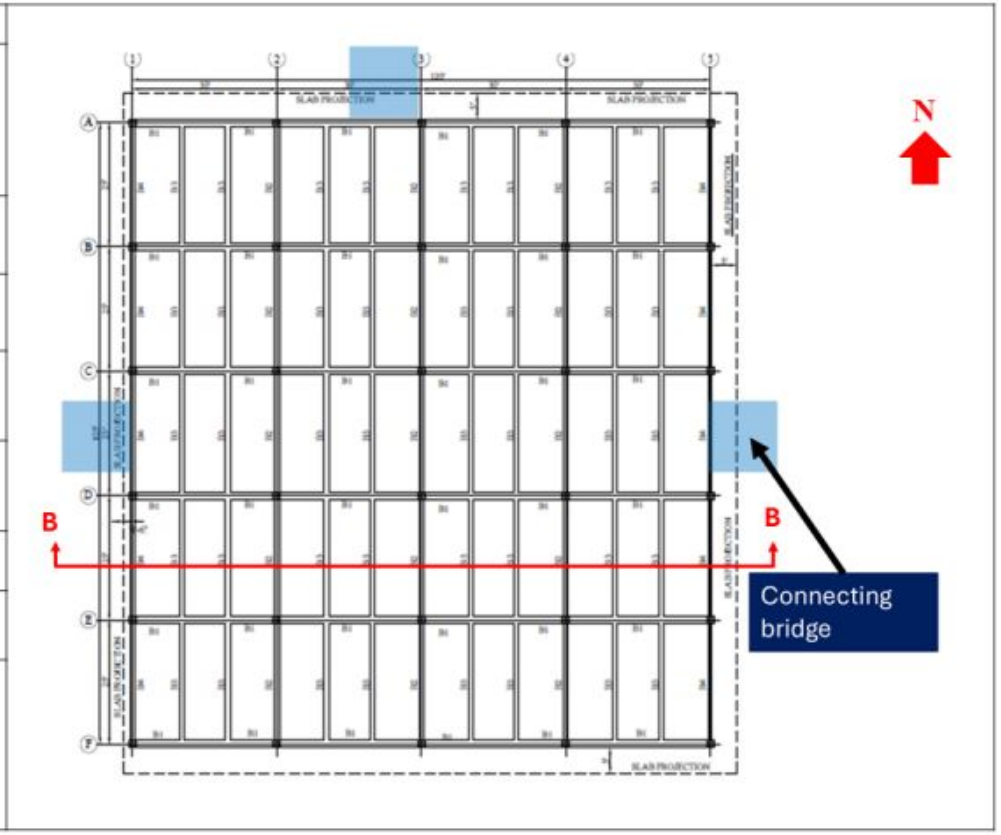


Figure 1.48. Typical floor framing plan detail of football production 2

Building	Football Production 2
Stability System	Load bearing brick masonry wall system.
Column Size (m)	-
Grid (m)	-
Primary Beam Size (m)	-
Secondary Beam Size (m)	-
Slab Depth (m)	-
Finishes Depth (m)	-
Floor to Ceiling Height (m)	4.2 (roof)

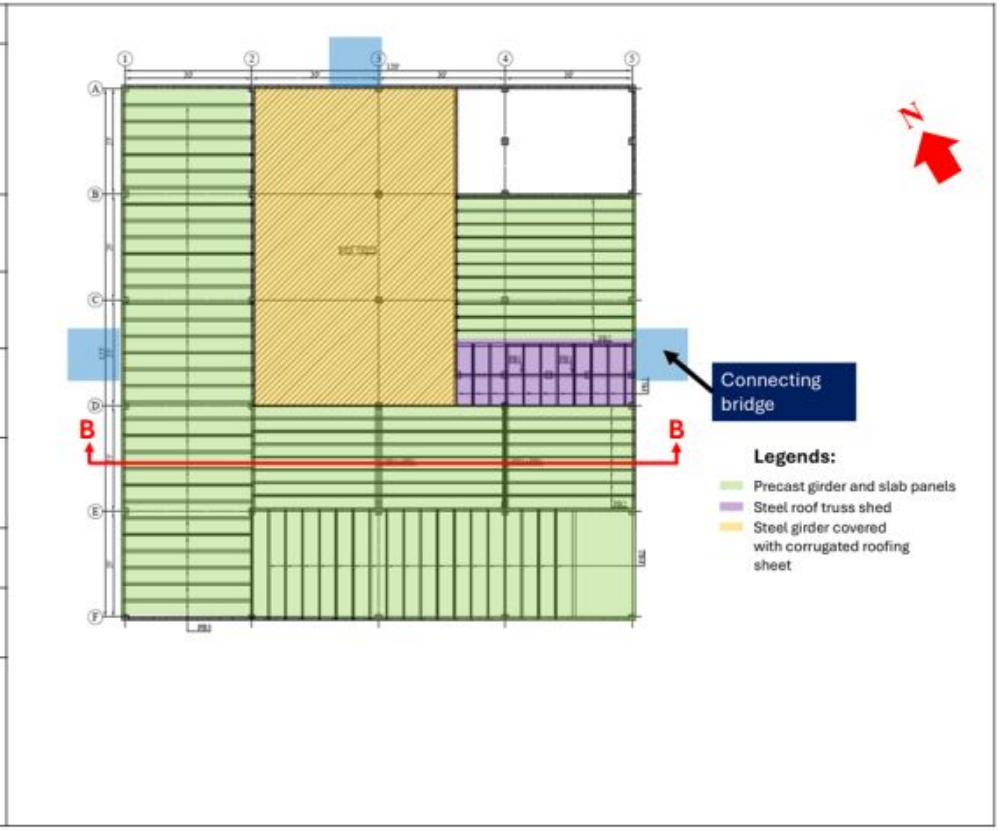


Figure 1.49. Roof framing plan detail of football production 2

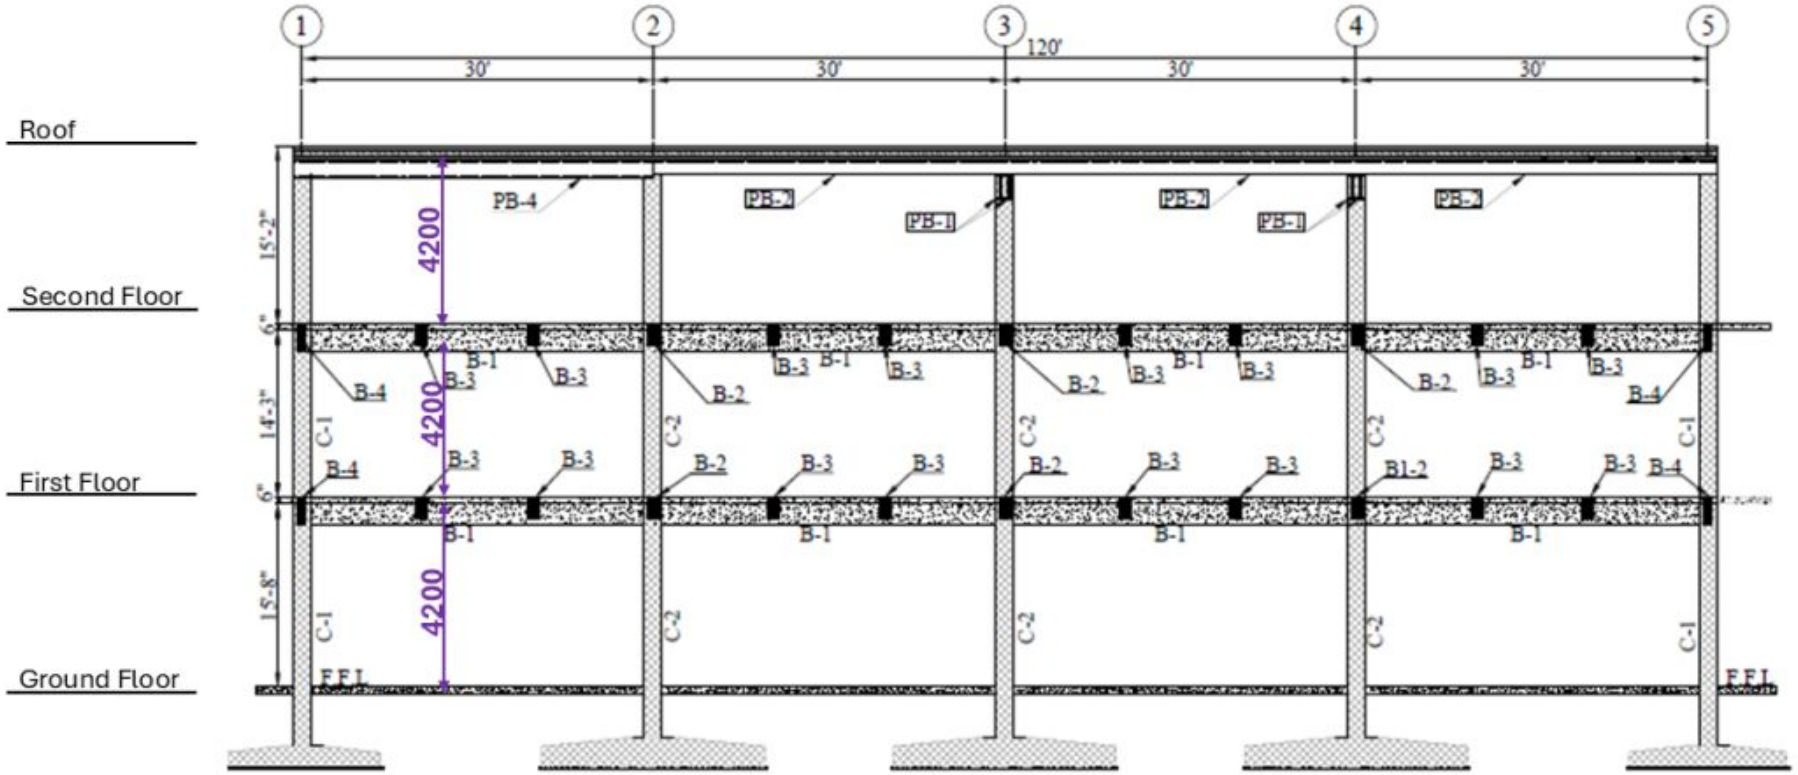


Figure 1.50. Section B-B of football production 2

Building	Football Production 3
Stability System	RC moment resisting frame and load bearing brick masonry wall supporting RC slab.
Column Size (m)	0.375 x 0.375
Grid (m)	6.54 x 7.63
Primary Beam Size (m)	0.35 x 0.475
Secondary Beam Size (m)	0.30 x 0.30
Slab Depth (m)	0.15
Finishes Depth (m)	0.1
Floor to Ceiling Height (m)	4.2

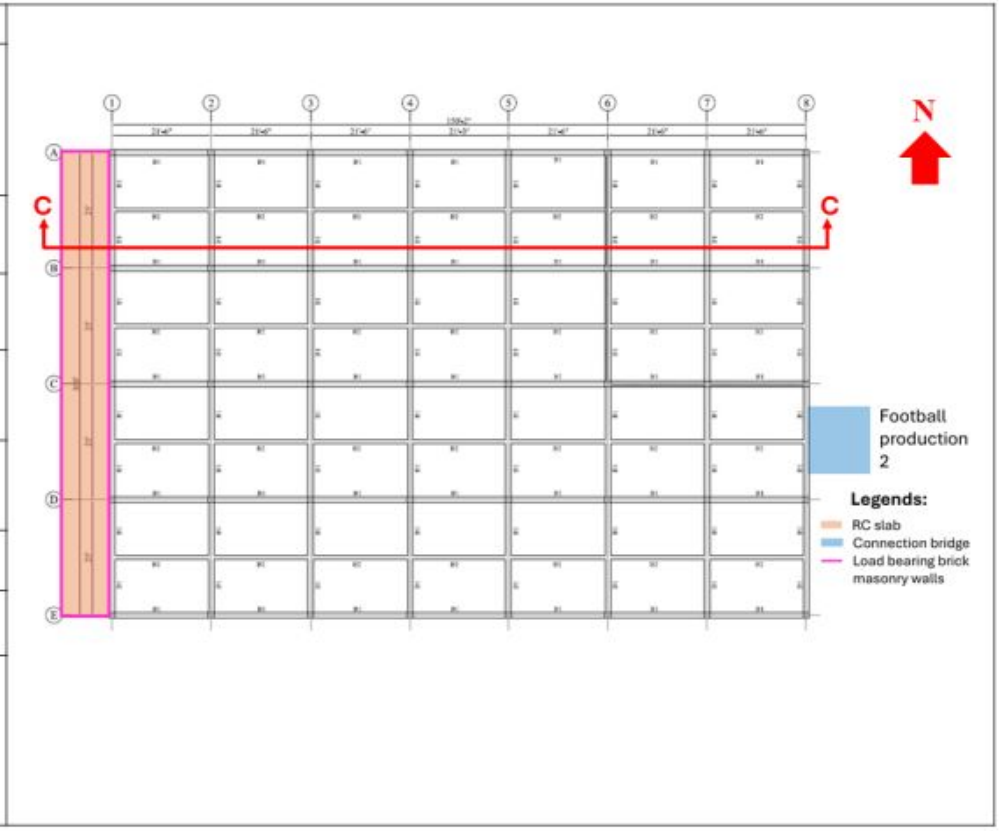


Figure 1.51. Typical floor framing plan detail of football production 3

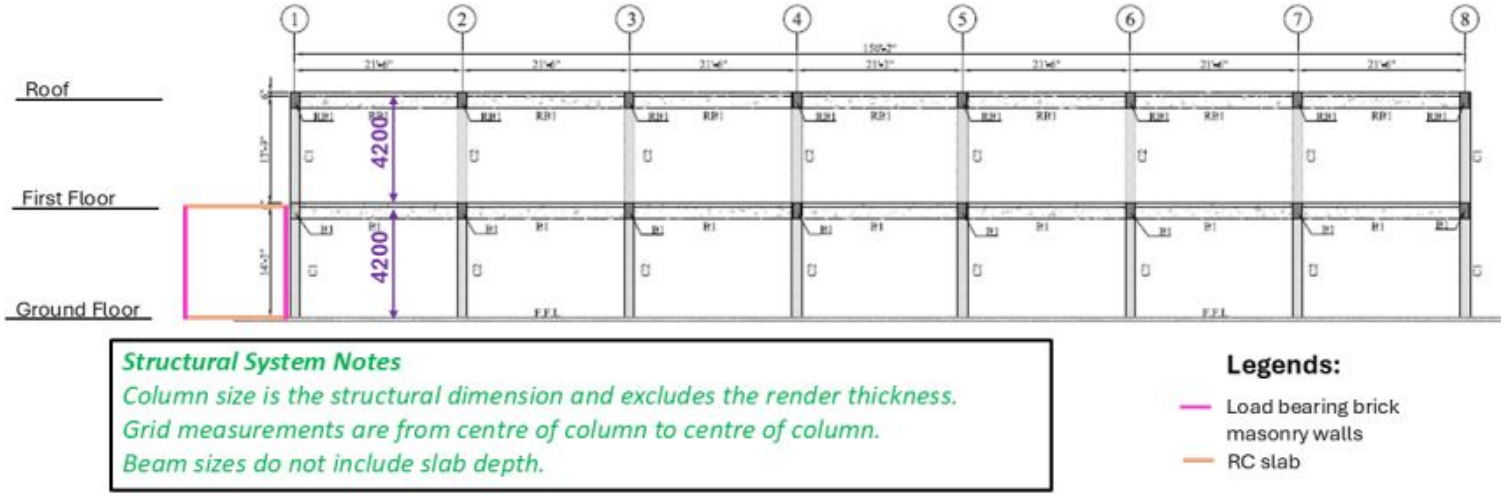


Figure 1.52. Section C-C of football production 3

Building	Composite and textile production
Stability System	RC moment resisting frame system
Column Size (m)	0.455x0.455
Grid (m)	9.28 x 8.28
Primary Beam Size (m)	0.48x0.54 0.30x0.39
Secondary Beam Size (m)	0.30x0.39
Slab Depth (m)	0.15
Finishes Depth (m)	0.1
Floor to Ceiling Height (m)	4.8 (Ground) 2.7 (Ground to Mezzanine) 4.2 (First)

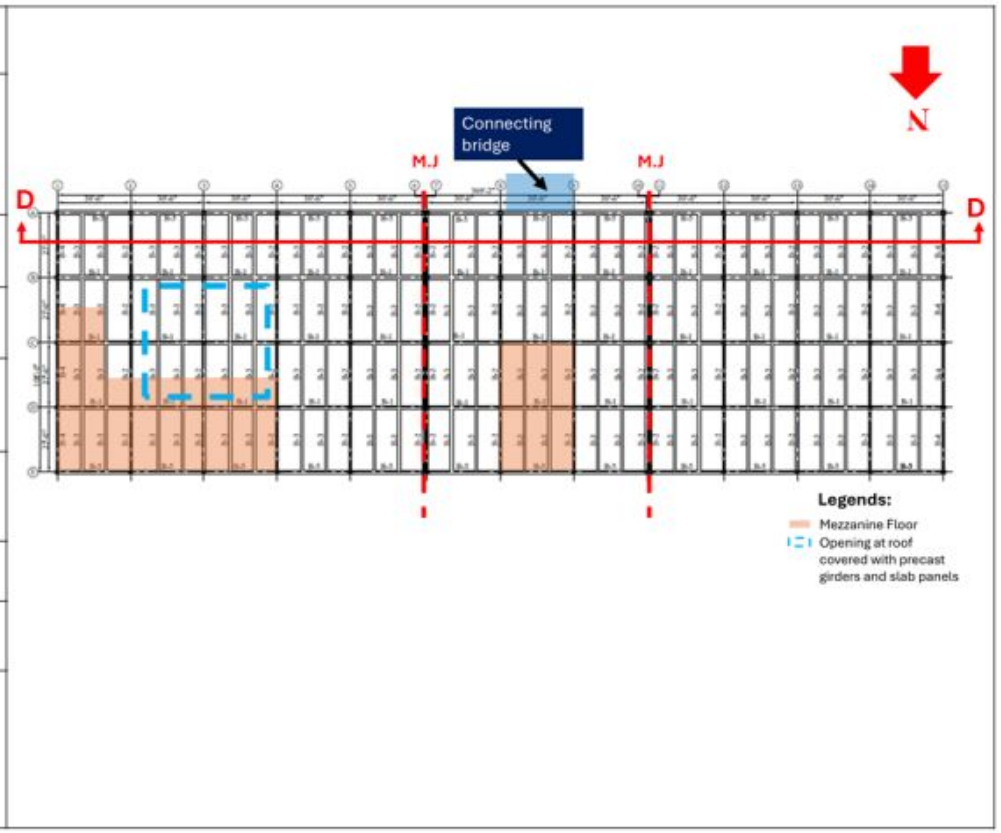


Figure 1.53. Typical floor framing plan detail of composite and textile production

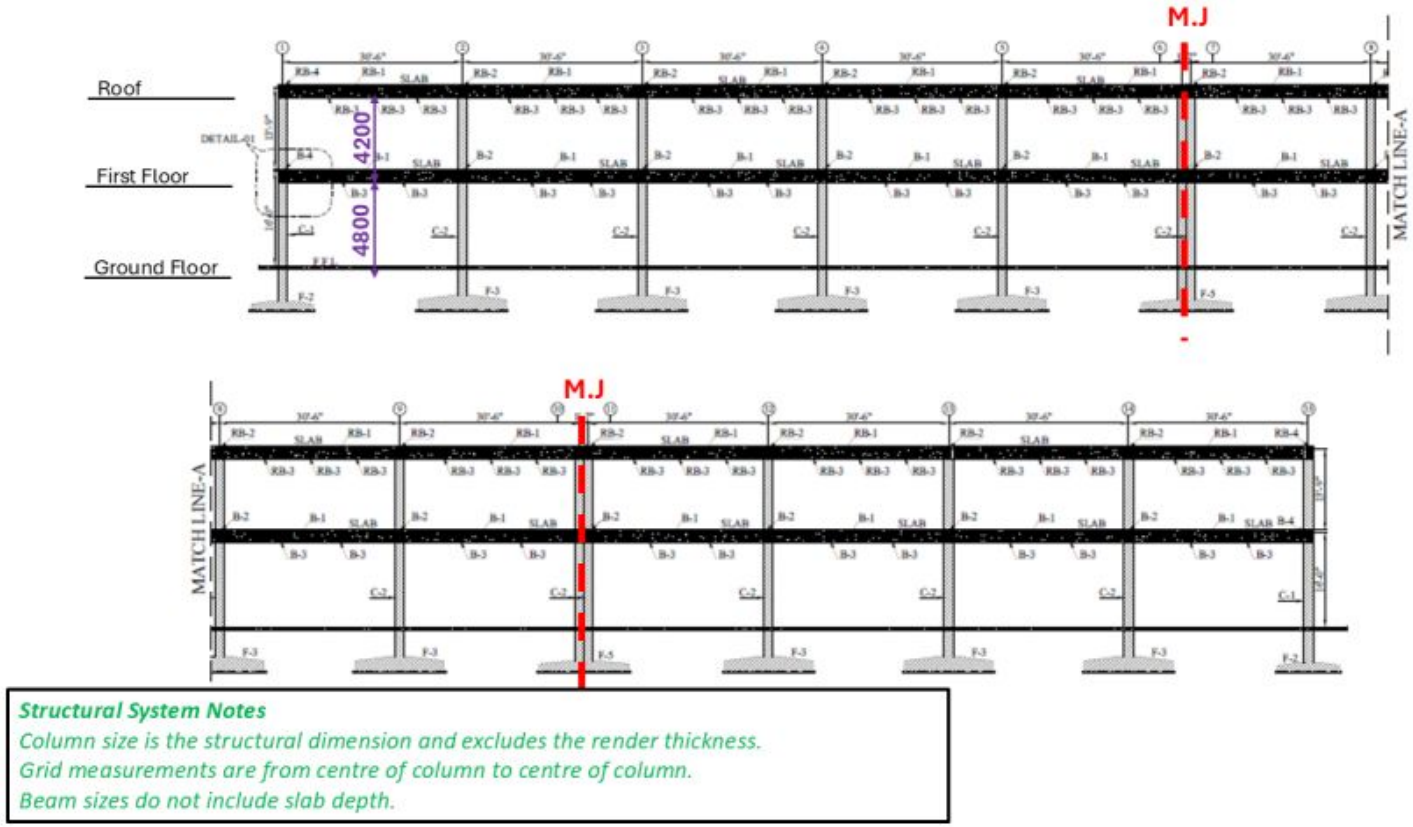


Figure 1.54. Section D-D of composite and textile production

3. Documentation

This table outlines the documentation details provided by the factory.

Table 2 - Documentation

Building	Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plans	Stability certificate	Inspection reports	Materials testing
Management Block	Yes (Incomplete)	No	No	No	Yes	No	No	No	No
Football Production 1	Yes (Incomplete)	No	No	No	Yes (non-conforming)	No	No	No	No
Football Production 2	Yes (Incomplete)	No	No	No	Yes (non-conforming)	No	No	No	No
Football Production 3	Yes (Incomplete)	No	No	No	Yes (non-conforming)	No	No	No	No
Composite and Textile Production 3	Yes (Incomplete)	No	No	No	Yes (non-conforming)	No	No	No	No
Chemical Store	Yes (Incomplete)	No	No	No	Yes (non-conforming)	No	No	No	No
Composite Production 1	Yes (Incomplete)	No	No	No	Yes	-	No	No	-
Composite Production 2	Yes (Incomplete)	No	No	No	Yes	-	No	No	-
Lamination	Yes	No	No	No	Yes	-	No	No	-

Hall	(Incomplete)								
Press Cut Hall	Yes (Incomplete)	No	No	No	Yes	-	No	No	-
R and D Lab	Yes (Incomplete)	No	No	No	Yes	-	No	No	-
Canteen	Yes (Incomplete)	No	No	No	Yes	-	No	No	-
Kitchen	Yes (Incomplete)	No	No	No	Yes	-	No	No	-
Security Guard Room	Yes (Incomplete)	No	No	No	Yes	-	No	No	-
Welder Shop	Yes (Incomplete)	No	No	No	Yes	-	No	No	-
Generator Room 1	Yes (Incomplete)	No	No	No	Yes	-	No	No	-
Generator Room 2 and Compressor Room	Yes (Incomplete)	No	No	No	Yes	-	No	No	-
Mosque	Yes (Incomplete)	No	No	No	Yes	-	No	No	-
Electrical Workshop and Driver Room	Yes (Incomplete)	No	No	No	Yes	-	No	No	-
Security Room, Purchase Office and Clinic	Yes (Incomplete)	No	No	No	Yes	-	No	No	-

4. Structural Safety Measures

During our structural site inspection of Ali Trading Company (Pvt.) Ltd., a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within Ali Trading Company (Pvt.) Ltd.. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3 Summary of issues by building:

Building	Potential Overstress	Structural system	Cracking	Loading	Other damage and defects	Structural documentation
Management Block	-	-	-	-	-	Differ from as – built structure Lack of Safe Load Plans

Football Production 1	Highly Stressed Columns	Lack of Local Stability	-	-	Corrosion of Reinforcement Health & Safety – Lack of Edge Protection	Documentation Unavailable Differ from as-built structure Non-Engineered Structure Lack of Safe Load Plans
Football Production 2	Highly Stressed Columns	-	-	-	-	Documentation Unavailable Differ from as-built structure Lack of Safe Load Plans
Football Production 3	-	-	-	-	Column Impact Damage Corrosion of Reinforcement Health & Safety – Lack of Edge Protection	Documentation Unavailable Differ from as-built structure Non-Engineered Structure Lack of Safe Load Plans
Composite and Textile Production 3	-	-	-	-	Health & Safety – Lack of Edge Protection Corrosion of Reinforcement	Documentation Unavailable Differ from as-built structure Non-Engineered Structure Documentation Unavailable Lack of Safe Load Plans

Chemical Store	-	-	-	-	-	Documentation Unavailable Differ from as-built structure Lack of Safe Load Plans
Composite Production 1	-	-	-	-	-	-
Composite Production 2	-	-	-	-	-	-
Lamination Hall	-	-	-	-	-	-
Press Cut Hall	-	-	-	-	-	-
R and D Lab	-	-	-	-	-	Differ from as – built structure
Canteen	-	-	-	-	-	Differ from as – built structure
Kitchen	-	-	-	-	-	-
Security Guard Room	-	-	-	-	-	-
Welder Shop	-	-	-	-	Excessive deflection or vibration	-
Generator Room 1	-	-	-	-	-	-
Generator Room 2 and Compressor Room	-	-	-	-	-	-
Mosque	-	-	-	-	-	-

Electrical Workshop and Driver Room	-	-	-	-	-	-
Security Room, Purchase Office and Clinic	-	-	-	-	-	-

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-065222

Timeline	Remediation Plan
Medium Term CAP-0077172	Factories should begin remediation of CAP items such as surface cracks or non-structural repairs using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Potential Overstress

6.1 Highly stressed columns

The internal ground floor columns of Football Production 1 were observed to be highly stressed, potentially due to the relatively large structural grid spacing (9 m × 7.6 m), addition of second floor, and absence of verified concrete strength data. These conditions make the structure vulnerable to potential structural distress and reduce the overall reliability of the load-carrying system. F-202604-065239

Timeline	Remediation Plan
Immediate CAP-0077200	Verify in-situ reinforcement by removing cover and confirming no. and diameter of bars and submit results to Pakistan Accord for review.
Immediate CAP-0077201	Verify strength of reinforcement through laboratory tensile strength testing and submit results to Pakistan Accord for review.
Immediate CAP-0077202	Verify in-situ concrete strength for the identified columns either by 100mm dia. cores from at least 4 columns or existing cylinder strength data and submit results to Pakistan Accord.
Immediate CAP-0080992	(1) Appoint qualified and competent Structural Engineer to carry out DEA on the full building, in accordance with the DEA scope and minimum requirements set out in the Initial Inspection report.
Medium Term CAP-0077204	Factory Engineer to review design, loads and columns stresses in area identified.
Medium Term CAP-0080993	(2) Submit accurate As-built Drawings showing structure, loading, elements, dimensions, levels, foundations and framing on Plan, Section and Elevation drawings and a report on Engineering tests carried out to justify material strengths and reinforcement content in all key elements studied, to Pakistan Accord for review.
Medium Term CAP-0080994	(3) Submit structural engineering assessment with supporting calculations based on the as-built drawing and material strengths along with safe load plans reviewed previously using a model-based design that justifies the safety and serviceability of the building against loading as set out in Building Code of Pakistan.

Medium Term CAP-0080995	(4) Submit proposals for any retrofitting works that may be needed to demonstrate the adequacy of the structure to Pakistan Accord for review.
Longer Term CAP-0080996	(5) Carry out all retrofitting works if needed as proposed and previously reviewed by Pakistan Accord.
Longer Term CAP-0080997	(6) Factory to advise Pakistan Accord when all retrofitting works are complete and make provision for a verification inspection attended by the factory Structural Engineer. Once Pakistan Accord has verified retrofitting works in accordance with previously reviewed proposals, then this item will be complete.
Longer Term CAP-0077210	Continue to implement load plan.



Figure 2.1 - Location of Highly Stressed Internal Ground Columns of Football Production 1

6.2 Highly stressed columns

The internal ground floor columns of Football Production 2 were observed to be highly stressed, potentially due to the relatively large structural grid size (9.18 m × 7.68 m), addition of second floor, and absence of verified concrete strength data. These conditions make the structure vulnerable to potential structural distress and reduce the overall reliability of the load-carrying system. F-202604-065240

Timeline	Remediation Plan
Medium Term CAP-0077211	Verify in-situ reinforcement by removing cover and confirming no. and diameter of bars and submit results to Pakistan Accord for review.
Medium Term CAP-0077212	Verify strength of reinforcement through laboratory tensile strength testing and submit results to Pakistan Accord for review.
Medium Term CAP-0077213	Verify in-situ concrete strength for the identified columns either by 100mm dia. cores from at least 4 columns or existing cylinder strength data and submit results to Pakistan Accord.
Medium Term CAP-0077215	Factory Engineer to review design, loads and columns stresses in area identified and submit to Pakistan Accord for review.
Longer Term CAP-0077221	Produce and actively manage a loading plan for all floor plates within the factory giving consideration to floor capacity and column capacity

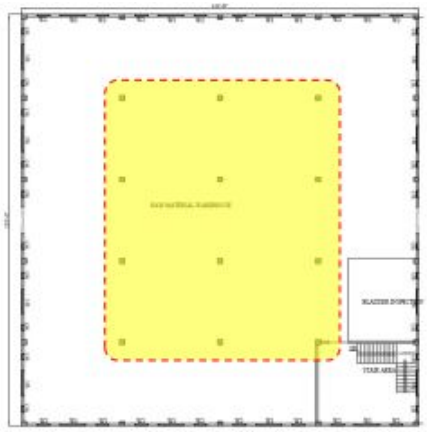


Figure 2.2 - Location of Highly Stressed Internal Ground Columns of Football Production 2

7. Structural System

7.1 Lack of local stability

This issue refers to the first-floor slab of Football Production 1. The original opening in the slab was covered with a reinforced concrete (RC) slab during the construction of the second floor. The newly cast slab appears to be unsupported by any internal beams. This condition raises structural concerns regarding its capacity to safely resist vertical loads, control deflection, and perform adequately under lateral loading. F-202604-065682

Timeline	Remediation Plan
Medium Term CAP-0077978	Building Engineer to review the design of structure and propose any strengthening measures as required and submit it to Pakistan Accord for review.
Longer Term CAP-0077979	Implement the Remediation as required.

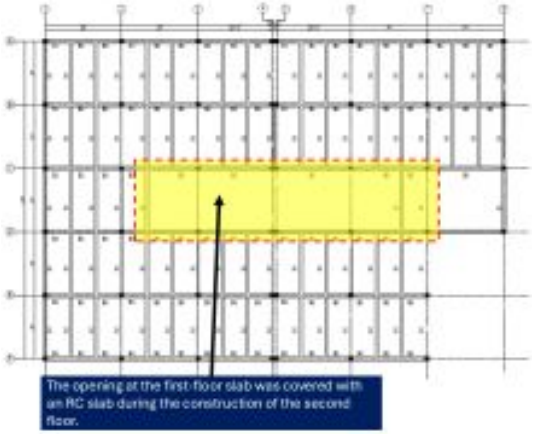


Figure 2.3 - Covered Opening within the First Floor Slab of Football Production 1 Building



Figure 2.4 - Covered Opening within the First Floor Slab of Football Production 1 Building

8. Other Damage/Defects

8.1 Corrosion of reinforcement

The dowel reinforcement of the column at the roof level of the Football Production 1 has been significantly affected by atmospheric corrosion. This condition may compromise the structural integrity over time. F-202604-065223

Timeline	Remediation Plan
Medium Term CAP-0077173	Propose the remedial measure to protect the dowel reinforcement from future atmospheric corrosion and submit to Pakistan Accord for review.
Longer Term CAP-0077174	Implement the required remedial work.

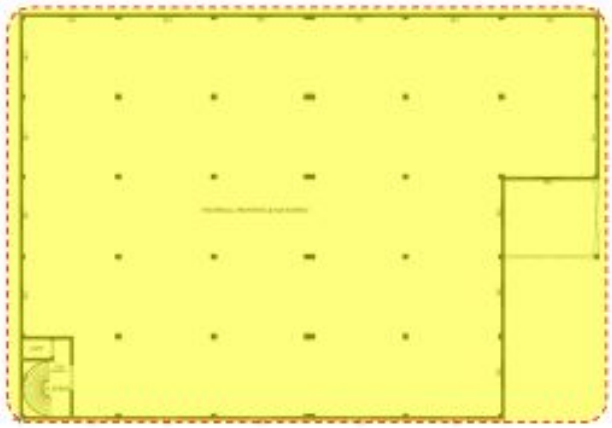


Figure 2.5 - Location of Exposed Corroded Dowel Reinforcement at the Roof of Football Production 1



Figure 2.6 - Exposed Corroded Dowel Reinforcement at the Roof of Football Production 1

8.2 Corrosion of reinforcement

The dowel reinforcement of the column at the roof level of the Football Production 3 has been significantly affected by atmospheric corrosion. This condition may compromise the structural integrity over time. F-202604-065224

Timeline	Remediation Plan
Medium Term CAP-0077175	Propose the remedial measure to protect the dowel reinforcement from future atmospheric corrosion and submit to Pakistan Accord for review.
Longer Term CAP-0077176	Implement the required remedial work.

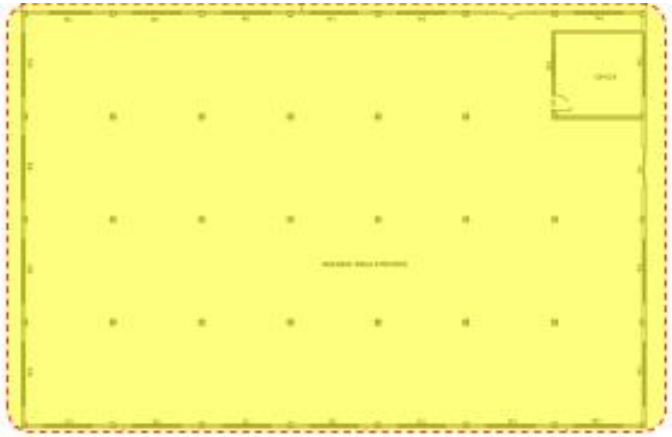


Figure 2.7 - Location of Exposed Corroded Dowel Reinforcement at the Roof of Football Production 3



Figure 2.8 - Location of Exposed Corroded Dowel Reinforcement at the Roof of Football Production 3

8.3 Corrosion of reinforcement

The dowel reinforcement of the column at the roof level of the Composite and Textile Production has been significantly affected by atmospheric corrosion. This condition may compromise the structural integrity over time F-202604-065225

Timeline	Remediation Plan
Medium Term CAP-0077177	Propose the remedial measure to protect the dowel reinforcement from future atmospheric corrosion and submit to Pakistan Accord for review.
Longer Term CAP-0077178	Implement the required remedial work.



Figure 2.9 - Location of Exposed Corroded Dowel Reinforcement at the Roof of Composite and Textile Production



Figure 2.10 - Exposed Corroded Dowel Reinforcement at the Roof of Composite and Textile Production

8.4 Column impact damage

This issue refers to the ground and first floor of Football Production 3.
Damaged RC columns were observed at the ground and first floor which appears to be due to impact, possibly from movement of machines or a loaded trolley.F-202604-065230

Timeline	Remediation Plan
Medium Term CAP-0077179	Propose suitable protection around all RC columns in areas with vehicle or loaded trolley movement to prevent damage and collapse of columns from potential impacts and submit it to Pakistan Accord for review.
Longer Term CAP-0078696	Implement the required remedial works.

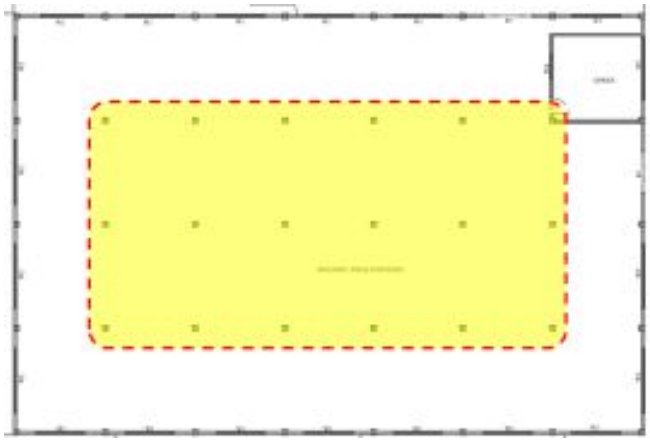


Figure 2.11 - Location of Damaged RC Columns at the Ground and First Floor of Football Production 3



Figure 2.12 - Damaged RC Columns at the Ground Floor of Football Production Building 3



Figure 2.13 - Damaged RC Columns at the First Floor of Football Production 3 Building

8.5 Excessive deflection or vibration

Excessive deflection was observed in the steel trusses, purlins, and roofing sheets of the welding workshop. Furthermore, misalignment of steel columns was noted. These deficiencies indicate compromised structural performance and pose a potential risk of structural instability and collapse. F-202604-065235

Timeline	Remediation Plan
Immediate CAP-0077195	The area shall be evacuated .
Medium Term CAP-0077196	Building structural engineer to review the as-built design for code compliance (vertical and lateral loads) and confirm if it is adequate.
Medium Term CAP-0077197	Propose strengthening works as required and submit to Pakistan Accord for review.
Longer Term CAP-0077198	Implement strengthening works as required.

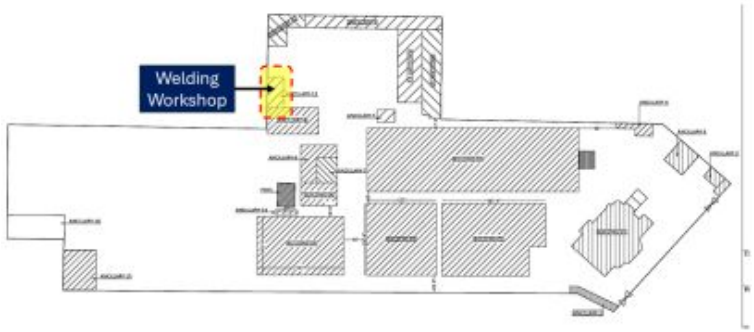


Figure 2.14 - Location of the Welder Shop



Figure 2.16 - Deflected Roof Trusses and Misaligned Column of the Welder Shop



Figure 2.15 - Deflected Roof Trusses, Purlins and Roofing Sheet of the Welder Shop

8.6 Health and Safety

It concerns with lack of edge protection at the roof of the Football Production 1 which present a risk of potential injury resulting from slip, trip or fall from roof during the access and maintenance of services – Health & Safety concern. F-202604-065226

Timeline	Remediation Plan
Immediate CAP-0077181	Provide adequate edge protection on the roof, and on any other part of the factory with the same issue.

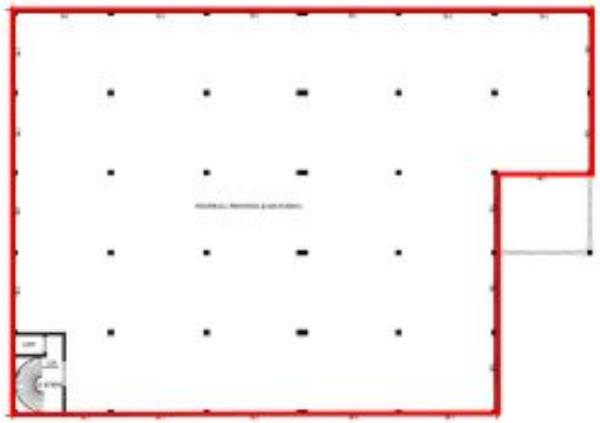


Figure 2.17 - Red Line Indicated Missing Edge Protection at the Roof of Football Production 1



Figure 2.18 - Missing Edge Protection at the Roof of Football Production 1

8.7 Health and Safety

It concerns with lack of edge protection at the roof of the Football Production 3 which present a risk of potential injury resulting from slip, trip or fall from roof during the access and maintenance of services – Health & Safety concern. F-202604-065227

Timeline	Remediation Plan
Immediate CAP-0077183	Provide adequate edge protection on the roof, and on any other part of the factory with the same issue.

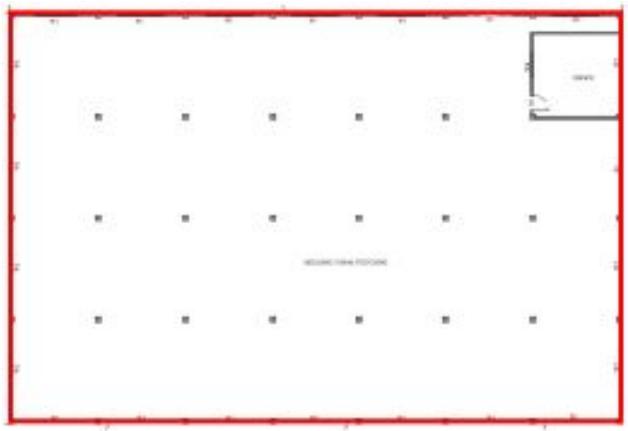


Figure 2.19 - Red Line Indicated Missing Edge Protection at the Roof of Football Production 3



Figure 2.20 - Missing Edge Protection at the Roof of Football Production 3

8.8 Health and Safety

It concerns with lack of edge protection at the roof of the Composite and Textile Production which present a risk of potential injury resulting from slip, trip or fall from roof during the access and maintenance of services – Health & Safety concern. F-202604-065228

Timeline	Remediation Plan
Immediate CAP-0077184	Provide adequate edge protection on the roof, and on any other part of the factory with the same issue.



Figure 2.21 - Red Line Indicated Missing Edge Protection at the Roof of Composite and Textile Production



Figure 2.22 - Missing Edge Protection at the Roof of Composite and Textile Production

9. Structural Documentation

9.1 Documentation unavailable

- Structural and as-built architectural details of the mezzanine floor in the Composite and Textile Production Building were not available.
- Slab thickness for Football Production 1 Building was not specified in the provided documents.
- Details of the steel staircases were not available in the architectural and structural drawings of all Management Block, Football Production 1,2, 3, Composite and Textile Production, Chemical Store.
- No details were provided for the connecting bridge between structures.
- The approved layout plan was not available.F-202604-065238

Timeline	Remediation Plan
Longer Term CAP-0077199	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete as-built documentation.

9.2 Differs from as-built structure

- The site layout plan requires updating to include the R&D Lab and the building currently under construction. Additionally, the layout of the canteen and security room should be revised to reflect the actual site conditions.
- The beam details provided for Football Production 1 differ from the actual site conditions. The second floor, constructed in 2021, has beam depths and sizes that are different from those of the ground and first floors as per site condition.
- The column reinforcement details for Football Production Buildings 1, 2, and 3, as well as the Composite and Textile Production Building, differ from the ferro scan results obtained during the initial inspection.
- In the as-built architectural drawings of the Management Block, the section line passes through the basement area; however, the basement is not shown in the section.F-202604-065683

Timeline	Remediation Plan
Longer Term CAP-0077980	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete as-built documentation.

9.3 Non-engineered structure

This issue refers to the steel stairs in the Football Production 1 Building. The stairs might have undersized structural elements and lack proper bracing, making them highly vulnerable. F-202604-065232

Timeline	Remediation Plan
Medium Term CAP-0077189	Building structural engineer to review the as-built design for code compliance (vertical and lateral loads) and confirm if it is adequate.
Medium Term CAP-0077190	Propose strengthening works as required and submit to Pakistan Accord for review.
Longer Term CAP-0077191	Implement strengthening works as required.

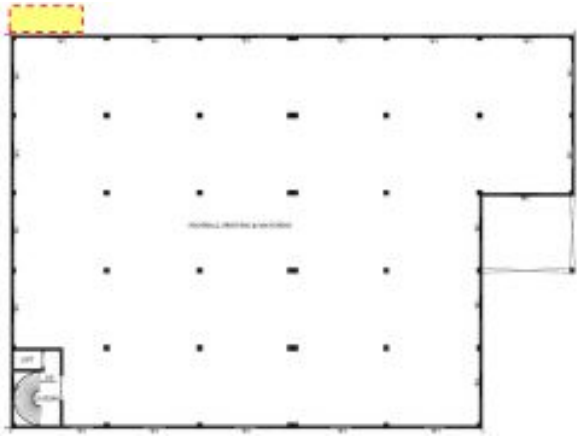


Figure 2.23 - Location of Steel Staircase in the Football Production 1 Building



Figure 2.24 - Structural Stability and Strength Issue in the Steel Staircase of Football Production 1

9.4 Non-engineered structure

This issue refers to the steel stairs in the Football Production 2 Building. The stairs might have undersized structural elements and lack proper bracing, making them highly vulnerable. F-202604-065234

Timeline	Remediation Plan
Medium Term CAP-0077192	Building structural engineer to review the as-built design for code compliance (vertical and lateral loads) and confirm if it is adequate.
Medium Term CAP-0077193	Propose strengthening works as required and submit to Pakistan Accord for review.
Longer Term CAP-0077194	Implement strengthening works as required.

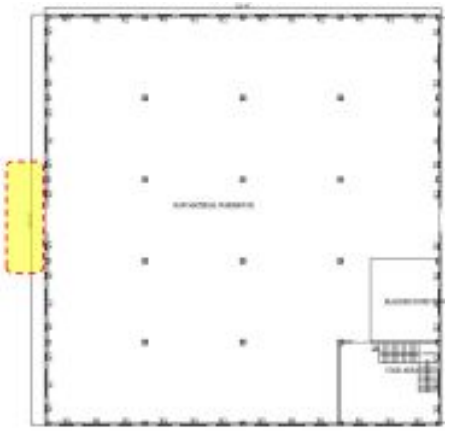


Figure 2.25 - Location of Steel Staircase in the Football Production 2 Building



Figure 2.26 - Structural Stability and Strength Issue in the Steel Staircase of Football Production 2

9.5 Lack of safe load plans

No safe load plans were posted in the Management Block, Football Production 1, Football Production 2, Football Production 3, Composite and Textile Production and Chemical Store. F-202604-065233

Timeline	Remediation Plan
Longer Term CAP-0077186	Building structural engineer to review design documentation to confirm load capacity of the structure.
Longer Term CAP-0077187	Develop safe load plans and submit to Pakistan Accord for review.
Longer Term CAP-0077188	Factory to post safe load plans on each floor.

10. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.