Issue	**1**
Factory ID	**25650**
Date of Issue	**05-Jun-2026**

Amtex Ltd.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

5-Pullian Ismail Road, Tehsil Faisalabad City,
Faisalabad
Punjab Pakistan

Latitude: [31.45965], longitude: [73.0738]
Date of inspection: 13-Apr-2026

Fire Safety Inspection Report

Observations & Actions



Authors	**Tariq Mehmood**
Reviewed by	**Shehroz Javed**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 13-04-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
3. Building Description 9
   - 3.1 Building Means of Egress Details 10
   - 3.2 Building Use 12
4. Documentation 14
5. Fire Safety Measures 15
6. Remediation Support 16
   - 6.1 Engineering Support 16
7. Means of Escape 17
   - 7.1 Escape doors 17
   - 7.2 Exit access 20
   - 7.3 Travel distance 23
   - 7.4 Number of exits 24
   - 7.5 Protection of stairs 25
   - 7.6 Escape stair condition 27
   - 7.7 Exit discharge 29
   - 7.8 Exit signage 31
8. Fire Rated Construction 33
   - 8.1 Separation of high-risk areas 33
   - 8.2 Separation of high-risk areas 35
   - 8.3 Separation of shafts 37

8.4 Separation of occupancies..... 39
8.5 Separation of occupancies..... 41
8.6 Storage..... 43
9. Fire Suppression..... 45
9.1 Fire extinguishers..... 45
10. Hazardous Materials..... 47
10.1 Chemicals handling..... 47
10.2 Chemicals storage..... 49
10.3 Gas storage..... 51
11. Fire Safety Management..... 53
11.1 Fire drills..... 53
11.2 Records of system testing..... 54
11.3 Records of systems maintenance..... 55
11.4 Emergency Action Plan..... 56
12. Assessment Limitations and Assumptions..... 57

1. Executive Summary

On 13-Apr-2026, Usama Ahmed Zia and Tariq Mehmood on behalf of the Pakistan Accord carried out an initial fire inspection for Amtex Ltd., a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Naveed Aslam (Manager Compliance), Faisal Ameer (Admin), Mr Tajammul Hussain (Electrical Engineer), along with other staff members of the factory. As the assessment was being carried out as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Accord were also present and the team was led by Engr. Usama Zia of Pakistan Accord.
The factory comprises of 2 main buildings and 3 ancillary structures, details of which are provided below:
Building 1 is 2 storey (Ground + 1) structure consist of RC Moment resisting frame (MRF) structure, uni-directional RC Moment resisting frame (MFR)supporting precast Tee slab and uni-directional RC moment resisting frame supporting steel trusses and PCC slab. The building has covered area (footprint) of 4871 sq. m. Building has 3 staircases among them 1 stair discharges internally. The building is used for solar at Roof; stitching hall, garment hall, sleeping area, child care and office at First Floor and offices, sample and fabric store, grey fabric store, cutting hall and coating hall, stitching hall, quilting and wadding hall, sleeping area and fabric store at Ground Floor. The construction date of building is year 2000.
Building 2 is a single storey (Ground only) structure consist of RC Moment resisting frame structure (MRF), uni- directional RC moment resisting frame supporting precast Tee slab, steel portal frame consists of streel trusses and girders. The building has covered area (footprint) of 3865 sq. m. The building is used for solar at roof; table printing, stitching hall, cutting hall, stitching hall, finishing hall, carton storage, stitching hall, luxor warehouse, raw and finished goods storage, online office, mosque, main office at Ground Floor. The construction date of building is year 2005 and the building was horizontally extended in year 2020.
Other building comprises of three structures. The construction date of the structures is year 2000.

- Ancillary toilet block is a single storey (Ground only) consist of load bearing structure with precast slab. It is used for washrooms.
- Ancillary dormitory 1 is a single storey (Ground only) consist of load bearing brick masonry walls with precast slab resting on steel girders. It is used for living.
- Ancillary dormitory 2 is a single storey (Ground only) consist of load bearing brick masonry walls with precast slab resting on precast girders. It is used for living.

The ancillaries, dormitory 1 & 2 mentioned above, are located at the safe distance from the production area.
The factory complex is completely occupied by Amtex Ltd. as owner.
The factory operates in a single shift (9am to 6pm) for all the activities. Approximately 500 workers operate in the factory with 20 workers being female.
We were presented with site and floor layout which were not as built whereas the section layouts were missing. Data regarding evacuation plan, emergency action plan and fire drill record was provided at the time of the inspection.

A summary of the main concerns identified during the inspection includes (list non-exhaustive):

- Lockable mechanism observed in escape route across the whole facility.
- Common path of travel exceeds at multiple locations.
- Sleeping areas found in the production building.
- There is no fire separation between stair, lift shafts and rest of the building.
- Exit discharge routes are not fire separated from high-risk areas.
- Storage areas are not fire separated from rest of the building.

We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes).

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

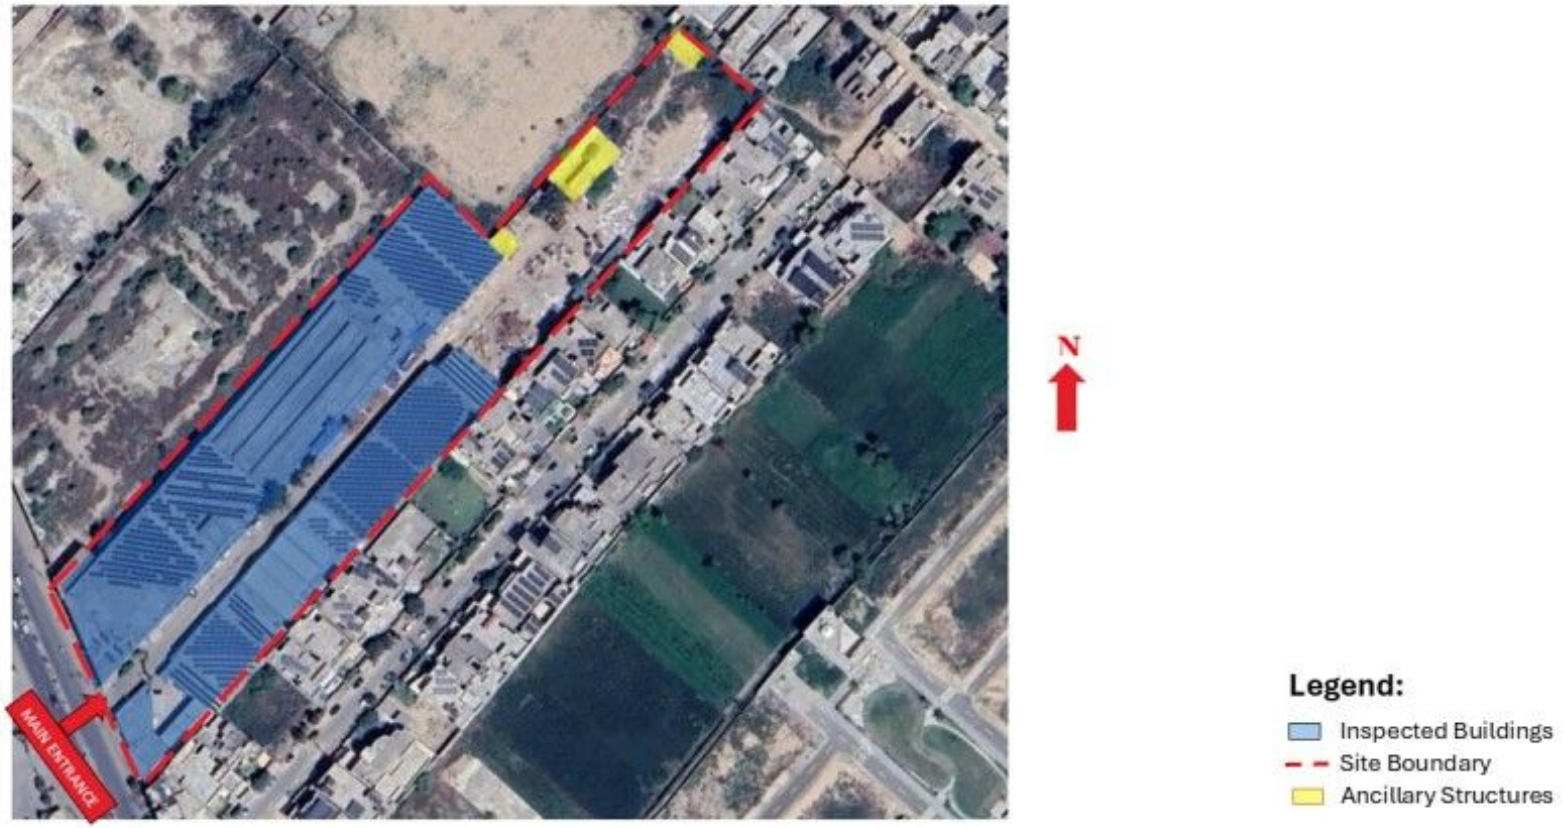


Figure 1.1. Site layout (satellite view)

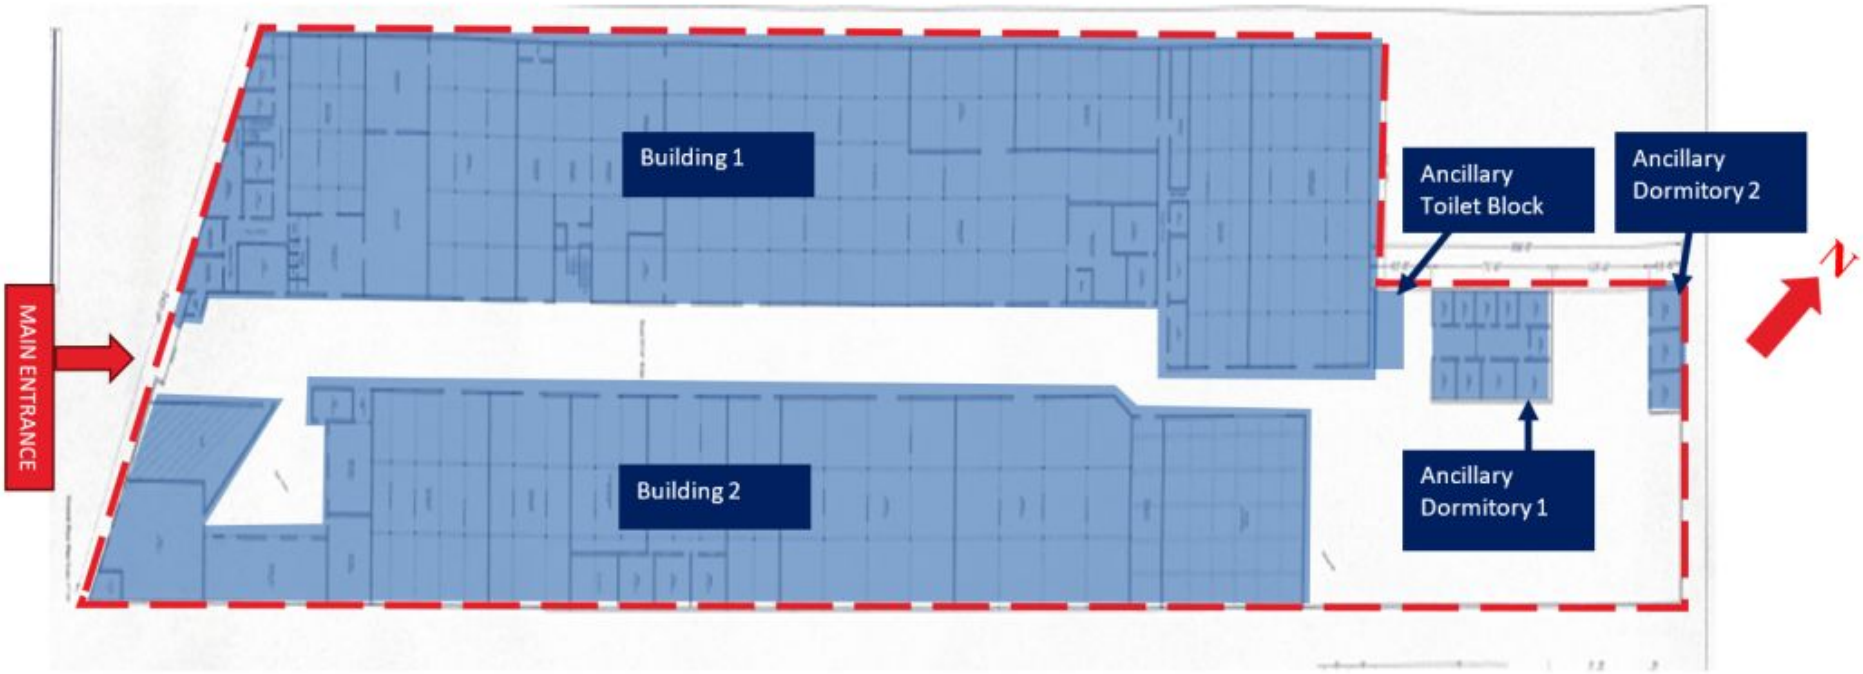


Figure 1.2. Site layout

3. Building Description

The factory comprises of 2 main buildings and 3 ancillary structures, details of which are provided below:

Building 1 is 2 storey (Ground + 1) structure consist of RC Moment resisting frame (MRF) structure, uni-directional RC Moment resisting frame (MFR)supporting precast Tee slab and uni-directional RC moment resisting frame supporting steel trusses and PCC slab. The building has covered area (footprint) of 4871 sq. m. Building has 3 staircases among them 1 stair discharges internally. The building is used for solar at Roof; stitching hall, garment hall, sleeping area, child care and office at First Floor and offices, sample and fabric store, grey fabric store, cutting hall and coating hall, stitching hall, quilting and wadding hall, sleeping area and fabric store at Ground Floor. The construction date of building is year 2000.

Building 2 is a single storey (Ground only) structure consist of RC Moment resisting frame structure (MRF), uni- directional RC moment resting frame supporting precast Tee slab, steel portal frame consists of streel trusses and girders. The building has covered area (footprint) of 3865 sq. m. The building is used for solar at roof; table printing, stitching hall, cutting hall, stitching hall, finishing hall, carton storage, stitching hall, luxor warehouse, raw and finished goods storage, online office, mosque, main office at Ground Floor. The construction date of building is year 2005 and the building was horizontally extended in year 2020.

Other building comprises of three structures. The construction date of the structures is year 2000.

- Ancillary toilet block is a single storey (Ground only) consist of load bearing structure with precast slab. It is used for washrooms.
- Ancillary dormitory 1 is a single storey (Ground only) consist of load bearing brick masonry walls with precast slab resting on steel girders. It is used for living.
- Ancillary dormitory 2 is a single storey (Ground only) consist of load bearing brick masonry walls with precast slab resting on precast girders. It is used for living.

The ancillaries, dormitory 1 & 2 mentioned above, are located at the safe distance from the production area.

3.1 Building Means of Egress Details

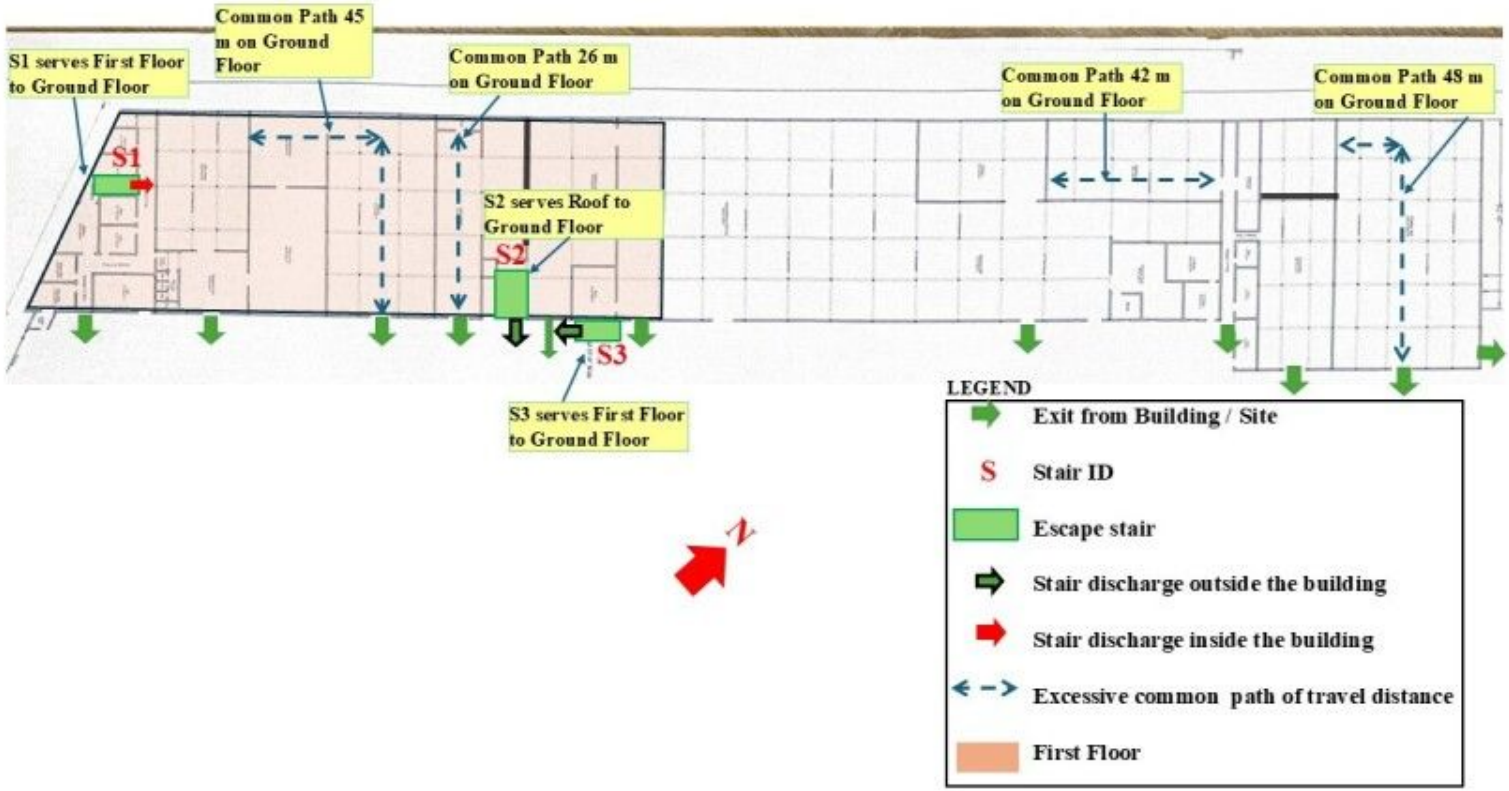


Figure 1.3. Egress layout of Building 1

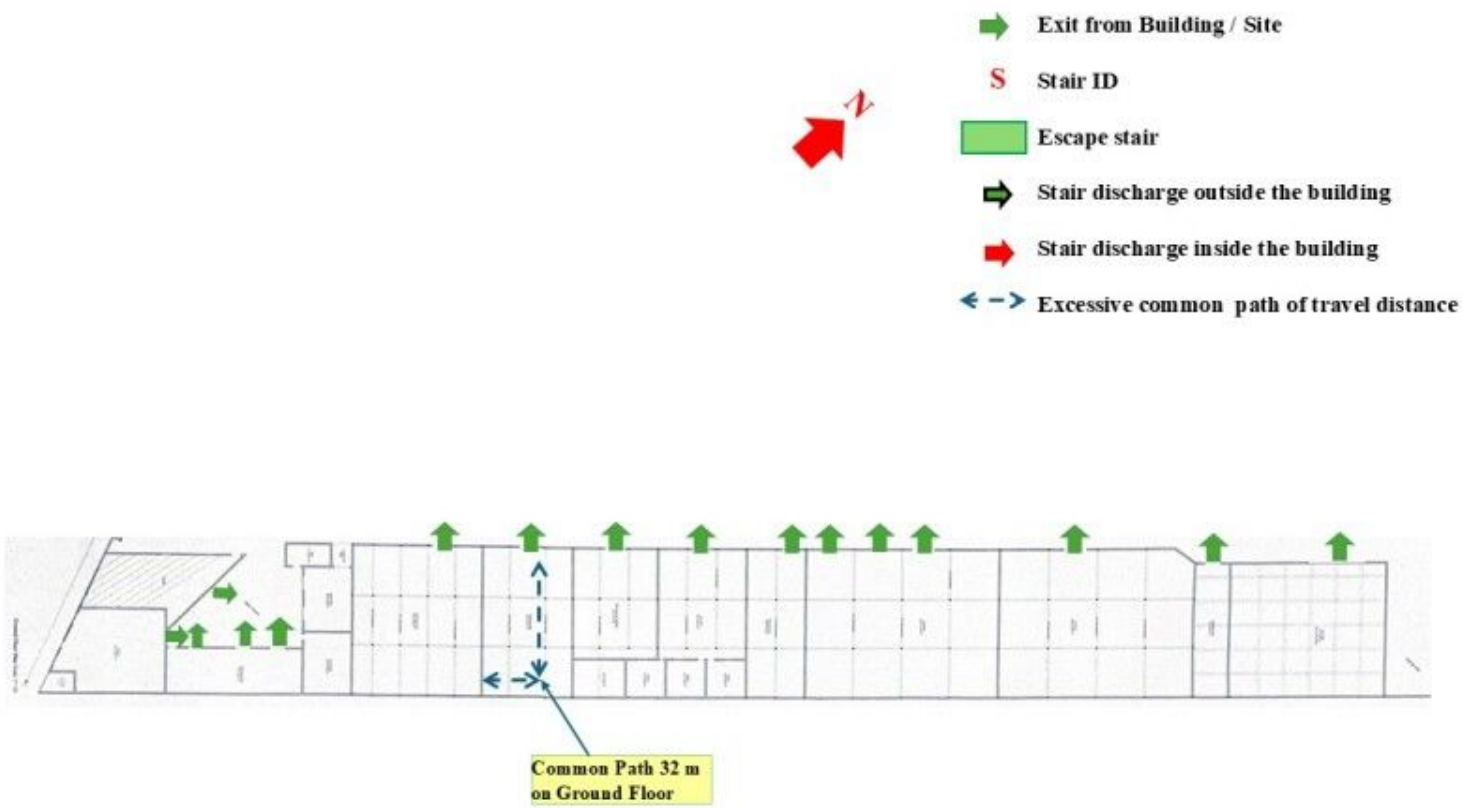


Figure 1.4. Egress layout of Building 2

3.2 Building Use

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Total Travel Distance	Common Path	Dead End
Building 1						
Ground Floor	Offices	60	2	-	-	-
	Sample and fabric store	40	1	-	45m	-
	Grey fabric store	25	1	-	26m	-
	Cutting hall and coating hall	100	3	-	-	-
	Stitching hall	50	1	-	42m	-
	Quilting and wadding Hall	25	1	-	48m	-
	Sleeping area	7	1	-	-	-
	Fabric store	10	1	-	-	-
First Floor	Stitching hall, sleeping area, day care and office	200	3	-	-	-
Roof	Solar panel	-	1	-	-	-
Building 2						

Ground Floor	Table printing, stitching hall	55	2	-	-	-
	Cutting, stitching and finishing hall	200	6	-	-	-
	Carton storage	10	1	-	-	-
	Stitching hall, luxor warehouse	80	2	-	32m	-
	Raw and finished goods storage	20	3	-	-	-
	Online office	20	1	-	-	-
	Mosque	70	1	-	-	-
	Main office	10	1	-	-	-
Roof	Solar panel	-	1	-	-	-

There is a sufficient exit capacity in the buildings generally but insufficient number of exits specifically to the mosque in Building 2. Excessive common path of travel distance issue was observed at Ground Floor of Building 1 and 2.

4. Documentation

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defence Certificate (NOC)		Yes	15-07-2025	-
2.	Architecture Layout		Yes	-	Not as per built structure
3.	Sectional Layout		No	-	
4.	Evacuation Maps		Yes	-	Insufficient coverage throughout the site
5.	Emergency Action Plan		Yes	-	Not as per Pakistan Accord Building Standards (roles and responsibilities not assigned)
6.	Inspection	Fire extinguishers	No	-	-
		Exit signage	No	-	-
7.	Testing	Fire extinguishers	No	-	-
		Exit signage	No	-	-
8.	Maintenance	Fire extinguishers	No	-	-
		Exit signage	No	-	-
9.	Evidence of Fire Drills		Yes	-	Not as per Pakistan Accord Building Standards (attendance sheet and pictorial evidence not provided)
10.	Staff Training		No	-	-

5. Fire Safety Measures

During our fire site inspection of Amtex Ltd., a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within Amtex Ltd.. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-065776

Timeline	Remediation Plan
Immediate CAP-0078211	Factories should begin remediation of CAP items such as installing extinguishers, signage, and clearing escape routes using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required.

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.
- Doors into stairs, stair discharge doors, final exit doors from site, and all doors serving areas with more than 50 occupants shall swing in the direction of escape
- Sliding doors shall not serve for escape from areas with more than 10 occupants.

This is not always achieved, examples include (list not exhaustive):
- Escape doors are lockable throughout the facility.
- The escape doors at the first floor leading to S2 and final exit door from site swing against the direction of escape.
- Sliding doors serve areas with over 10 occupants in the wadding hall at ground floor of Building 1 and as well as at the main entrance of the printing area at ground floor in Building 2.
- Vertical shutter door serve area more than 10 occupants in garment hall at first floor of Building 1, at discharge of S2 and at the entrance of cutting hall at ground floor in Building 1.

Recommended remedial actions are provided below.F-202604-065323

Timeline	Remediation Plan
Immediate CAP-0077408	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term CAP-0077409	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5. Replace sliding doors with swing doors or provide bypass doors nearby or pocket doors built into the existing sliding door, that are side swinging and open in the direction of travel to an exit.

Longer Term CAP-0077410	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Vertical shutter door serving more than 10 occupants at garment hall first floor Building 1



Figure 2.2 - Sliding door serving more than 10 occupants at table printing hall Building 2



Figure 2.3 - Escape door at first floor leading to S2 swing against the direction of escape and lockable

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.
- Headroom along escape route should be more than 2.05m.

This is not always achieved, examples include (list not exhaustive):
- S1 discharges inside the Building 1.
- Headroom height is 1.7m in exit access which connects table printing hall with stitching hall and headroom clearance of 1.8m of exit access which connects inspection and packing hall of Building 2.
- The exit access to S1 has effective width of 0.7m.

Recommended remedial actions are provided below.F-202604-065324

Timeline	Remediation Plan
Immediate CAP-0077389	Remove obstructions on escape routes and keep them clear for escape. Provide warning signs where headroom height is less than 2.05 m on escape routes. Provide soft padding where headroom height is less.
Medium Term CAP-0077390	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks) Propose modifications to ensure 2.05m headroom height is achieved along the escape routes or propose alternative egress routes that comply. Submit the proposal to Pakistan Accord for review.

Longer Term CAP-0077391	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted. Implement measures to ensure adequate clear head height is achieved along all escape routes.



Figure 2.4 - Headroom height of escape door is 1.7m in the table printing hall ground floor Building 2



Figure 2.6 - Headroom height of escape door is 1.8m between inspection and packing hall ground floor Building 2



Figure 2.5 - The exit access to S1 has effective width of 0.7m



Figure 2.7 - S1 discharges inside the Building 1

7.3 Travel distance

Travel distances should meet the limits in the Pakistan Accord Standard. The standard provides limitations on:
- Common path of travel, i.e. the distance the occupants have to travel before there is a choice of escape routes.

This is not always achieved, examples include (list not exhaustive):
- Common path of travel distances exceed permitted limits such as:
a: Fabric storage at ground floor in Building 1 (extended common path of travel distance is 45m).
b: Wadding hall at ground floor in Building 1 (extended commmon path of travel distance is 48 meters).
c: Stitching hall in Building 2 (extended common path of travel distance is 32m).
d: Stitching hall in Building 1 (extended common path of travel distance is 42m).
e: Grey fabric store in Building 1 (extended common path of travel distance is 26m).

Recommended remedial actions are provided below.F-202604-065321

Timeline	Remediation Plan
Immediate CAP-0077441	Reduce the common path of travel distance to a maximum of 46 m in the areas with higher common path of travel or vacate the area until the travel distance is reduced.
Medium Term CAP-0077442	Propose a plan for addressing the excessive travel distance through alternative escape routes and/or additional exits and submit to Pakistan Accord for review prior to commencing any rectification works on site. Review travel distances from all areas in the building(s) to ensure that they meet the limits in the Pakistan Accord Standard.
Longer Term CAP-0077443	Implement the plan previous reviewed by Pakistan Accord and ensure all travel distances to emergency exits meet the requirements of the Pakistan Accord Standard.

7.4 Number of exits

Per Pakistan Accord Standard, the exit provisions should meet the following:
- Minimum 2 exits from every occupied floor.
- Minimum 2 exits from every occupied area with more than 50 occupants.
- Exits to be sufficiently spaced apart to be classed as alternative exits.

This is not always achieved, examples include (list not exhaustive):
- Mosque in building 2 serves more than 50 occupants and has only one exit.
- Exits do not meet the remoteness criteria in stitching hall at ground floor in Building 1

Recommended remedial actions are provided below.F-202604-065777

Timeline	Remediation Plan
Medium Term CAP-0078209	Review each floor and area to ensure that the number of exits complies with Pakistan Accord Standard. Develop plans and drawings to provide additional exits where necessary. Submit the plan and drawings to Pakistan Accord for review and approval prior to commencing rectification works.
Longer Term CAP-0078210	Implement the above plan as agreed with Pakistan Accord. Number of exits from all floors and parts of the building should comply with Pakistan Accord Standard.

7.5 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- Stair discharge routes should be protected to the same level of safety as the stair.
- There should be no fire load and/or services passing through a stair.

This is not always achieved, examples include (list not exhaustive):
- Unprotected openings on the roof and first floor of S2.
- Missing fire rated enclosure and fire doors in S1 and S2.
- Fire load in stairs such as fire load under S2 at ground floor and roof.

Recommended remedial actions are provided below.F-202604-065322

Timeline	Remediation Plan
Immediate CAP-0077413	Remove fire load and any other obstructions due to stored items from stairs
Medium Term CAP-0077414	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.
Longer Term CAP-0077415	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.8 - Fire load under S2 ground floor



Figure 2.9 - Unprotected opening at S3



Figure 2.10 - Fire load at S2 at roof

7.6 Escape stair condition

Per Pakistan Accord Standard, escape stairs should be designed to be safe for use, including day to day use.

This is not always achieved, examples include (list not exhaustive):
- S3 support to ground is not structurally safe.
- Handrail is misssing on one side at S2.

Recommended remedial actions are provided below.F-202604-065473

Timeline	Remediation Plan
Immediate CAP-0077450	Follow the remediation plan laid out by the Structural Engineer in Structure Safety Report
Medium Term CAP-0079001	Handrails to be provided on both sides of each stair. Ensure the handrails are at appropriate height.



Figure 2.11 - Handrail missing on one side of S2



Figure 2.12 - S3 support to ground is not structurally safe

7.7 Exit discharge

Exit discharge routes outside the building should be sufficiently protected so that people can escape safely in the event of a fire anywhere in the building. This includes:
- External escape routes should not lead via high-risk areas.

This is not always achieved, examples include (list not exhaustive):
- External escape routes are through high-risk areas such as:
a: Electric steamer present at exit discharge of grey fabric hall in Building 2.
b: Chemical storage present at the exit discharge of coating hall ground floor in Building 1.
c: Electric steamer and compressor are present at the exit discharge of finishing hall in Building 2.

Recommended remedial actions are provided below.F-202604-065508

Timeline	Remediation Plan
Medium Term CAP-0077568	Prepare drawings showing proposed fire separating construction to exit discharge routes. These shall be submitted to Accord for review and approval prior to commencing rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge routes - Details of proposed fire resisting walls and fire door assemblies required to protect discharge routes Provide additional exits from site.
Longer Term CAP-0077569	- Ensure external exit discharge routes are adequately fire separated from the rest of the building. - Ensure external escape routes do not pass close to unprotected high-risk areas



Figure 2.13 - Electric steamer present at the external discharge of the grey fabric storage hall in Building 1



Figure 2.15 - Electric steamer and compressor present at the exit discharge of the finishing hall in Building 2



Figure 2.14 - Chemical storage present at the exit discharge of coating hall in Building 1

7.8 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs production areas.
- Missing exit signs in office block at ground floor in Building 1.
- Exit signs are misleading in fabric storage at ground floor in Building 1 which do not lead the occupants to nearest exit, same is the case with the exit sign present in stitching hall which lead to luxor hall in Building 2.
- Electrically powered exit signs are not a tested and listed system throughout the facility.
- Exit signs are not uniform throughout the facility.

Recommended remedial actions are provided below.F-202604-065510

Timeline	Remediation Plan
Immediate CAP-0077581	Remove misleading directional escape signs.
Medium Term CAP-0077582	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3
Longer Term CAP-0077583	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.16 - Exit signage missing in stitching hall at first floor in Building 1



Figure 2.18 - Misleading signage in fabric store at ground floor in Building 1



Figure 2.17 - Exit signage missing in office at ground floor in Building 1



Figure 2.19 - Misleading signage from stitching hall to laxor store at ground floor in Building 2

8. Fire Rated Construction

8.1 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- LT room is not fire separated from the coating and stitching hall at ground floor in Building 1.
- Generator is not fire separated from LT room at ground floor in Building 1.
- Server room is not fire separated from the dormitory at first floor in Building 1.
- Cooking area is not fire separated from offices at ground floor in Building 1.

Recommended remedial actions are provided below.F-202604-065536

Timeline	Remediation Plan
Medium Term CAP-0077615	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0077616	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.20 - Server room is not fire separated from the sleeping area at first floor in Building 1



Figure 2.21 - Generator is not fire separated from the LT room at ground floor in Building 1



Figure 2.22 - LT room is not fire separated from the stitiching and coating hall at ground floor in Building 1



Figure 2.23 - Cooking area is not fire separated from office at ground floor in Building 1

8.2 Separation of high-risk areas

Per Pakistan Accord Standard, electric steam generators (pressure vessels) in occupied areas require blast protection consisting of:
- Minimum 3 m high reinforced concrete/ block masonry wall to separate it from the rest of the occupied portions of the building.
- Door to be solid steel door with a self-closer and a positive latch.
- Opening from the steam generator room to outside the building to release the blast out from the building.
The aim of these provisions is to protect the occupants nearby from the effects of a potential blast.

The following deficiencies have been observed on site, including (list not exhaustive):
- Steam generator rooms are not enclosed in minimum 3m high sturdy construction to separate them from occupied areas as steam generator present in fabric storage area at ground floor in Building 1.
- Steam generator is not fire separated from finishing hall at ground floor in Building 2.

Recommended remedial actions are provided below.F-202604-065547

Timeline	Remediation Plan
Medium Term CAP-0077636	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Separation to electric steam generator up to 3 m above the finished floor level. This should be achieved using reinforced concrete / masonry walls with solid steel doors. - The door must have a self-closer and a positive latch. - Blast vent should be provided to outside the building.
Longer Term CAP-0077637	Implement the above plan on site. All buildings to be compliant with Pakistan Accord Standard.



Figure 2.24 - Electric steamer is present in fabric store at ground floor in Building 1



Figure 2.25 - Electric steamer is not fire separated from finishing hall in Building 2

8.3 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction to maintain compartmentation between floors.

The following deficiencies have been observed on site, including (list not exhaustive):

- Lift shafts are not separated with fire rated construction from S2 and production hall both at first floor and ground floor in Building 1.

Recommended remedial actions are provided below.F-202604-065548

Timeline	Remediation Plan
Medium Term CAP-0077646	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0077647	Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.26 - Lift shaft is not separated with fire rated construction from stitching and garment hall

8.4 Separation of occupancies

Pakistan Accord Standard requires different occupancy types to be fire separated from each other. The aim is to limit the fire to only one occupancy type.

The following deficiencies have been observed on site, including (list not exhaustive):
- Large office areas not fire separated from fabric store at ground floor in Building 1.
- Day care is not fire separated from sleeping area and office at first floor in Building 1.
- Mosque is not fire separated from RO plant in Building 2.

Recommended remedial actions are provided below.F-202604-065556

Timeline	Remediation Plan
Medium Term CAP-0077692	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Different occupancy types in the building - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0077693	Provide fire rated separation between occupancies as per proposal reviewed by Pakistan Accord



Figure 2.27 - Large office area not fire separated from the fabric storage at ground floor in Building 1



Figure 2.28 - Day care is not fire separated from the sleeping area and offices at first floor in Building 1

8.5 Separation of occupancies

Residential sleeping areas should comply with special measures required for sleeping occupancies. Such measures include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key.
- Fire separation of dormitories from other occupancies.
- Providing a minimum of 2 escape routes from the above ground levels.
- Providing an automatic fire detection and alarm system.
- Fire separation of cooking facilities/kitchens from the remainder of the dormitory.

The following deficiencies have been observed on site, including (list not exhaustive):
Sleeping areas observed at first floor and ground floor of Building 1 which does not meet the following requirements:
- Locking devices on doors do not allow for free escape from dormitories in all circumstances.
- No automatic fire detection and alarm system.
- Lack of fire rated separation between the sleeping area and server room at first floor in Building 1.
- Sleeping area near toilet section are not fire separated from wadding hall at ground floor in Building 1.

Recommended remedial actions are provided below.F-202604-065559

Timeline	Remediation Plan
Immediate CAP-0077705	The sleeping area is not to be used until minimum requirements for sleeping occupancies have been provided. Alternative arrangements must be sought immediately for the sleeping area as continuing the use of the building for this purpose is not appropriate. Sleeping area not to be re-occupied until the minimum requirements have been implemented.
Medium Term CAP-0077706	Document proposals for design of remedial measures to ensure compliance with all fire safety requirements for sleeping occupancies to comply with Pakistan Accord Standard. Submit proposals to Pakistan Accord for review.
Longer Term CAP-0077707	Implement remediation measures to ensure full compliance with dormitory requirements of Pakistan Accord Standard and Pakistan Building Code in accordance with previously reviewed design.



Figure 2.29 - Sleeping area not fire separated from office area and server room at first floor in Building 1



Figure 2.30 - Sleeping area is not fire separated from wadding hall at ground floor in Building 1

8.6 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.
Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area
- Storage height is less than 2.45m
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Fabric storage hall is not fire separated from the quilting hall at ground floor in Building 1.
- Storage is not fire separated from cutting hall at ground floor in Building 2.
- Carton storage is not fire separated from stitching hall in Building 2.
- Finished goods and raw material storage is not fire separated from finishing hall in Building 2.
- Luxor storage is not fire separated from stitching hall in Building 2.

Recommended remedial actions are provided below.F-202604-065566

Timeline	Remediation Plan
Medium Term CAP-0077734	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0077735	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard



Figure 2.31 - Storage is not fire separated from cutting hall in Building 2



Figure 2.32 - Luxor storage is not fire separated from stitching section in Building 2



Figure 2.33 - Carton storage is not fire separated from stitching section in Building 2

9. Fire Suppression

9.1 Fire extinguishers

Extinguisher coverage and type of extinguishers used should comply with NFPA 10.

The following deficiencies have been observed on site, including (list not exhaustive):

- Fire extinguisher is not present in kitchen in office at ground floor in Building 1.
- Poor condition of fire extinguishers (rusted shells, improper hanging frame, hose damaged) at multiple locations such as in stitching hall at first floor in Building 1, office block at ground floor in Building 1

Recommended remedial actions are provided below.F-202604-065573

Timeline	Remediation Plan
Medium Term CAP-0077748	Ensure that all building areas are protected using fire extinguishers. The coverage and type of extinguishers used should follow NFPA 10.
Longer Term CAP-0077749	Monitor fire extinguishers for coverage and extinguisher type to comply with NFPA 10.



Figure 2.34 - Improper hanging frames of fire extinguisher at stitching hall first floor in Building 1



Figure 2.35 - Rusted shell of fire extinguisher at garment hall first floor in Building 1

10. Hazardous Materials

10.1 Chemicals handling

Chemical handling procedures should follow the best international practice.

The following deficiencies have been observed on site, including (list not exhaustive):
- Large amounts of chemicals in production areas such as:
- Chemical present in large amount inside and outside of coating hall at ground floor in Building 1.

Recommended remedial actions are provided below.F-202604-065576

Timeline	Remediation Plan
Medium Term CAP-0077765	Develop a chemical handling strategy for the building. Identify dangerous chemicals, how they will be used and handled, the standards that will be followed, and the people responsible for the implementation of the strategy. Submit to Accord for review.
Longer Term CAP-0078208	Implement the chemical handling strategy on site as agreed with Accord.



Figure 2.36 - large amount of chemical in coating hall at ground floor in Building 1



Figure 2.37 - Large amount of chemicals outside coating hall at ground floor in Building 1

10.2 Chemicals storage

This relates to storage, handling, and use of flammable chemicals and combustible liquids and solids.
Chemical storage areas should be fire separated from the rest of the building. Adequate ventilation should be provided.

The following deficiencies have been observed on site, including (list not exhaustive):
- Chemical storage is not fire separated from table printing hall in Building 2.

Recommended remedial actions are provided below.F-202604-065578

Timeline	Remediation Plan
Medium Term CAP-0077769	Factory to collect MSDS sheets for all chemicals stored, classify materials, and propose storage arrangements to meet NFPA 30 requirements. Prepare drawings showing the proposed chemical storage areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all chemical storage areas - Locations of fire rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction) - Ventilation provisions to each of these rooms
Longer Term CAP-0077770	Implement the above plan on site. All chemical storage areas to be compliant with Pakistan Accord Standard.



Figure 2.38 - Chemical storage is not fire separated in table printing hall in Building 2

10.3 Gas storage

Flammable gas storage areas should be fire separated from the rest of the building. Adequate ventilation should be provided.

The following deficiencies have been observed on site, including (list not exhaustive):
- LPG cylinders are not fire separated from chemical handling section and kitchen area at ground floor in Building 1.

Recommended remedial actions are provided below.F-202604-065580

Timeline	Remediation Plan
Medium Term CAP-0077772	Prepare drawings showing gas storage areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of gas storage areas - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction) - Ventilation provisions to each of these rooms
Longer Term CAP-0077773	Implement the above plan on site. All gas storage areas to be compliant with Pakistan Accord Standard.



Figure 2.39 - LPG Gas cylinder present in chemical handling section at ground floor of Building 1



Figure 2.40 - Gas cylinder present in kitchen area at office block in Building 1

11. Fire Safety Management

11.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Fire drill documentation is not as per standard requirement (Pictorial evidence is not produced).
- All of the staff is not involved in the fire drill

Recommended remedial actions are provided below.F-202604-065584

Timeline	Remediation Plan
Medium Term CAP-0077782	Conduct a fire drill and make records, including findings and recommended future improvements.
Longer Term CAP-0077783	Ensure fire drills are performed a minimum of 2 times per year.

11.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):

- No record of testing of Fire Extinguishers
- No record of testing of Emergency Exit Signage

Recommended remedial actions are provided below.F-202604-065614

Timeline	Remediation Plan
Medium Term CAP-0077791	Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0077792	- Ensure all systems are being tested as per the schedule agreed with Accord. - Keep testing records.

11.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):

- No record of maintenance of Fire Extinguishers
-No record of maintenance of Emergency Exit Signage

Recommended remedial actions are provided below.F-202604-065616

Timeline	Remediation Plan
Medium Term CAP-0077797	- Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0077798	- Ensure all systems are being maintained as per the schedule agreed with Accord. - Keep maintenance records.

11.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023.
Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation
plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid fire fighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):

- Escape diagrams are missing on some levels of production areas.
- EAP document is available however it does not include the required components as outlined by the Pakistan Accord Building Standards.

Recommended remedial actions are provided below.F-202604-065651

Timeline	Remediation Plan
Medium Term CAP-0077947	Ensure that evacuation plans are provided on each level. Prepare an Emergency Action Plan report.
Longer Term CAP-0077948	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

12. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.